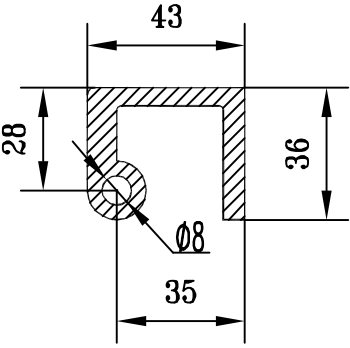
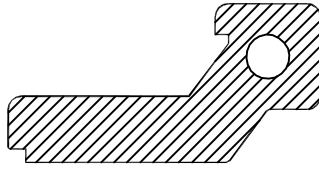
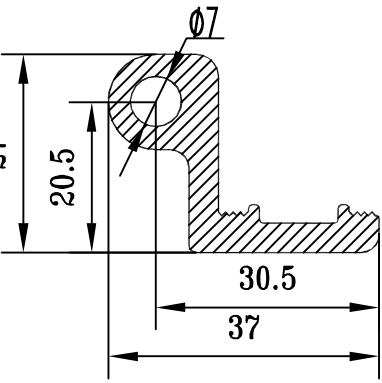
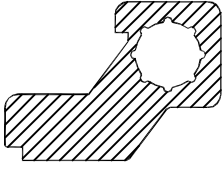
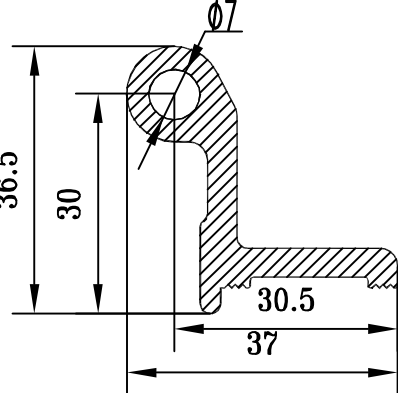
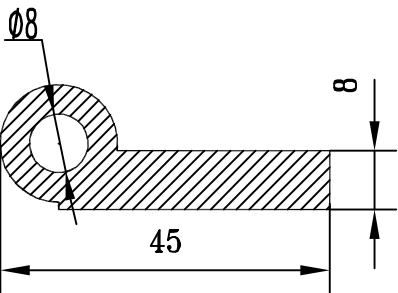
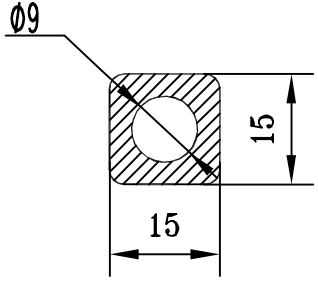
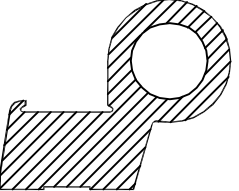
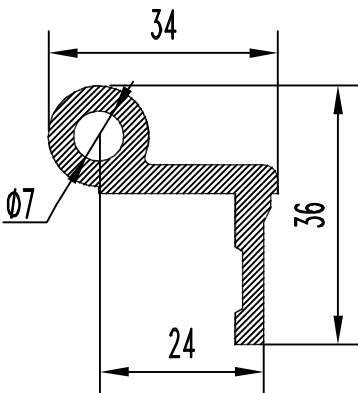
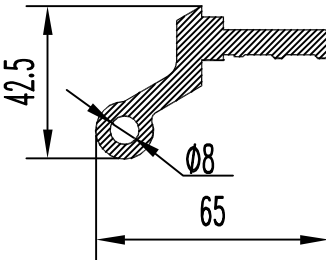
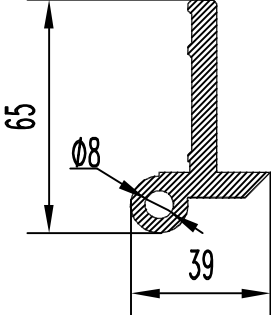
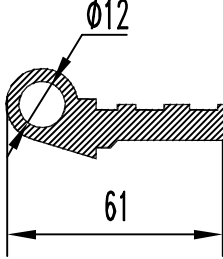
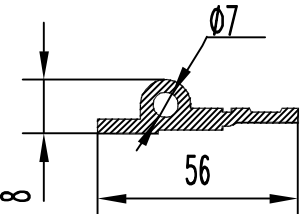
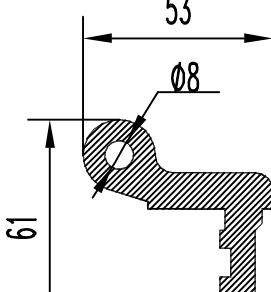
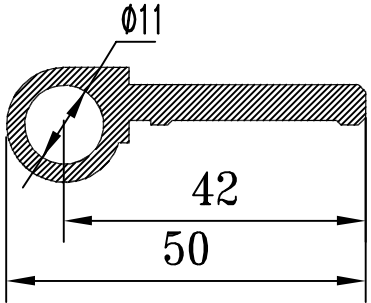
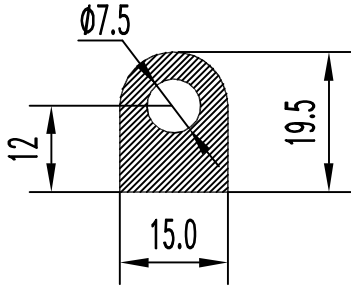
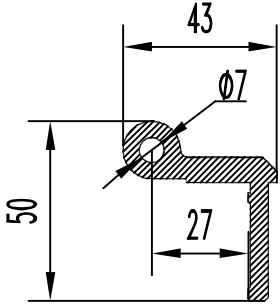
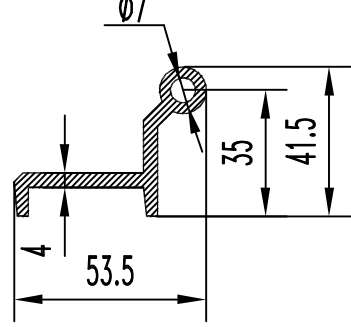
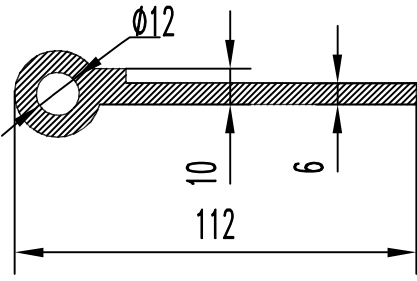
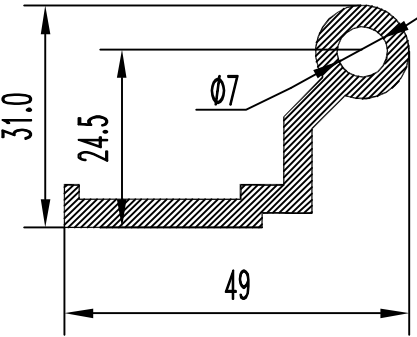
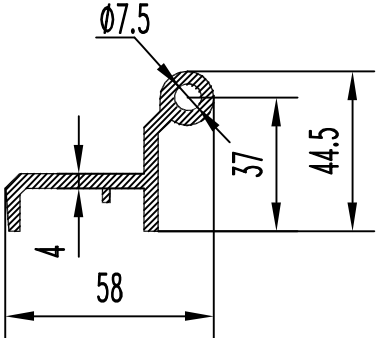
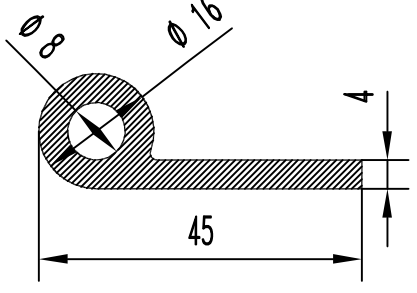
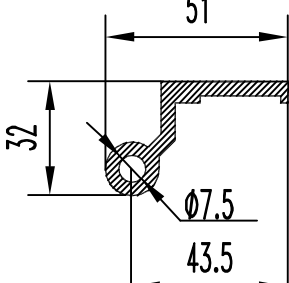
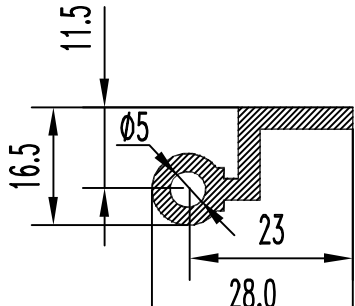
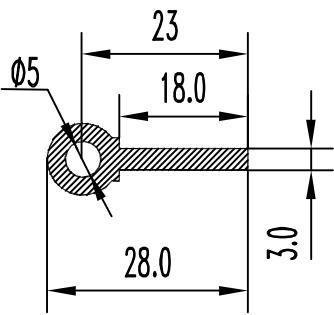
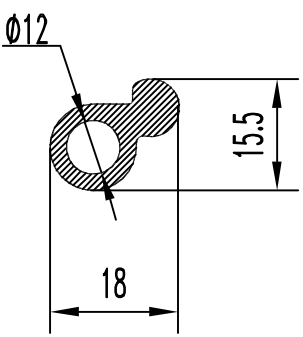
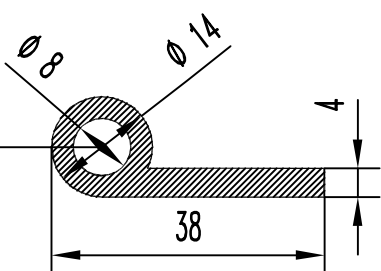
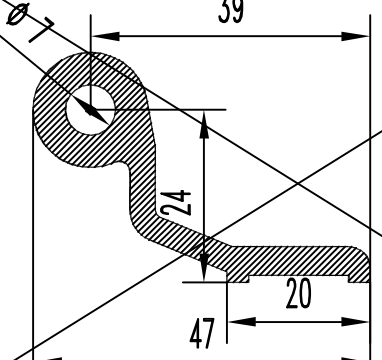
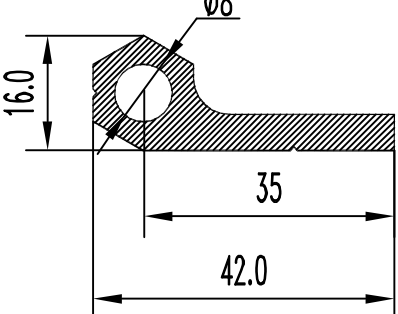
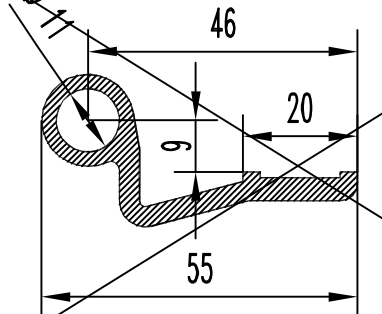
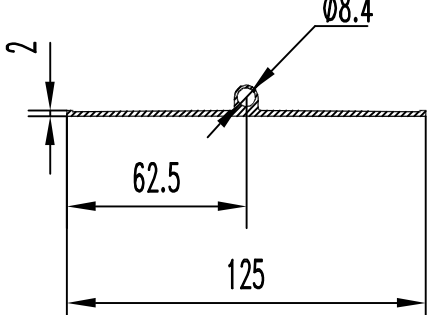
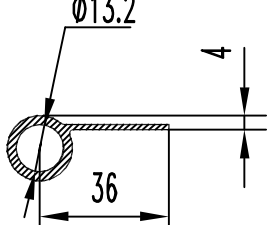


	БПП-001 $F \text{ см}^2 = 6.960$ $Q \text{ кг.} = 1.886$ $D \text{ оп.мм} = 56.0$ $P \text{ н.мм} = 222.5$ $P \text{ в.н.мм} = 25.1$ Гр. сл. = IV Точн. = П		БПП-006 $F \text{ см}^2 = 12.847$ $Q \text{ кг.} = 3.469$ $D \text{ оп.мм} = 77.2$ $P \text{ н.мм} = 202.5$ $P \text{ в.н.мм} = 31.4$ Гр. сл. = V Точн. = П
	БПП-002 $F \text{ см}^2 = 2.940$ $Q \text{ кг.} = 0.796$ $D \text{ оп.мм} = 42.3$ $P \text{ н.мм} = 128$ $P \text{ в.н.мм} = 22$ Гр. сл. = V Точн. = П		БПП-007 $F \text{ см}^2 = 8.436$ $Q \text{ кг.} = 2.278$ $D \text{ оп.мм} = 57.7$ $P \text{ н.мм} = 158.5$ $P \text{ в.н.мм} = 57.3$ Гр. сл. = V Точн. = П
	БПП-003 $F \text{ см}^2 = 3.098$ $Q \text{ кг.} = 0.840$ $D \text{ оп.мм} = 46.7$ $P \text{ н.мм} = 130$ $P \text{ в.н.мм} = 22$ Гр. сл. = V Точн. = П		БПП-008
	БПП-004 $F \text{ см}^2 = 4.100$ $Q \text{ кг.} = 1.111$ $D \text{ оп.мм} = 45.8$ $P \text{ н.мм} = 114.1$ $P \text{ в.н.мм} = 25.1$ Гр. сл. = IV Точн. = П		БПП-009 $F \text{ см}^2 = 1.608$ $Q \text{ кг.} = 0.436$ $D \text{ оп.мм} = 18.0$ $P \text{ н.мм} = 56.9$ $P \text{ в.н.мм} = 28.0$ Гр. сл. = IV Точн. = Н
	БПП-005		БПП-010

			БПП-016 $F \text{ см}^2 = 2.889$ $Q \text{ кг.} = 0.783$ $D \text{ оп.мм} = 45.0$ $P \text{ н.мм} = 127.1$ $P \text{ вн.мм} = 21.7$ Гр. сл. = VI Точн. = П
			БПП-017 $F \text{ см}^2 = 6.872$ $Q \text{ кг.} = 1.862$ $D \text{ оп.мм} = 80.0$ $P \text{ н.мм} = 191.6$ $P \text{ вн.мм} = 24.8$ Гр. сл. = VI Точн. = П
			БПП-018 $F \text{ см}^2 = 6.650$ $Q \text{ кг.} = 1.802$ $D \text{ оп.мм} = 67.5$ $P \text{ н.мм} = 195.7$ $P \text{ вн.мм} = 24.8$ Гр. сл. = VI Точн. = П
			БПП-019 $F \text{ см}^2 = 6.400$ $Q \text{ кг.} = 1.734$ $D \text{ оп.мм} = 61.0$ $P \text{ н.мм} = 160.0$ $P \text{ вн.мм} = 440.2$ Гр. сл. = VI Точн. = П
	БПП-015 $F \text{ см}^2 = 3.263$ $Q \text{ кг.} = 0.884$ $D \text{ оп.мм} = 57.0$ $P \text{ н.мм} = 138.8$ $P \text{ вн.мм} = 21.7$ Гр. сл. = VI Точн. = П		БПП-020 $F \text{ см}^2 = 9.650$ $Q \text{ кг.} = 2.615$ $D \text{ оп.мм} = 73.0$ $P \text{ н.мм} = 222.3$ $P \text{ вн.мм} = 24.8$ Гр. сл. = VI Точн. = П

	БПП-021 $F \text{ см}^2 = 3.063$ $Q \text{ кг.} = 0.830$ $D \text{ оп.мм} = 51.0$ $P \text{ н.мм} = 122.9$ $P \text{ в.мм} = 34.2$ Гр. сл. = VI Точн. = П		БПП-026 $F \text{ см}^2 = 2.285$ $Q \text{ кг.} = 0.619$ $D \text{ оп.мм} = 22.0$ $P \text{ н.мм} = 62.9$ $P \text{ в.мм} = 23.3$ Гр. сл. = IV Точн. = П
	БПП-022 $F \text{ см}^2 = 5.344$ $Q \text{ кг.} = 1.448$ $D \text{ оп.мм} = 62.0$ $P \text{ н.мм} = 173.6$ $P \text{ в.мм} = 21.7$ Гр. сл. = VI Точн. = П		БПП-027 $F \text{ см}^2 = 3.980$ $Q \text{ кг.} = 1.079$ $D \text{ оп.мм} = 65.5$ $P \text{ н.мм} = 190.7$ $P \text{ в.мм} = 21.7$ Гр. сл. = V Точн. = П
	БПП-023 $F \text{ см}^2 = 9.153$ $Q \text{ кг.} = 2.480$ $D \text{ оп.мм} = 112.5$ $P \text{ н.мм} = 253.9$ $P \text{ в.мм} = 37.4$ Гр. сл. = IV Точн. = Т		БПП-028 $F \text{ см}^2 = 3.133$ $Q \text{ кг.} = 0.849$ $D \text{ оп.мм} = 55.5$ $P \text{ н.мм} = 149.7$ $P \text{ в.мм} = 21.7$ Гр. сл. = V Точн. = П
	БПП-024 $F \text{ см}^2 = 4.793$ $Q \text{ кг.} = 1.299$ $D \text{ оп.мм} = 68.0$ $P \text{ н.мм} = 220.4$ $P \text{ в.мм} = 23.3$ Гр. сл. = IV Точн. = П		БПП-029 $F \text{ см}^2 = 0.772$ $Q \text{ кг.} = 0.209$ $D \text{ оп.мм} = 45.7$ $P \text{ н.мм} = 103.1$ $P \text{ в.мм} = 25.1$ Гр. сл. = IV Точн. = П
	БПП-025 $F \text{ см}^2 = 3.728$ $Q \text{ кг.} = 1.010$ $D \text{ оп.мм} = 58.0$ $P \text{ н.мм} = 157.7$ $P \text{ в.мм} = 23.3$ Гр. сл. = IV Точн. = П		БПП-030 $F \text{ см}^2 = 1.500$ $Q \text{ кг.} = 0.407$ $D \text{ оп.мм} = 32.0$ $P \text{ н.мм} = 89.3$ $P \text{ в.мм} = 15.4$ Гр. сл. = IV Точн. = П

	БПП-031 $F \text{ см}^2 = 1.190$ $Q \text{ кг.} = 0.322$ $D \text{ оп.мм} = 28.2$ $P \text{ н.мм} = 69.3$ $P \text{ в.мм} = 15.4$ Гр. сл. = IV Точн. = П		БПП-036 $F \text{ см}^2 = 1.228$ $Q \text{ кг.} = 0.333$ $D \text{ оп.мм} = 20.0$ $P \text{ н.мм} = 54.9$ $P \text{ в.мм} = 23.3$ Гр. сл. = IV Точн. = П
	БПП-032 $F \text{ см}^2 = 2.180$ $Q \text{ кг.} = 0.591$ $D \text{ оп.мм} = 38.9$ $P \text{ н.мм} = 96.2$ $P \text{ в.мм} = 24.7$ Гр. сл. = IV Точн. = Н		БПП-037 $F \text{ см}^2 = 3.424$ $Q \text{ кг.} = 0.928$ $D \text{ оп.мм} = 53.8$ $P \text{ н.мм} = 139.4$ $P \text{ в.мм} = 21.7$ Гр. сл. = V Точн. = П
	БПП-033 $F \text{ см}^2 = 2.830$ $Q \text{ кг.} = 0.767$ $D \text{ оп.мм} = 44.0$ $P \text{ н.мм} = 106.2$ $P \text{ в.мм} = 24.8$ Гр. сл. = IV Точн. = П		БПП-038 $F \text{ см}^2 = 3.146$ $Q \text{ кг.} = 0.853$ $D \text{ оп.мм} = 56.4$ $P \text{ н.мм} = 155.1$ $P \text{ в.мм} = 34.2$ Гр. сл. = V Точн. = П
	БПП-034 $F \text{ см}^2 = 2.972$ $Q \text{ кг.} = 0.805$ $D \text{ оп.мм} = 125.0$ $P \text{ н.мм} = 271.0$ $P \text{ в.мм} = 26.4$ Гр. сл. = VI Точн. = Н		
	БПП-035 $F \text{ см}^2 = 1.675$ $Q \text{ кг.} = 0.454$ $D \text{ оп.мм} = 46.0$ $P \text{ н.мм} = 113.6$ $P \text{ в.мм} = 41.5$ Гр. сл. = VI Точн. = П		

	БПП-041 $F \text{ см}^2 = 11.960$ $Q \text{ кг.} = 3.241$ $D \text{ оп.мм} = 72.2$ $P \text{ н.мм} = 188.5$ $P \text{ в.мм} = 31.1$ Гр. сл. = VI Точн. = П		БПП-046 $F \text{ см}^2 = 2.200$ $Q \text{ кг.} = 0.596$ $D \text{ оп.мм} = 35.6$ $P \text{ н.мм} = 109.2$ $P \text{ в.мм} = 22.0$ Гр. сл. = V Точн. = П
	БПП-042 $F \text{ см}^2 = 2.267$ $Q \text{ кг.} = 0.614$ $D \text{ оп.мм} = 33.8$ $P \text{ н.мм} = 120.4$ $P \text{ в.мм} = 28.9$ Гр. сл. = 0соб. Точн. = Н		БПП-047 $F \text{ см}^2 = 3.140$ $Q \text{ кг.} = 0.851$ $D \text{ оп.мм} = 54.8$ $P \text{ н.мм} = 160.4$ $P \text{ в.мм} = 22.0$ Гр. сл. = V Точн. = П
	БПП-043 $F \text{ см}^2 = 8.441$ $Q \text{ кг.} = 2.288$ $D \text{ оп.мм} = 55.9$ $P \text{ н.мм} = 156.2$ $P \text{ в.мм} = 46.8$ Гр. сл. = VI Точн. = П		БПП-048 $F \text{ см}^2 = 3.200$ $Q \text{ кг.} = 0.867$ $D \text{ оп.мм} = 54.1$ $P \text{ н.мм} = 158.4$ $P \text{ в.мм} = 22.0$ Гр. сл. = V Точн. = П
	БПП-044 $F \text{ см}^2 = 1.846$ $Q \text{ кг.} = 0.500$ $D \text{ оп.мм} = 32.0$ $P \text{ н.мм} = 84.6$ $P \text{ в.мм} = 15.7$ Гр. сл. = IV Точн. = Н		БПП-049 $F \text{ см}^2 = 4.37$ $Q \text{ кг.} = 1.18$ $D \text{ оп.мм} = 70$ $P \text{ н.мм} = 164.7$ $P \text{ в.мм} = 53.4$ Гр. сл. = V Точн. = Н
	БПП-045 $F \text{ см}^2 = 1.763$ $Q \text{ кг.} = 0.478$ $D \text{ оп.мм} = 31.1$ $P \text{ н.мм} = 82.3$ $P \text{ в.мм} = 15.7$ Гр. сл. = IV		БПП-050 $F \text{ см}^2 = 2.79$ $Q \text{ кг.} = 0.756$ $D \text{ оп.мм} = 50$ $P \text{ н.мм} = 115.1$ $P \text{ в.мм} = 26.7$ Гр. сл. = V

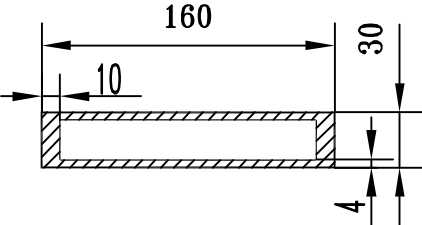
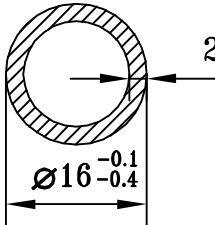
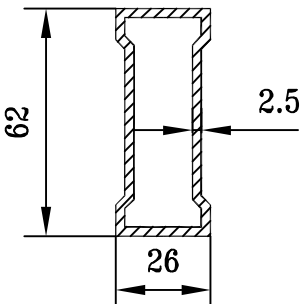
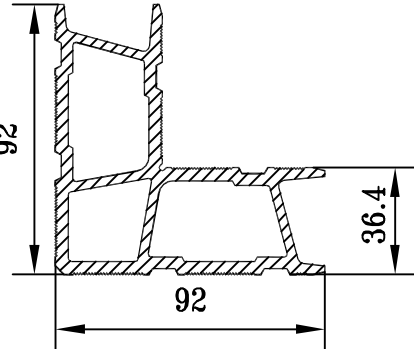
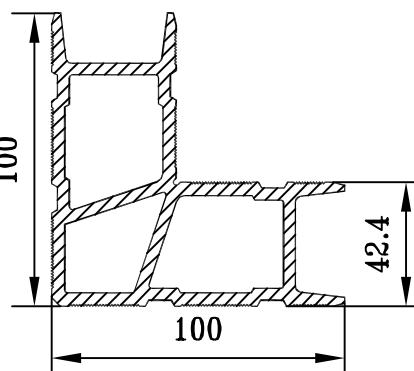
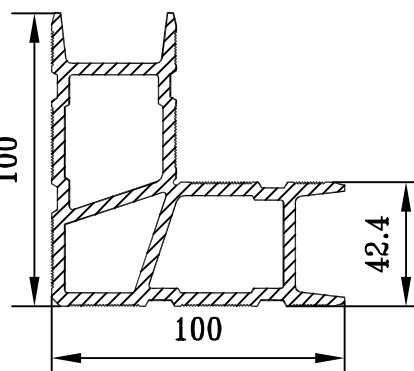
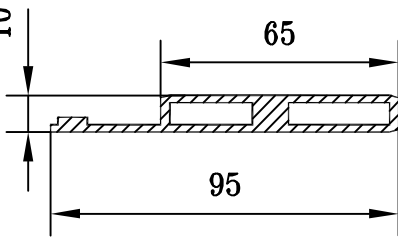
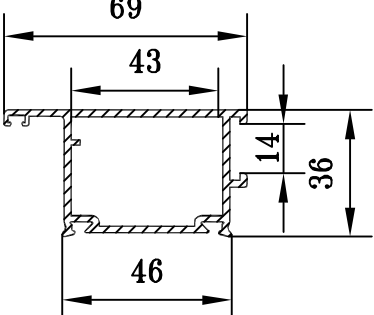
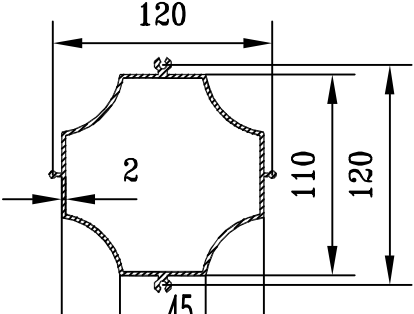
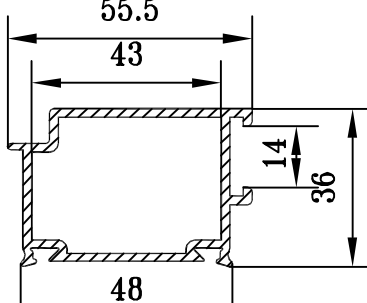
	БПП-051 $F \text{ см}^2 = 1.85$ $Q \text{ кг.} = 0.501$ $D \text{ оп.мм} = 31$ $P \text{ н.мм} = 91.6$ $P \text{ вн.мм} = 18.9$ Гр. сл. = IV Точн. = Н		БПП-056 $F \text{ см}^2 = 2.86$ $Q \text{ кг.} = 0.772$ $D \text{ оп.мм} = 39.9$ $P \text{ н.мм} = 109.2$ $P \text{ вн.мм} = 22$ Гр. сл. = V Точн. = II
	БПП-052 $F \text{ см}^2 = 2.575$ $Q \text{ кг.} = 0.698$ $D \text{ оп.мм} = 51$ $P \text{ н.мм} = 119.8$ $P \text{ вн.мм} = 25.1$ Гр. сл. = V Точн. = Н		
	БПП-053 $F \text{ см}^2 = 6.62$ $Q \text{ кг.} = 1.79$ $D \text{ оп.мм} = 63$ $P \text{ н.мм} = 164.1$ $P \text{ вн.мм} = 47.1$ Гр. сл. = VI Точн. = II		
	БПП-054 $F \text{ см}^2 = 9.945$ $Q \text{ кг.} = 2.57$ $D \text{ оп.мм} = 69.7$ $P \text{ н.мм} = 203$ $P \text{ вн.мм} = 31.42$ Гр. сл. = VI Точн. = II		
	БПП-055 $F \text{ см}^2 = 7.34$ $Q \text{ кг.} = 1.983$ $D \text{ оп.мм} = 72$ $P \text{ н.мм} = 185.7$ $P \text{ вн.мм} = 47.12$ Гр. сл. = VI Точн. = II		БПП-060 $F \text{ см}^2 = 2.602$ $Q \text{ кг.} = 0.705$ $D \text{ оп.мм} = 51.6$ $P \text{ н.мм} = 168.2$ $P \text{ вн.мм} = 12.6$ Гр. сл. = VI Точн. = II

pdfMachine

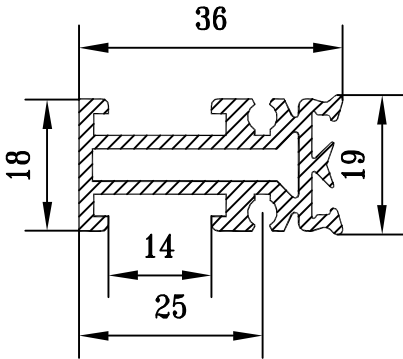
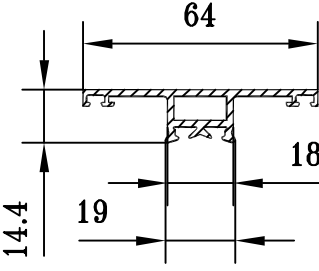
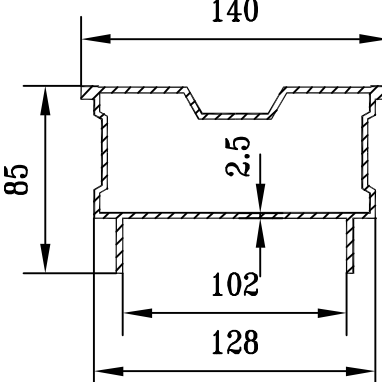
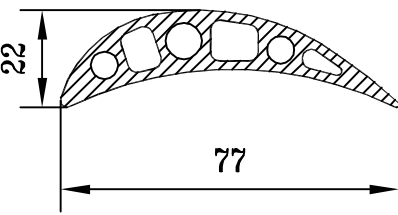
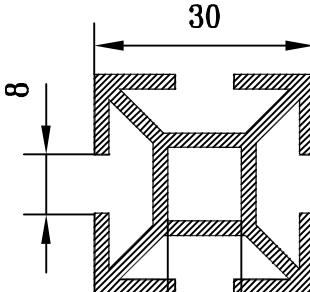
A pdf writer that produces quality PDF files with ease!

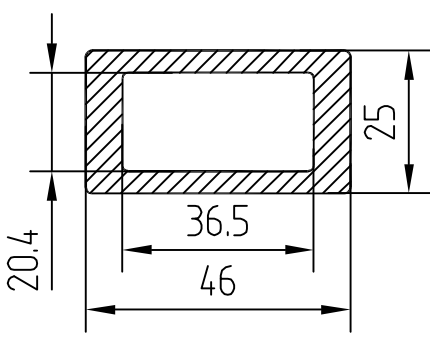
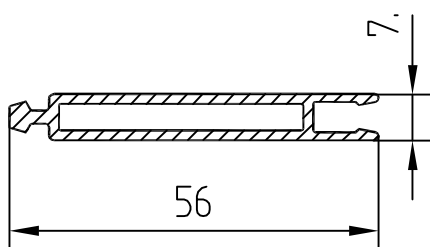
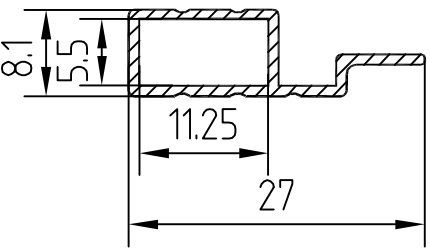
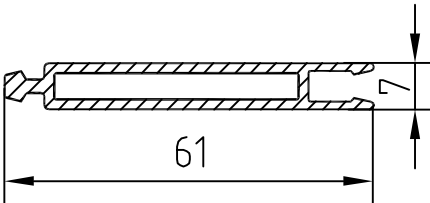
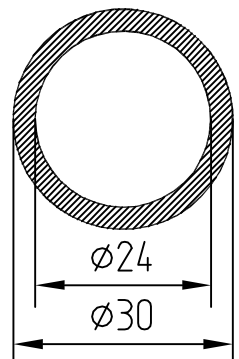
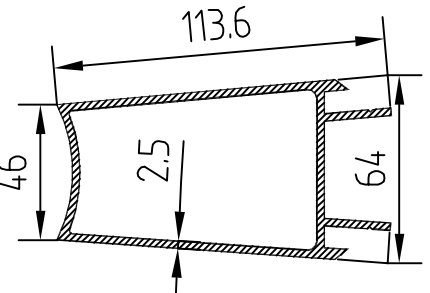
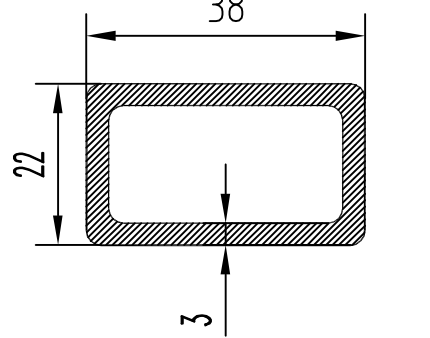
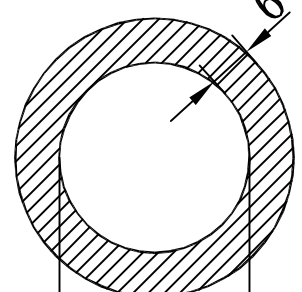
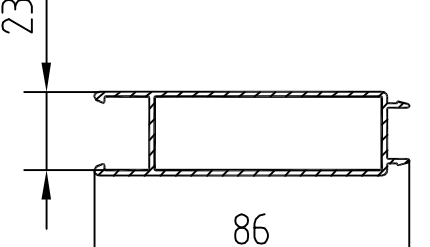
Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

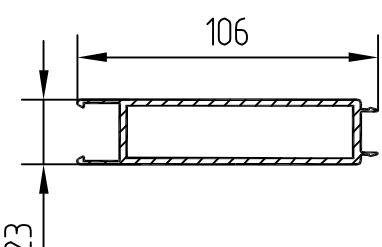
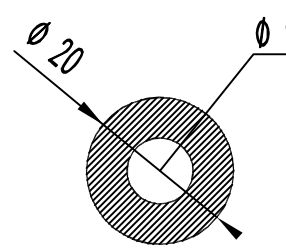
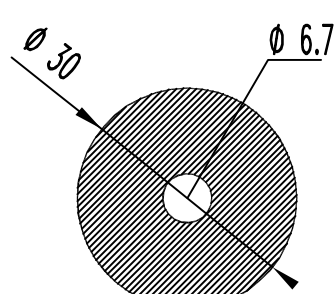
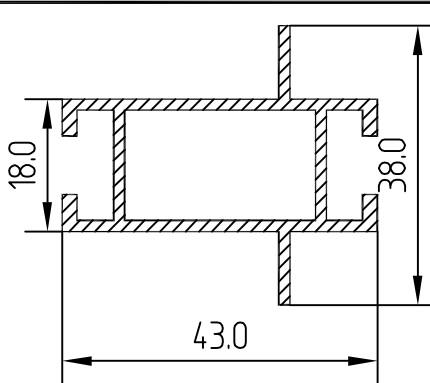
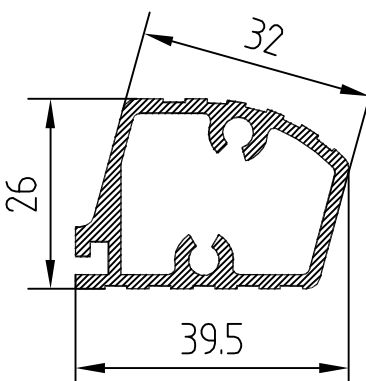
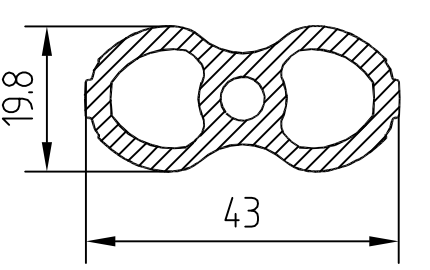
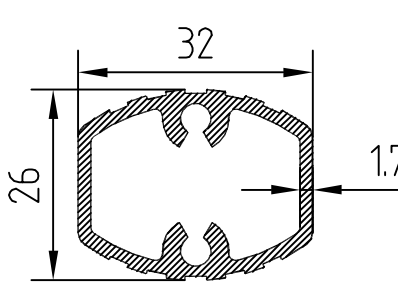
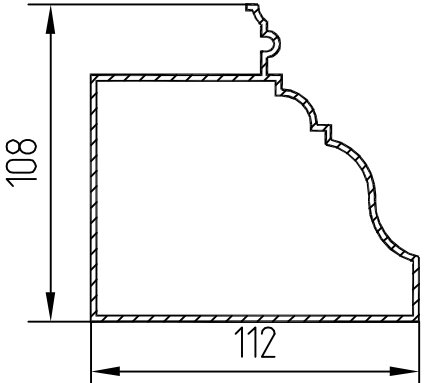
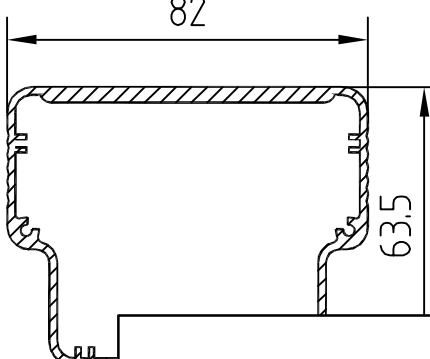
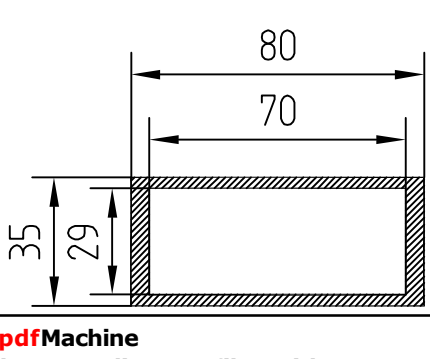
Get yours now!

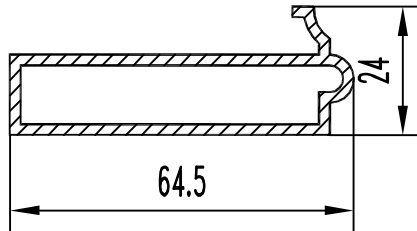
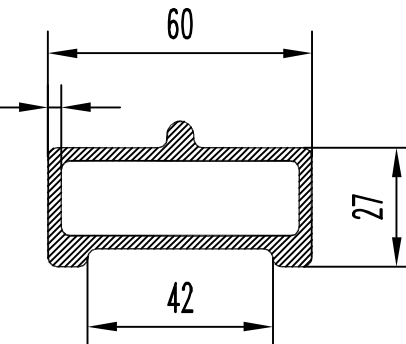
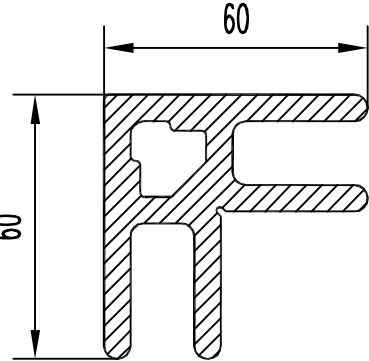
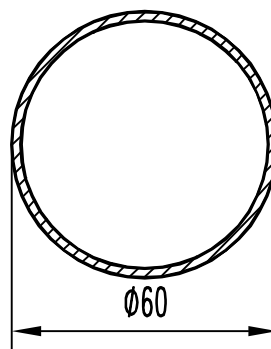
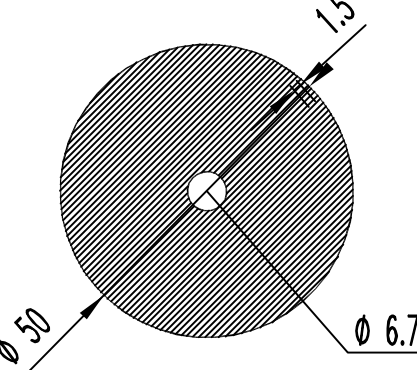
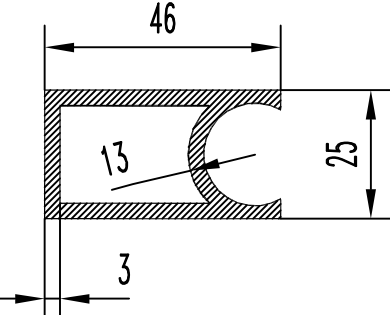
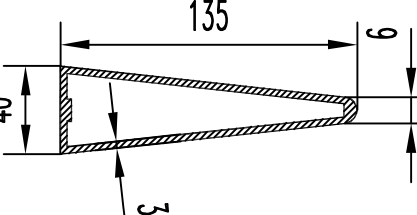
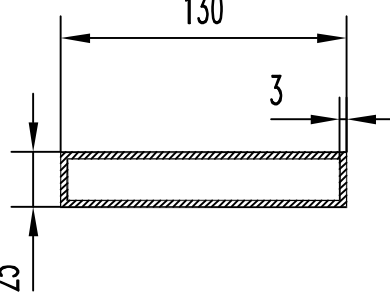
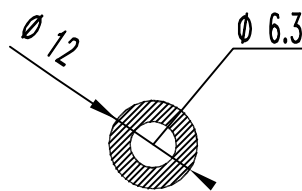
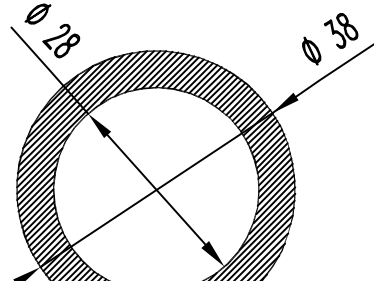
	БПЗ-001 $F \text{ см}^2 = 17.202$ $Q \text{ кг.} = 4.662$ $D \text{ оп.мм} = 163.0$ $P \text{ н.мм} = 323.14$ $P \text{ вн.мм} = 380$ Гр. сл. = IV Точн. = Н		БПЗ-0006 $F \text{ см}^2 = 0.88$ $Q \text{ кг.} = 0.238$ $D \text{ оп.мм} = 16$ $P \text{ н.мм} = 50.3$ $P \text{ вн.мм} = 37.7$ Гр. сл. = III Точн. = П
	БПЗ-0002 $F \text{ см}^2 = 0.43$ $Q \text{ кг.} = 0.165$ $D \text{ оп.мм} = 68$ $P \text{ н.мм} = 180.1$ $P \text{ вн.мм} = 160.1$ Гр. сл. = IV Точн. = П		БПЗ-0007 $F \text{ см}^2 = 15.81$ $Q \text{ кг.} = 4.285$ $D \text{ оп.мм} = 129$ $P \text{ н.мм} = 494$ $P \text{ вн.мм} = 375$ Гр. сл. = IV Точн. = П
	БПЗ-0003 $F \text{ см}^2 = 2.895$ $Q \text{ кг.} = 0.785$ $D \text{ оп.мм} = 50$ $P \text{ н.мм} = 171.5$ $P \text{ вн.мм} = 118.3$ Гр. сл. = VI Точн. = П		БПЗ-0008 $F \text{ см}^2 = 18.67$ $Q \text{ кг.} = 5.059$ $D \text{ оп.мм} = 140$ $P \text{ н.мм} = 545$ $P \text{ вн.мм} = 411$ Гр. сл. = V Точн. = П
	БПЗ-0004 $F \text{ см}^2 = 4.235$ $Q \text{ кг.} = 1.148$ $D \text{ оп.мм} = 96.1$ $P \text{ н.мм} = 212.3$ $P \text{ вн.мм} = 124$ Гр. сл. = VI Точн. = П		БПЗ-0009 $F \text{ см}^2 = 3.922$ $Q \text{ кг.} = 1.062$ $D \text{ оп.мм} = 74$ $P \text{ н.мм} = 263$ $P \text{ вн.мм} = 151$ Гр. сл. = V Точн. = П
	БПЗ-0005 $F \text{ см}^2 = 8.63$ $Q \text{ кг.} = 2.339$ $D \text{ оп.мм} = 128.0$ $P \text{ н.мм} = 472.8$ $P \text{ вн.мм} = 361.3$ Гр. сл. = VI Точн. = П		БПЗ-0010 $F \text{ см}^2 = 3.562$ $Q \text{ кг.} = 0.965$ $D \text{ оп.мм} = 63$ $P \text{ н.мм} = 222$ $P \text{ вн.мм} = 145$ Гр. сл. = V Точн. = П

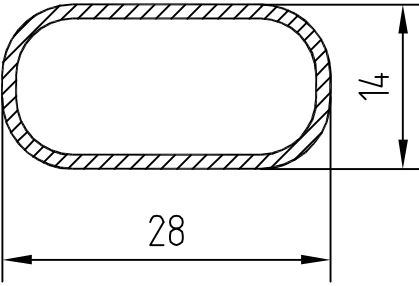
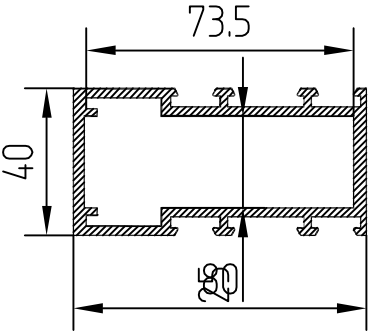
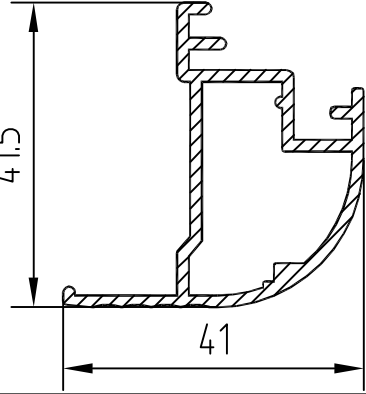
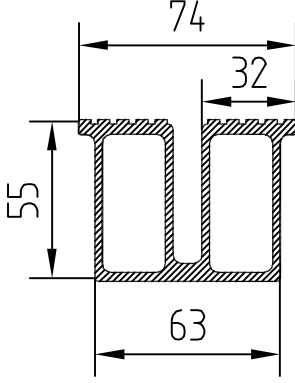
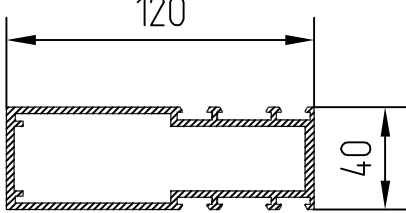
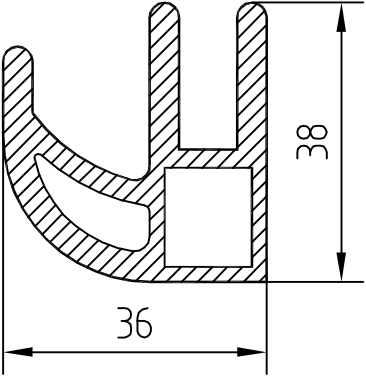
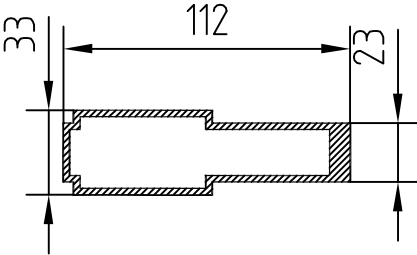
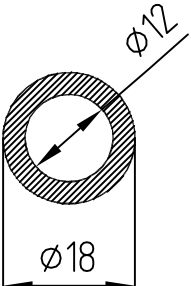
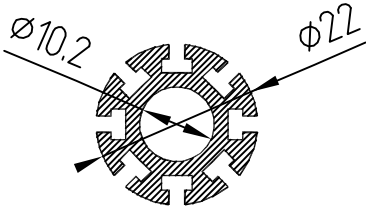
	БПЗ-0011 $F \text{ см}^2 = 1.413$ $Q \text{ кг.} = 0.383$ $D \text{ оп.мм} = 28$ $P \text{ н.мм} = 101$ $P \text{ вн.мм} = 30$ Гр. сл. = V Точн. = П		БПЗ-0016 $F \text{ см}^2 = 4.175$ $Q \text{ кг.} = 1.128$ $D \text{ оп.мм} = 79$ $P \text{ н.мм} = 293$ $P \text{ вн.мм} = 145$ Гр. сл. = V Точн. = П
	БПЗ-0012 $F \text{ см}^2 = 3.266$ $Q \text{ кг.} = 0.885$ $D \text{ оп.мм} = 43$ $P \text{ н.мм} = 143$ $P \text{ вн.мм} = 121$ Гр. сл. = V Точн. = П		БПЗ-017 $F \text{ см}^2 = 8.275$ $Q \text{ кг.} = 2.243$ $D \text{ оп.мм} = 90.0$ $P \text{ н.мм} = 276.0$ $P \text{ вн.мм} = 198.0$ Гр. сл. = IV Точн. = П
	БПЗ-0013 $F \text{ см}^2 = 5.337$ $Q \text{ кг.} = 1.446$ $D \text{ оп.мм} = 146$ $P \text{ н.мм} = 334$ $P \text{ вн.мм} = 211.4$ Гр. сл. = V Точн. = П		БПЗ-018 $F \text{ см}^2 = 21.195$ $Q \text{ кг.} = 5.744$ $D \text{ оп.мм} = 140.0$ $P \text{ н.мм} = 439.8$ $P \text{ вн.мм} = 408.4$ Гр. сл. = V Точн. = П
	БПЗ-0014 $F \text{ см}^2 = 7.290$ $Q \text{ кг.} = 1.968$ $D \text{ оп.мм} = 127$ $P \text{ н.мм} = 438$ $P \text{ вн.мм} = 301$ Гр. сл. = V Точн. = П		БПЗ-0019 $F \text{ см}^2 = 3.351$ $Q \text{ кг.} = 0.908$ $D \text{ оп.мм} = 92$ $P \text{ н.мм} = 266$ $P \text{ вн.мм} = 103$ Гр. сл. = V Точн. = П
	БПЗ-0015 $F \text{ см}^2 = 3.131$ $Q \text{ кг.} = 0.845$ $D \text{ оп.мм} = 85$ $P \text{ н.мм} = 236$ $P \text{ вн.мм} = 103$ Гр. сл. = V Точн. = П		БПЗ-0020 $F \text{ см}^2 = 2.455$ $Q \text{ кг.} = 0.663$ $D \text{ оп.мм} = 56$ $P \text{ н.мм} = 165$ $P \text{ вн.мм} = 91$ Гр. сл. = V Точн. = П

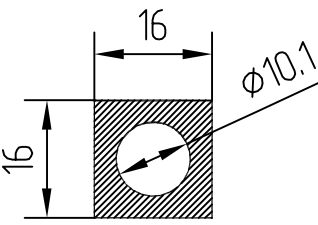
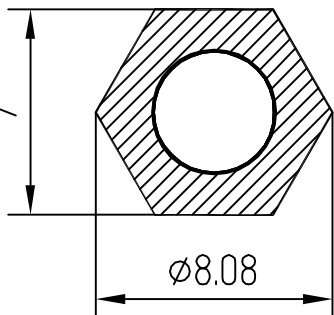
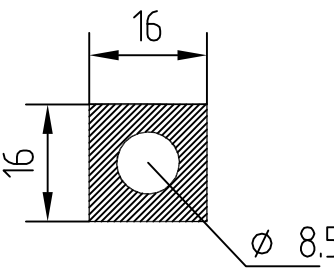
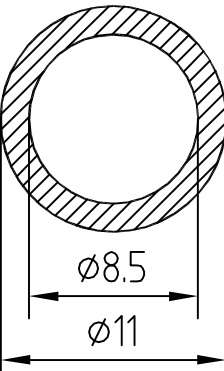
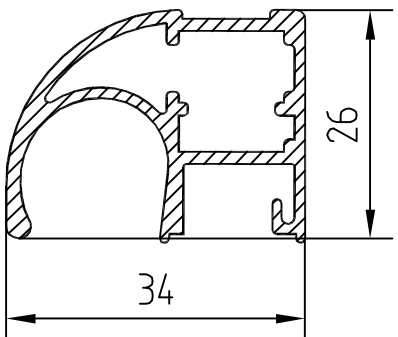
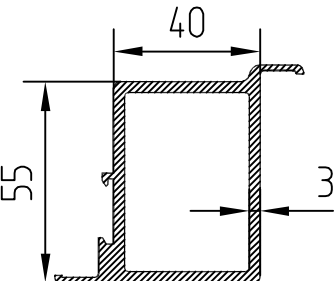
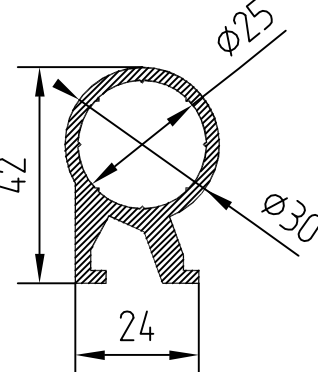
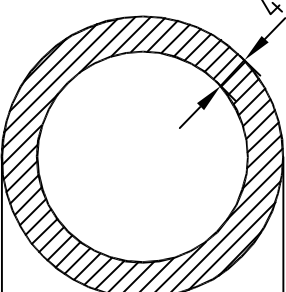
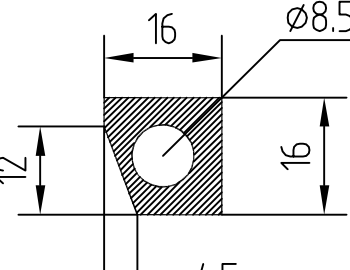
	БПЗ-0021 $F_{\text{см}} = 2.632$ $Q_{\text{кг}} = 0.713$ $D_{\text{оп.мм}} = 40$ $P_{\text{н.мм}} = 195$ $P_{\text{вн.мм}} = 71$ Гр. сл. = V Точн. = П		
			БПЗ-0027 $F_{\text{см}^2} = 2.133$ $Q_{\text{кг}} = 0.578$ $D_{\text{оп.мм}} = 64$ $P_{\text{н.мм}} = 214$ $P_{\text{вн.мм}} = 42$ Гр. сл. = V Точн. = П
			БПЗ-0028 $F_{\text{см}^2} = 6.47$ $Q_{\text{кг}} = 1.753$ $D_{\text{оп.мм}} = 106.0$ $P_{\text{н.мм}} = 355.5$ $P_{\text{вн.мм}} = 210.9$ Гр. сл. = VI Точн. = П
			БПЗ-0029 $F_{\text{см}^2} = 4.951$ $Q_{\text{кг}} = 1.342$ $D_{\text{оп.мм}} = 78$ $P_{\text{н.мм}} = 173.4$ $P_{\text{вн.мм}} = 155.1$ Гр. сл. = Особ. Точн. = П
			БПЗ-030 $F_{\text{см}^2} = 3.238$ $Q_{\text{кг}} = 0.877$ $D_{\text{оп.мм}} = 42.4$ $P_{\text{н.мм}} = 277.3$ $P_{\text{вн.мм}} = 40.0$ Гр. сл. = IV

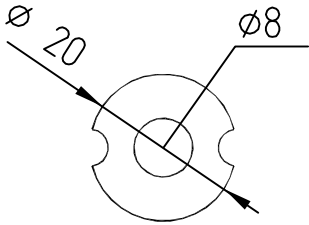
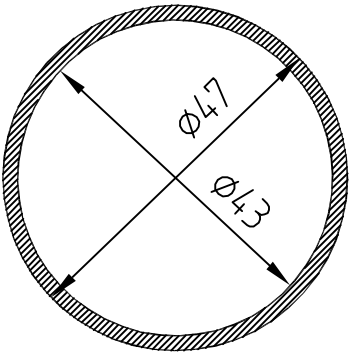
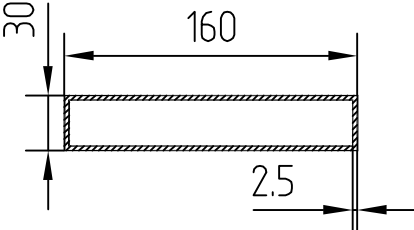
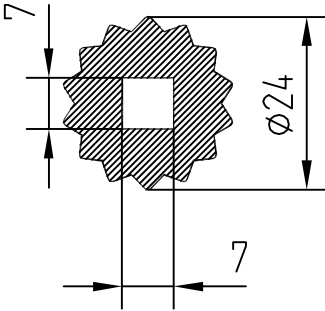
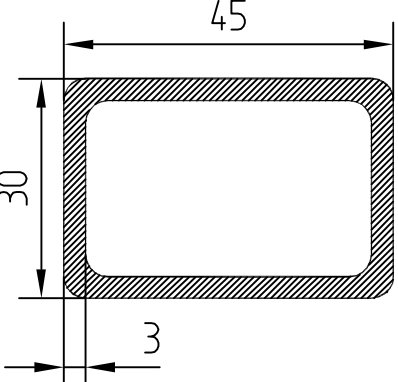
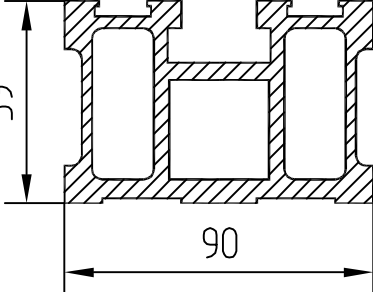
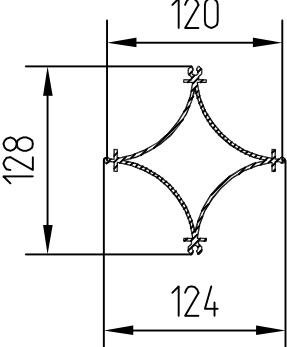
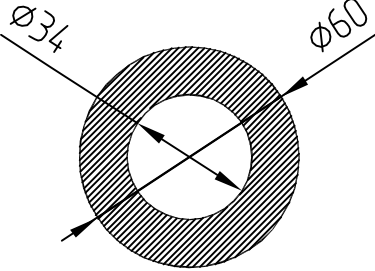
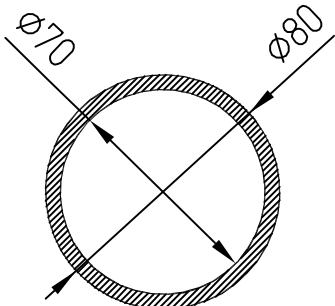
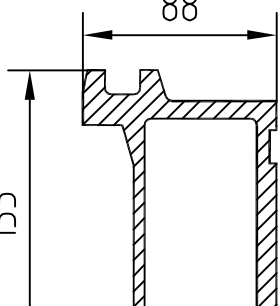
	БПЗ-031 $F_{\text{см}} = 4.05$ $Q_{\text{кг.}} = 1.098$ $D_{\text{оп.мм}} = 58.5$ $P_{\text{н.мм}} = 142$ $P_{\text{вн.мм}} = 113$ Гр. сл. = IV Точн. = II		БПЗ-0036 $F_{\text{см}^2} = 1.750$ $Q_{\text{кг.}} = 0.474$ $D_{\text{оп.мм}} = 56.2$ $P_{\text{н.мм}} = 146.9$ $P_{\text{вн.мм}} = 81.5$ Гр. сл. = VI Точн. = П
	БПЗ-032 $F_{\text{см}} = 0.692$ $Q_{\text{кг.}} = 0.187$ $D_{\text{оп.мм}} = 27.2$ $P_{\text{н.мм}} = 78.2$ $P_{\text{вн.мм}} = 33.6$ Гр. сл. = IV Точн. = II		БПЗ-0037 $F_{\text{см}^2} = 1.89$ $Q_{\text{кг.}} = 0.512$ $D_{\text{оп.мм}} = 61.2$ $P_{\text{н.мм}} = 157.8$ $P_{\text{вн.мм}} = 91.5$ Гр. сл. = VI Точн. = П
	БПЗ-033 $F_{\text{см}^2} = 2.54$ $Q_{\text{кг.}} = 0.688$ $D_{\text{оп.мм}} = 30.0$ $P_{\text{н.мм}} = 94.3$ $P_{\text{вн.мм}} = 75.4$ Гр. сл. = IV Точн. = П		
	БПЗ-034 $F_{\text{см}^2} = 8.605$ $Q_{\text{кг.}} = 2.332$ $D_{\text{оп.мм}} = 121.8$ $P_{\text{н.мм}} = 409.9$ $P_{\text{вн.мм}} = 263.7$ Гр. сл. = VI Точн. = П		БПЗ-039 $F_{\text{см}^2} = 3.24$ $Q_{\text{кг.}} = 0.878$ $D_{\text{оп.мм}} = 43.3$ $P_{\text{н.мм}} = 116.6$ $P_{\text{вн.мм}} = 92.57$ Гр. сл. = IV Точн. = Н
	БПЗ-0035 $F_{\text{см}^2} = 5.932$ $Q_{\text{кг.}} = 1.608$ $D_{\text{оп.мм}} = 38.0$ $P_{\text{н.мм}} = 119.4$ $P_{\text{вн.мм}} = 81.7$		БПЗ-0040 $F_{\text{см}^2} = 3.200$ $Q_{\text{кг.}} = 0.867$ $D_{\text{оп.мм}} = 87.8$ $P_{\text{н.мм}} = 260.2$ $P_{\text{вн.мм}} = 163.5$

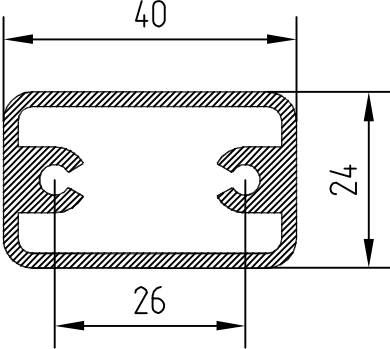
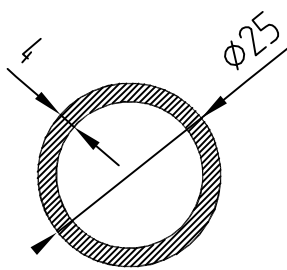
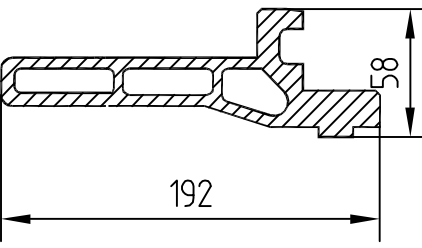
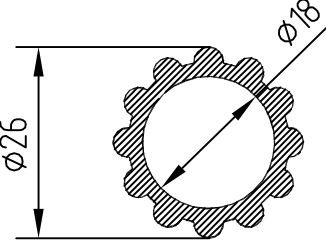
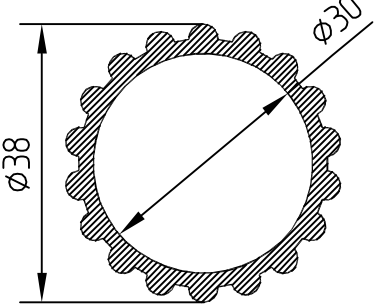
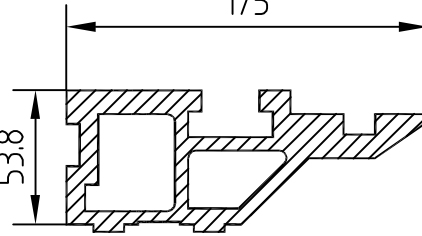
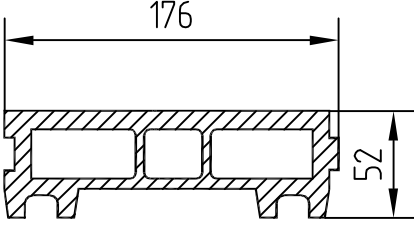
	БПЗ-041 $F \text{ см}^2 = 3.8$ $Q \text{ кг.} = 1.1$ $D \text{ оп.мм} = 107.4$ $P \text{ н.мм} = 300.2$ $P \text{ вн.мм} = 203.5$ Гр. сл. = IV Точн. = П		БПЗ-046 $F \text{ см}^2 = 2.505$ $Q \text{ кг.} = 0.679$ $D \text{ оп.мм} = 20.0$ $P \text{ н.мм} = 62.8$ $P \text{ вн.мм} = 28.27$ Гр. сл. = III Точн. = Н
	БПЗ-042 $F \text{ см}^2 = 6.716$ $Q \text{ кг.} = 1.82$ $D \text{ оп.мм} = 30.0$ $P \text{ н.мм} = 94.3$ $P \text{ вн.мм} = 20.1$ Гр. сл. = IV Точн. = П		БПЗ-047 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм} = 0$ $P \text{ н.мм} = 0$ $P \text{ вн.мм} = 0$ Гр. сл. = III Точн. = Н
	БПЗ-043 $F \text{ см}^2 = 2.463$ $Q \text{ кг.} = 0.667$ $D \text{ оп.мм} = 46.0$ $P \text{ н.мм} = 134$ $P \text{ вн.мм} = 127.7$ Гр. сл. = IV Точн. = Н		БПЗ-0048 $F \text{ см}^2 = 3.607$ $Q \text{ кг.} = 0.977$ $D \text{ оп.мм} = 43.0$ $P \text{ н.мм} = 111.9$ $P \text{ вн.мм} = 105.6$ Гр. сл. = 0особ. Точн. = П
	БПЗ-044 $F \text{ см}^2 = 2.17$ $Q \text{ кг.} = 0.588$ $D \text{ оп.мм} = 34.0$ $P \text{ н.мм} = 109.8$ $P \text{ вн.мм} = 121.9$ Гр. сл. = VI Точн. = Н		БПЗ-0049 $F \text{ см}^2 = 7.930$ $Q \text{ кг.} = 2.149$ $D \text{ оп.мм} = 159.0$ $P \text{ н.мм} = 437.1$ $P \text{ вн.мм} = 356.0$ Гр. сл. = VI Точн. = П
	БПЗ-0045 $F \text{ см}^2 = 6.418$ $Q \text{ кг.} = 1.739$ $D \text{ оп.мм} = 120.0$ $P \text{ н.мм} = 275.2$ $P \text{ вн.мм} = 316.9$		БПЗ-050 $F \text{ см}^2 = 7.7$ $Q \text{ кг.} = 2.087$ $D \text{ оп.мм} = 87.3$ $P \text{ н.мм} = 230$ $P \text{ вн.мм} = 198$

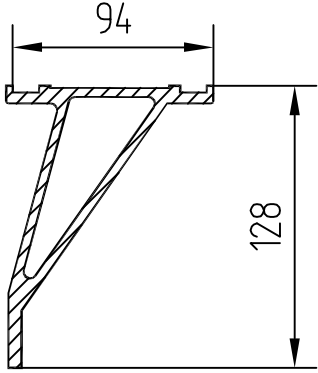
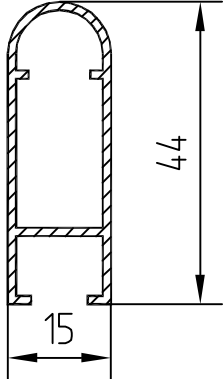
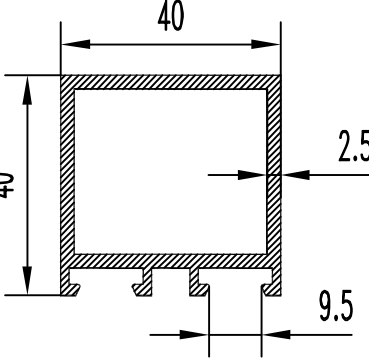
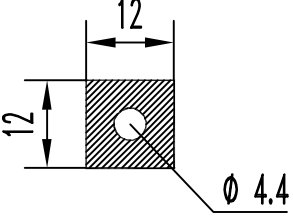
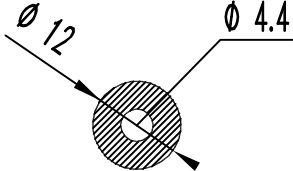
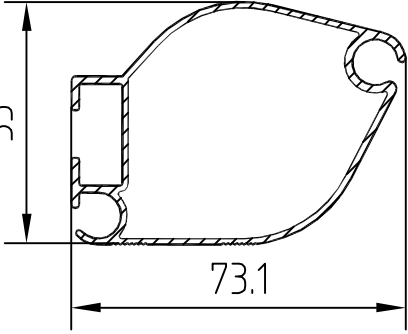
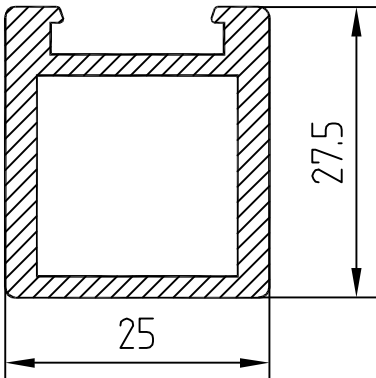
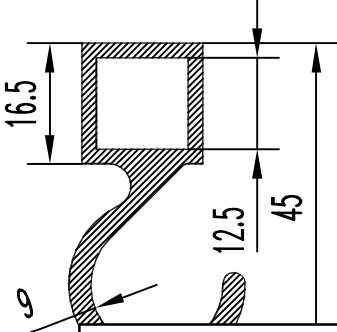
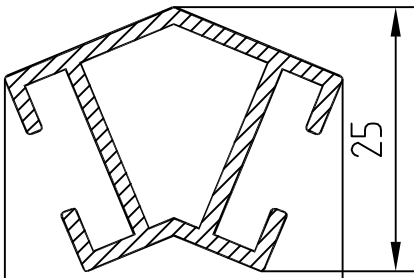
	БПЗ-0051 $F \text{ см}^2 = 3.200$ $Q \text{ кг.} = 0.867$ $D \text{ оп.мм} = 65.5$ $P \text{ н.мм} = 179.2$ $P \text{ вн.мм} = 140.9$ Гр. сл. = V Точн. = П		БПЗ-0056 $F \text{ см}^2 = 6.100$ $Q \text{ кг.} = 1.653$ $D \text{ оп.мм} = 68.0$ $P \text{ н.мм} = 212.2$ $P \text{ вн.мм} = 126.0$ Гр. сл. = IV Точн. = П
	БПЗ-0052 $F \text{ см}^2 = 13.480$ $Q \text{ кг.} = 3.653$ $D \text{ оп.мм} = 81.0$ $P \text{ н.мм} = 349.7$ $P \text{ вн.мм} = 60.3$ Гр. сл. = VI Точн. = П		БПЗ-0057 $F \text{ см}^2 = 2.750$ $Q \text{ кг.} = 0.745$ $D \text{ оп.мм} = 60.0$ $P \text{ н.мм} = 188.5$ $P \text{ вн.мм} = 179.1$ Гр. сл. = IV Точн. = Н
	БПЗ-0053 $F \text{ см}^2 = 19.28$ $Q \text{ кг.} = 5.225$ $D \text{ оп.мм} = 50.0$ $P \text{ н.мм} = 157.1$ $P \text{ вн.мм} = 21.05$ Гр. сл. = II Точн. = П		БПЗ-0058 $F \text{ см}^2 = 4.190$ $Q \text{ кг.} = 1.135$ $D \text{ оп.мм} = 52.0$ $P \text{ н.мм} = 166.5$ $P \text{ вн.мм} = 112.5$ Гр. сл. = IV Точн. = П
	БПЗ-0054 $F \text{ см}^2 = 9.56$ $Q \text{ кг.} = 2.591$ $D \text{ оп.мм} = 136.0$ $P \text{ н.мм} = 318.4$ $P \text{ вн.мм} = 296.8$ Гр. сл. = IV Точн. = Н		БПЗ-0059 $F \text{ см}^2 = 7.700$ $Q \text{ кг.} = 2.087$ $D \text{ оп.мм} = 132.0$ $P \text{ н.мм} = 310.0$ $P \text{ вн.мм} = 288.0$ Гр. сл. = III Точн. = Н
	БПЗ-0055 $F \text{ см}^2 = 0.819$ $Q \text{ кг.} = 0.222$ $D \text{ оп.мм} = 12.0$ $P \text{ н.мм} = 37.7$ $P \text{ вн.мм} = 19.8$ Гр. сл. = III		БПЗ-0060 $F \text{ см}^2 = 5.183$ $Q \text{ кг.} = 1.405$ $D \text{ оп.мм} = 38.0$ $P \text{ н.мм} = 119.4$ $P \text{ вн.мм} = 87.9$ Гр. сл. = IV

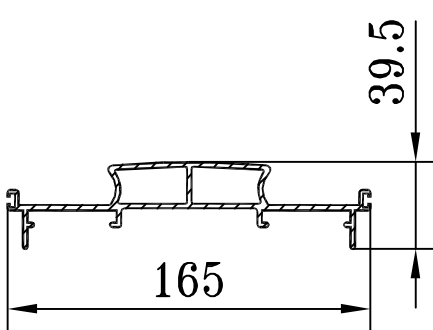
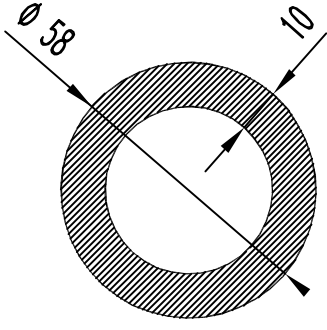
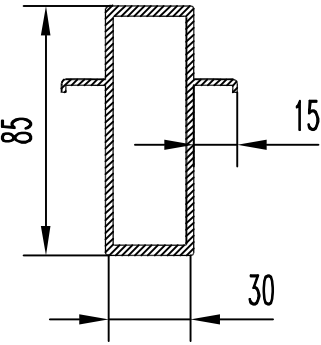
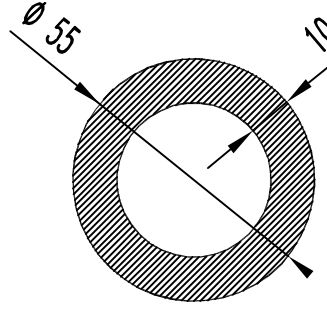
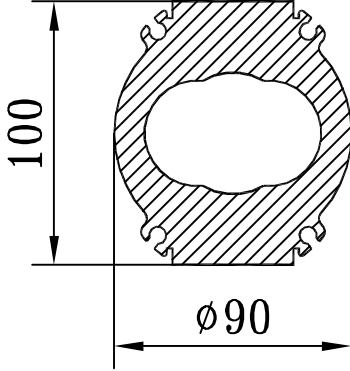
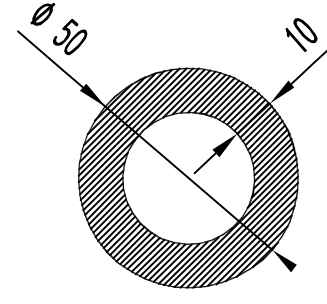
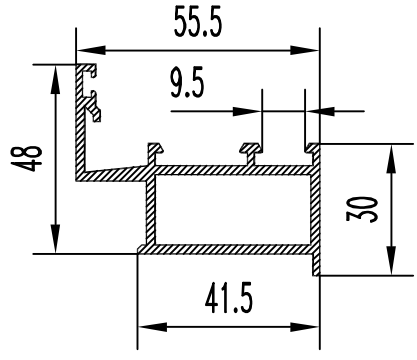
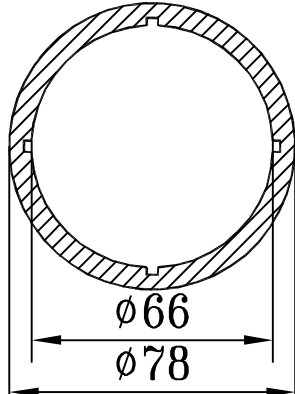
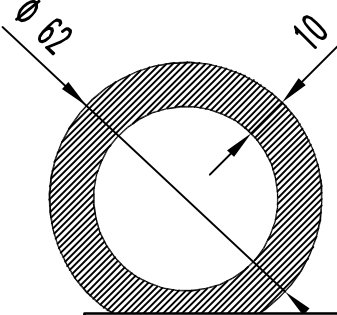
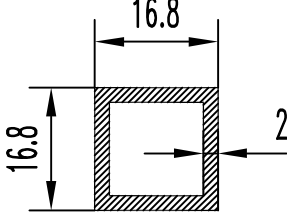
	БПЗ-0061 $F \text{ см}^2 = 0.840$ $Q \text{ кг.} = 0.228$ $D \text{ оп.мм} = 28.0$ $P \text{ н.мм} = 73.7$ $P \text{ вн.мм} = 66.2$ Гр. сл. = IV Точн. = Н		БПЗ-066 $F \text{ см}^2 = 7.28$ $Q \text{ кг.} = 1.973$ $D \text{ оп.мм} = 89.4$ $P \text{ н.мм} = 338.2$ $P \text{ вн.мм} = 229$ Гр. сл. = VI Точн. = П
	БПЗ-0062 $F \text{ см}^2 = 2.360$ $Q \text{ кг.} = 0.640$ $D \text{ оп.мм} = 51.0$ $P \text{ н.мм} = 193.2$ $P \text{ вн.мм} = 97.0$ Гр. сл. = VI Точн. = П		БПЗ-067 $F \text{ см}^2 = 11.110$ $Q \text{ кг.} = 3.011$ $D \text{ оп.мм} = 45.0$ $P \text{ н.мм} = 397.3$ $P \text{ вн.мм} = 255.7$ Гр. сл. = 0соб. Точн. = Н
			БПЗ-068 $F \text{ см}^2 = 9.28$ $Q \text{ кг.} = 2.515$ $D \text{ оп.мм} = 126.5$ $P \text{ н.мм} = 418.2$ $P \text{ вн.мм} = 309$ Гр. сл. = VI Точн. = П
	БПЗ-0064 $F \text{ см}^2 = 5.010$ $Q \text{ кг.} = 1.358$ $D \text{ оп.мм} = 48.0$ $P \text{ н.мм} = 203.7$ $P \text{ вн.мм} = 96.9$ Гр. сл. = 0соб. Точн. = П		БПЗ-069 $F \text{ см}^2 = 7.99$ $Q \text{ кг.} = 2.165$ $D \text{ оп.мм} = 117.0$ $P \text{ н.мм} = 290$ $P \text{ вн.мм} = 259$ Гр. сл. = IV Точн. = П
	БПЗ-065 $F \text{ см}^2 = 1.413$ $Q \text{ кг.} = 0.383$ $D \text{ оп.мм} = 18.0$ $P \text{ н.мм} = 56.55$ $P \text{ вн.мм} = 37.7$ Гр. сл. = II		БПЗ-070 $F \text{ см}^2 = 2.060$ $Q \text{ кг.} = 0.558$ $D \text{ оп.мм} = 22.0$ $P \text{ н.мм} = 165.0$ $P \text{ вн.мм} = 32.0$ Гр. сл. = 0соб.

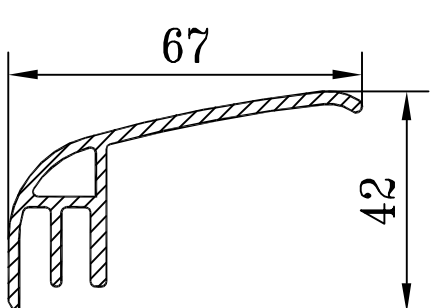
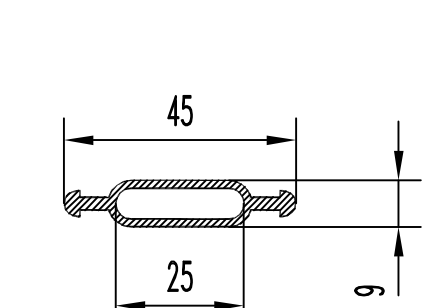
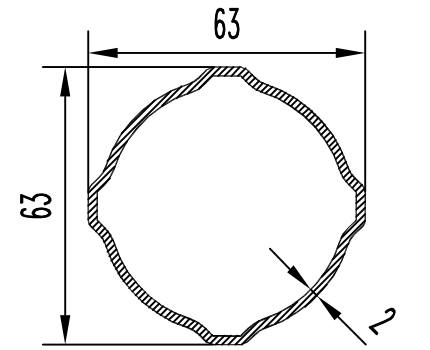
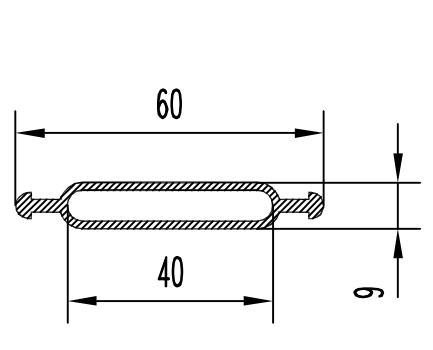
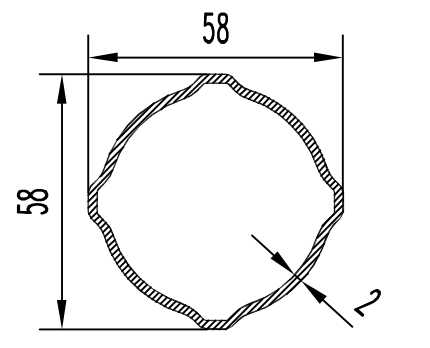
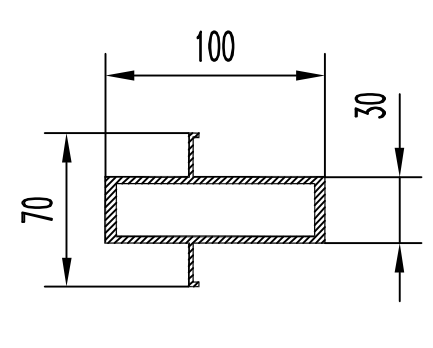
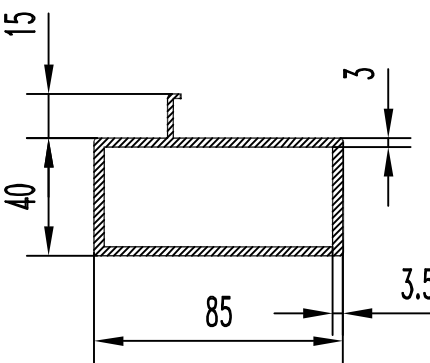
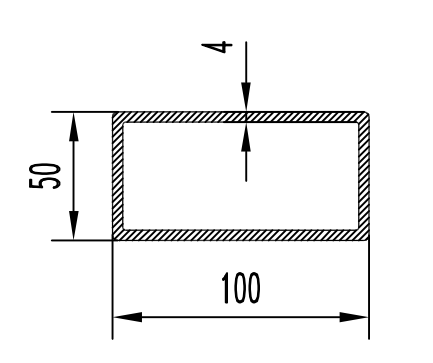
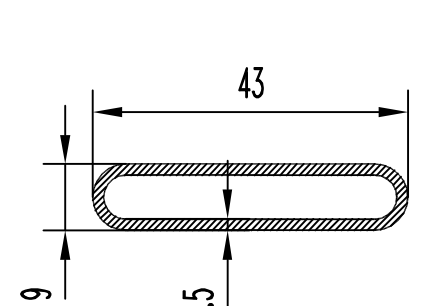
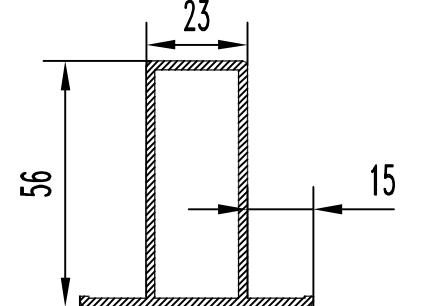
	БПЗ-071 $F \text{ см}^2 = 1.758$ $Q \text{ кг.} = 0.476$ $D \text{ оп.мм} = 22.7$ $P \text{ н.мм} = 64$ $P \text{ вн.мм} = 31.7$ Гр. сл. = IV Точн. = П		БПЗ-0076 $F \text{ см}^2 = 0.298$ $Q \text{ кг.} = 0.081$ $D \text{ оп.мм} = 8.1$ $P \text{ н.мм} = 24.3$ $P \text{ вн.мм} = 12.6$ Гр. сл. = V Точн. = Н
	БПЗ-072 $F \text{ см}^2 = 1.99$ $Q \text{ кг.} = 0.539$ $D \text{ оп.мм} = 22.7$ $P \text{ н.мм} = 64$ $P \text{ вн.мм} = 26.7$ Гр. сл. = IV Точн. = П		БПЗ-0077 $F \text{ см}^2 = 0.382$ $Q \text{ кг.} = 0.104$ $D \text{ оп.мм} = 11.0$ $P \text{ н.мм} = 34.6$ $P \text{ вн.мм} = 26.8$ Гр. сл. = IV Точн. = Н
	БПЗ-0073 $F \text{ см}^2 = 1.945$ $Q \text{ кг.} = 0.527$ $D \text{ оп.мм} = 42$ $P \text{ н.мм} = 171.5$ $P \text{ вн.мм} = 83.4$ Гр. сл. = 0соб. Точн. = П		БПЗ-078 $F \text{ см}^2 = 6.640$ $Q \text{ кг.} = 1.8$ $D \text{ оп.мм} = 89.0$ $P \text{ н.мм} = 166.0$ $P \text{ вн.мм} = 271.0$ Гр. сл. = IV Точн. = Т
			БПЗ-079 $F \text{ см}^2 = 3.757$ $Q \text{ кг.} = 1.018$ $D \text{ оп.мм} = 38.7$ $P \text{ н.мм} = 157.2$ $P \text{ вн.мм} = 81.79$ Гр. сл. = VI Точн. = П
	БПЗ-0075 $F \text{ см}^2 = 3.519$ $Q \text{ кг.} = 0.954$ $D \text{ оп.мм} = 32.0$ $P \text{ н.мм} = 100.5$ $P \text{ вн.мм} = 75.4$ Гр. сл. = IV		БПЗ-080 $F \text{ см}^2 = 1.72$ $Q \text{ кг.} = 0.466$ $D \text{ оп.мм} = 16.0$ $P \text{ н.мм} = 60.3$ $P \text{ вн.мм} = 26.7$ Гр. сл. = IV

	БПЗ-081-01 $F \text{ см}^2 = 2.453$ $Q \text{ кг.} = 0.665$ $D \text{ оп.мм} = 20.0$ $P \text{ н.мм} = 67.26$ $P \text{ вн.мм} = 25.13$ Гр. сл. = IV Точн. = П		БПЗ-086 $F \text{ см}^2 = 2.827$ $Q \text{ кг.} = 0.766$ $D \text{ оп.мм} = 47.0$ $P \text{ н.мм} = 135.1$ $P \text{ вн.мм} = 147.7$ Гр. сл. = III Точн. = Н
	БПЗ-082 $F \text{ см}^2 = 9.620$ $Q \text{ кг.} = 2.607$ $D \text{ оп.мм} = 162.8$ $P \text{ н.мм} = 380.4$ $P \text{ вн.мм} = 359.6$ Гр. сл. = Особ. Точн. = Н		БПЗ-087 $F \text{ см}^2 = 2.730$ $Q \text{ кг.} = 0.740$ $D \text{ оп.мм} = 24.0$ $P \text{ н.мм} = 162.0$ $P \text{ вн.мм} = 28.0$ Гр. сл. = VI Точн. = П
	БПЗ-083 $F \text{ см}^2 = 4.480$ $Q \text{ кг.} = 1.2$ $D \text{ оп.мм} = 51.6$ $P \text{ н.мм} = 144.8$ $P \text{ вн.мм} = 120.8$ Гр. сл. = IV Точн. = Н		БПЗ-0088 $F \text{ см}^2 = 18.830$ $Q \text{ кг.} = 5.103$ $D \text{ оп.мм} = 107.6$ $P \text{ н.мм} = 398.5$ $P \text{ вн.мм} = 353.7$ Гр. сл. = Особ. Точн. = П
	БПЗ-084 $F \text{ см}^2 = 8.77$ $Q \text{ кг.} = 2.377$ $D \text{ оп.мм} = 128.0$ $P \text{ н.мм} = 534.7$ $P \text{ вн.мм} = 294.8$ Гр. сл. = VI Точн. = П		БПЗ-089 $F \text{ см}^2 = 19.200$ $Q \text{ кг.} = 5.203$ $D \text{ оп.мм} = 60.0$ $P \text{ н.мм} = 188.5$ $P \text{ вн.мм} = 106.8$ Гр. сл. = III Точн. = Н
	БПЗ-085 $F \text{ см}^2 = 11.784$ $Q \text{ кг.} = 3.193$ $D \text{ оп.мм} = 80.0$ $P \text{ н.мм} = 251.3$ $P \text{ вн.мм} = 219.9$ Гр. сл. = IV Точн. = П		БПЗ-0090 $F \text{ см}^2 = 30.290$ $Q \text{ кг.} = 8.209$ $D \text{ оп.мм} = 152.0$ $P \text{ н.мм} = 457.4$ $P \text{ вн.мм} = 296.9$ Гр. сл. = Особ. Точн. = П

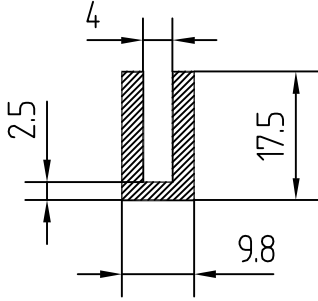
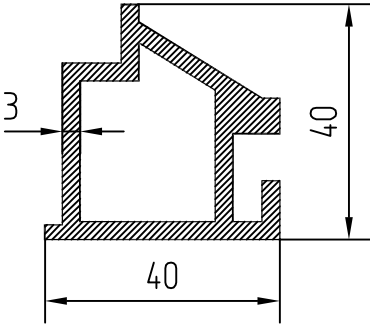
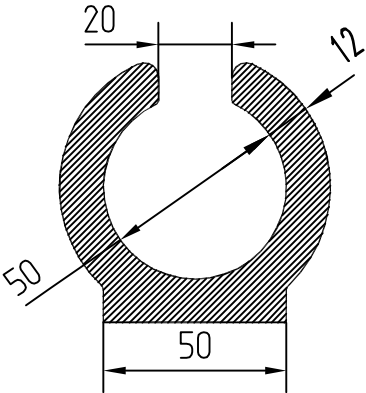
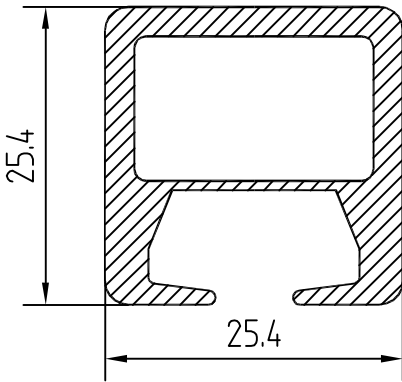
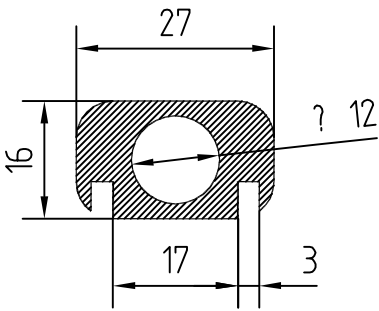
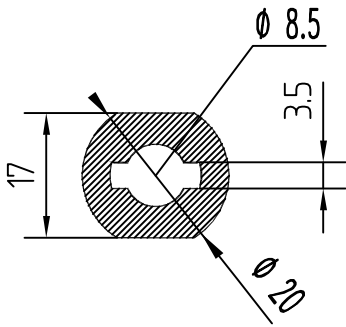
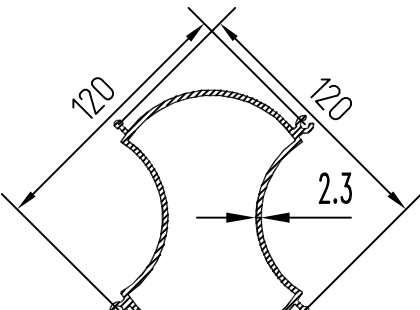
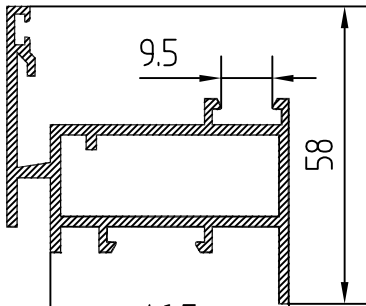
	БПЗ-091 F см ² = 3.39 Q кг. = 0.919 D оп.мм = 46.7 P н.мм = 121.1 P в.мм = 161 Гр. сл. = VI Точн. = П		БПЗ-096-01 F см ² = 2.640 Q кг. = 0.715 D оп.мм = 25.0 P н.мм = 78.5 P в.мм = 53.4 Гр. сл. = II Точн. = Н
	БПЗ-0092 F см ² = 29.600 Q кг. = 8.022 D оп.мм = 194.0 P н.мм = 503.0 P в.мм = 334.5 Гр. сл. = Особ. Точн. = П		БПЗ-097 F см ² = 2.04 Q кг. = 0.553 D оп.мм = 26.0 P н.мм = 100.8 P в.мм = 56.55 Гр. сл. = IV Точн. = Н
			БПЗ-098 F см ² = 3.16 Q кг. = 0.856 D оп.мм = 38.0 P н.мм = 152.1 P в.мм = 94.25 Гр. сл. = IV Точн. = Н
	БПЗ-0095 F см ² = 30.241 Q кг. = 8.195 D оп.мм = 180.2 P н.мм = 522.7 P в.мм = 321.0 Гр. сл. = Особ. Точн. = П		БПЗ-0100 F см ² = 37.790 Q кг. = 10.241 D оп.мм = 185.0 P н.мм = 532.7 P в.мм = 427.7 Гр. сл. = Особ. Точн. = П

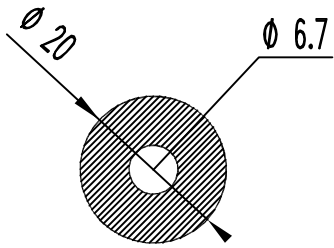
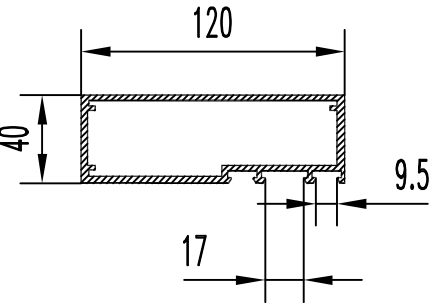
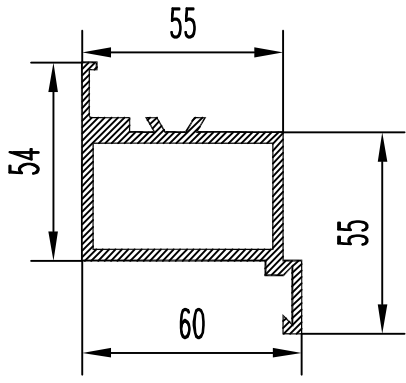
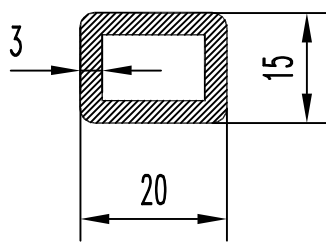
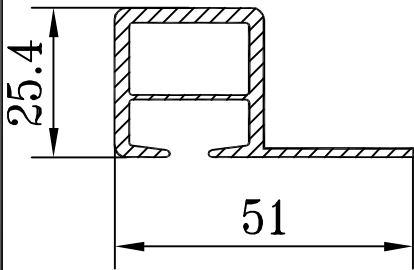
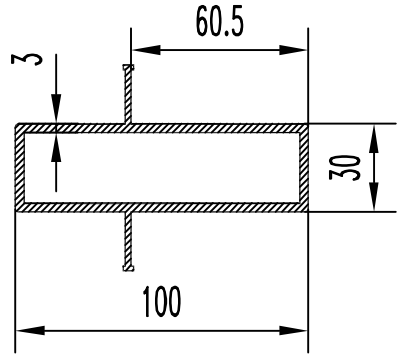
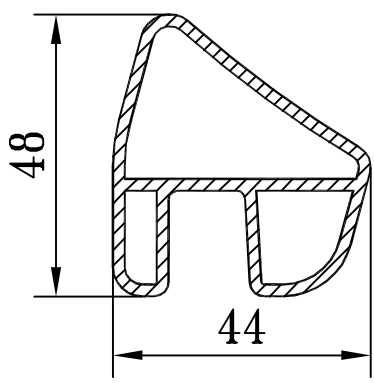
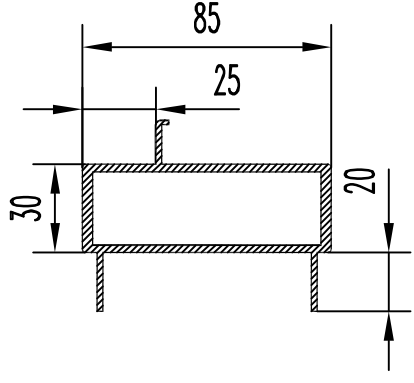
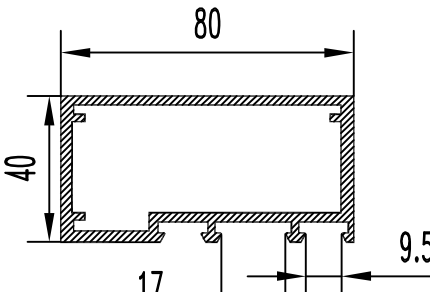
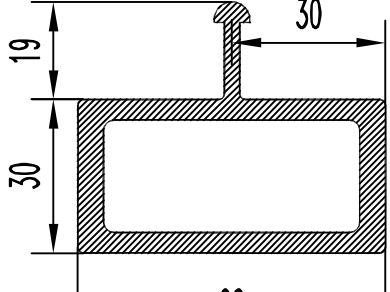
	БПЗ-0101 $F \text{ см}^2 = 15.493$ $Q \text{ кг.} = 4.199$ $D \text{ оп.мм} = 158.2$ $P \text{ н.мм} = 435.8$ $P \text{ вн.мм} = 224.4$ Гр. сл. = 0соб. Точн. = П		
	БПЗ-0102 $F \text{ см}^2 = 1.383$ $Q \text{ кг.} = 0.375$ $D \text{ оп.мм} = 45.3$ $P \text{ н.мм} = 140.2$ $P \text{ вн.мм} = 90.4$ Гр. сл. = VI Точн. = Н		БПЗ-107 $F \text{ см}^2 = 3.93$ $Q \text{ кг.} = 1.065$ $D \text{ оп.мм} = 56.5$ $P \text{ н.мм} = 203.0$ $P \text{ вн.мм} = 130.0$ Гр. сл. = III Точн. = Н
	БПЗ-103 $F \text{ см}^2 = 1.287$ $Q \text{ кг.} = 0.349$ $D \text{ оп.мм} = 17.0$ $P \text{ н.мм} = 48$ $P \text{ вн.мм} = 13.8$ Гр. сл. = IV Точн. = Н		БПЗ-108 $F \text{ см}^2 = 0.978$ $Q \text{ кг.} = 0.265$ $D \text{ оп.мм} = 12.0$ $P \text{ н.мм} = 37.7$ $P \text{ вн.мм} = 13.8$ Гр. сл. = III Точн. = Н
	БПЗ-0104 $F \text{ см}^2 = 3.520$ $Q \text{ кг.} = 0.954$ $D \text{ оп.мм} = 83.0$ $P \text{ н.мм} = 307.1$ $P \text{ вн.мм} = 189.3$ Гр. сл. = 0соб. Точн. = П		БПЗ-0109 $F \text{ см}^2 = 2.549$ $Q \text{ кг.} = 0.691$ $D \text{ оп.мм} = 36.4$ $P \text{ н.мм} = 116.0$ $P \text{ вн.мм} = 76.0$ Гр. сл. = VI Точн. = П
	БПЗ-105-01 $F \text{ см}^2 = 2.92$ $Q \text{ кг.} = 0.791$ $D \text{ оп.мм} = 42.0$ $P \text{ н.мм} = 165.4$ $P \text{ вн.мм} = 49.5$ Гр. сл. = VI Точн. = Н		БПЗ-0110 $F \text{ см}^2 = 1.576$ $Q \text{ кг.} = 0.427$ $D \text{ оп.мм} = 33.0$ $P \text{ н.мм} = 151.3$ $P \text{ вн.мм} = 58.3$ Гр. сл. = VI Точн. = Н

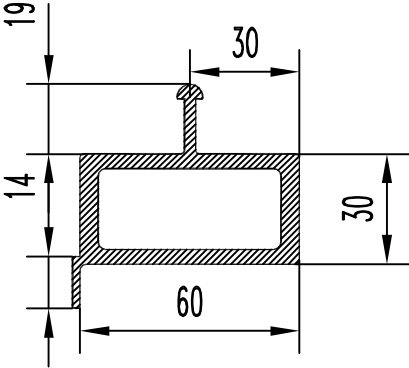
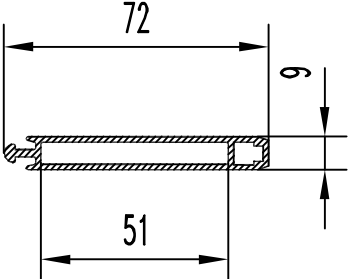
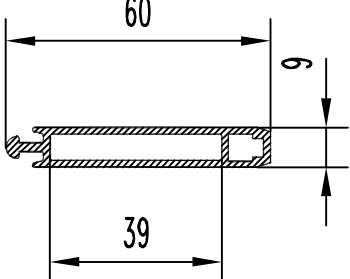
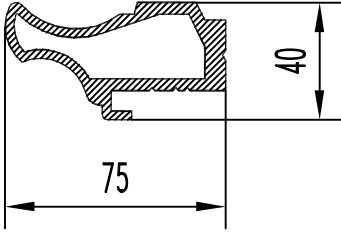
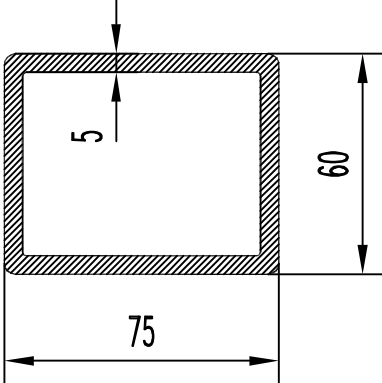
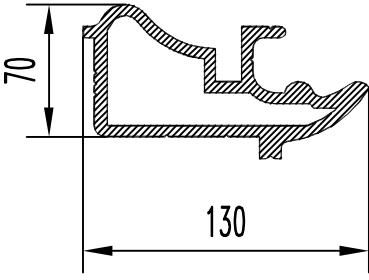
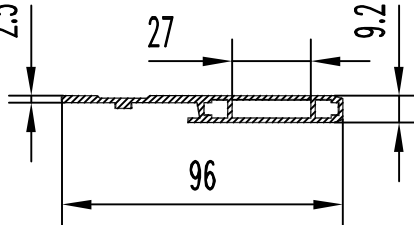
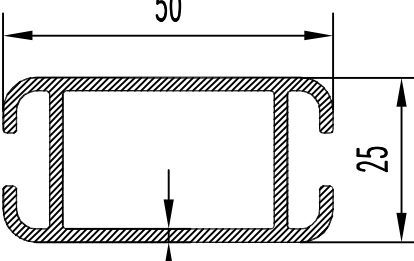
	БПЗ-0111 $F \text{ см}^2 = 7.870$ $Q \text{ кг.} = 2.133$ $D \text{ оп.мм} = 165.0$ $P \text{ н.мм} = 542.9$ $P \text{ вн.мм} = 192.0$ Гр. сл. = 0соб. Точн. = П		БПЗ-116 $F \text{ см}^2 = 15.300$ $Q \text{ кг.} = 4.146$ $D \text{ оп.мм} = 58.0$ $P \text{ н.мм} = 182.0$ $P \text{ вн.мм} = 119.0$ Гр. сл. = I Точн. = Т
	БПЗ-112 $F \text{ см}^2 = 6.960$ $Q \text{ кг.} = 1.886$ $D \text{ оп.мм} = 88.0$ $P \text{ н.мм} = 299.0$ $P \text{ вн.мм} = 206.0$ Гр. сл. = VI Точн. = Т		БПЗ-117 $F \text{ см}^2 = 14.130$ $Q \text{ кг.} = 3.829$ $D \text{ оп.мм} = 55.0$ $P \text{ н.мм} = 172.7$ $P \text{ вн.мм} = 109.9$ Гр. сл. = I Точн. = Т
	БПЗ-0113 $F \text{ см}^2 = 48.000$ $Q \text{ кг.} = 13.008$ $D \text{ оп.мм} = 111.6$ $P \text{ н.мм} = 421.2$ $P \text{ вн.мм} = 182.3$ Гр. сл. = V Точн. = П		БПЗ-118 $F \text{ см}^2 = 12.560$ $Q \text{ кг.} = 3.404$ $D \text{ оп.мм} = 50.0$ $P \text{ н.мм} = 157.0$ $P \text{ вн.мм} = 94.2$ Гр. сл. = I Точн. = Т
	БПЗ-114 $F \text{ см}^2 = 3.73$ $Q \text{ кг.} = 1.01$ $D \text{ оп.мм} = 74.0$ $P \text{ н.мм} = 276.8$ $P \text{ вн.мм} = 103$ Гр. сл. = VI Точн. = П		БПЗ-0119 $F \text{ см}^2 = 13.334$ $Q \text{ кг.} = 3.614$ $D \text{ оп.мм} = 78.0$ $P \text{ н.мм} = 245.0$ $P \text{ вн.мм} = 223.3$ Гр. сл. = IV Точн. = П
	БПЗ-115 $F \text{ см}^2 = 16.330$ $Q \text{ кг.} = 4.425$ $D \text{ оп.мм} = 62.0$ $P \text{ н.мм} = 195.0$ $P \text{ вн.мм} = 132.0$ Гр. сл. = I		БПЗ-120 $F \text{ см}^2 = 1.180$ $Q \text{ кг.} = 0.320$ $D \text{ оп.мм} = 24.0$ $P \text{ н.мм} = 67.2$ $P \text{ вн.мм} = 51.2$ Гр. сл. = IV

	БПЗ-0121 $F \text{ см}^2 = 3.277$ $Q \text{ кг.} = 0.888$ $D \text{ оп.мм} = 77.0$ $P \text{ н.мм} = 249.2$ $P \text{ вн.мм} = 36.5$ Гр. сл. = 0соб. Точн. = П		БПЗ-126 $F \text{ см}^2 = 1.680$ $Q \text{ кг.} = 0.46$ $D \text{ оп.мм} = 45.0$ $P \text{ н.мм} = 108.0$ $P \text{ вн.мм} = 57.0$ Гр. сл. = IV Точн. = Т
	БПЗ-122 $F \text{ см}^2 = 3.750$ $Q \text{ кг.} = 1.02$ $D \text{ оп.мм} = 63.0$ $P \text{ н.мм} = 196.0$ $P \text{ вн.мм} = 180.0$ Гр. сл. = IV Точн. = Т		БПЗ-127 $F \text{ см}^2 = 2.030$ $Q \text{ кг.} = 0.550$ $D \text{ оп.мм} = 60.0$ $P \text{ н.мм} = 138.0$ $P \text{ вн.мм} = 87.0$ Гр. сл. = IV Точн. = Т
	БПЗ-123 $F \text{ см}^2 = 4.230$ $Q \text{ кг.} = 1.15$ $D \text{ оп.мм} = 58.0$ $P \text{ н.мм} = 180.0$ $P \text{ вн.мм} = 168.0$ Гр. сл. = IV Точн. = Т		БПЗ-128 $F \text{ см}^2 = 9.700$ $Q \text{ кг.} = 2.63$ $D \text{ оп.мм} = 108.0$ $P \text{ н.мм} = 351.0$ $P \text{ вн.мм} = 228.0$ Гр. сл. = VI Точн. = Т
	БПЗ-124 $F \text{ см}^2 = 8.120$ $Q \text{ кг.} = 2.2$ $D \text{ оп.мм} = 95.0$ $P \text{ н.мм} = 295.0$ $P \text{ вн.мм} = 124.0$ Гр. сл. = VI Точн. = Т		БПЗ-129 $F \text{ см}^2 = 12.070$ $Q \text{ кг.} = 3.27$ $D \text{ оп.мм} = 110.0$ $P \text{ н.мм} = 296.0$ $P \text{ вн.мм} = 266.0$ Гр. сл. = V Точн. = Т
	БПЗ-125 $F \text{ см}^2 = 1.480$ $Q \text{ кг.} = 0.402$ $D \text{ оп.мм} = 43.0$ $P \text{ н.мм} = 102.0$ $P \text{ вн.мм} = 93.0$ Гр. сл. = IV Точн. = Т		БПЗ-130 $F \text{ см}^2 = 3.860$ $Q \text{ кг.} = 1.04$ $D \text{ оп.мм} = 70.0$ $P \text{ н.мм} = 218.0$ $P \text{ вн.мм} = 142.0$ Гр. сл. = VI Точн. = Т

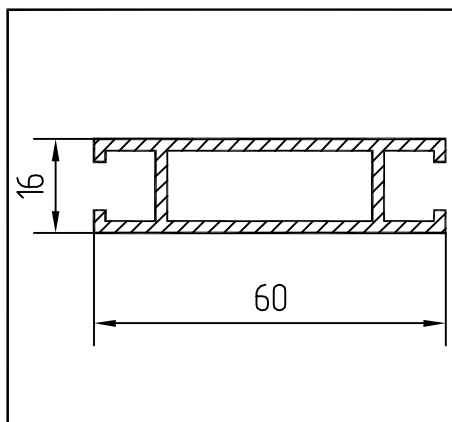
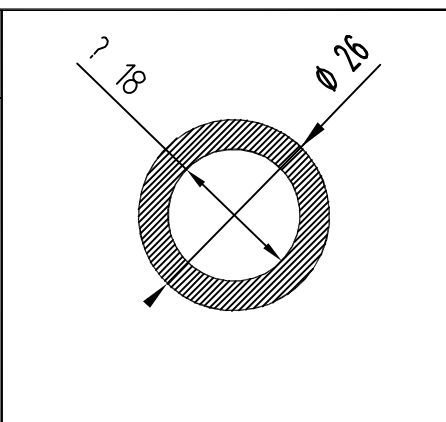
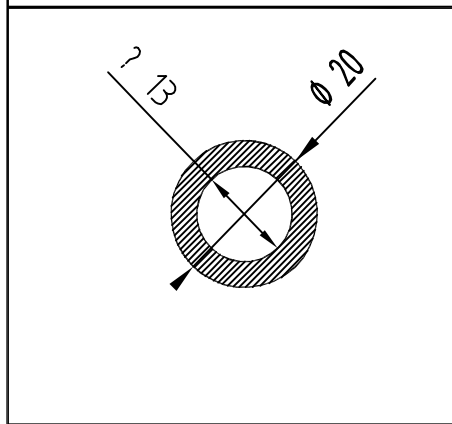
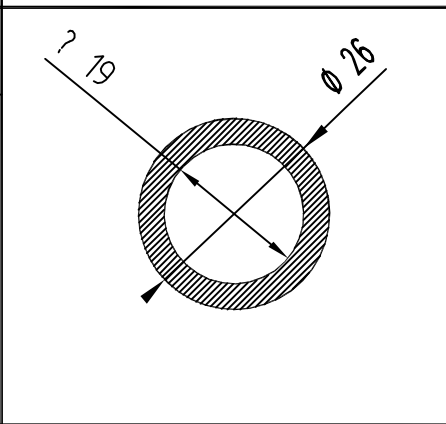
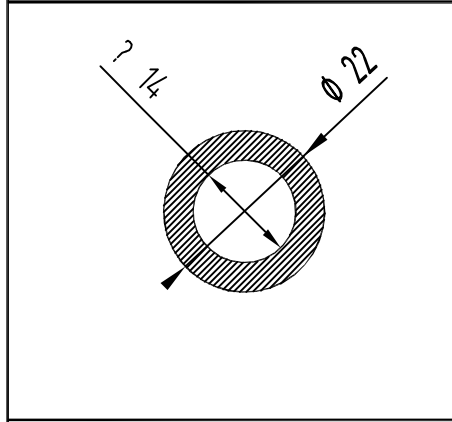
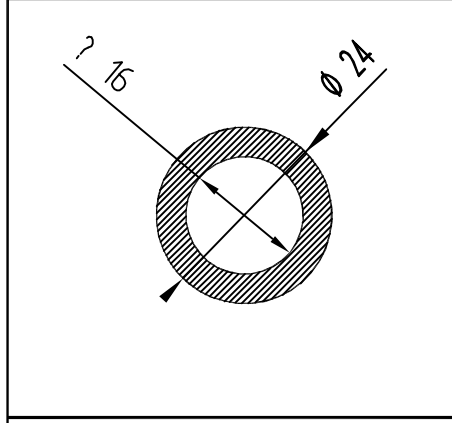
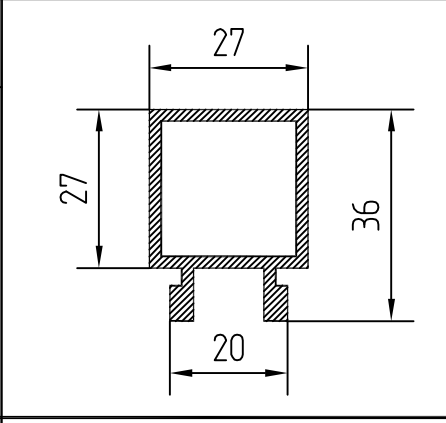
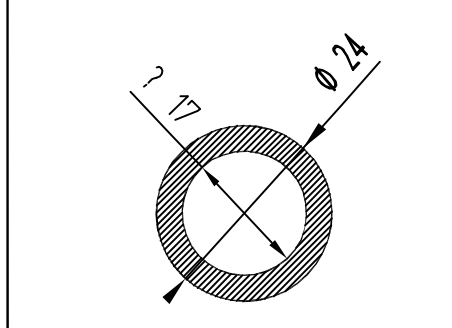
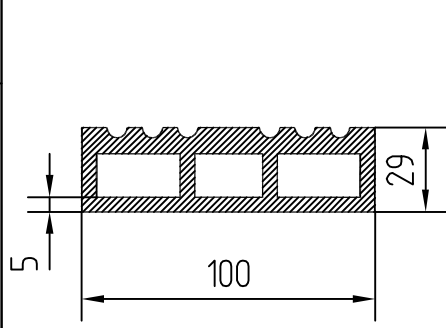
	БПЗ-131 $F \text{ см}^2 = 4.36$ $Q \text{ кг.} = 1.182$ $D \text{ оп.мм} = 82.0$ $P \text{ н.мм} = 328.8$ $P \text{ вн.мм} = 123$ Гр. сл. = VI Точн. = П		БПЗ-0136 $F \text{ см}^2 = 3.450$ $Q \text{ кг.} = 0.935$ $D \text{ оп.мм} = 76.0$ $P \text{ н.мм} = 244.0$ $P \text{ вн.мм} = 62.9$ Гр. сл. = 0соб. Точн. = П
	БПЗ-132 $F \text{ см}^2 = 11.500$ $Q \text{ кг.} = 3.12$ $D \text{ оп.мм} = 140.0$ $P \text{ н.мм} = 416.0$ $P \text{ вн.мм} = 307.0$ Гр. сл. = 0соб. Точн. = Т		БПЗ-0137 $F \text{ см}^2 = 2.227$ $Q \text{ кг.} = 0.604$ $D \text{ оп.мм} = 63.5$ $P \text{ н.мм} = 176.7$ $P \text{ вн.мм} = 85.2$ Гр. сл. = 0соб. Точн. = П
	БПЗ-133 $F \text{ см}^2 = 7.650$ $Q \text{ кг.} = 2.07$ $D \text{ оп.мм} = 94.0$ $P \text{ н.мм} = 292.0$ $P \text{ вн.мм} = 206.0$ Гр. сл. = VI Точн. = Т		
	БПЗ-134 $F \text{ см}^2 = 8.950$ $Q \text{ кг.} = 2.42$ $D \text{ оп.мм} = 94.0$ $P \text{ н.мм} = 363.0$ $P \text{ вн.мм} = 210.0$ Гр. сл. = VI Точн. = Т		
	БПЗ-135 $F \text{ см}^2 = 7.060$ $Q \text{ кг.} = 1.91$ $D \text{ оп.мм} = 91.0$ $P \text{ н.мм} = 294.0$ $P \text{ вн.мм} = 219.0$ Гр. сл. = VI		

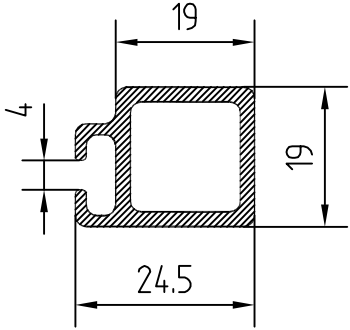
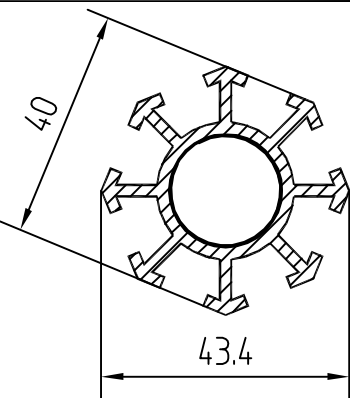
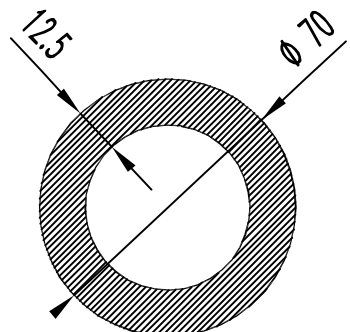
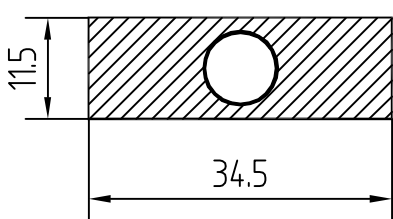
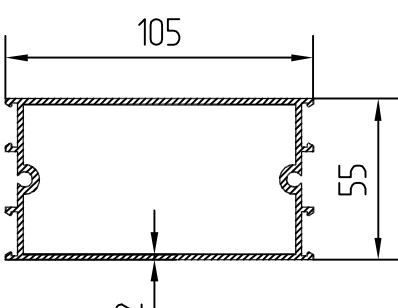
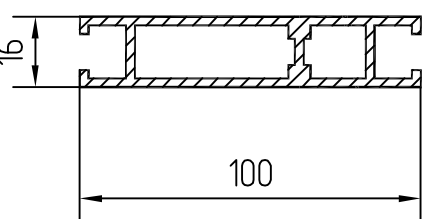
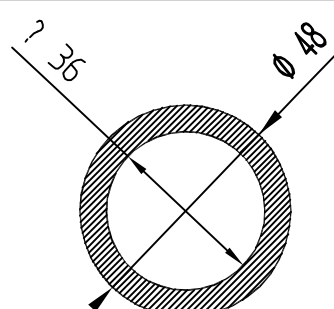
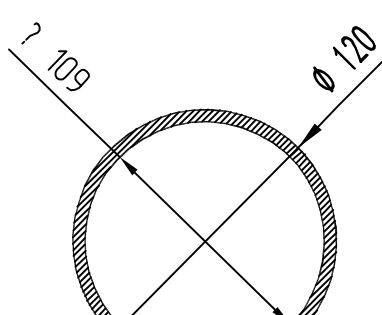
			БПЗ-146 $F \text{ см}^2 = 1.115$ $Q \text{ кг.} = 0.302$ $D \text{ оп.мм} = 20.0$ $P \text{ н.мм} = 84.6$ $P \text{ вн.мм} = 0.0$ Гр. сл. = III Точн. = П
			БПЗ-147 $F \text{ см}^2 = 4.740$ $Q \text{ кг.} = 1.285$ $D \text{ оп.мм} = 52.0$ $P \text{ н.мм} = 171.0$ $P \text{ вн.мм} = 101.5$ Гр. сл. = V Точн. = Т
	БПЗ-143 $F \text{ см}^2 = 22.75$ $Q \text{ кг.} = 6.16$ $D \text{ оп.мм} = 80.0$ $P \text{ н.мм} = 239.0$ $P \text{ вн.мм} = 136.0$ Гр. сл. = VI Точн. = Т		БПЗ-0148 $F \text{ см}^2 = 2.421$ $Q \text{ кг.} = 0.656$ $D \text{ оп.мм} = 35.0$ $P \text{ н.мм} = 134.7$ $P \text{ вн.мм} = 63.7$ Гр. сл. = 0особ. Точн. = П
	БПЗ-144 $F \text{ см}^2 = 2.600$ $Q \text{ кг.} = 0.704$ $D \text{ оп.мм} = 28.0$ $P \text{ н.мм} = 103.0$ $P \text{ вн.мм} = 38.0$ Гр. сл. = V Точн. = Т		БПЗ-149 $F \text{ см}^2 = 2.217$ $Q \text{ кг.} = 0.601$ $D \text{ оп.мм} = 20.0$ $P \text{ н.мм} = 61.7$ $P \text{ вн.мм} = 35.1$ Гр. сл. = II Точн. = П
	БПЗ-145 $F \text{ см}^2 = 9.26$ $Q \text{ кг.} = 2.509$ $D \text{ оп.мм} = 127.0$ $P \text{ н.мм} = 455.6$ $P \text{ вн.мм} = 345.6$		БПЗ-150 $F \text{ см}^2 = 4.55$ $Q \text{ кг.} = 1.233$ $D \text{ оп.мм} = 82.0$ $P \text{ н.мм} = 347.87$ $P \text{ вн.мм} = 123$

	БПЗ-151 $F \text{ см}^2 = 2.789$ $Q \text{ кг.} = 0.756$ $D \text{ оп.мм} = 20.0$ $P \text{ н.мм} = 62.8$ $P \text{ в.н.мм} = 21.05$ Гр. сл. = II Точн. = Н		БПЗ-156 $F \text{ см}^2 = 8.820$ $Q \text{ кг.} = 2.390$ $D \text{ оп.мм} = 126.5$ $P \text{ н.мм} = 359.7$ $P \text{ в.н.мм} = 315.0$ Гр. сл. = IV Точн. = П
	БПЗ-152 $F \text{ см}^2 = 7.360$ $Q \text{ кг.} = 1.99$ $D \text{ оп.мм} = 95.3$ $P \text{ н.мм} = 302.5$ $P \text{ в.н.мм} = 156.0$ Гр. сл. = V Точн. = Т		БПЗ-157 $F \text{ см}^2 = 1.800$ $Q \text{ кг.} = 0.487$ $D \text{ оп.мм} = 24.0$ $P \text{ н.мм} = 66.5$ $P \text{ в.н.мм} = 46.0$ Гр. сл. = III Точн. = Н
	БПЗ-0153 $F \text{ см}^2 = 2.519$ $Q \text{ кг.} = 0.683$ $D \text{ оп.мм} = 56.0$ $P \text{ н.мм} = 194.0$ $P \text{ в.н.мм} = 65.5$ Гр. сл. = 0соб. Точн. = П		БПЗ-158 $F \text{ см}^2 = 9.150$ $Q \text{ кг.} = 2.480$ $D \text{ оп.мм} = 105.0$ $P \text{ н.мм} = 346.0$ $P \text{ в.н.мм} = 236.0$ Гр. сл. = IV Точн. = Т
	БПЗ-0154 $F \text{ см}^2 = 4.036$ $Q \text{ кг.} = 1.094$ $D \text{ оп.мм} = 55.0$ $P \text{ н.мм} = 183.2$ $P \text{ в.н.мм} = 210.2$ Гр. сл. = 0соб. Точн. = П		БПЗ-159 $F \text{ см}^2 = 7.540$ $Q \text{ кг.} = 2.043$ $D \text{ оп.мм} = 98.0$ $P \text{ н.мм} = 343.0$ $P \text{ в.н.мм} = 206.0$ Гр. сл. = VI Точн. = Т
	БПЗ-155 $F \text{ см}^2 = 6.820$ $Q \text{ кг.} = 1.848$ $D \text{ оп.мм} = 89.4$ $P \text{ н.мм} = 278.7$ $P \text{ в.н.мм} = 235.0$ Гр. сл. = IV		БПЗ-160 $F \text{ см}^2 = 8.000$ $Q \text{ кг.} = 2.17$ $D \text{ оп.мм} = 69.0$ $P \text{ н.мм} = 223.0$ $P \text{ в.н.мм} = 144.0$ Гр. сл. = IV

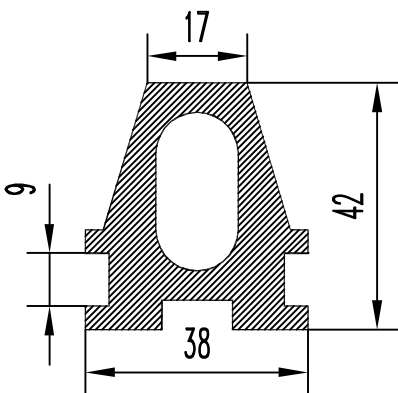
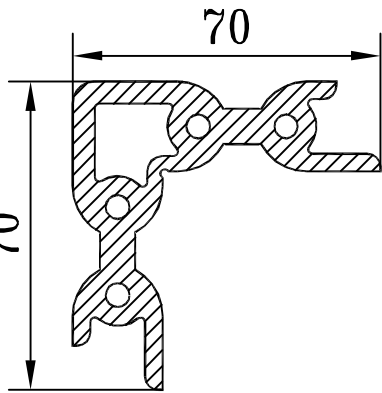
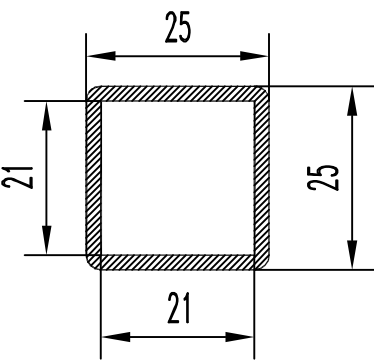
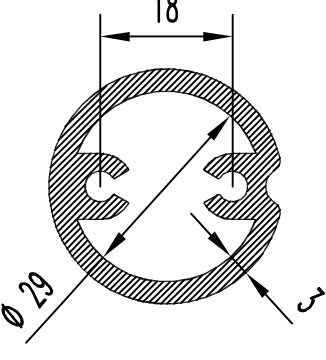
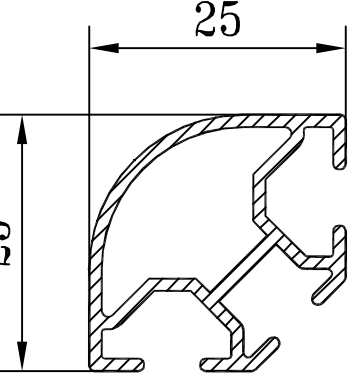
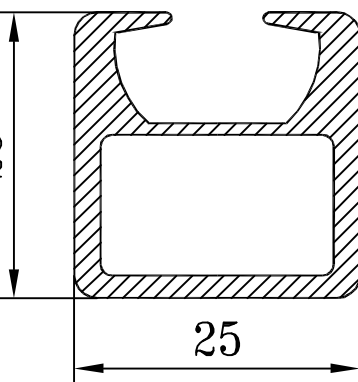
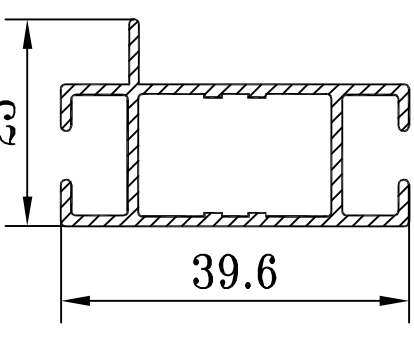
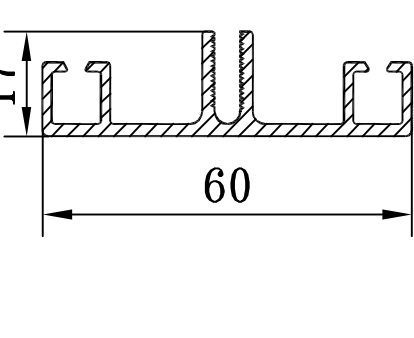
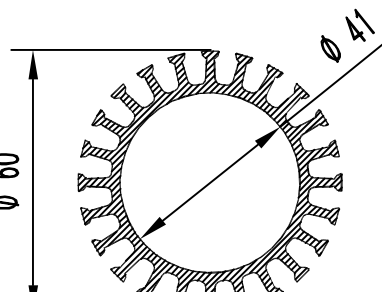
	БПЗ-161 $F \text{ см}^2 = 8.310$ $Q \text{ кг.} = 2.252$ $D \text{ оп.мм} = 78.0$ $P \text{ н.мм} = 251.0$ $P \text{ вн.мм} = 144.0$ Гр. сл. = IV Точн. = Т		БПЗ-166 $F \text{ см}^2 = 2.680$ $Q \text{ кг.} = 0.725$ $D \text{ оп.мм} = 73.0$ $P \text{ н.мм} = 167.0$ $P \text{ вн.мм} = 115.0$ Гр. сл. = 0соб. Точн. = Н
			БПЗ-167 $F \text{ см}^2 = 2.380$ $Q \text{ кг.} = 0.64$ $D \text{ оп.мм} = 61.0$ $P \text{ н.мм} = 143.0$ $P \text{ вн.мм} = 91.0$ Гр. сл. = 0соб. Точн. = Н
			БПЗ-168 $F \text{ см}^2 = 7.800$ $Q \text{ кг.} = 2.114$ $D \text{ оп.мм} = 78.0$ $P \text{ н.мм} = 237.0$ $P \text{ вн.мм} = 170.0$ Гр. сл. = V Точн. = Т
	БПЗ-164 $F \text{ см}^2 = 13.07$ $Q \text{ кг.} = 3.54$ $D \text{ оп.мм} = 96.0$ $P \text{ н.мм} = 265.0$ $P \text{ вн.мм} = 229.0$ Гр. сл. = III Точн. = Т		БПЗ-169 $F \text{ см}^2 = 20.200$ $Q \text{ кг.} = 5.49$ $D \text{ оп.мм} = 134.0$ $P \text{ н.мм} = 440.0$ $P \text{ вн.мм} = 275.0$ Гр. сл. = VI Точн. = Т
	БПЗ-165 $F \text{ см}^2 = 3.350$ $Q \text{ кг.} = 0.909$ $D \text{ оп.мм} = 98.0$ $P \text{ н.мм} = 217.0$ $P \text{ вн.мм} = 126.0$ Гр. сл. = IV Точн. = Т		БПЗ-170 $F \text{ см}^2 = 3.420$ $Q \text{ кг.} = 0.93$ $D \text{ оп.мм} = 51.8$ $P \text{ н.мм} = 212.5$ $P \text{ вн.мм} = 106.0$ Гр. сл. = V Точн. = Т

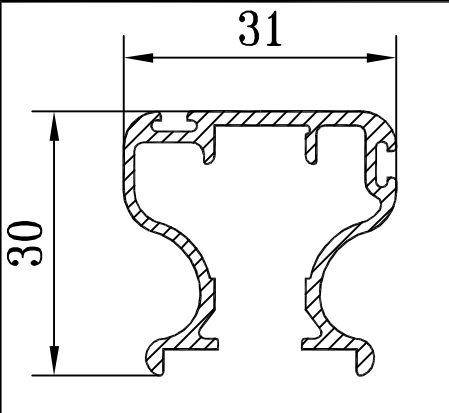
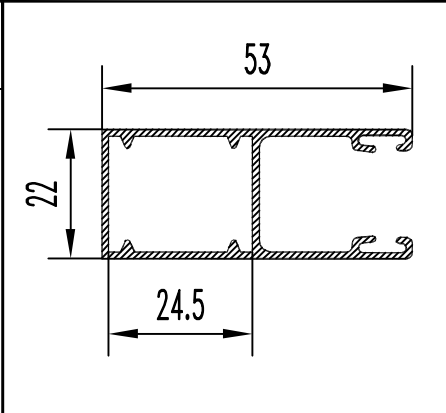
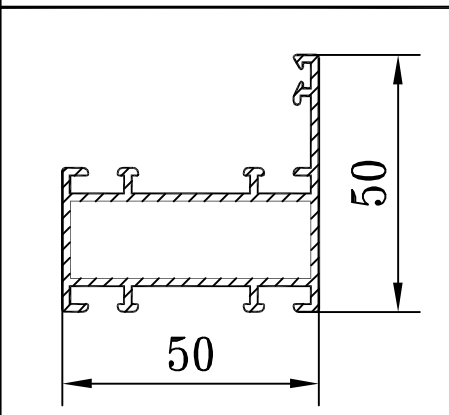
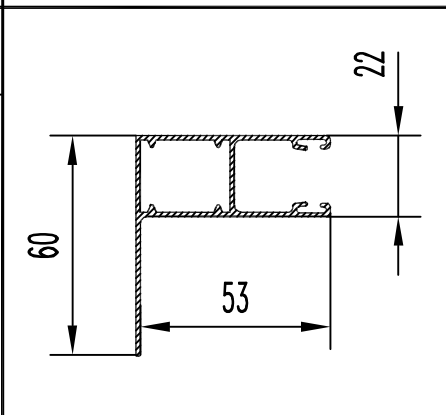
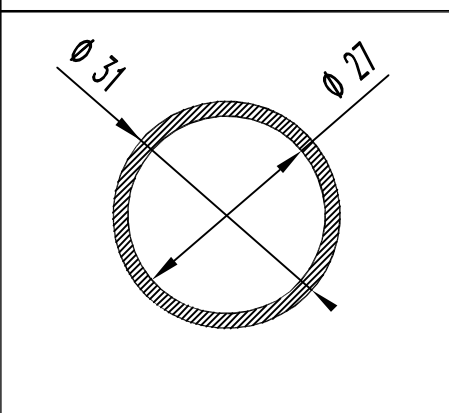
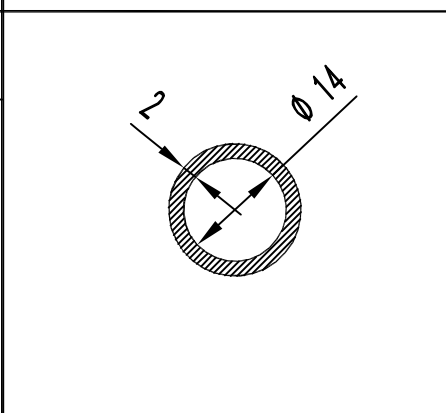
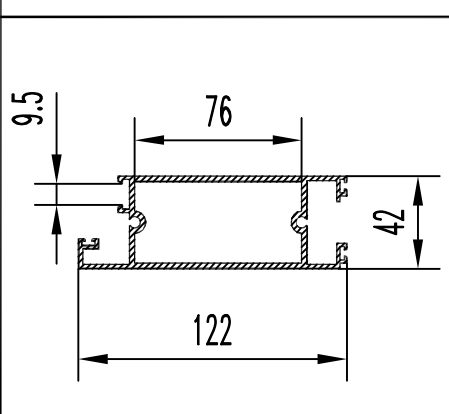
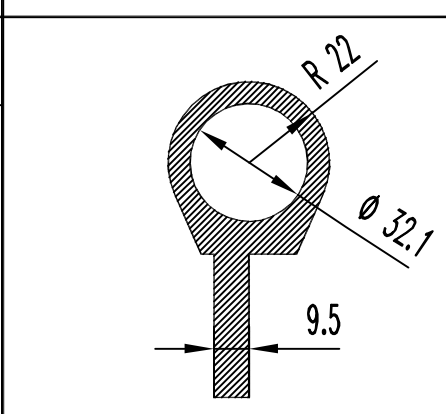
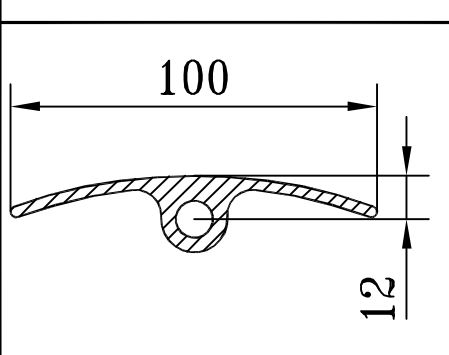
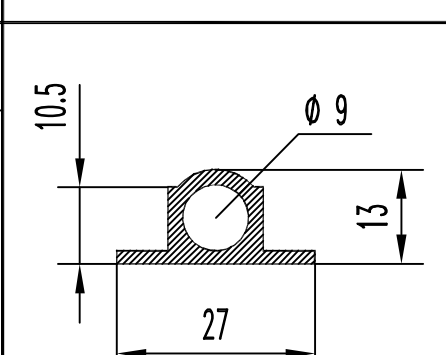
	БПЗ-171 $F \text{ см}^2 = 3.670$ $Q \text{ кг.} = 0.991$ $D \text{ оп.мм} = 51.8$ $P \text{ н.мм} = 236.5$ $P \text{ вн.мм} = 106.0$ Гр. сл. = VI Точн. = Т		БПЗ-176 $F \text{ см}^2 = 6.328$ $Q \text{ кг.} = 1.715$ $D \text{ оп.мм} = 99.4$ $P \text{ н.мм} = 326.3$ $P \text{ вн.мм} = 232.8$ Гр. сл. = 0соб. Точн. = П
	БПЗ-172 $F \text{ см}^2 = 3.920$ $Q \text{ кг.} = 1.064$ $D \text{ оп.мм} = 51.8$ $P \text{ н.мм} = 260.5$ $P \text{ вн.мм} = 106.0$ Гр. сл. = VI Точн. = Т		БПЗ-177 $F \text{ см}^2 = 4.69$ $Q \text{ кг.} = 1.271$ $D \text{ оп.мм} = 56.4$ $P \text{ н.мм} = 257$ $P \text{ вн.мм} = 148.2$ Гр. сл. = 0соб. Точн. = П
	БПЗ-173 $F \text{ см}^2 = 3.260$ $Q \text{ кг.} = 0.883$ $D \text{ оп.мм} = 38.3$ $P \text{ н.мм} = 256.0$ $P \text{ вн.мм} = 48.0$ Гр. сл. = V Точн. = Т		БПЗ-178 $F \text{ см}^2 = 1.040$ $Q \text{ кг.} = 0.282$ $D \text{ оп.мм} = 14.0$ $P \text{ н.мм} = 44.0$ $P \text{ вн.мм} = 25.1$ Гр. сл. = IV Точн. = Т
	БПЗ-174 $F \text{ см}^2 = 7.540$ $Q \text{ кг.} = 2.04$ $D \text{ оп.мм} = 70.7$ $P \text{ н.мм} = 557.5$ $P \text{ вн.мм} = 163.2$ Гр. сл. = 0соб. Точн. = Т		БПЗ-179 $F \text{ см}^2 = 1.370$ $Q \text{ кг.} = 0.371$ $D \text{ оп.мм} = 16.0$ $P \text{ н.мм} = 50.2$ $P \text{ вн.мм} = 28.3$ Гр. сл. = IV Точн. = Т
	БПЗ-175 $F \text{ см}^2 = 3.320$ $Q \text{ кг.} = 0.900$ $D \text{ оп.мм} = 38.3$ $P \text{ н.мм} = 260.0$ $P \text{ вн.мм} = 54.2$ Гр. сл. = 0соб. Точн. = Т		БПЗ-180 $F \text{ см}^2 = 1.600$ $Q \text{ кг.} = 0.434$ $D \text{ оп.мм} = 18.0$ $P \text{ н.мм} = 56.5$ $P \text{ вн.мм} = 34.5$ Гр. сл. = IV Точн. = Т

	БПЗ-0181 $F \text{ см}^2 = 3.032$ $Q \text{ кг.} = 0.822$ $D \text{ оп.мм} = 63.0$ $P \text{ н.мм} = 209.2$ $P \text{ вн.мм} = 94.0$ Гр. сл. = IV Точн. = П		БПЗ-186 $F \text{ см}^2 = 2.760$ $Q \text{ кг.} = 0.748$ $D \text{ оп.мм} = 26.0$ $P \text{ н.мм} = 81.6$ $P \text{ вн.мм} = 56.3$ Гр. сл. = II Точн. = Т
	БПЗ-182 $F \text{ см}^2 = 1.810$ $Q \text{ кг.} = 0.491$ $D \text{ оп.мм} = 20.0$ $P \text{ н.мм} = 62.8$ $P \text{ вн.мм} = 40.8$ Гр. сл. = IV Точн. = Т		БПЗ-187 $F \text{ см}^2 = 2.470$ $Q \text{ кг.} = 0.669$ $D \text{ оп.мм} = 26.0$ $P \text{ н.мм} = 81.6$ $P \text{ вн.мм} = 59.7$ Гр. сл. = II Точн. = Т
	БПЗ-183 $F \text{ см}^2 = 2.260$ $Q \text{ кг.} = 0.612$ $D \text{ оп.мм} = 22.0$ $P \text{ н.мм} = 69.1$ $P \text{ вн.мм} = 44.0$ Гр. сл. = IV Точн. = Т		
	БПЗ-184 $F \text{ см}^2 = 2.510$ $Q \text{ кг.} = 0.680$ $D \text{ оп.мм} = 24.0$ $P \text{ н.мм} = 75.4$ $P \text{ вн.мм} = 50.2$ Гр. сл. = II Точн. = Т		БПЗ-189 $F \text{ см}^2 = 2.6$ $Q \text{ кг.} = 0.705$ $D \text{ оп.мм} = 43.0$ $P \text{ н.мм} = 152$ $P \text{ вн.мм} = 92$ Гр. сл. = V Точн. = П
	БПЗ-185 $F \text{ см}^2 = 2.250$ $Q \text{ кг.} = 0.610$ $D \text{ оп.мм} = 24.0$ $P \text{ н.мм} = 75.4$ $P \text{ вн.мм} = 53.4$ Гр. сл. = II		БПЗ-190 $F \text{ см}^2 = 16.300$ $Q \text{ кг.} = 4.42$ $D \text{ оп.мм} = 104.0$ $P \text{ н.мм} = 303.0$ $P \text{ вн.мм} = 250.0$ Гр. сл. = V

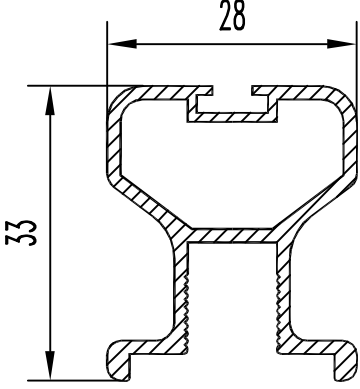
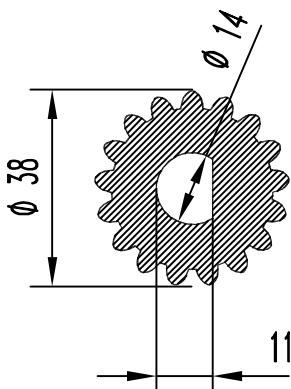
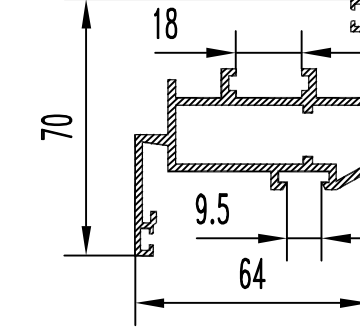
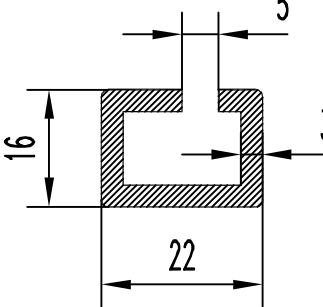
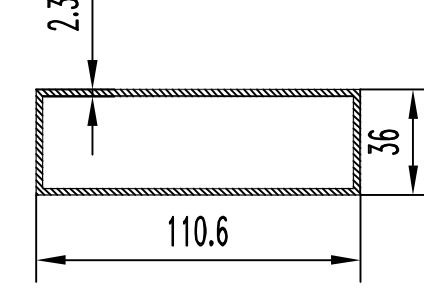
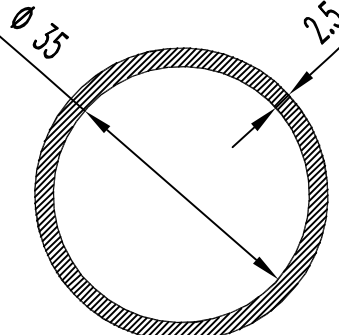
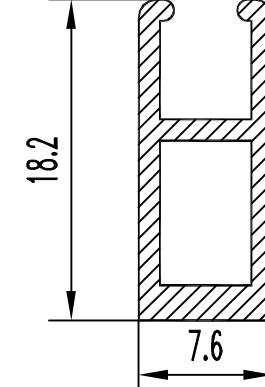
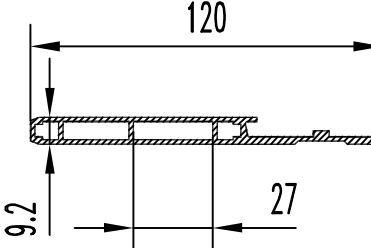
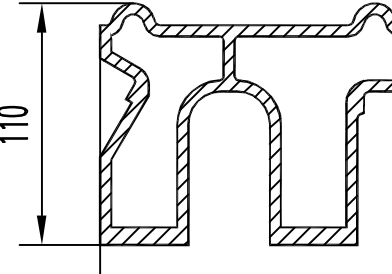
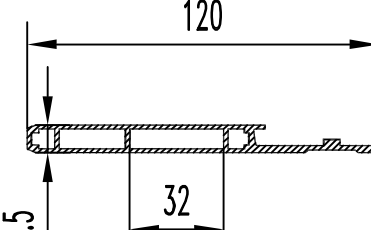
	БПЗ-191 $F \text{ см}^2 = 1.65$ $Q \text{ кг.} = 0.447$ $D \text{ оп.мм} = 30.0$ $P \text{ н.мм} = 104.7$ $P \text{ вн.мм} = 57.4$ Гр. сл. = IV Точн. = Н		БПЗ-0196 $F \text{ см}^2 = 3.770$ $Q \text{ кг.} = 1.022$ $D \text{ оп.мм} = 43.4$ $P \text{ н.мм} = 309.4$ $P \text{ вн.мм} = 62.8$ Гр. сл. = 0соб. Точн. = П
	БПЗ-192 $F \text{ см}^2 = 22.560$ $Q \text{ кг.} = 6.114$ $D \text{ оп.мм} = 70.0$ $P \text{ н.мм} = 219.9$ $P \text{ вн.мм} = 141.3$ Гр. сл. = II Точн. = Т		БПЗ-0197 $F \text{ см}^2 = 3.440$ $Q \text{ кг.} = 0.932$ $D \text{ оп.мм} = 36.4$ $P \text{ н.мм} = 92.0$ $P \text{ вн.мм} = 25.8$ Гр. сл. = 0соб. Точн. = П
	БПЗ-193 $F \text{ см}^2 = 7.037$ $Q \text{ кг.} = 1.907$ $D \text{ оп.мм} = 118.0$ $P \text{ н.мм} = 408.1$ $P \text{ вн.мм} = 301.6$ Гр. сл. = VI Точн. = П		
	БПЗ-0194 $F \text{ см}^2 = 5.052$ $Q \text{ кг.} = 1.369$ $D \text{ оп.мм} = 102.0$ $P \text{ н.мм} = 289.2$ $P \text{ вн.мм} = 194.0$ Гр. сл. = 0соб. Точн. = П		БПЗ-199 $F \text{ см}^2 = 8.075$ $Q \text{ кг.} = 2.188$ $D \text{ оп.мм} = 48.0$ $P \text{ н.мм} = 151.2$ $P \text{ вн.мм} = 112.7$ Гр. сл. = IV Точн. = П
			БПЗ-200 $F \text{ см}^2 = 20.504$ $Q \text{ кг.} = 5.556$ $D \text{ оп.мм} = 120.0$ $P \text{ н.мм} = 377.6$ $P \text{ вн.мм} = 341.8$ Гр. сл. = IV

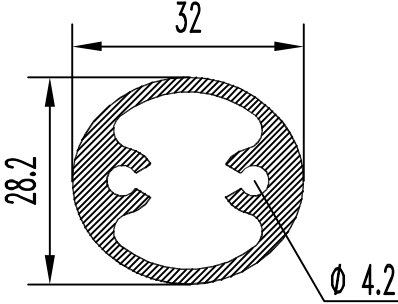
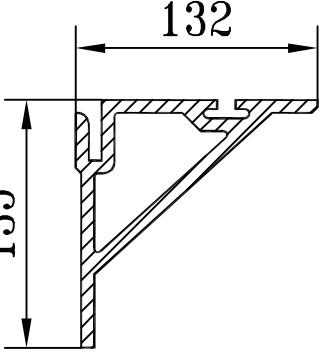
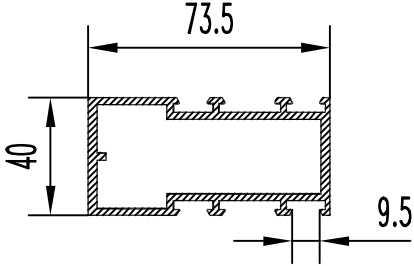
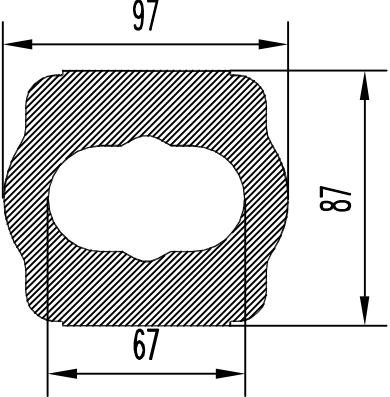
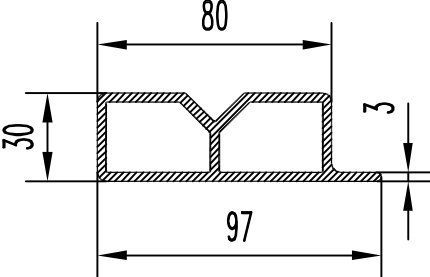
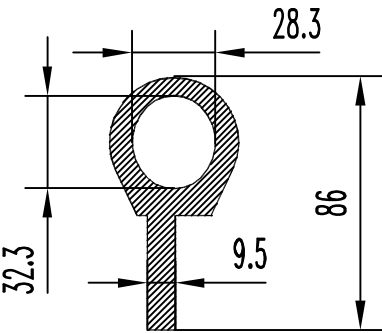
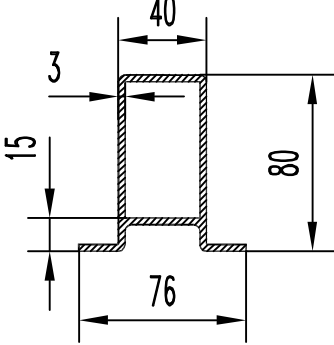
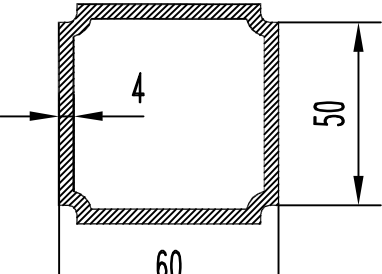
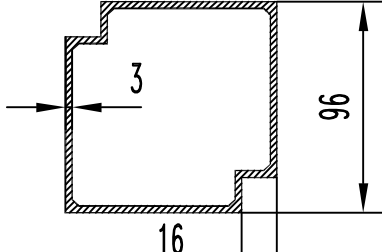
			БПЗ-0206 $F \text{ см}^2 = 3.108$ $Q \text{ кг.} = 0.842$ $D \text{ оп.мм} = 98.0$ $P \text{ н.мм} = 215.0$ $P \text{ вн.мм} = 190.3$ Гр. сл. = 0соб. Точн. = П
			БПЗ-0207 $F \text{ см}^2 = 7.492$ $Q \text{ кг.} = 2.030$ $D \text{ оп.мм} = 92.0$ $P \text{ н.мм} = 287.7$ $P \text{ вн.мм} = 280.6$ Гр. сл. = 0соб. Точн. = П
	БПЗ-203 $F \text{ см}^2 = 5.337$ $Q \text{ кг.} = 1.446$ $D \text{ оп.мм} = 82.0$ $P \text{ н.мм} = 347.9$ $P \text{ вн.мм} = 182$ Гр. сл. = VI Точн. = П		БПЗ-208 $F \text{ см}^2 = 12.060$ $Q \text{ кг.} = 3.268$ $D \text{ оп.мм} = 98.0$ $P \text{ н.мм} = 307.1$ $P \text{ вн.мм} = 278.3$ Гр. сл. = VI Точн. = Т
	БПЗ-204 $F \text{ см}^2 = 4.908$ $Q \text{ кг.} = 1.33$ $D \text{ оп.мм} = 82.0$ $P \text{ н.мм} = 290.3$ $P \text{ вн.мм} = 182$ Гр. сл. = VI Точн. = П		БПЗ-209 $F \text{ см}^2 = 3.220$ $Q \text{ кг.} = 0.873$ $D \text{ оп.мм} = 52.3$ $P \text{ н.мм} = 192.0$ $P \text{ вн.мм} = 118.0$ Гр. сл. = V Точн. = Т
	БПЗ-205 $F \text{ см}^2 = 25.298$ $Q \text{ кг.} = 6.856$ $D \text{ оп.мм} = 148.0$ $P \text{ н.мм} = 397.4$ $P \text{ вн.мм} = 359.4$ Гр. сл. = VI Точн. = П		БПЗ-210 $F \text{ см}^2 = 3.558$ $Q \text{ кг.} = 0.964$ $D \text{ оп.мм} = 22.0$ $P \text{ н.мм} = 157.4$ $P \text{ вн.мм} = 82.0$ Гр. сл. = IV Точн. = П

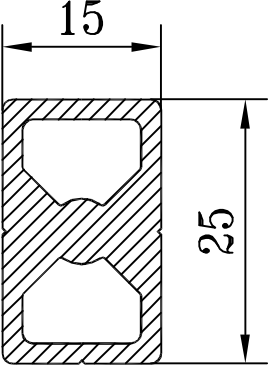
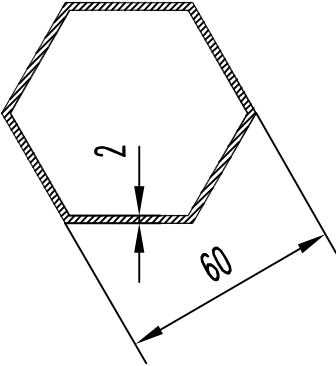
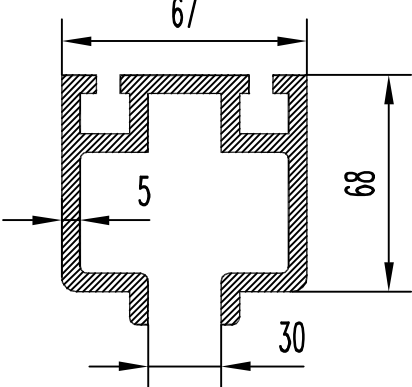
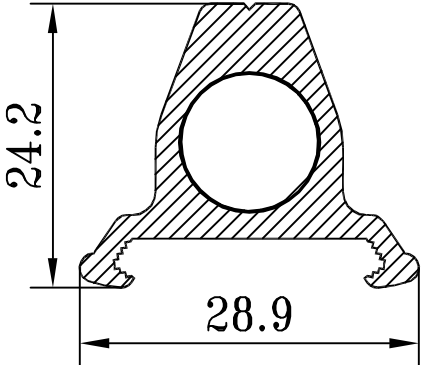
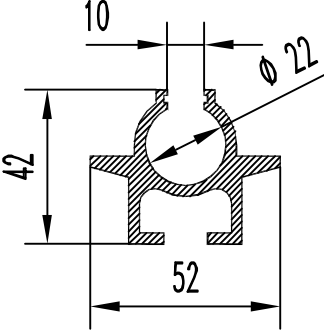
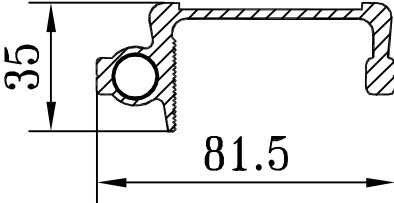
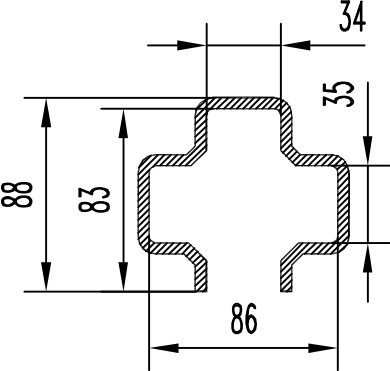
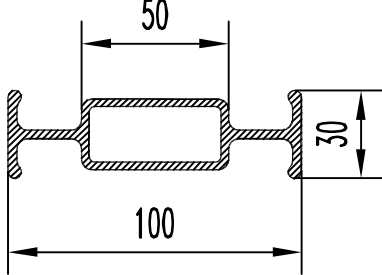
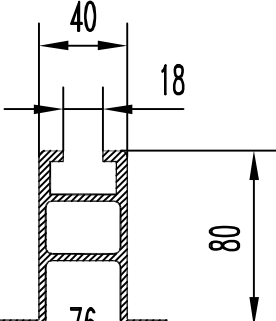
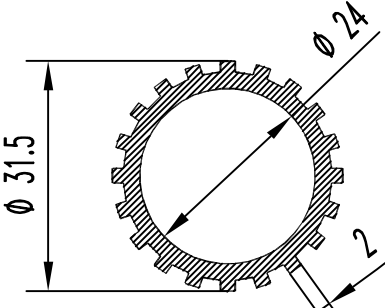
	БПЗ-211 $F \text{ см}^2 = 8.090$ $Q \text{ кг.} = 2.192$ $D \text{ оп.мм} = 50.0$ $P \text{ н.мм} = 173.0$ $P \text{ вн.мм} = 57.0$ Гр. сл. = IV Точн. = Т		БПЗ-0216 $F \text{ см}^2 = 12.400$ $Q \text{ кг.} = 3.360$ $D \text{ оп.мм} = 81.5$ $P \text{ н.мм} = 317.8$ $P \text{ вн.мм} = 139.0$ Гр. сл. = VI Точн. = П
	БПЗ-212 $F \text{ см}^2 = 1.805$ $Q \text{ кг.} = 0.489$ $D \text{ оп.мм} = 33.7$ $P \text{ н.мм} = 96.6$ $P \text{ вн.мм} = 84$ Гр. сл. = III Точн. = П		БПЗ-217 $F \text{ см}^2 = 3.612$ $Q \text{ кг.} = 0.979$ $D \text{ оп.мм} = 32.0$ $P \text{ н.мм} = 126.2$ $P \text{ вн.мм} = 102.3$ Гр. сл. = VI Точн. = Н
	БПЗ-0213 $F \text{ см}^2 = 1.369$ $Q \text{ кг.} = 0.371$ $D \text{ оп.мм} = 35.4$ $P \text{ н.мм} = 159.0$ $P \text{ вн.мм} = 63.9$ Гр. сл. = 0соб. Точн. = П		БПЗ-0218 $F \text{ см}^2 = 2.227$ $Q \text{ кг.} = 0.604$ $D \text{ оп.мм} = 35.0$ $P \text{ н.мм} = 129.3$ $P \text{ вн.мм} = 63.7$ Гр. сл. = 0соб. Точн. = П
	БПЗ-0214 $F \text{ см}^2 = 1.547$ $Q \text{ кг.} = 0.419$ $D \text{ оп.мм} = 42.8$ $P \text{ н.мм} = 185.0$ $P \text{ вн.мм} = 74.0$ Гр. сл. = VI Точн. = П		БПЗ-0219 $F \text{ см}^2 = 2.544$ $Q \text{ кг.} = 0.689$ $D \text{ оп.мм} = 63.0$ $P \text{ н.мм} = 288.1$ $P \text{ вн.мм} = 0.0$ Гр. сл. = 0соб. Точн. = П
	БПЗ-215 $F \text{ см}^2 = 7.338$ $Q \text{ кг.} = 1.989$ $D \text{ оп.мм} = 60.0$ $P \text{ н.мм} = 541.5$ $P \text{ вн.мм} = 128.5$ Гр. сл. = 0соб. Точн. = П		

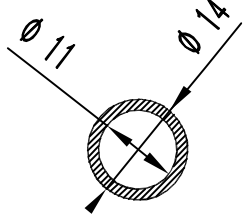
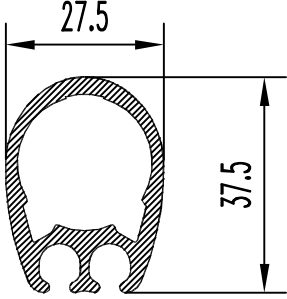
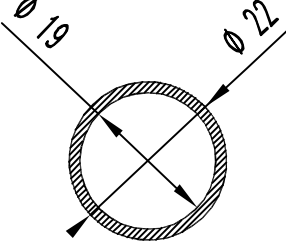
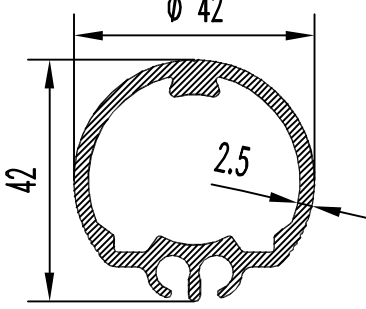
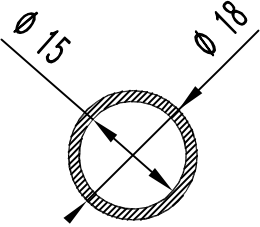
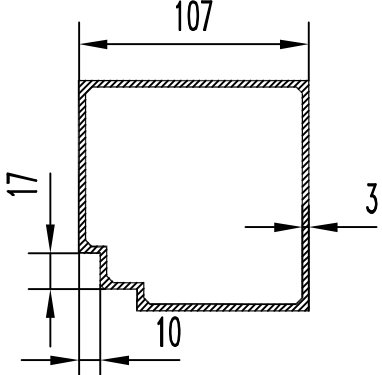
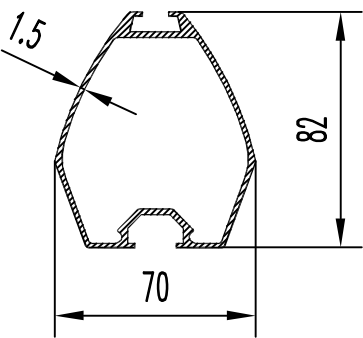
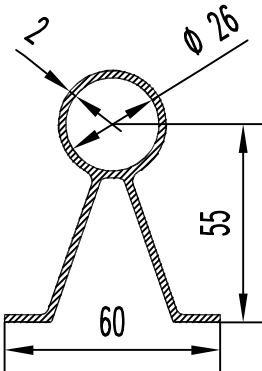
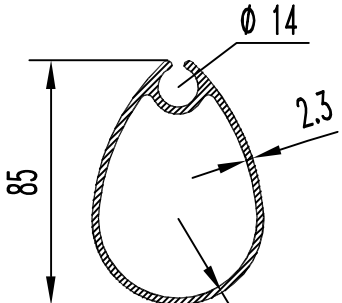
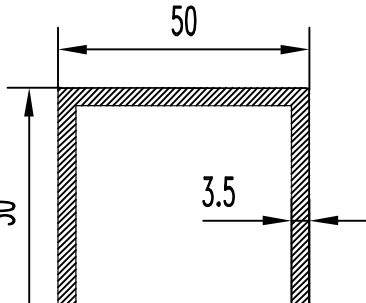
	БПЗ-0221 $F \text{ см}^2 = 1.723$ $Q \text{ кг.} = 0.467$ $D \text{ оп.мм} = 40.0$ $P \text{ н.мм} = 239.9$ $P \text{ вн.мм} = 0.0$ Гр. сл. = 0соб. Точн. = П		БПЗ-226 $F \text{ см}^2 = 2$ $Q \text{ кг.} = 0.54$ $D \text{ оп.мм} = 57.0$ $P \text{ н.мм} = 232.0$ $P \text{ вн.мм} = 101.3$ Гр. сл. = 0соб. Точн. = Н
	БПЗ-0222 $F \text{ см}^2 = 3.349$ $Q \text{ кг.} = 0.908$ $D \text{ оп.мм} = 71.0$ $P \text{ н.мм} = 319.7$ $P \text{ вн.мм} = 124.0$ Гр. сл. = IV Точн. = П		БПЗ-227 $F \text{ см}^2 = 2.68$ $Q \text{ кг.} = 0.726$ $D \text{ оп.мм} = 80.0$ $P \text{ н.мм} = 306.5$ $P \text{ вн.мм} = 101.3$ Гр. сл. = 0соб. Точн. = Н
	БПЗ-223 $F \text{ см}^2 = 1.820$ $Q \text{ кг.} = 0.493$ $D \text{ оп.мм} = 31.0$ $P \text{ н.мм} = 97.3$ $P \text{ вн.мм} = 84.8$ Гр. сл. = III Точн. = Т		БПЗ-228 $F \text{ см}^2 = 1.000$ $Q \text{ кг.} = 0.271$ $D \text{ оп.мм} = 18.0$ $P \text{ н.мм} = 56.5$ $P \text{ вн.мм} = 44.0$ Гр. сл. = IV Точн. = Т
	БПЗ-224 $F \text{ см}^2 = 8.441$ $Q \text{ кг.} = 2.288$ $D \text{ оп.мм} = 129.0$ $P \text{ н.мм} = 237.4$ $P \text{ вн.мм} = 521.8$ Гр. сл. = VI Точн. = П		БПЗ-229 $F \text{ см}^2 = 12.35$ $Q \text{ кг.} = 3.347$ $D \text{ оп.мм} = 88.0$ $P \text{ н.мм} = 226.7$ $P \text{ вн.мм} = 100.9$ Гр. сл. = V Точн. = Н
	БПЗ-0225 $F \text{ см}^2 = 5.372$ $Q \text{ кг.} = 1.456$ $D \text{ оп.мм} = 100.0$ $P \text{ н.мм} = 227.7$ $P \text{ вн.мм} = 31.7$ Гр. сл. = IV		БПЗ-230 $F \text{ см}^2 = 1.16$ $Q \text{ кг.} = 0.314$ $D \text{ оп.мм} = 26.0$ $P \text{ н.мм} = 76.5$ $P \text{ вн.мм} = 28.3$ Гр. сл. = IV

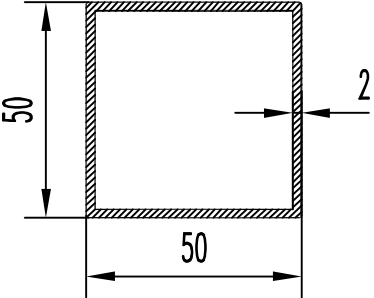
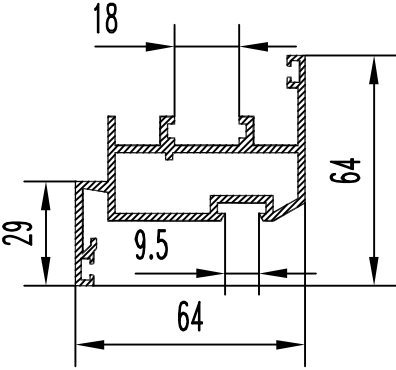
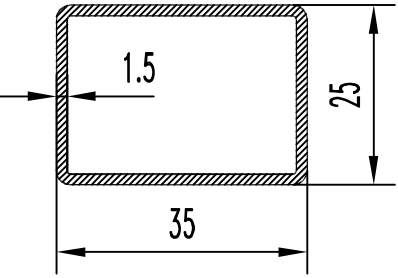
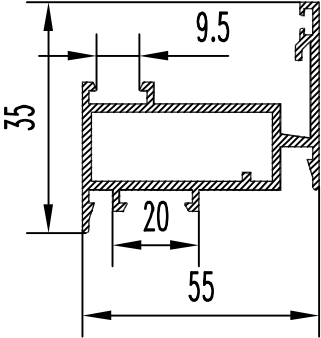
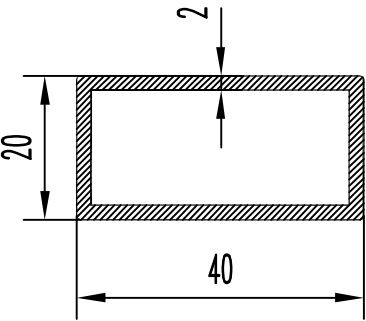
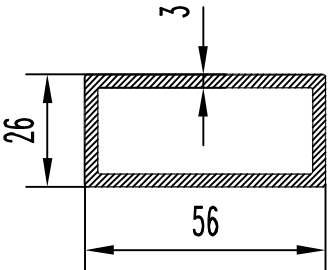
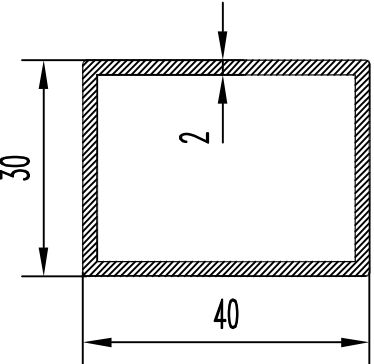
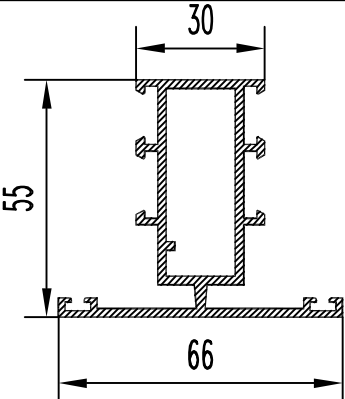
	БПЗ-231 $F \text{ см}^2 = 6.870$ $Q \text{ кг.} = 1.858$ $D \text{ оп.мм} = 68.0$ $P \text{ н.мм} = 416.0$ $P \text{ вн.мм} = 0.0$ Гр. сл. = 0соб. Точн. = П		БПЗ-236 $F \text{ см}^2 = 7.600$ $Q \text{ кг.} = 2.060$ $D \text{ оп.мм} = 40.0$ $P \text{ н.мм} = 125.7$ $P \text{ вн.мм} = 78.5$ Гр. сл. = I Точн. = Т
	БПЗ-232 $F \text{ см}^2 = 6.120$ $Q \text{ кг.} = 1.659$ $D \text{ оп.мм} = 59.0$ $P \text{ н.мм} = 324.0$ $P \text{ вн.мм} = 0.0$ Гр. сл. = 0соб. Точн. = П		БПЗ-237 $F \text{ см}^2 = 23.700$ $Q \text{ кг.} = 6.423$ $D \text{ оп.мм} = 75.0$ $P \text{ н.мм} = 235.6$ $P \text{ вн.мм} = 160.0$ Гр. сл. = I Точн. = Т
	БПЗ-233-01 $F \text{ см}^2 = 6.140$ $Q \text{ кг.} = 1.664$ $D \text{ оп.мм} = 98.0$ $P \text{ н.мм} = 317.0$ $P \text{ вн.мм} = 237.0$ Гр. сл. = V Точн. = П		БПЗ-238 $F \text{ см}^2 = 30.600$ $Q \text{ кг.} = 8.293$ $D \text{ оп.мм} = 80.0$ $P \text{ н.мм} = 251.3$ $P \text{ вн.мм} = 157.1$ Гр. сл. = I Точн. = Т
	БПЗ-234-01 $F \text{ см}^2 = 6.730$ $Q \text{ кг.} = 1.824$ $D \text{ оп.мм} = 98.0$ $P \text{ н.мм} = 385.0$ $P \text{ вн.мм} = 228.0$ Гр. сл. = VI Точн. = П		БПЗ-0239 $F \text{ см}^2 = 19.986$ $Q \text{ кг.} = 5.416$ $D \text{ оп.мм} = 95.0$ $P \text{ н.мм} = 264.4$ $P \text{ вн.мм} = 62.8$ Гр. сл. = IV Точн. = Н
	БПЗ-0235 $F \text{ см}^2 = 15.800$ $Q \text{ кг.} = 4.282$ $D \text{ оп.мм} = 114.0$ $P \text{ н.мм} = 289.9$ $P \text{ вн.мм} = 34.6$ Гр. сл. = IV		БПЗ-0240 $F \text{ см}^2 = 2.097$ $Q \text{ кг.} = 0.568$ $D \text{ оп.мм} = 42.8$ $P \text{ н.мм} = 212.5$ $P \text{ вн.мм} = 0.0$ Гр. сл. = V

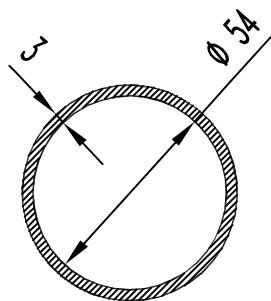
	БПЗ-0241 $F \text{ см}^2 = 1.916$ $Q \text{ кг.} = 0.519$ $D \text{ оп.мм} = 42.0$ $P \text{ н.мм} = 183.2$ $P \text{ вн.мм} = 73.8$ Гр. сл. = VI Точн. = П		БПЗ-247 $F \text{ см}^2 = 7.780$ $Q \text{ кг.} = 2.178$ $D \text{ оп.мм} = 38.0$ $P \text{ н.мм} = 217.6$ $P \text{ вн.мм} = 30.7$ Гр. сл. = 0соб. Точн. = П
	БПЗ-242 $F \text{ см}^2 = 5.418$ $Q \text{ кг.} = 1.468$ $D \text{ оп.мм} = 95.0$ $P \text{ н.мм} = 401$ $P \text{ вн.мм} = 148.5$ Гр. сл. = IV Точн. = П		БПЗ-248 $F \text{ см}^2 = 1.823$ $Q \text{ кг.} = 0.494$ $D \text{ оп.мм} = 27.2$ $P \text{ н.мм} = 122.6$ $P \text{ вн.мм} = 0.0$ Гр. сл. = III Точн. = П
	БПЗ-243 $F \text{ см}^2 = 6.53$ $Q \text{ кг.} = 1.77$ $D \text{ оп.мм} = 120.0$ $P \text{ н.мм} = 293.2$ $P \text{ вн.мм} = 274.8$ Гр. сл. = 0соб. Точн. = П		БПЗ-249 $F \text{ см}^2 = 2.950$ $Q \text{ кг.} = 0.799$ $D \text{ оп.мм} = 40.0$ $P \text{ н.мм} = 125.6$ $P \text{ вн.мм} = 109.9$ Гр. сл. = III Точн. = Т
	БПЗ-0244 $F \text{ см}^2 = 0.615$ $Q \text{ кг.} = 0.167$ $D \text{ оп.мм} = 20.0$ $P \text{ н.мм} = 66.5$ $P \text{ вн.мм} = 26.8$ Гр. сл. = VI Точн. = Н		БПЗ-250 $F \text{ см}^2 = 3.900$ $Q \text{ кг.} = 1.057$ $D \text{ оп.мм} = 120.5$ $P \text{ н.мм} = 268.3$ $P \text{ вн.мм} = 117.6$ Гр. сл. = 0соб. Точн. = Т
	БПЗ-0245 $F \text{ см}^2 = 34.160$ $Q \text{ кг.} = 9.257$ $D \text{ оп.мм} = 173.0$ $P \text{ н.мм} = 642.1$ $P \text{ вн.мм} = 607.9$ Гр. сл. = VI		БПЗ-250-01 $F \text{ см}^2 = 3.818$ $Q \text{ кг.} = 1.035$ $D \text{ оп.мм} = 120.0$ $P \text{ н.мм} = 268.0$ $P \text{ вн.мм} = 115.0$ Гр. сл. = 0соб.

	БПЗ-251 $F \text{ см}^2 = 3.070$ $Q \text{ кг.} = 0.832$ $D \text{ оп.мм} = 32.0$ $P \text{ н.мм} = 96.2$ $P \text{ вн.мм} = 116.5$ Гр. сл. = IV Точн. = П		
	БПЗ-0252 $F \text{ см}^2 = 29.700$ $Q \text{ кг.} = 8.049$ $D \text{ оп.мм} = 187.0$ $P \text{ н.мм} = 571.4$ $P \text{ вн.мм} = 246.4$ Гр. сл. = VI Точн. = П		БПЗ-257 $F \text{ см}^2 = 6.86$ $Q \text{ кг.} = 1.859$ $D \text{ оп.мм} = 91.7$ $P \text{ н.мм} = 343.2$ $P \text{ вн.мм} = 229.8$ Гр. сл. = VI Точн. = П
	БПЗ-253 $F \text{ см}^2 = 48.800$ $Q \text{ кг.} = 13.225$ $D \text{ оп.мм} = 110.0$ $P \text{ н.мм} = 318.0$ $P \text{ вн.мм} = 178.0$ Гр. сл. = IV Точн. = Т		БПЗ-258 $F \text{ см}^2 = 7.910$ $Q \text{ кг.} = 2.144$ $D \text{ оп.мм} = 102.0$ $P \text{ н.мм} = 256.1$ $P \text{ вн.мм} = 111.7$ Гр. сл. = 0соб. Точн. = Н
	БПЗ-254 $F \text{ см}^2 = 13.35$ $Q \text{ кг.} = 3.618$ $D \text{ оп.мм} = 88.0$ $P \text{ н.мм} = 226.2$ $P \text{ вн.мм} = 94.2$ Гр. сл. = IV Точн. = П		БПЗ-259 $F \text{ см}^2 = 8.300$ $Q \text{ кг.} = 2.249$ $D \text{ оп.мм} = 103.0$ $P \text{ н.мм} = 329.5$ $P \text{ вн.мм} = 161.0$ Гр. сл. = VI Точн. = Н
	БПЗ-255 $F \text{ см}^2 = 8.660$ $Q \text{ кг.} = 2.347$ $D \text{ оп.мм} = 80.0$ $P \text{ н.мм} = 235.7$ $P \text{ вн.мм} = 198.0$ Гр. сл. = V		БПЗ-260 $F \text{ см}^2 = 12.020$ $Q \text{ кг.} = 3.257$ $D \text{ оп.мм} = 118.0$ $P \text{ н.мм} = 385.0$ $P \text{ вн.мм} = 349.0$ Гр. сл. = VI

	БПЗ-0261 $F \text{ см}^2 = 2.2$ $Q \text{ кг.} = 0.527$ $D \text{ оп.мм} = 28.0$ $P \text{ н.мм} = 79.0$ $P \text{ вн.мм} = 67.9$ $\Gamma \text{р. сл.} = 0 \text{соб.}$ $\text{Точн.} = \text{П}$		БПЗ-266 $F \text{ см}^2 = 4.018$ $Q \text{ кг.} = 1.089$ $D \text{ оп.мм} = 69.3$ $P \text{ н.мм} = 207.9$ $P \text{ вн.мм} = 194$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{Н}$
	БПЗ-262-01 $F \text{ см}^2 = 13.731$ $Q \text{ кг.} = 3.721$ $D \text{ оп.мм} = 87.6$ $P \text{ н.мм} = 551.7$ $P \text{ вн.мм} = 0.0$ $\Gamma \text{р. сл.} = \text{IV}$ $\text{Точн.} = \text{П}$		БПЗ-0267 $F \text{ см}^2 = 2.000$ $Q \text{ кг.} = 0.542$ $D \text{ оп.мм} = 32.0$ $P \text{ н.мм} = 105.8$ $P \text{ вн.мм} = 37.7$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$
	БПЗ-263-01 $F \text{ см}^2 = 5.180$ $Q \text{ кг.} = 1.404$ $D \text{ оп.мм} = 52.0$ $P \text{ н.мм} = 291.8$ $P \text{ вн.мм} = 0.0$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \text{Н}$		БПЗ-268 $F \text{ см}^2 = 5.61$ $Q \text{ кг.} = 1.52$ $D \text{ оп.мм} = 83$ $P \text{ н.мм} = 280.4$ $P \text{ вн.мм} = 37.7$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$
	БПЗ-264 $F \text{ см}^2 = 14.840$ $Q \text{ кг.} = 4.022$ $D \text{ оп.мм} = 103.0$ $P \text{ н.мм} = 581.0$ $P \text{ вн.мм} = 0.0$ $\Gamma \text{р. сл.} = \text{IV}$ $\text{Точн.} = \text{Н}$		БПЗ-269 $F \text{ см}^2 = 6.860$ $Q \text{ кг.} = 1.859$ $D \text{ оп.мм} = 105.0$ $P \text{ н.мм} = 337.8$ $P \text{ вн.мм} = 124.6$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{Н}$
	БПЗ-265 $F \text{ см}^2 = 9.670$ $Q \text{ кг.} = 2.621$ $D \text{ оп.мм} = 100.5$ $P \text{ н.мм} = 426.0$ $P \text{ вн.мм} = 111.0$ $\Gamma \text{р. сл.} = \text{IV}$ $\text{Точн.} = \text{Н}$		БПЗ-270 $F \text{ см}^2 = 2.470$ $Q \text{ кг.} = 0.669$ $D \text{ оп.мм} = 31.5$ $P \text{ н.мм} = 138.1$ $P \text{ вн.мм} = 75.4$ $\Gamma \text{р. сл.} = \text{III}$ $\text{Точн.} = \text{Н}$

	БПЗ-271 $F \text{ см}^2 = 0.589$ $Q \text{ кг.} = 0.160$ $D \text{ оп.мм} = 14.0$ $P \text{ н.мм} = 44.0$ $P \text{ в.мм} = 34.5$ Гр. сл. = IV Точн. = П		БПЗ-276 $F \text{ см}^2 = 3.040$ $Q \text{ кг.} = 0.824$ $D \text{ оп.мм} = 39.0$ $P \text{ н.мм} = 146.0$ $P \text{ в.мм} = 89.0$ Гр. сл. = VI Точн. = Н
	БПЗ-272 $F \text{ см}^2 = 0.960$ $Q \text{ кг.} = 0.260$ $D \text{ оп.мм} = 22.0$ $P \text{ н.мм} = 69.1$ $P \text{ в.мм} = 59.7$ Гр. сл. = IV Точн. = П		БПЗ-277 $F \text{ см}^2 = 3.880$ $Q \text{ кг.} = 1.051$ $D \text{ оп.мм} = 42.0$ $P \text{ н.мм} = 168.0$ $P \text{ в.мм} = 124.0$ Гр. сл. = 0соб. Точн. = Н
	БПЗ-273 $F \text{ см}^2 = 0.780$ $Q \text{ кг.} = 0.211$ $D \text{ оп.мм} = 18.0$ $P \text{ н.мм} = 56.5$ $P \text{ в.мм} = 47.1$ Гр. сл. = IV Точн. = П		БПЗ-278 $F \text{ см}^2 = 13.500$ $Q \text{ кг.} = 3.659$ $D \text{ оп.мм} = 151.0$ $P \text{ н.мм} = 428.0$ $P \text{ в.мм} = 388.0$ Гр. сл. = VI Точн. = Н
	БПЗ-274 $F \text{ см}^2 = 5.230$ $Q \text{ кг.} = 1.417$ $D \text{ оп.мм} = 90.0$ $P \text{ н.мм} = 303.0$ $P \text{ в.мм} = 246.0$ Гр. сл. = VI Точн. = Н		БПЗ-279 $F \text{ см}^2 = 3.972$ $Q \text{ кг.} = 1.076$ $D \text{ оп.мм} = 80.0$ $P \text{ н.мм} = 306.8$ $P \text{ в.мм} = 81.7$ Гр. сл. = VI Точн. = Н
	БПЗ-275 $F \text{ см}^2 = 6.100$ $Q \text{ кг.} = 1.653$ $D \text{ оп.мм} = 85.5$ $P \text{ н.мм} = 266.0$ $P \text{ в.мм} = 209.0$		БПЗ-280 $F \text{ см}^2 = 6.510$ $Q \text{ кг.} = 1.764$ $D \text{ оп.мм} = 70.0$ $P \text{ н.мм} = 200.0$ $P \text{ в.мм} = 172.0$

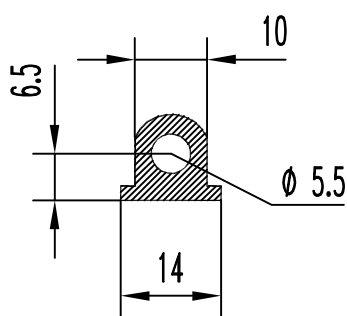
	БПЗ-281 $F \text{ см}^2 = 3.840$ $Q \text{ кг.} = 1.041$ $D \text{ оп.мм} = 70.0$ $P \text{ н.мм} = 200.0$ $P \text{ в.н.мм} = 184.0$ Гр. сл. = VI Точн. = Т		БПЗ-286 $F \text{ см}^2 = 5.264$ $Q \text{ кг.} = 1.427$ $D \text{ оп.мм} = 90.5$ $P \text{ н.мм} = 387.3$ $P \text{ в.н.мм} = 146.5$ Гр. сл. = VI Точн. = П
	БПЗ-282 $F \text{ см}^2 = 1.679$ $Q \text{ кг.} = 0.455$ $D \text{ оп.мм} = 41.0$ $P \text{ н.мм} = 116.6$ $P \text{ в.н.мм} = 107.1$ Гр. сл. = 0соб. Точн. = Н		БПЗ-287 $F \text{ см}^2 = 4.520$ $Q \text{ кг.} = 1.225$ $D \text{ оп.мм} = 72.0$ $P \text{ н.мм} = 332.0$ $P \text{ в.н.мм} = 120.0$ Гр. сл. = VI Точн. = П
	БПЗ-283 $F \text{ см}^2 = 2.240$ $Q \text{ кг.} = 0.607$ $D \text{ оп.мм} = 44.0$ $P \text{ н.мм} = 120.0$ $P \text{ в.н.мм} = 104.0$ Гр. сл. = V Точн. = Н		БПЗ-288 $F \text{ см}^2 = 4.740$ $Q \text{ кг.} = 1.284$ $D \text{ оп.мм} = 61.5$ $P \text{ н.мм} = 163.5$ $P \text{ в.н.мм} = 138.7$ Гр. сл. = IV Точн. = Н
	БПЗ-284 $F \text{ см}^2 = 2.640$ $Q \text{ кг.} = 0.715$ $D \text{ оп.мм} = 51.0$ $P \text{ н.мм} = 140.0$ $P \text{ в.н.мм} = 124.0$ Гр. сл. = VI Точн. = Н		БПЗ-289 $F \text{ см}^2 = 4.884$ $Q \text{ кг.} = 1.324$ $D \text{ оп.мм} = 71.0$ $P \text{ н.мм} = 394.8$ $P \text{ в.н.мм} = 123$ Гр. сл. = VI Точн. = П
	БПЗ-285 $F \text{ см}^2 = 2.264$ $Q \text{ кг.} = 0.614$ $D \text{ оп.мм} = 47.0$ $P \text{ н.мм} = 205.5$ $P \text{ в.н.мм} = 70.4$ Гр. сл. = IV		



БПЗ-291

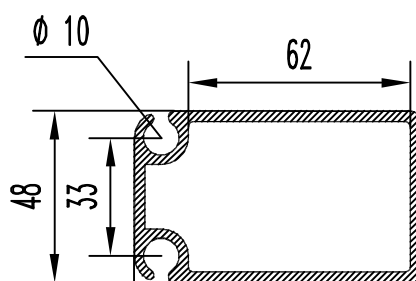
$F \text{ см}^2 = 5.55$
 $Q \text{ кг.} = 1.5$
 $D \text{ оп.мм} = 60.0$
 $P \text{ н.мм} = 188.7$
 $P \text{ вн.мм} = 165.2$
 Гр. сл. = IV
 Точн. = Н

БПЗ-299



$F \text{ см}^2 = 0.952$
 $Q \text{ кг.} = 0.258$
 $D \text{ оп.мм} = 15.0$
 $P \text{ н.мм} = 48.13$
 $P \text{ вн.мм} = 17.28$
 Гр. сл. = IV
 Точн. = Н

БПЗ-300



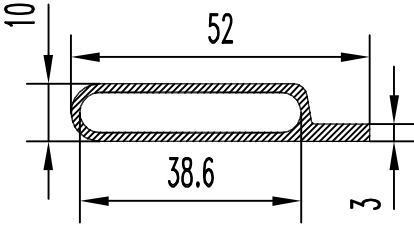
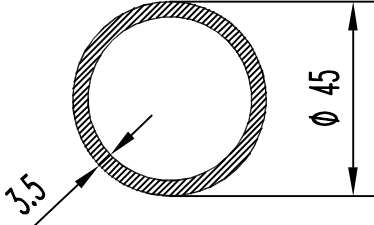
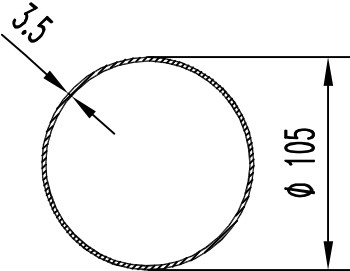
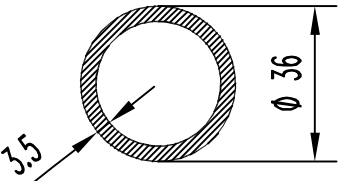
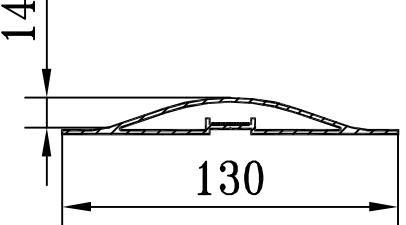
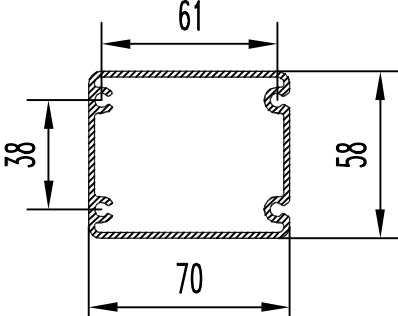
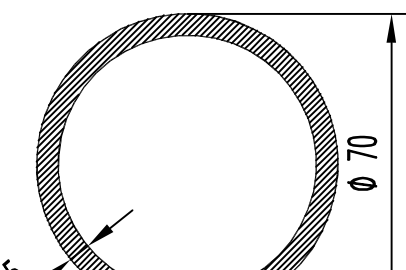
$F \text{ см}^2 = 7.910$
 $Q \text{ кг.} = 2.144$
 $D \text{ оп.мм} = 91.0$
 $P \text{ н.мм} = 303.0$
 $P \text{ вн.мм} = 226.0$

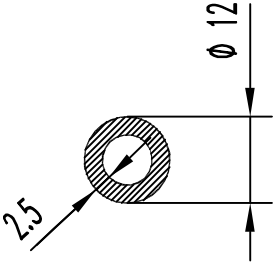
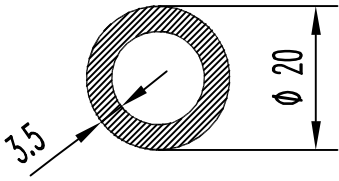
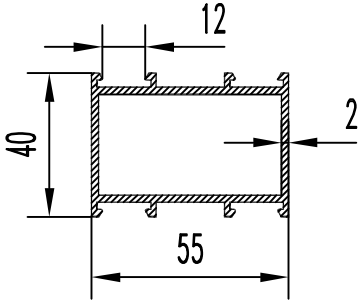
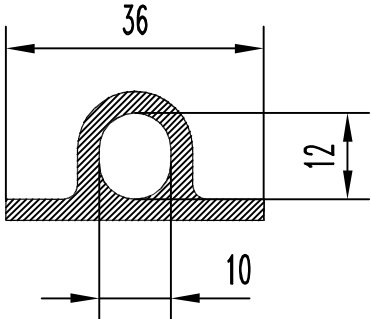
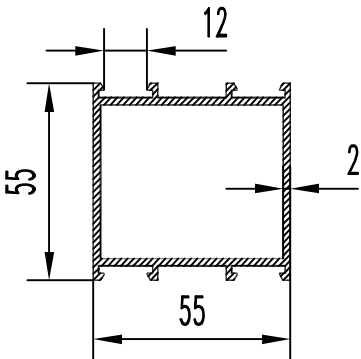
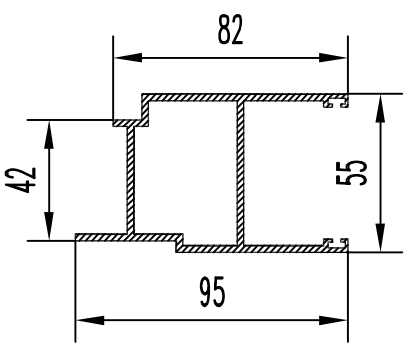
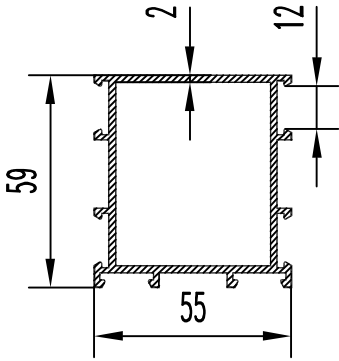
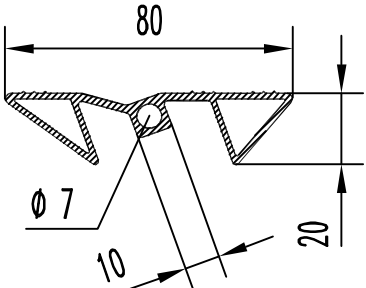
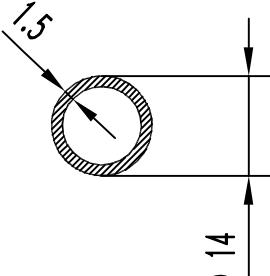
pdfMachine

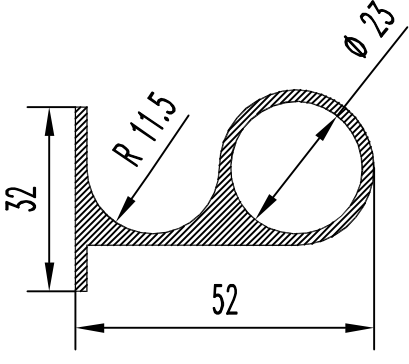
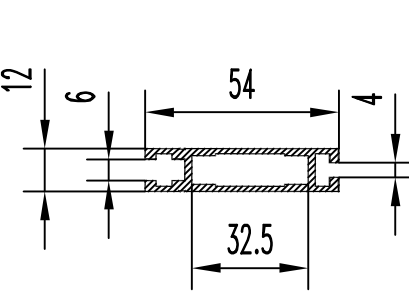
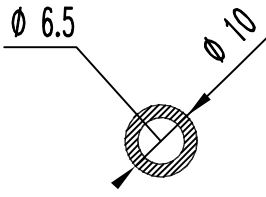
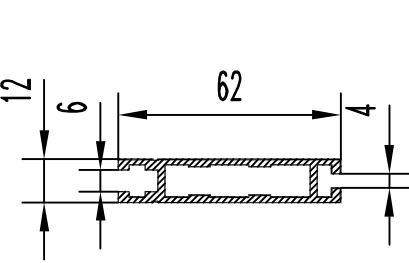
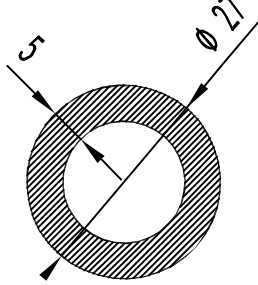
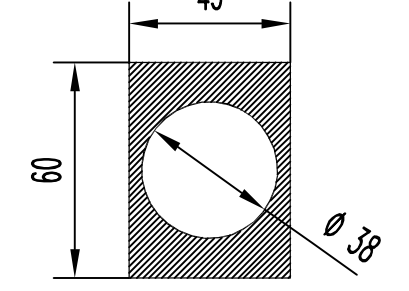
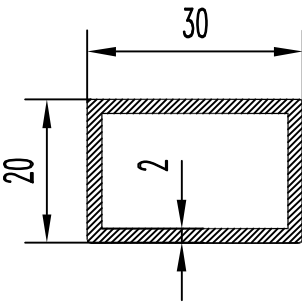
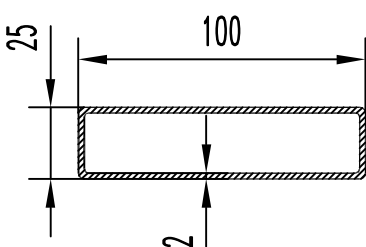
A pdf writer that produces quality PDF files with ease!

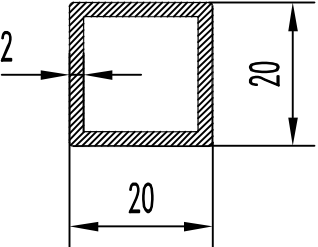
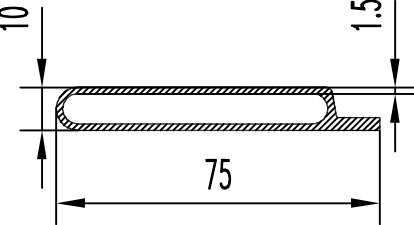
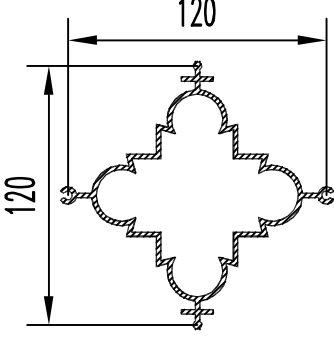
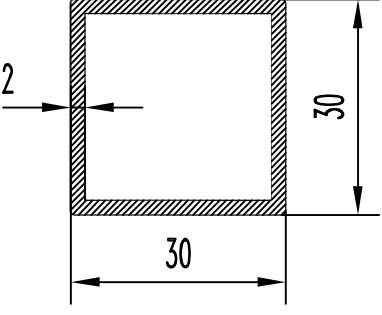
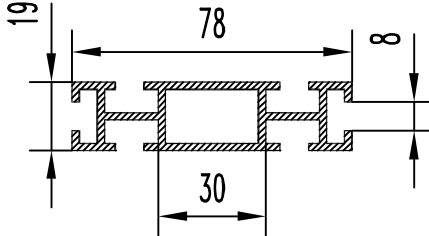
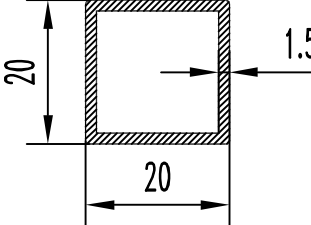
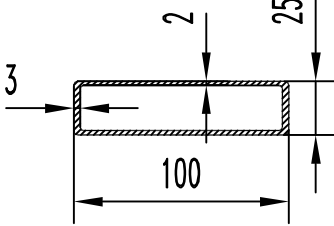
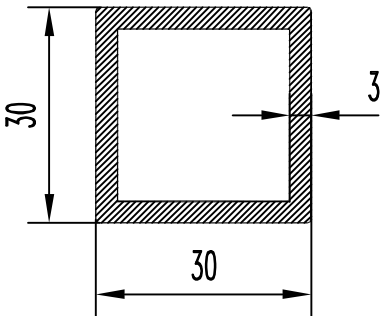
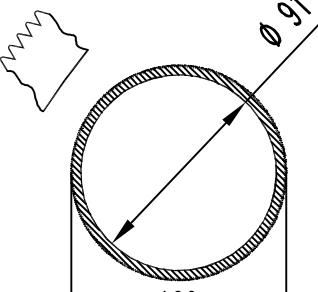
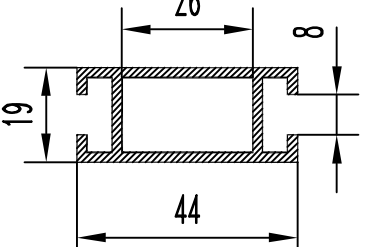
Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

Get yours now!

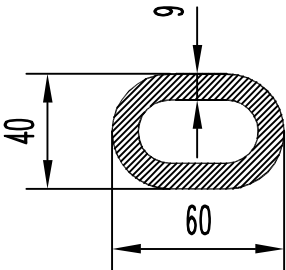
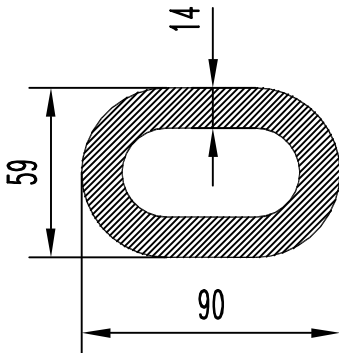
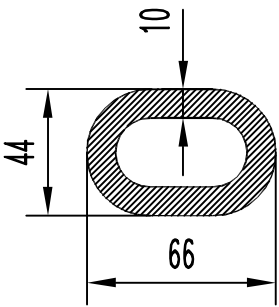
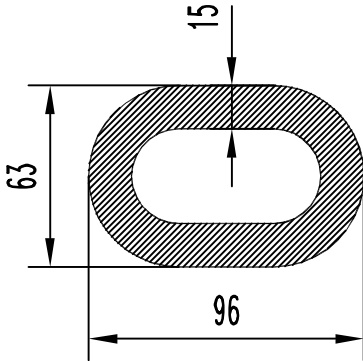
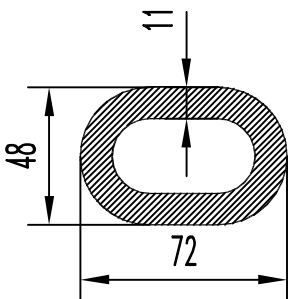
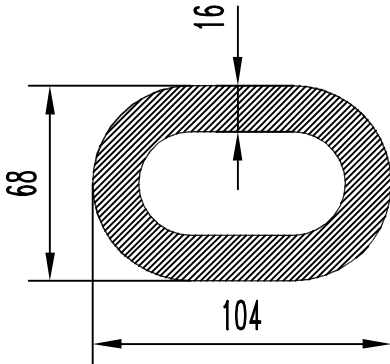
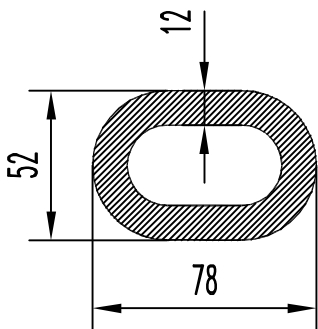
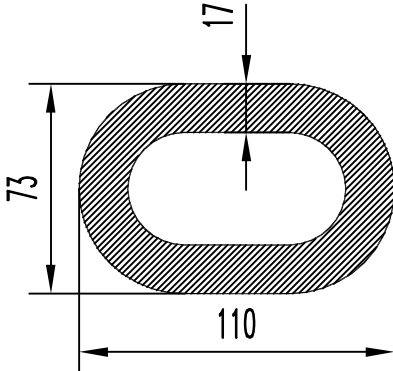
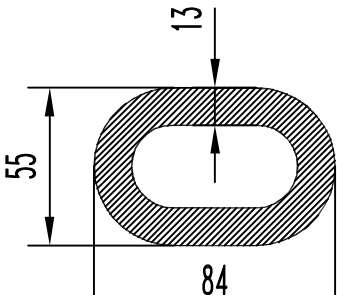
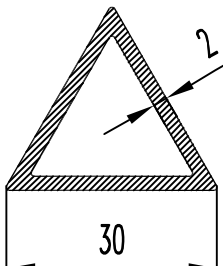
	БПЗ-301 $F \text{ см}^2 = 1.848$ $Q \text{ кг.} = 0.501$ $D \text{ оп.мм} = 52.3$ $P \text{ н.мм} = 118.1$ $P \text{ вн.мм} = 84.8$ Гр. сл. = IV Точн. = Н		БПЗ-306 $F \text{ см}^2 = 4.560$ $Q \text{ кг.} = 1.236$ $D \text{ оп.мм} = 45.0$ $P \text{ н.мм} = 141.4$ $P \text{ вн.мм} = 119.4$ Гр. сл. = II Точн. = Н
	БПЗ-302 $F \text{ см}^2 = 11.160$ $Q \text{ кг.} = 3.024$ $D \text{ оп.мм} = 105.0$ $P \text{ н.мм} = 330.0$ $P \text{ вн.мм} = 308.0$ Гр. сл. = V Точн. = Н		БПЗ-307 $F \text{ см}^2 = 3.570$ $Q \text{ кг.} = 0.967$ $D \text{ оп.мм} = 36.0$ $P \text{ н.мм} = 113.1$ $P \text{ вн.мм} = 91.1$ Гр. сл. = II Точн. = Н
			БПЗ-308 $F \text{ см}^2 = 3.665$ $Q \text{ кг.} = 0.993$ $D \text{ оп.мм} = 130$ $P \text{ н.мм} = 270.8$ $P \text{ вн.мм} = 194.4$ Гр. сл. = VI Точн. = II
			БПЗ-309 $F \text{ см}^2 = 5.920$ $Q \text{ кг.} = 1.604$ $D \text{ оп.мм} = 88.0$ $P \text{ н.мм} = 275.7$ $P \text{ вн.мм} = 299.0$ Гр. сл. = 0соб. Точн. = П
			БПЗ-310 $F \text{ см}^2 = 10.200$ $Q \text{ кг.} = 2.766$ $D \text{ оп.мм} = 70.0$ $P \text{ н.мм} = 219.8$ $P \text{ вн.мм} = 188.4$ Гр. сл. = II

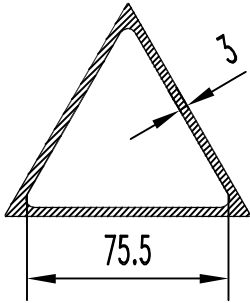
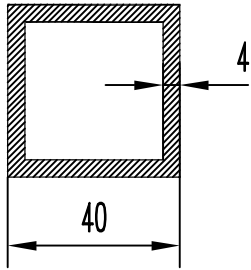
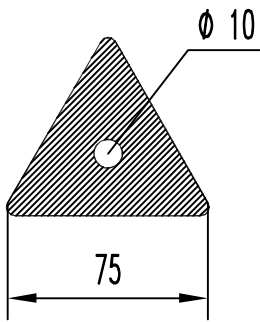
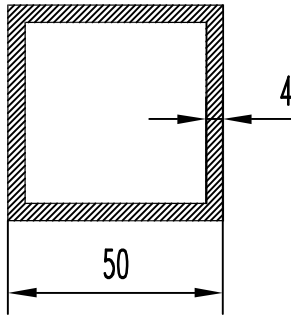
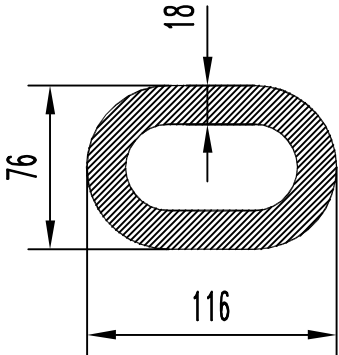
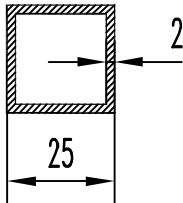
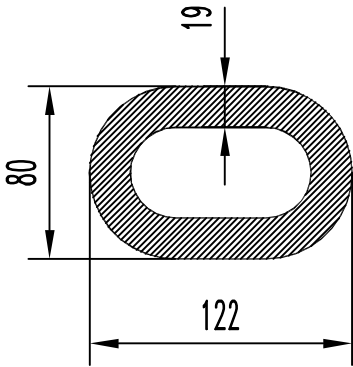
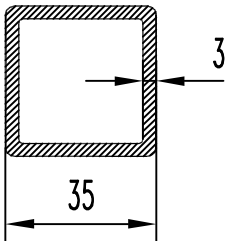
	БПЗ-321 $F \text{ см}^2 = 0.750$ $Q \text{ кг.} = 0.203$ $D \text{ оп.мм} = 12.0$ $P \text{ н.мм} = 37.7$ $P \text{ вн.мм} = 21.9$ Гр. сл. = IV Точн. = Н		
	БПЗ-322 $F \text{ см}^2 = 1.810$ $Q \text{ кг.} = 0.491$ $D \text{ оп.мм} = 20.0$ $P \text{ н.мм} = 62.8$ $P \text{ вн.мм} = 40.8$ Гр. сл. = III Точн. = Н		БПЗ-327 $F \text{ см}^2 = 3.978$ $Q \text{ кг.} = 1.076$ $D \text{ оп.мм} = 68.0$ $P \text{ н.мм} = 255.5$ $P \text{ вн.мм} = 158$ Гр. сл. = IV Точн. = П
	БПЗ-323 $F \text{ см}^2 = 2.28$ $Q \text{ кг.} = 0.618$ $D \text{ оп.мм} = 36.5$ $P \text{ н.мм} = 99.6$ $P \text{ вн.мм} = 35.4$ Гр. сл. = IV Точн. = Н		БПЗ-328 $F \text{ см}^2 = 4.458$ $Q \text{ кг.} = 1.241$ $D \text{ оп.мм} = 77.8$ $P \text{ н.мм} = 285.5$ $P \text{ вн.мм} = 188$ Гр. сл. = IV Точн. = П
	БПЗ-324 $F \text{ см}^2 = 6.463$ $Q \text{ кг.} = 1.751$ $D \text{ оп.мм} = 110.0$ $P \text{ н.мм} = 415.2$ $P \text{ вн.мм} = 172.8$ Гр. сл. = IV Точн. = П		БПЗ-329 $F \text{ см}^2 = 4.907$ $Q \text{ кг.} = 1.33$ $D \text{ оп.мм} = 81.4$ $P \text{ н.мм} = 326.2$ $P \text{ вн.мм} = 188$ Гр. сл. = IV Точн. = П
	БПЗ-325 $F \text{ см}^2 = 3.240$ $Q \text{ кг.} = 0.878$ $D \text{ оп.мм} = 80.5$ $P \text{ н.мм} = 233.0$ $P \text{ вн.мм} = 153.0$ Гр. сл. = IV Точн. = П		БПЗ-330 $F \text{ см}^2 = 0.589$ $Q \text{ кг.} = 0.160$ $D \text{ оп.мм} = 14.0$ $P \text{ н.мм} = 44.0$ $P \text{ вн.мм} = 34.5$ Гр. сл. = IV Точн. = П

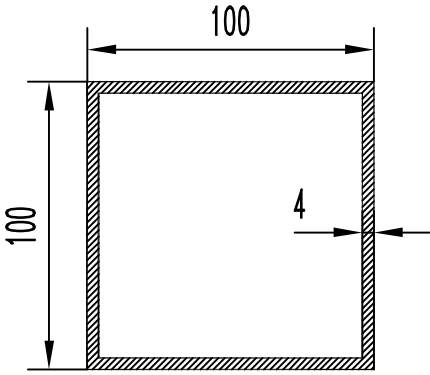
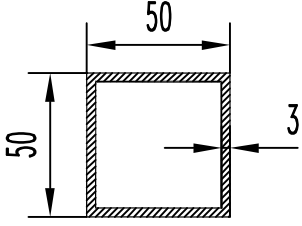
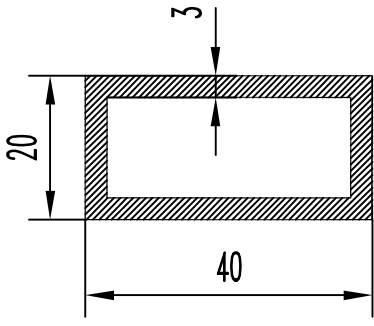
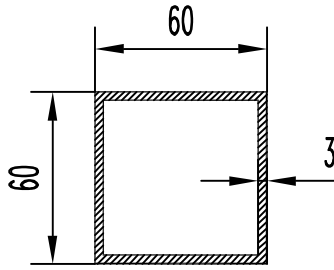
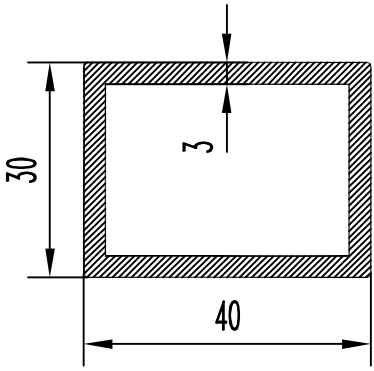
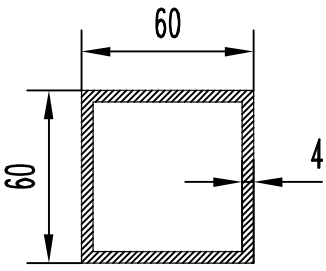
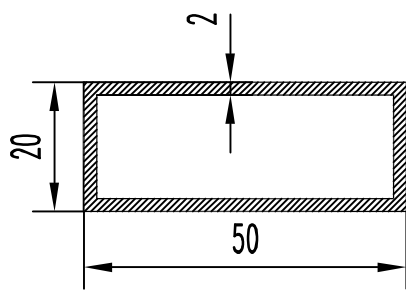
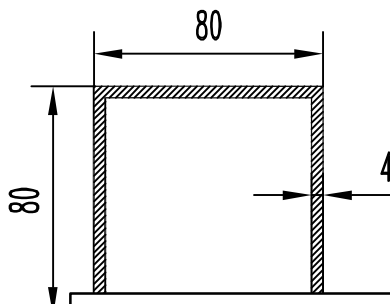
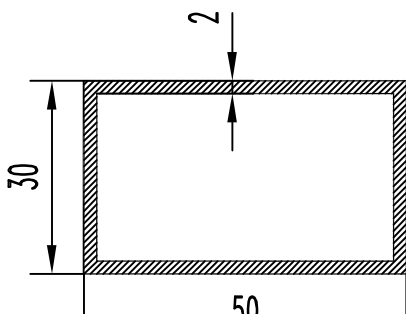
	БПЗ-331 $F \text{ см}^2 = 3.640$ $Q \text{ кг.} = 0.986$ $D \text{ оп.мм} = 57.8$ $P \text{ н.мм} = 190.0$ $P \text{ вн.мм} = 72.3$ Гр. сл. = IV Точн. = П		
	БПЗ-332 $F \text{ см}^2 = 2.550$ $Q \text{ кг.} = 0.691$ $D \text{ оп.мм} = 55.4$ $P \text{ н.мм} = 184.4$ $P \text{ вн.мм} = 82.6$ Гр. сл. = III Точн. = Н		БПЗ-337 $F \text{ см}^2 = 0.454$ $Q \text{ кг.} = 0.123$ $D \text{ оп.мм} = 10.0$ $P \text{ н.мм} = 31.7$ $P \text{ вн.мм} = 20.42$ Гр. сл. = II Точн. = Н
	БПЗ-333 $F \text{ см}^2 = 2.800$ $Q \text{ кг.} = 0.759$ $D \text{ оп.мм} = 63.2$ $P \text{ н.мм} = 200.4$ $P \text{ вн.мм} = 102.6$ Гр. сл. = III Точн. = Н		БПЗ-338 $F \text{ см}^2 = 3.520$ $Q \text{ кг.} = 0.954$ $D \text{ оп.мм} = 27.0$ $P \text{ н.мм} = 85.1$ $P \text{ вн.мм} = 53.1$ Гр. сл. = III Точн. = Н
	БПЗ-334 $F \text{ см}^2 = 15.660$ $Q \text{ кг.} = 4.244$ $D \text{ оп.мм} = 39.7$ $P \text{ н.мм} = 210.0$ $P \text{ вн.мм} = 119.4$ Гр. сл. = IV Точн. = Н		БПЗ-339 $F \text{ см}^2 = 1.840$ $Q \text{ кг.} = 0.499$ $D \text{ оп.мм} = 36.0$ $P \text{ н.мм} = 100.0$ $P \text{ вн.мм} = 84.0$ Гр. сл. = V Точн. = Н
			БПЗ-340 $F \text{ см}^2 = 4.825$ $Q \text{ кг.} = 1.308$ $D \text{ оп.мм} = 103.0$ $P \text{ н.мм} = 246.6$ $P \text{ вн.мм} = 231.4$

	БПЗ-341 $F \text{ см}^2 = 1.440$ $Q \text{ кг.} = 0.390$ $D \text{ оп.мм} = 28.0$ $P \text{ н.мм} = 80.0$ $P \text{ вн.мм} = 64.0$ Гр. сл. = IV Точн. = 0соб.		БПЗ-346 $F \text{ см}^2 = 2.440$ $Q \text{ кг.} = 0.661$ $D \text{ оп.мм} = 75.1$ $P \text{ н.мм} = 164.0$ $P \text{ вн.мм} = 131.0$ Гр. сл. = V Точн. = П
	БПЗ-342 $F \text{ см}^2 = 9.292$ $Q \text{ кг.} = 2.518$ $D \text{ оп.мм} = 127.0$ $P \text{ н.мм} = 559.3$ $P \text{ вн.мм} = 369.9$ Гр. сл. = VI Точн. = П		БПЗ-347 $F \text{ см}^2 = 2.240$ $Q \text{ кг.} = 0.607$ $D \text{ оп.мм} = 42.0$ $P \text{ н.мм} = 119.2$ $P \text{ вн.мм} = 104.0$ Гр. сл. = V Точн. = 0соб.
	БПЗ-343 $F \text{ см}^2 = 4.56$ $Q \text{ кг.} = 1.236$ $D \text{ оп.мм} = 80.3$ $P \text{ н.мм} = 374.0$ $P \text{ вн.мм} = 82.0$ Гр. сл. = 0соб. Точн. = П		БПЗ-348 $F \text{ см}^2 = 1.182$ $Q \text{ кг.} = 0.320$ $D \text{ оп.мм} = 28.0$ $P \text{ н.мм} = 79.5$ $P \text{ вн.мм} = 67.6$ Гр. сл. = VI Точн. = Н
	БПЗ-344 $F \text{ см}^2 = 5.250$ $Q \text{ кг.} = 1.423$ $D \text{ оп.мм} = 103.0$ $P \text{ н.мм} = 246.5$ $P \text{ вн.мм} = 227.4$ Гр. сл. = 0соб. Точн. = 0соб.		БПЗ-349 $F \text{ см}^2 = 3.240$ $Q \text{ кг.} = 0.878$ $D \text{ оп.мм} = 42.0$ $P \text{ н.мм} = 119.1$ $P \text{ вн.мм} = 96.0$ Гр. сл. = III Точн. = 0соб.
	БПЗ-345 $F \text{ см}^2 = 12.160$ $Q \text{ кг.} = 3.295$ $D \text{ оп.мм} = 100.0$ $P \text{ н.мм} = 665.5$ $P \text{ вн.мм} = 285.5$ Гр. сл. = 0соб. Точн. = 0соб.		БПЗ-350 $F \text{ см}^2 = 2.640$ $Q \text{ кг.} = 0.715$ $D \text{ оп.мм} = 47.9$ $P \text{ н.мм} = 182.0$ $P \text{ вн.мм} = 82.0$ Гр. сл. = 0соб. Точн. = 0соб.

	БПЗ-351 $F \text{ см}^2 = 2.880$ $Q \text{ кг.} = 0.780$ $D \text{ оп.мм} = 50.0$ $P \text{ н.мм} = 206.0$ $P \text{ вн.мм} = 82.0$ Гр. сл. = 0соб. Точн. = П		БПЗ-356 $F \text{ см}^2 = 3.230$ $Q \text{ кг.} = 0.875$ $D \text{ оп.мм} = 31.0$ $P \text{ н.мм} = 85.9$ $P \text{ вн.мм} = 57.7$ Гр. сл. = III Точн. = Н
	БПЗ-352 $F \text{ см}^2 = 3.120$ $Q \text{ кг.} = 0.846$ $D \text{ оп.мм} = 50.0$ $P \text{ н.мм} = 230$ $P \text{ вн.мм} = 82.0$ Гр. сл. = 0соб. Точн. = П		БПЗ-357 $F \text{ см}^2 = 5.580$ $Q \text{ кг.} = 1.512$ $D \text{ оп.мм} = 36.0$ $P \text{ н.мм} = 127.4$ $P \text{ вн.мм} = 96.0$ Гр. сл. = III Точн. = Н
	БПЗ-353 $F \text{ см}^2 = 0.640$ $Q \text{ кг.} = 0.173$ $D \text{ оп.мм} = 14.0$ $P \text{ н.мм} = 38.3$ $P \text{ вн.мм} = 25.7$ Гр. сл. = III Точн. = Н		БПЗ-358 $F \text{ см}^2 = 5.825$ $Q \text{ кг.} = 1.579$ $D \text{ оп.мм} = 42.0$ $P \text{ н.мм} = 116.0$ $P \text{ вн.мм} = 78.2$ Гр. сл. = III Точн. = Н
	БПЗ-354 $F \text{ см}^2 = 1.100$ $Q \text{ кг.} = 0.298$ $D \text{ оп.мм} = 19.0$ $P \text{ н.мм} = 51.7$ $P \text{ вн.мм} = 36.0$ Гр. сл. = III Точн. = Н		БПЗ-359 $F \text{ см}^2 = 7.730$ $Q \text{ кг.} = 2.095$ $D \text{ оп.мм} = 48.0$ $P \text{ н.мм} = 132.5$ $P \text{ вн.мм} = 88.5$ Гр. сл. = III Точн. = Н
	БПЗ-355 $F \text{ см}^2 = 2.000$ $Q \text{ кг.} = 0.542$ $D \text{ оп.мм} = 25.0$ $P \text{ н.мм} = 68.2$ $P \text{ вн.мм} = 46.3$ Гр. сл. = III Точн. = Н		БПЗ-360 $F \text{ см}^2 = 9.910$ $Q \text{ кг.} = 2.686$ $D \text{ оп.мм} = 54.0$ $P \text{ н.мм} = 149.0$ $P \text{ вн.мм} = 98.8$ Гр. сл. = III Точн. = Н

	БПЗ-361 $F \text{ см}^2 = 12.360$ $Q \text{ кг.} = 3.350$ $D \text{ оп.мм} = 60.0$ $P \text{ н.мм} = 165.6$ $P \text{ вн.мм} = 109.1$ Гр. сл. = III Точн. = Н		БПЗ-366 $F \text{ см}^2 = 28.460$ $Q \text{ кг.} = 7.713$ $D \text{ оп.мм} = 90.0$ $P \text{ н.мм} = 247.0$ $P \text{ вн.мм} = 159.0$ Гр. сл. = III Точн. = Н
	БПЗ-362 $F \text{ см}^2 = 15.080$ $Q \text{ кг.} = 4.087$ $D \text{ оп.мм} = 66.0$ $P \text{ н.мм} = 182.0$ $P \text{ вн.мм} = 119.4$ Гр. сл. = III Точн. = Н		БПЗ-367 $F \text{ см}^2 = 32.510$ $Q \text{ кг.} = 8.810$ $D \text{ оп.мм} = 96.0$ $P \text{ н.мм} = 263.8$ $P \text{ вн.мм} = 169.6$ Гр. сл. = III Точн. = Н
	БПЗ-363 $F \text{ см}^2 = 18.050$ $Q \text{ кг.} = 4.892$ $D \text{ оп.мм} = 72.0$ $P \text{ н.мм} = 198.7$ $P \text{ вн.мм} = 129.6$ Гр. сл. = III Точн. = Н		БПЗ-368 $F \text{ см}^2 = 37.640$ $Q \text{ кг.} = 10.200$ $D \text{ оп.мм} = 104.0$ $P \text{ н.мм} = 285.5$ $P \text{ вн.мм} = 185.0$ Гр. сл. = III Точн. = Н
	БПЗ-364 $F \text{ см}^2 = 21.310$ $Q \text{ кг.} = 5.8$ $D \text{ оп.мм} = 78.0$ $P \text{ н.мм} = 215.3$ $P \text{ вн.мм} = 140.0$ Гр. сл. = III Точн. = Н		БПЗ-369 $F \text{ см}^2 = 42.500$ $Q \text{ кг.} = 11.518$ $D \text{ оп.мм} = 110.0$ $P \text{ н.мм} = 303.2$ $P \text{ вн.мм} = 196.5$ Гр. сл. = III Точн. = Н
	БПЗ-365 $F \text{ см}^2 = 24.700$ $Q \text{ кг.} = 6.7$ $D \text{ оп.мм} = 84.0$ $P \text{ н.мм} = 230.7$ $P \text{ вн.мм} = 149.1$ Гр. сл. = III Точн. = Н		БПЗ-370 $F \text{ см}^2 = 1.640$ $Q \text{ кг.} = 0.444$ $D \text{ оп.мм} = 34.5$ $P \text{ н.мм} = 90.1$ $P \text{ вн.мм} = 66.9$ Гр. сл. = III Точн. = Н

	БПЗ-371 $F \text{ см}^2 = 7.850$ $Q \text{ кг.} = 2.13$ $D \text{ оп.мм} = 104.0$ $P \text{ н.мм} = 270.0$ $P \text{ в.н.мм} = 227.8$ Гр. сл. = VI Точн. = П		БПЗ-376 $F \text{ см}^2 = 5.760$ $Q \text{ кг.} = 1.561$ $D \text{ оп.мм} = 56.6$ $P \text{ н.мм} = 160.0$ $P \text{ в.н.мм} = 128.0$ Гр. сл. = III Точн. = DIN
	БПЗ-372 $F \text{ см}^2 = 26.200$ $Q \text{ кг.} = 7.100$ $D \text{ оп.мм} = 86.0$ $P \text{ н.мм} = 226.5$ $P \text{ в.н.мм} = 31.4$ Гр. сл. = IV Точн. = П		БПЗ-377 $F \text{ см}^2 = 7.360$ $Q \text{ кг.} = 1.995$ $D \text{ оп.мм} = 70.7$ $P \text{ н.мм} = 200.0$ $P \text{ в.н.мм} = 168.0$ Гр. сл. = III Точн. = DIN
	БПЗ-373 $F \text{ см}^2 = 32.780$ $Q \text{ кг.} = 8.883$ $D \text{ оп.мм} = 116.0$ $P \text{ н.мм} = 238.6$ $P \text{ в.н.мм} = 125.6$ Гр. сл. = III Точн. = Н		БПЗ-378 $F \text{ см}^2 = 1.840$ $Q \text{ кг.} = 0.499$ $D \text{ оп.мм} = 35.4$ $P \text{ н.мм} = 100.0$ $P \text{ в.н.мм} = 84.0$ Гр. сл. = V Точн. = DIN
	БПЗ-374 $F \text{ см}^2 = 52.350$ $Q \text{ кг.} = 14.187$ $D \text{ оп.мм} = 122.0$ $P \text{ н.мм} = 335.2$ $P \text{ в.н.мм} = 215.9$ Гр. сл. = III Точн. = Н		
	БПЗ-375 $F \text{ см}^2 = 3.810$ $Q \text{ кг.} = 1.033$ $D \text{ оп.мм} = 48.0$ $P \text{ н.мм} = 136.6$ $P \text{ в.н.мм} = 116.0$ Гр. сл. = III		

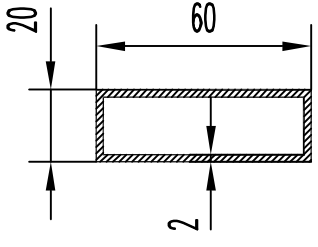
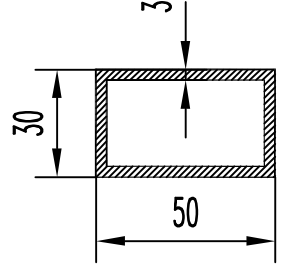
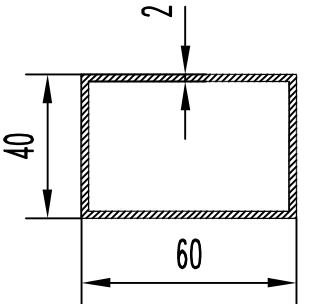
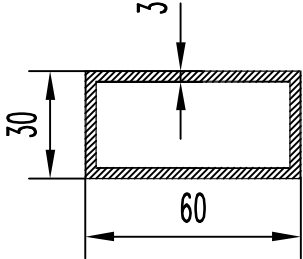
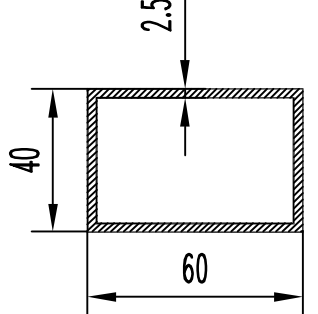
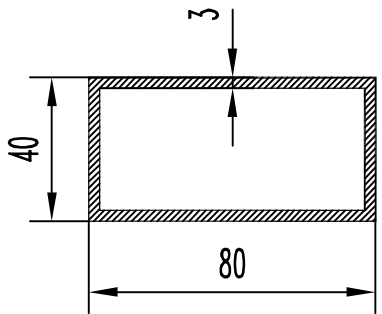
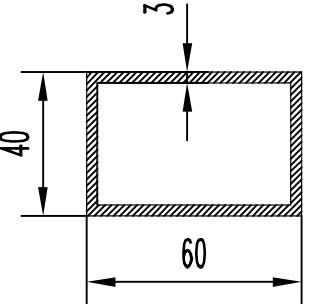
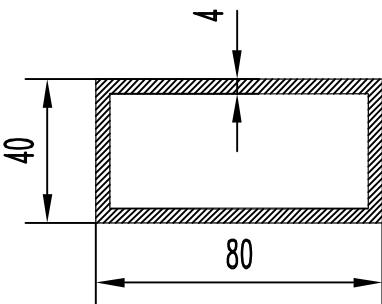
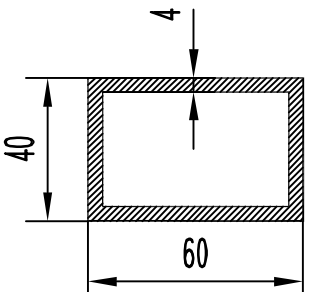
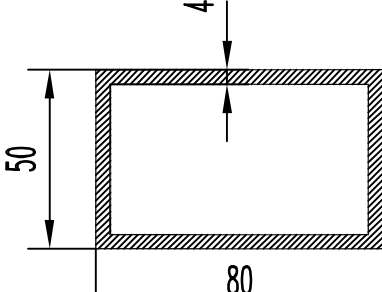
			БПЗ-386 $F \text{ см}^2 = 15.360$ $Q \text{ кг.} = 4.163$ $D \text{ оп.мм} = 141.4$ $P \text{ н.мм} = 400.0$ $P \text{ вн.мм} = 368.0$ Гр. сл. = V Точн. = Н
	БПЗ-382 $F \text{ см}^2 = 5.640$ $Q \text{ кг.} = 1.528$ $D \text{ оп.мм} = 70.7$ $P \text{ н.мм} = 200.0$ $P \text{ вн.мм} = 176.0$ Гр. сл. = IV Точн. = Н		БПЗ-387 $F \text{ см}^2 = 3.240$ $Q \text{ кг.} = 0.878$ $D \text{ оп.мм} = 44.7$ $P \text{ н.мм} = 120.0$ $P \text{ вн.мм} = 96.0$ Гр. сл. = III Точн. = Н
	БПЗ-383 $F \text{ см}^2 = 6.840$ $Q \text{ кг.} = 1.854$ $D \text{ оп.мм} = 84.9$ $P \text{ н.мм} = 240.0$ $P \text{ вн.мм} = 216.0$ Гр. сл. = V Точн. = Н		БПЗ-388 $F \text{ см}^2 = 3.840$ $Q \text{ кг.} = 1.041$ $D \text{ оп.мм} = 49.6$ $P \text{ н.мм} = 139.1$ $P \text{ вн.мм} = 116.0$ Гр. сл. = III Точн. = Н
	БПЗ-384 $F \text{ см}^2 = 8.960$ $Q \text{ кг.} = 2.428$ $D \text{ оп.мм} = 84.9$ $P \text{ н.мм} = 240.0$ $P \text{ вн.мм} = 208.0$ Гр. сл. = IV Точн. = Н		БПЗ-389 $F \text{ см}^2 = 2.640$ $Q \text{ кг.} = 0.715$ $D \text{ оп.мм} = 53.9$ $P \text{ н.мм} = 140.0$ $P \text{ вн.мм} = 124.0$ Гр. сл. = VI Точн. = Н
	БПЗ-385 $F \text{ см}^2 = 12.160$ $Q \text{ кг.} = 3.295$ $D \text{ оп.мм} = 113.1$ $P \text{ н.мм} = 320.0$ $P \text{ вн.мм} = 288.0$ Гр. сл. = V		БПЗ-390 $F \text{ см}^2 = 3.040$ $Q \text{ кг.} = 0.824$ $D \text{ оп.мм} = 53.8$ $P \text{ н.мм} = 160.0$ $P \text{ вн.мм} = 144.0$ Гр. сл. = VI

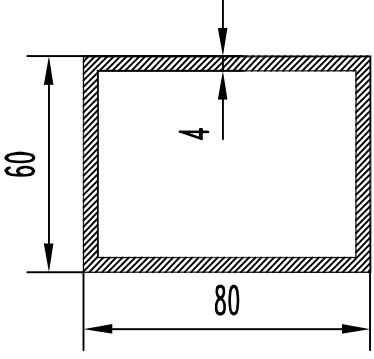
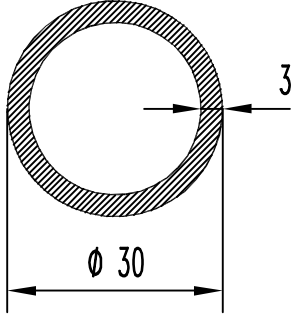
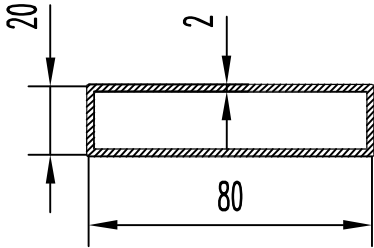
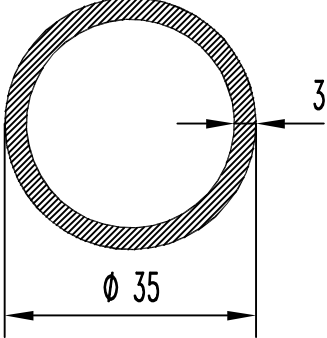
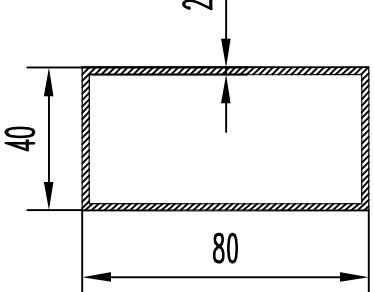
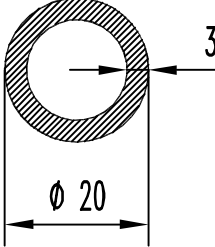
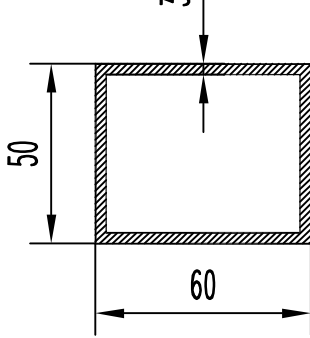
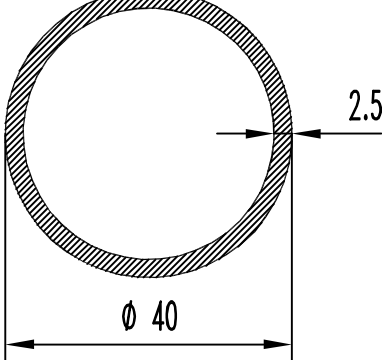
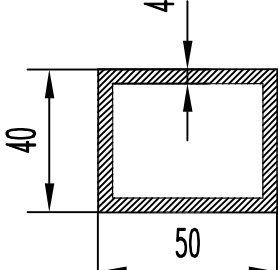
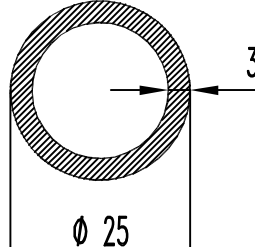
pdfMachine

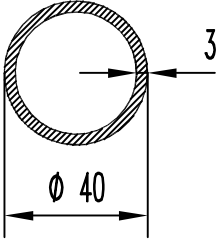
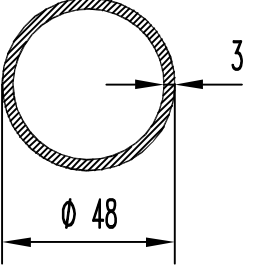
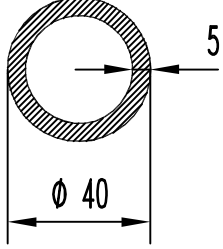
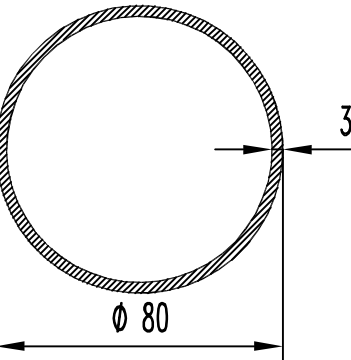
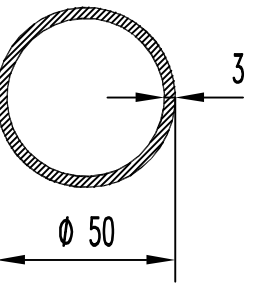
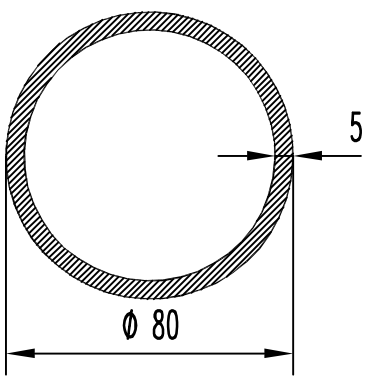
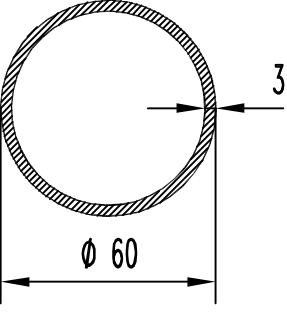
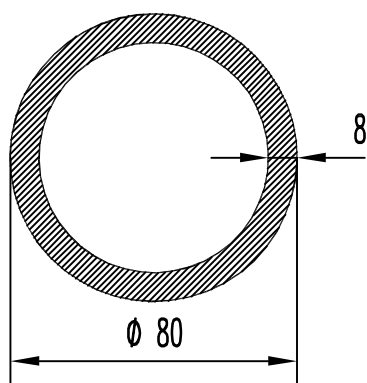
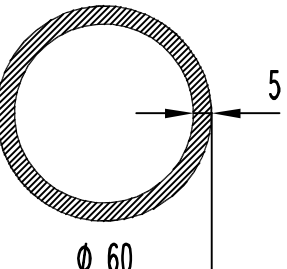
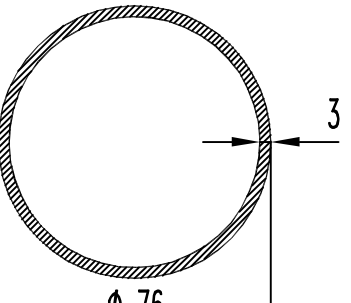
A pdf writer that produces quality PDF files with ease!

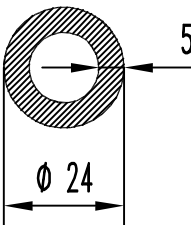
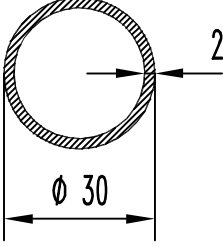
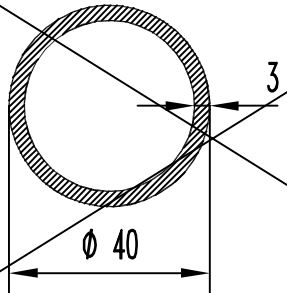
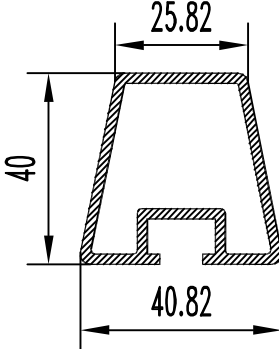
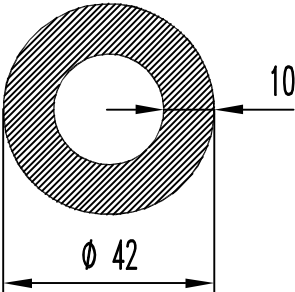
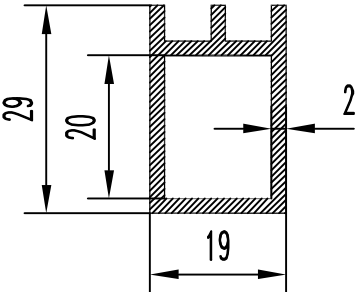
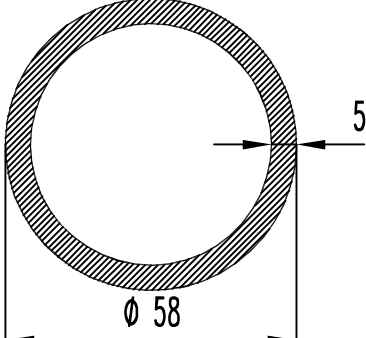
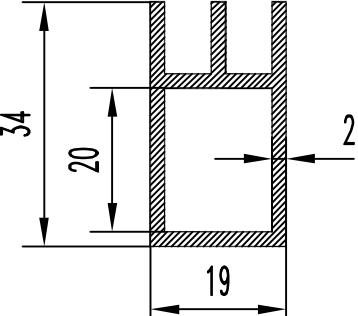
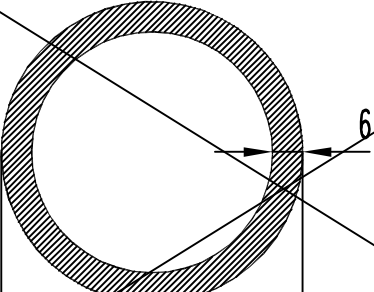
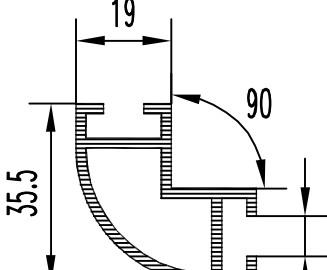
Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

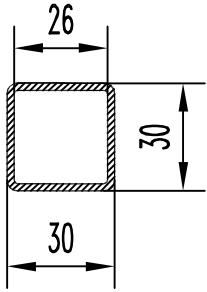
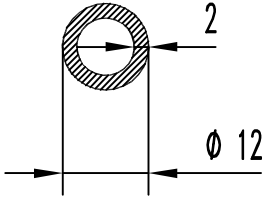
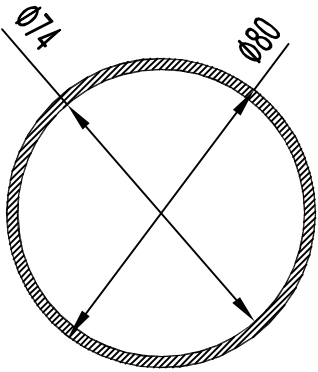
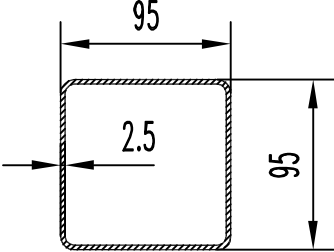
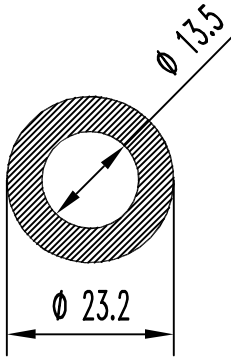
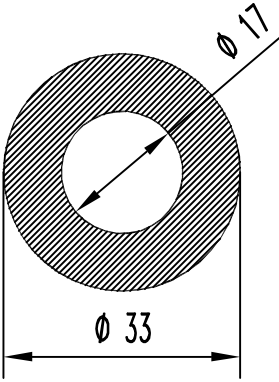
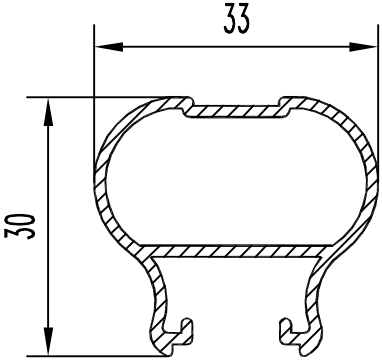
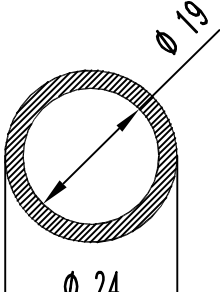
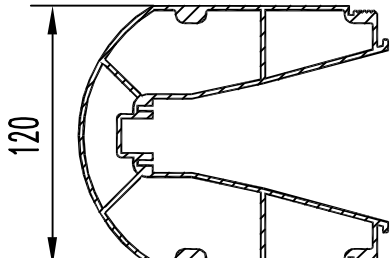
Get yours now!

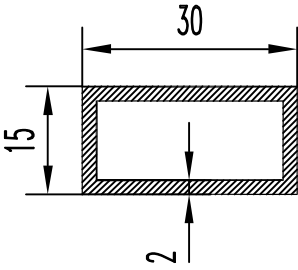
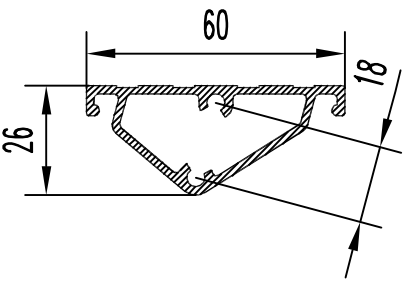
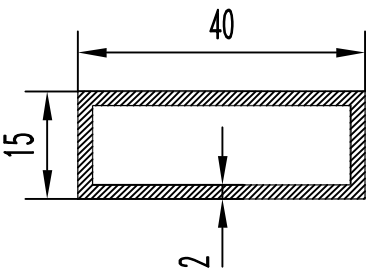
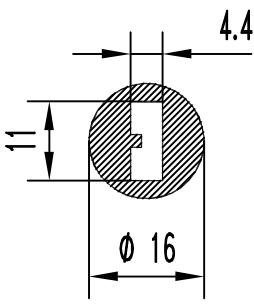
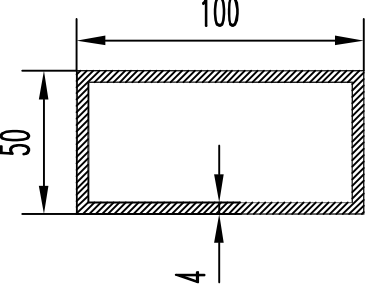
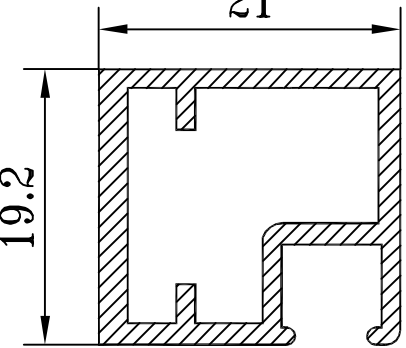
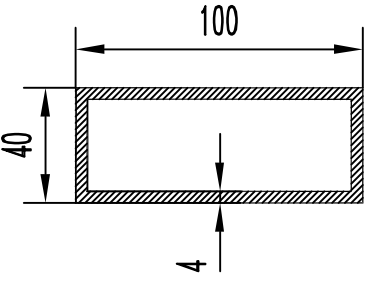
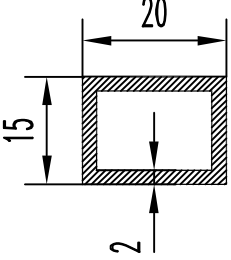
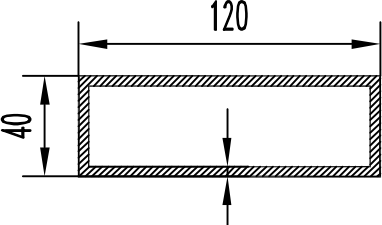
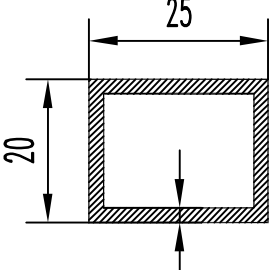
	БПЗ-391 $F \text{ см}^2 = 3.040$ $Q \text{ кг.} = 0.824$ $D \text{ оп.мм} = 63.2$ $P \text{ н.мм} = 160.0$ $P \text{ вн.мм} = 144.0$ Гр. сл. = VI Точн. = Н		БПЗ-396 $F \text{ см}^2 = 4.440$ $Q \text{ кг.} = 1.203$ $D \text{ оп.мм} = 58.3$ $P \text{ н.мм} = 160.0$ $P \text{ вн.мм} = 136.0$ Гр. сл. = IV Точн. = Н
	БПЗ-392 $F \text{ см}^2 = 3.840$ $Q \text{ кг.} = 1.041$ $D \text{ оп.мм} = 72.1$ $P \text{ н.мм} = 200.0$ $P \text{ вн.мм} = 184.0$ Гр. сл. = VI Точн. = Н		БПЗ-397 $F \text{ см}^2 = 5.040$ $Q \text{ кг.} = 1.366$ $D \text{ оп.мм} = 67.1$ $P \text{ н.мм} = 180.0$ $P \text{ вн.мм} = 156.0$ Гр. сл. = IV Точн. = Н
	БПЗ-393 $F \text{ см}^2 = 4.750$ $Q \text{ кг.} = 1.287$ $D \text{ оп.мм} = 72.1$ $P \text{ н.мм} = 200.0$ $P \text{ вн.мм} = 180.0$ Гр. сл. = V Точн. = Н		БПЗ-398 $F \text{ см}^2 = 6.840$ $Q \text{ кг.} = 1.854$ $D \text{ оп.мм} = 89.4$ $P \text{ н.мм} = 240.0$ $P \text{ вн.мм} = 216.0$ Гр. сл. = V Точн. = Н
	БПЗ-394 $F \text{ см}^2 = 5.640$ $Q \text{ кг.} = 1.528$ $D \text{ оп.мм} = 72.1$ $P \text{ н.мм} = 200.0$ $P \text{ вн.мм} = 176.0$ Гр. сл. = IV Точн. = Н		БПЗ-399 $F \text{ см}^2 = 8.600$ $Q \text{ кг.} = 2.331$ $D \text{ оп.мм} = 89.4$ $P \text{ н.мм} = 240.0$ $P \text{ вн.мм} = 208.0$ Гр. сл. = IV Точн. = Н
	БПЗ-395 $F \text{ см}^2 = 7.600$ $Q \text{ кг.} = 2.060$ $D \text{ оп.мм} = 72.1$ $P \text{ н.мм} = 200.0$ $P \text{ вн.мм} = 168.0$ Гр. сл. = III		БПЗ-400 $F \text{ см}^2 = 9.760$ $Q \text{ кг.} = 2.645$ $D \text{ оп.мм} = 94.3$ $P \text{ н.мм} = 260.0$ $P \text{ вн.мм} = 228.0$ Гр. сл. = IV

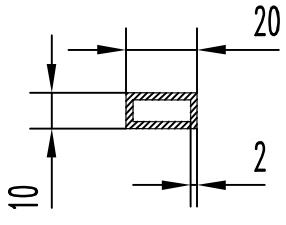
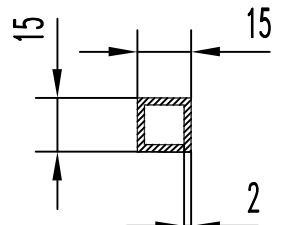
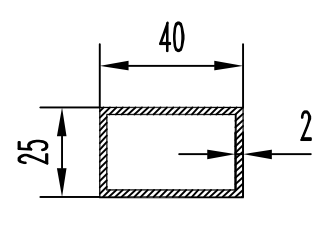
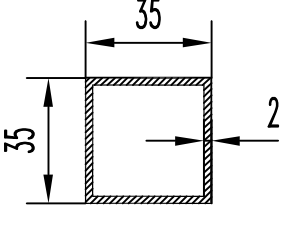
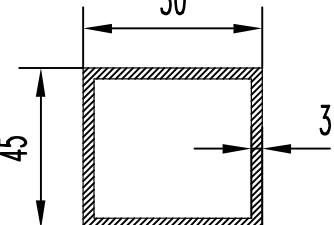
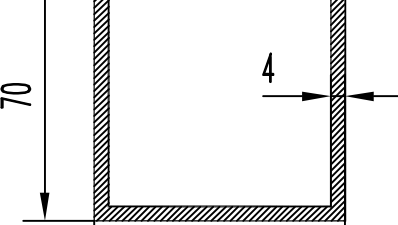
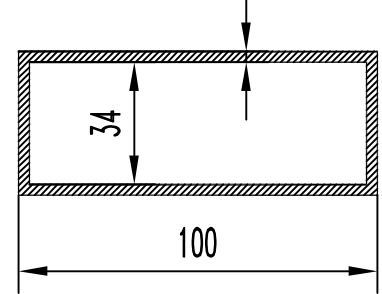
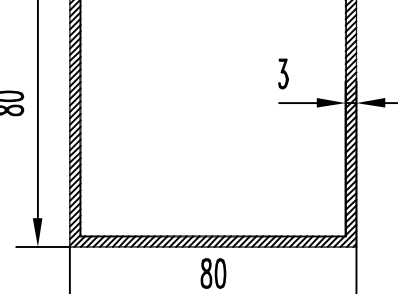
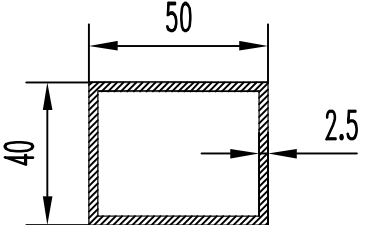
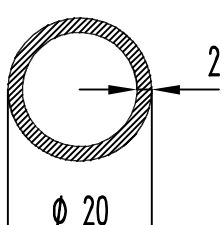
	БПЗ-401 $F \text{ см}^2 = 10.560$ $Q \text{ кг.} = 2.862$ $D \text{ оп.мм} = 100.0$ $P \text{ н.мм} = 280.0$ $P \text{ вн.мм} = 248.0$ Гр. сл. = IV Точн. = Н		БПЗ-406 $F \text{ см}^2 = 2.550$ $Q \text{ кг.} = 0.691$ $D \text{ оп.мм} = 30.0$ $P \text{ н.мм} = 94.2$ $P \text{ вн.мм} = 75.4$ Гр. сл. = III Точн. = Н
	БПЗ-402 $F \text{ см}^2 = 3.840$ $Q \text{ кг.} = 1.041$ $D \text{ оп.мм} = 82.3$ $P \text{ н.мм} = 199.2$ $P \text{ вн.мм} = 184.0$ Гр. сл. = 0соб. Точн. = Н		БПЗ-407 $F \text{ см}^2 = 3.020$ $Q \text{ кг.} = 0.818$ $D \text{ оп.мм} = 35.0$ $P \text{ н.мм} = 110.0$ $P \text{ вн.мм} = 91.1$ Гр. сл. = III Точн. = Н
	БПЗ-403 $F \text{ см}^2 = 4.640$ $Q \text{ кг.} = 1.257$ $D \text{ оп.мм} = 90.0$ $P \text{ н.мм} = 240.0$ $P \text{ вн.мм} = 224.0$ Гр. сл. = V Точн. = Н		БПЗ-408 $F \text{ см}^2 = 1.600$ $Q \text{ кг.} = 0.434$ $D \text{ оп.мм} = 20.0$ $P \text{ н.мм} = 62.8$ $P \text{ вн.мм} = 44.0$ Гр. сл. = IV Точн. = Н
	БПЗ-404 $F \text{ см}^2 = 6.240$ $Q \text{ кг.} = 1.691$ $D \text{ оп.мм} = 78.1$ $P \text{ н.мм} = 220.0$ $P \text{ вн.мм} = 196.0$ Гр. сл. = V Точн. = Н		БПЗ-409 $F \text{ см}^2 = 2.940$ $Q \text{ кг.} = 0.797$ $D \text{ оп.мм} = 40.0$ $P \text{ н.мм} = 125.6$ $P \text{ вн.мм} = 109.9$ Гр. сл. = III Точн. = Н
	БПЗ-405 $F \text{ см}^2 = 6.560$ $Q \text{ кг.} = 1.778$ $D \text{ оп.мм} = 64.0$ $P \text{ н.мм} = 180.0$ $P \text{ вн.мм} = 148.0$ Гр. сл. = III Точн. = Н		БПЗ-410 $F \text{ см}^2 = 2.070$ $Q \text{ кг.} = 0.561$ $D \text{ оп.мм} = 25.0$ $P \text{ н.мм} = 78.5$ $P \text{ вн.мм} = 59.7$ Гр. сл. = III Точн. = Н

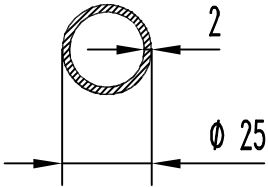
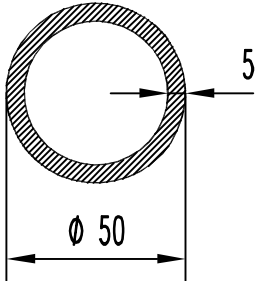
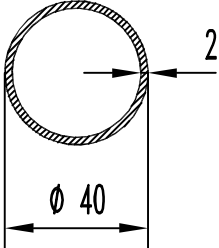
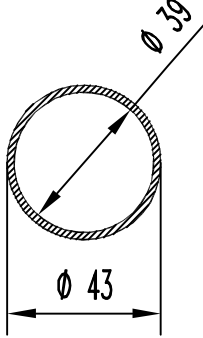
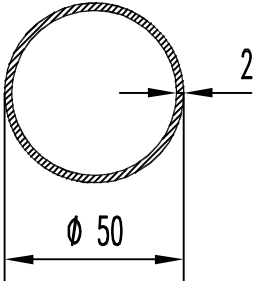
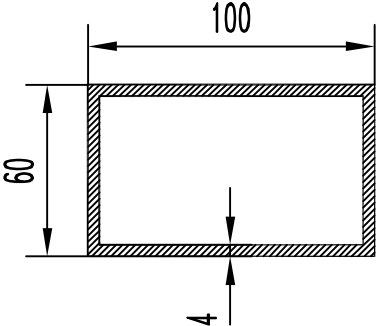
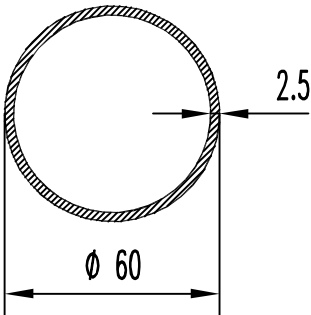
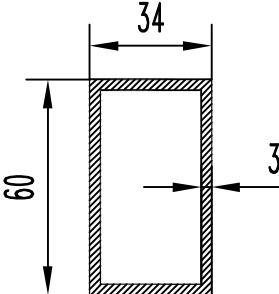
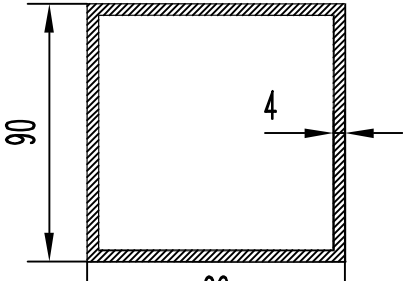
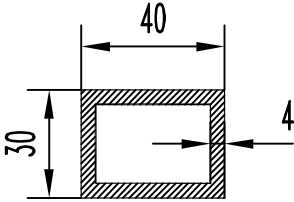
	БПЗ-411 $F \text{ см}^2 = 3.470$ $Q \text{ кг.} = 0.940$ $D \text{ оп.мм} = 40.0$ $P \text{ н.мм} = 125.7$ $P \text{ вн.мм} = 106.8$ Гр. сл. = III Точн. = Н		БПЗ-416 $F \text{ см}^2 = 4.250$ $Q \text{ кг.} = 1.152$ $D \text{ оп.мм} = 48.0$ $P \text{ н.мм} = 150.8$ $P \text{ вн.мм} = 131.9$ Гр. сл. = III Точн. = Н
	БПЗ-412 $F \text{ см}^2 = 5.470$ $Q \text{ кг.} = 1.482$ $D \text{ оп.мм} = 40.0$ $P \text{ н.мм} = 125.7$ $P \text{ вн.мм} = 94.2$ Гр. сл. = I Точн. = Н		БПЗ-417 $F \text{ см}^2 = 7.300$ $Q \text{ кг.} = 1.978$ $D \text{ оп.мм} = 80.0$ $P \text{ н.мм} = 251.3$ $P \text{ вн.мм} = 232.5$ Гр. сл. = V Точн. = Н
	БПЗ-413 $F \text{ см}^2 = 4.400$ $Q \text{ кг.} = 1.192$ $D \text{ оп.мм} = 50.0$ $P \text{ н.мм} = 157.0$ $P \text{ вн.мм} = 130.2$ Гр. сл. = III Точн. = Н		БПЗ-418 $F \text{ см}^2 = 11.800$ $Q \text{ кг.} = 3.198$ $D \text{ оп.мм} = 80.0$ $P \text{ н.мм} = 251.3$ $P \text{ вн.мм} = 219.9$ Гр. сл. = III Точн. = Н
	БПЗ-414 $F \text{ см}^2 = 5.370$ $Q \text{ кг.} = 1.455$ $D \text{ оп.мм} = 60.0$ $P \text{ н.мм} = 188.5$ $P \text{ вн.мм} = 169.6$ Гр. сл. = III Точн. = Н		БПЗ-419 $F \text{ см}^2 = 18.100$ $Q \text{ кг.} = 4.905$ $D \text{ оп.мм} = 80.0$ $P \text{ н.мм} = 251.3$ $P \text{ вн.мм} = 201.1$ Гр. сл. = II Точн. = Н
	БПЗ-415 $F \text{ см}^2 = 8.640$ $Q \text{ кг.} = 2.341$ $D \text{ оп.мм} = 60.0$ $P \text{ н.мм} = 188.5$ $P \text{ вн.мм} = 157.1$ Гр. сл. = II Точн. = Н		БПЗ-420 $F \text{ см}^2 = 6.876$ $Q \text{ кг.} = 1.863$ $D \text{ оп.мм} = 76.0$ $P \text{ н.мм} = 238.7$ $P \text{ вн.мм} = 219.9$ Гр. сл. = III Точн. = Н

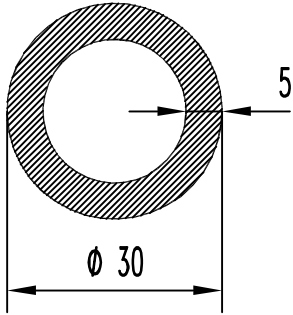
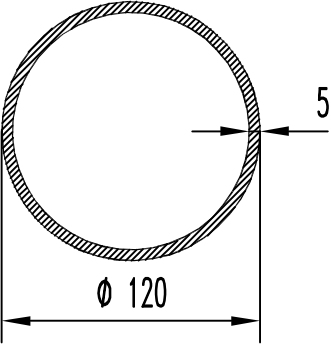
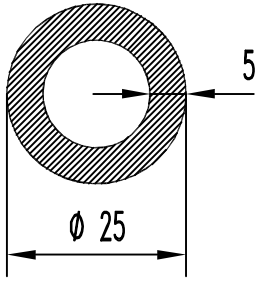
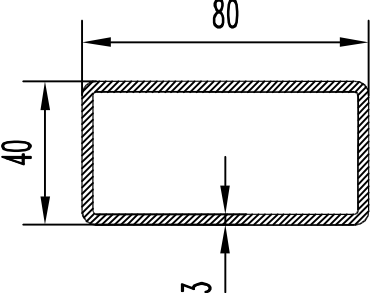
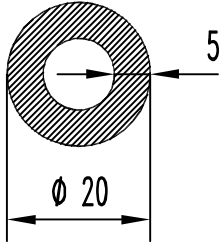
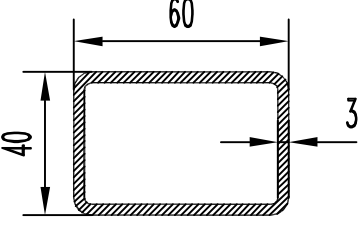
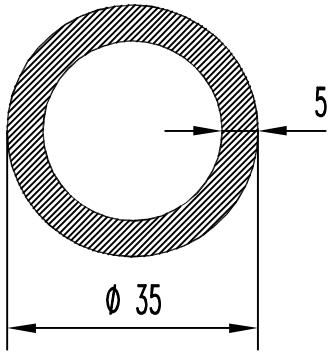
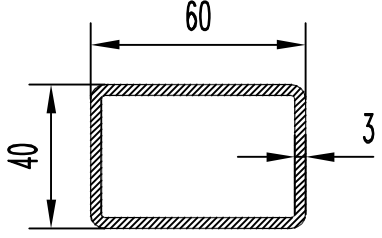
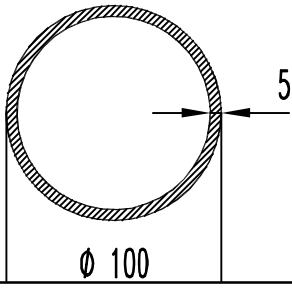
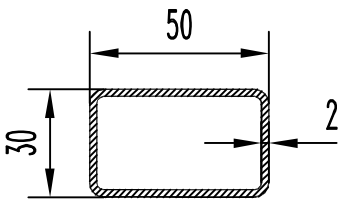
	БПЗ-421 $F \text{ см}^2 = 2.980$ $Q \text{ кг.} = 0.808$ $D \text{ оп.мм} = 24.0$ $P \text{ н.мм} = 75.36$ $P \text{ вн.мм} = 44.0$ Гр. сл. = I Точн. = П		БПЗ-426 $F \text{ см}^2 = 1.759$ $Q \text{ кг.} = 0.477$ $D \text{ оп.мм} = 30.0$ $P \text{ н.мм} = 94.3$ $P \text{ вн.мм} = 81.7$ Гр. сл. = V Точн. = Особ.
	БПЗ-422 $F \text{ см}^2 = 3.490$ $Q \text{ кг.} = 0.946$ $D \text{ оп.мм} = 40.0$ $P \text{ н.мм} = 125.6$ $P \text{ вн.мм} = 106.8$ Гр. сл. = I Точн. = П		БПЗ-427 $F \text{ см}^2 = 3.220$ $Q \text{ кг.} = 0.874$ $D \text{ оп.мм} = 51.2$ $P \text{ н.мм} = 172.3$ $P \text{ вн.мм} = 147.3$ Гр. сл. = 0соб. Точн. = 0соб.
	БПЗ-423 $F \text{ см}^2 = 10.128$ $Q \text{ кг.} = 2.745$ $D \text{ оп.мм} = 42.0$ $P \text{ н.мм} = 132.1$ $P \text{ вн.мм} = 68.8$ Гр. сл. = II Точн. = П		БПЗ-428 $F \text{ см}^2 = 1.860$ $Q \text{ кг.} = 0.504$ $D \text{ оп.мм} = 35.0$ $P \text{ н.мм} = 116.0$ $P \text{ вн.мм} = 70.0$ Гр. сл. = V Точн. = П
	БПЗ-424 $F \text{ см}^2 = 8.454$ $Q \text{ кг.} = 2.291$ $D \text{ оп.мм} = 58.0$ $P \text{ н.мм} = 182.4$ $P \text{ вн.мм} = 150.5$ Гр. сл. = II Точн. = П		БПЗ-429 $F \text{ см}^2 = 2.160$ $Q \text{ кг.} = 0.585$ $D \text{ оп.мм} = 40.0$ $P \text{ н.мм} = 146.0$ $P \text{ вн.мм} = 70.0$ Гр. сл. = V Точн. = П
	БПЗ-425 $F \text{ см}^2 = 10.310$ $Q \text{ кг.} = 2.794$ $D \text{ оп.мм} = 60.0$ $P \text{ н.мм} = 188.6$ $P \text{ вн.мм} = 150.5$ Гр. сл. = V Точн. = П		БПЗ-430 $F \text{ см}^2 = 2.776$ $Q \text{ кг.} = 0.752$ $D \text{ оп.мм} = 52.0$ $P \text{ н.мм} = 188.4$ $P \text{ вн.мм} = 89.27$ Гр. сл. = V Точн. = П

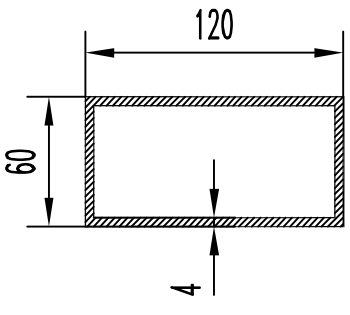
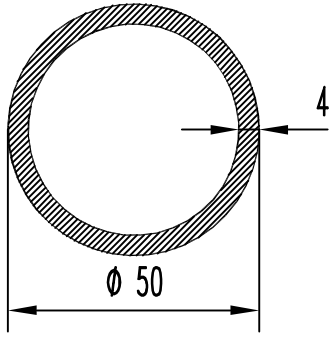
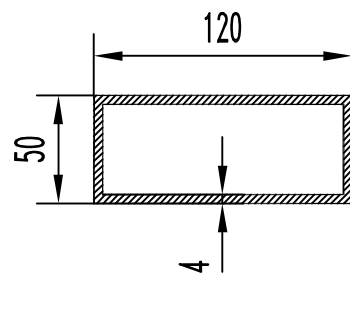
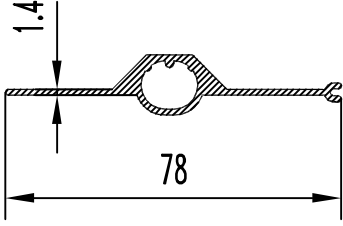
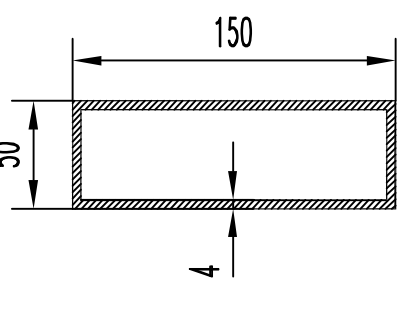
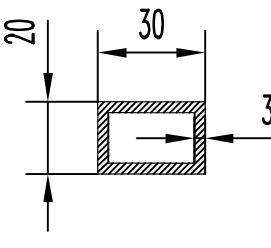
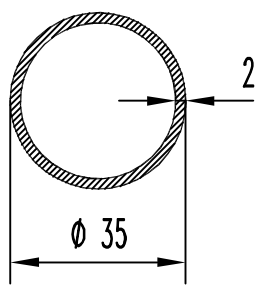
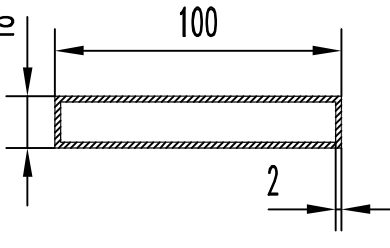
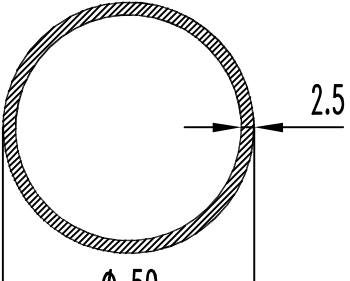
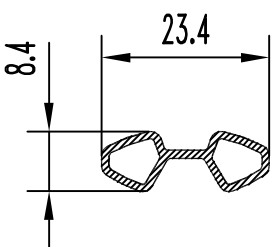
	БПЗ-431 $F \text{ см}^2 = 2.170$ $Q \text{ кг.} = 0.588$ $D \text{ оп.мм} = 40.0$ $P \text{ н.мм} = 114.8$ $P \text{ вн.мм} = 102.3$ Гр. сл. = V Точн. = Особ.		БПЗ-436 $F \text{ см}^2 = 0.628$ $Q \text{ кг.} = 0.170$ $D \text{ оп.мм} = 12.0$ $P \text{ н.мм} = 37.7$ $P \text{ вн.мм} = 25.1$ Гр. сл. = IV Точн. = Н
			БПЗ-437 $F \text{ см}^2 = 7.823$ $Q \text{ кг.} = 2.12$ $D \text{ оп.мм} = 86.0$ $P \text{ н.мм} = 270.2$ $P \text{ вн.мм} = 251.3$ Гр. сл. = III Точн. = Н
	БПЗ-433 $F \text{ см}^2 = 9.250$ $Q \text{ кг.} = 2.507$ $D \text{ оп.мм} = 130.0$ $P \text{ н.мм} = 371.0$ $P \text{ вн.мм} = 351.0$ Гр. сл. = Особ. Точн. = Н		БПЗ-438 $F \text{ см}^2 = 2.796$ $Q \text{ кг.} = 0.758$ $D \text{ оп.мм} = 23.2$ $P \text{ н.мм} = 72.9$ $P \text{ вн.мм} = 42.4$ Гр. сл. = III Точн. = Н
	БПЗ-434 $F \text{ см}^2 = 8.100$ $Q \text{ кг.} = 2.195$ $D \text{ оп.мм} = 33.0$ $P \text{ н.мм} = 103.9$ $P \text{ вн.мм} = 53.0$ Гр. сл. = II Точн. = Н		БПЗ-0439 $F \text{ см}^2 = 1.570$ $Q \text{ кг.} = 0.425$ $D \text{ оп.мм} = 20.0$ $P \text{ н.мм} = 153.3$ $P \text{ вн.мм} = 81.3$ Гр. сл. = VI Точн. = П
	БПЗ-435 $F \text{ см}^2 = 2.236$ $Q \text{ кг.} = 0.605$ $D \text{ оп.мм} = 24.0$ $P \text{ н.мм} = 75.6$ $P \text{ вн.мм} = 59.4$ Гр. сл. = II		БПЗ-0440 $F \text{ см}^2 = 18.820$ $Q \text{ кг.} = 5.100$ $D \text{ оп.мм} = 162.0$ $P \text{ н.мм} = 727.7$ $P \text{ вн.мм} = 868.6$ Гр. сл. = VI

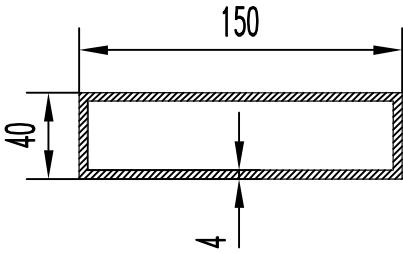
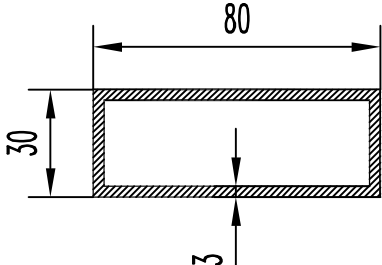
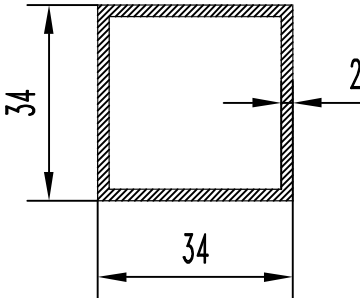
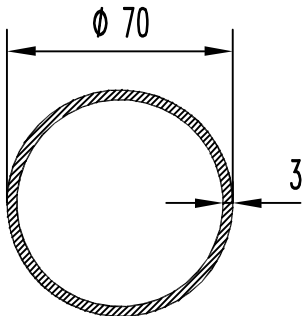
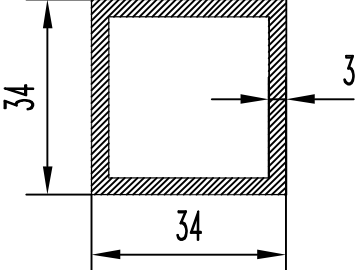
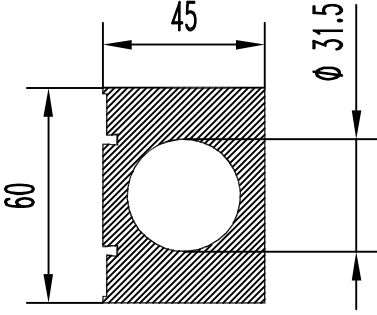
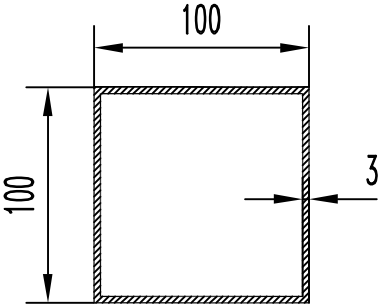
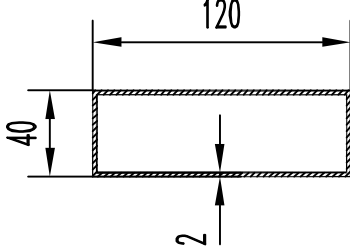
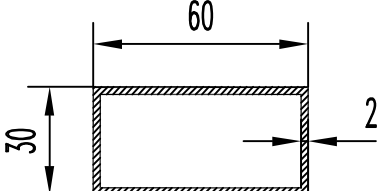
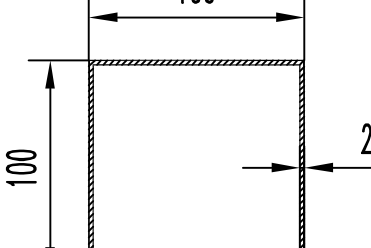
	БПЗ-441 $F \text{ см}^2 = 1.640$ $Q \text{ кг.} = 0.444$ $D \text{ оп.мм} = 35.0$ $P \text{ н.мм} = 90.0$ $P \text{ вн.мм} = 74.0$ Гр. сл. = V Точн. = Особ.		БПЗ-446 $F \text{ см}^2 = 2.811$ $Q \text{ кг.} = 0.762$ $D \text{ оп.мм} = 62.0$ $P \text{ н.мм} = 174.1$ $P \text{ вн.мм} = 129.4$ Гр. сл. = IV Точн. = П
	БПЗ-442 $F \text{ см}^2 = 2.040$ $Q \text{ кг.} = 0.553$ $D \text{ оп.мм} = 42.7$ $P \text{ н.мм} = 110.0$ $P \text{ вн.мм} = 94.0$ Гр. сл. = V Точн. = Особ.		БПЗ-447 $F \text{ см}^2 = 1.554$ $Q \text{ кг.} = 0.421$ $D \text{ оп.мм} = 16.0$ $P \text{ н.мм} = 50.3$ $P \text{ вн.мм} = 33.8$ Гр. сл. = IV Точн. = Н
	БПЗ-443 $F \text{ см}^2 = 11.360$ $Q \text{ кг.} = 3.079$ $D \text{ оп.мм} = 114.0$ $P \text{ н.мм} = 300.0$ $P \text{ вн.мм} = 268.0$ Гр. сл. = V Точн. = Особ.		БПЗ-0448 $F \text{ см}^2 = 1.327$ $Q \text{ кг.} = 0.360$ $D \text{ оп.мм} = 28.0$ $P \text{ н.мм} = 96.9$ $P \text{ вн.мм} = 78.5$ Гр. сл. = V Точн. = П
	БПЗ-444 $F \text{ см}^2 = 10.560$ $Q \text{ кг.} = 2.862$ $D \text{ оп.мм} = 109.0$ $P \text{ н.мм} = 280.0$ $P \text{ вн.мм} = 218.0$ Гр. сл. = V Точн. = Особ.		БПЗ-449 $F \text{ см}^2 = 1.240$ $Q \text{ кг.} = 0.336$ $D \text{ оп.мм} = 25.0$ $P \text{ н.мм} = 70.0$ $P \text{ вн.мм} = 54.0$ Гр. сл. = IV Точн. = Особ.
	БПЗ-445 $F \text{ см}^2 = 12.160$ $Q \text{ кг.} = 3.295$ $D \text{ оп.мм} = 126.5$ $P \text{ н.мм} = 320.0$ $P \text{ вн.мм} = 288.0$ Гр. сл. = V Точн. = Особ.		БПЗ-450 $F \text{ см}^2 = 1.640$ $Q \text{ кг.} = 0.444$ $D \text{ оп.мм} = 32.0$ $P \text{ н.мм} = 90.0$ $P \text{ вн.мм} = 74.0$ Гр. сл. = V Точн. = Особ.

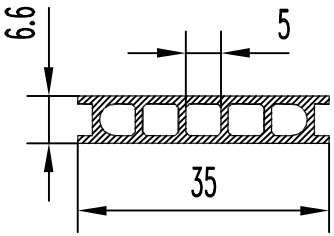
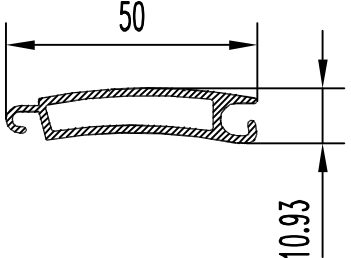
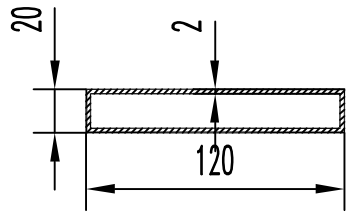
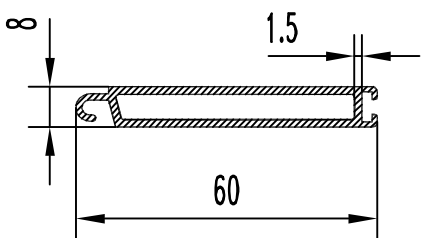
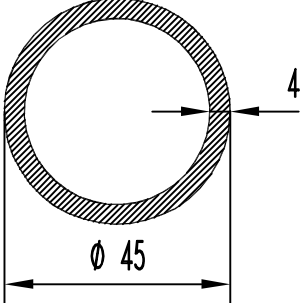
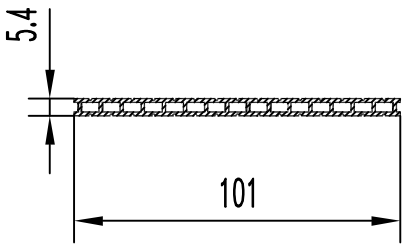
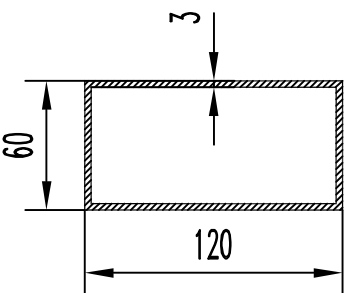
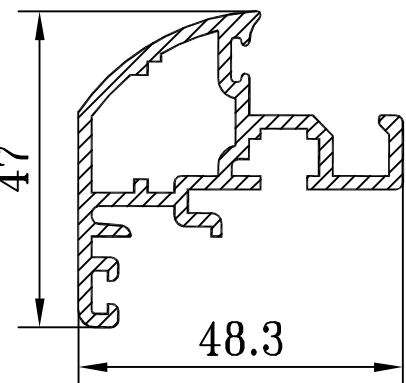
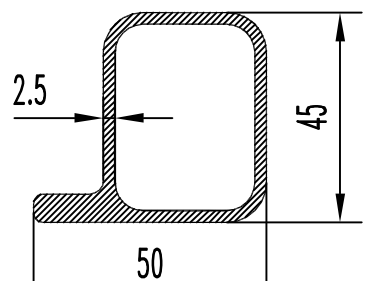
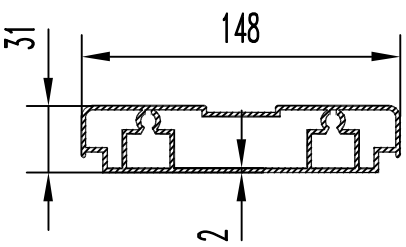
	БПЗ-451 $F \text{ см}^2 = 1.040$ $Q \text{ кг.} = 0.282$ $D \text{ оп.мм} = 22.4$ $P \text{ н.мм} = 60.0$ $P \text{ вн.мм} = 44.0$ Гр. сл. = IV Точн. = 0соб.		БПЗ-456 $F \text{ см}^2 = 1.040$ $Q \text{ кг.} = 0.282$ $D \text{ оп.мм} = 21.2$ $P \text{ н.мм} = 60.0$ $P \text{ вн.мм} = 44.0$ Гр. сл. = IV Точн. = 0соб.
	БПЗ-452 $F \text{ см}^2 = 2.440$ $Q \text{ кг.} = 0.661$ $D \text{ оп.мм} = 47.2$ $P \text{ н.мм} = 130.0$ $P \text{ вн.мм} = 114.0$ Гр. сл. = V Точн. = 0соб.		БПЗ-457 $F \text{ см}^2 = 2.640$ $Q \text{ кг.} = 0.715$ $D \text{ оп.мм} = 49.5$ $P \text{ н.мм} = 140.0$ $P \text{ вн.мм} = 124.0$ Гр. сл. = V Точн. = 0соб.
	БПЗ-453 $F \text{ см}^2 = 3.640$ $Q \text{ кг.} = 0.986$ $D \text{ оп.мм} = 67.3$ $P \text{ н.мм} = 190.0$ $P \text{ вн.мм} = 174.0$ Гр. сл. = IV Точн. = 0соб.		БПЗ-458 $F \text{ см}^2 = 10.560$ $Q \text{ кг.} = 2.862$ $D \text{ оп.мм} = 99.0$ $P \text{ н.мм} = 280.0$ $P \text{ вн.мм} = 248.0$ Гр. сл. = IV Точн. = 0соб.
	БПЗ-454 $F \text{ см}^2 = 8.040$ $Q \text{ кг.} = 2.179$ $D \text{ оп.мм} = 107.7$ $P \text{ н.мм} = 280.0$ $P \text{ вн.мм} = 256.0$ Гр. сл. = VI Точн. = 0соб.		БПЗ-459 $F \text{ см}^2 = 9.240$ $Q \text{ кг.} = 2.504$ $D \text{ оп.мм} = 113.1$ $P \text{ н.мм} = 320.0$ $P \text{ вн.мм} = 296.0$ Гр. сл. = VI Точн. = 0соб.
	БПЗ-455 $F \text{ см}^2 = 4.250$ $Q \text{ кг.} = 1.152$ $D \text{ оп.мм} = 64.0$ $P \text{ н.мм} = 180.0$ $P \text{ вн.мм} = 160.0$ Гр. сл. = V Точн. = 0соб.		БПЗ-460 $F \text{ см}^2 = 1.130$ $Q \text{ кг.} = 0.306$ $D \text{ оп.мм} = 20.0$ $P \text{ н.мм} = 62.8$ $P \text{ вн.мм} = 50.3$ Гр. сл. = III Точн. = 0соб.

	БПЗ-461 $F \text{ см}^2 = 1.450$ $Q \text{ кг.} = 0.393$ $D \text{ оп.мм} = 25.0$ $P \text{ н.мм} = 78.5$ $P \text{ вн.мм} = 66.0$ Гр. сл. = III Точн. = 0соб.		БПЗ-466 $F \text{ см}^2 = 7.069$ $Q \text{ кг.} = 1.916$ $D \text{ оп.мм} = 50.0$ $P \text{ н.мм} = 157.0$ $P \text{ вн.мм} = 125.7$ Гр. сл. = II Точн. = 0соб.
	БПЗ-462 $F \text{ см}^2 = 2.390$ $Q \text{ кг.} = 0.648$ $D \text{ оп.мм} = 40.0$ $P \text{ н.мм} = 125.7$ $P \text{ вн.мм} = 113.1$ Гр. сл. = V Точн. = 0соб.		БПЗ-467 $F \text{ см}^2 = 2.570$ $Q \text{ кг.} = 0.696$ $D \text{ оп.мм} = 43.0$ $P \text{ н.мм} = 135.0$ $P \text{ вн.мм} = 122.5$ Гр. сл. = IV Точн. = H
	БПЗ-463 $F \text{ см}^2 = 3.020$ $Q \text{ кг.} = 0.819$ $D \text{ оп.мм} = 50.0$ $P \text{ н.мм} = 157.0$ $P \text{ вн.мм} = 144.5$ Гр. сл. = V Точн. = 0соб.		БПЗ-468 $F \text{ см}^2 = 12.160$ $Q \text{ кг.} = 3.295$ $D \text{ оп.мм} = 116.6$ $P \text{ н.мм} = 320.0$ $P \text{ вн.мм} = 288.0$ Гр. сл. = V Точн. = 0соб.
	БПЗ-464 $F \text{ см}^2 = 4.520$ $Q \text{ кг.} = 1.225$ $D \text{ оп.мм} = 60.0$ $P \text{ н.мм} = 188.5$ $P \text{ вн.мм} = 172.8$ Гр. сл. = V Точн. = 0соб.		БПЗ-469 $F \text{ см}^2 = 5.280$ $Q \text{ кг.} = 1.431$ $D \text{ оп.мм} = 69.0$ $P \text{ н.мм} = 188.0$ $P \text{ вн.мм} = 164.0$ Гр. сл. = IV Точн. = 0соб.
	БПЗ-465 $F \text{ см}^2 = 13.760$ $Q \text{ кг.} = 3.729$ $D \text{ оп.мм} = 127.2$ $P \text{ н.мм} = 360.0$ $P \text{ вн.мм} = 328.0$ Гр. сл. = V Точн. = 0соб.		БПЗ-470 $F \text{ см}^2 = 4.960$ $Q \text{ кг.} = 1.344$ $D \text{ оп.мм} = 50.0$ $P \text{ н.мм} = 140.0$ $P \text{ вн.мм} = 108.0$ Гр. сл. = III Точн. = 0соб.

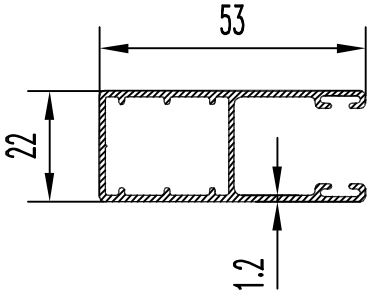
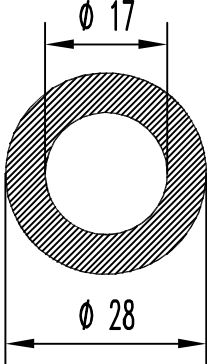
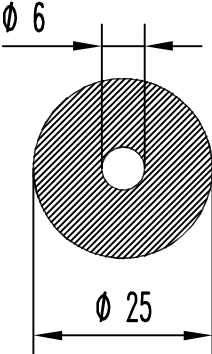
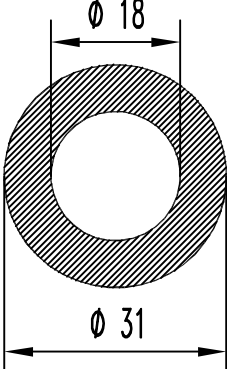
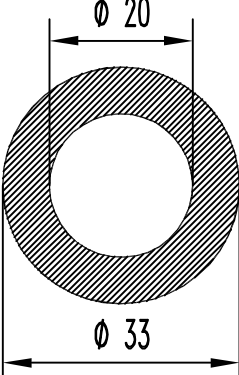
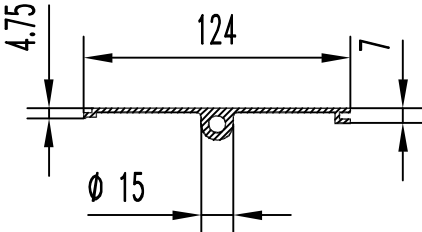
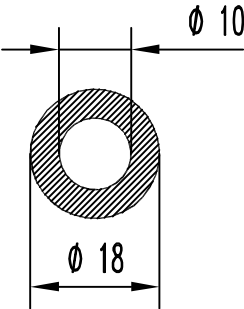
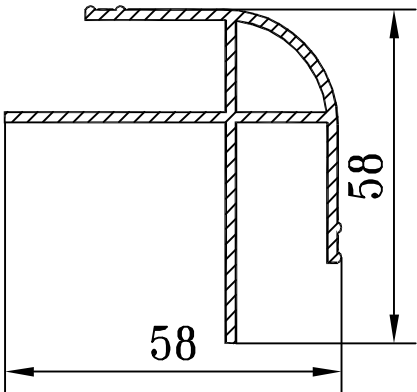
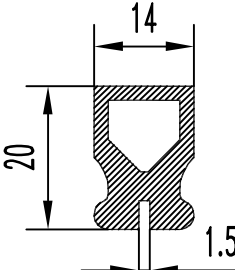
	БПЗ-471 $F \text{ см}^2 = 3.920$ $Q \text{ кг.} = 1.062$ $D \text{ оп.мм} = 30.0$ $P \text{ н.мм} = 94.2$ $P \text{ вн.мм} = 62.8$ $\Gamma \text{ р. сл.} = \text{I}$ $\text{Точн.} = 0 \text{ особ.}$		БПЗ-476 $F \text{ см}^2 = 18.060$ $Q \text{ кг.} = 4.894$ $D \text{ оп.мм} = 120.0$ $P \text{ н.мм} = 377.0$ $P \text{ вн.мм} = 345.6$ $\Gamma \text{ р. сл.} = \text{V}$ $\text{Точн.} = 0 \text{ особ.}$
	БПЗ-472 $F \text{ см}^2 = 3.140$ $Q \text{ кг.} = 0.851$ $D \text{ оп.мм} = 25.0$ $P \text{ н.мм} = 78.5$ $P \text{ вн.мм} = 47.1$ $\Gamma \text{ р. сл.} = \text{I}$ $\text{Точн.} = 0 \text{ особ.}$		БПЗ-477 $F \text{ см}^2 = 6.710$ $Q \text{ кг.} = 1.818$ $D \text{ оп.мм} = 86.8$ $P \text{ н.мм} = 233.1$ $P \text{ вн.мм} = 214.3$ $\Gamma \text{ р. сл.} = \text{V}$ $\text{Точн.} = 0 \text{ особ.}$
	БПЗ-473 $F \text{ см}^2 = 2.360$ $Q \text{ кг.} = 0.640$ $D \text{ оп.мм} = 20.0$ $P \text{ н.мм} = 62.8$ $P \text{ вн.мм} = 31.4$ $\Gamma \text{ р. сл.} = \text{II}$ $\text{Точн.} = 0 \text{ особ.}$		БПЗ-478 $F \text{ см}^2 = 5.360$ $Q \text{ кг.} = 1.453$ $D \text{ оп.мм} = 68.3$ $P \text{ н.мм} = 191.4$ $P \text{ вн.мм} = 172.6$ $\Gamma \text{ р. сл.} = \text{IV}$ $\text{Точн.} = 0 \text{ особ.}$
	БПЗ-474 $F \text{ см}^2 = 4.720$ $Q \text{ кг.} = 1.279$ $D \text{ оп.мм} = 35.0$ $P \text{ н.мм} = 110.0$ $P \text{ вн.мм} = 78.5$ $\Gamma \text{ р. сл.} = \text{I}$ $\text{Точн.} = 0 \text{ особ.}$		БПЗ-479 $F \text{ см}^2 = 5.510$ $Q \text{ кг.} = 1.493$ $D \text{ оп.мм} = 69.0$ $P \text{ н.мм} = 193.1$ $P \text{ вн.мм} = 174.3$ $\Gamma \text{ р. сл.} = \text{IV}$ $\text{Точн.} = 0 \text{ особ.}$
	БПЗ-475 $F \text{ см}^2 = 14.920$ $Q \text{ кг.} = 4.043$ $D \text{ оп.мм} = 100.0$ $P \text{ н.мм} = 314.2$ $P \text{ вн.мм} = 282.7$ $\Gamma \text{ р. сл.} = \text{IV}$ $\text{Точн.} = 0 \text{ особ.}$		БПЗ-480 $F \text{ см}^2 = 2.940$ $Q \text{ кг.} = 0.797$ $D \text{ оп.мм} = 55.4$ $P \text{ н.мм} = 153.1$ $P \text{ вн.мм} = 140.6$ $\Gamma \text{ р. сл.} = \text{VI}$ $\text{Точн.} = 0 \text{ особ.}$

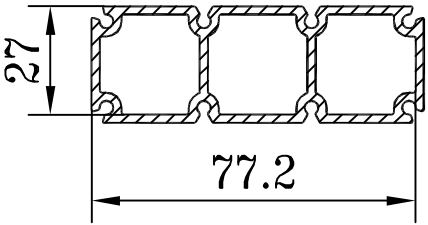
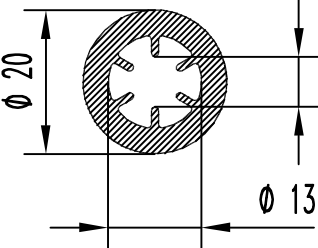
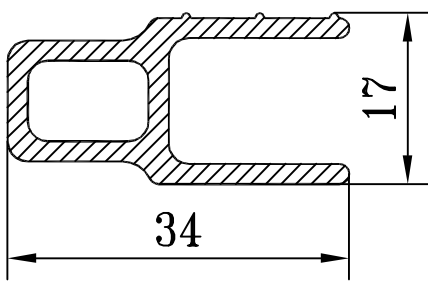
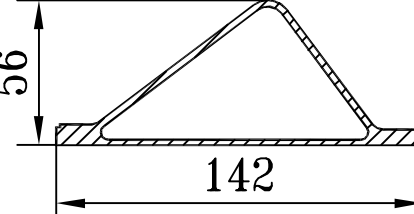
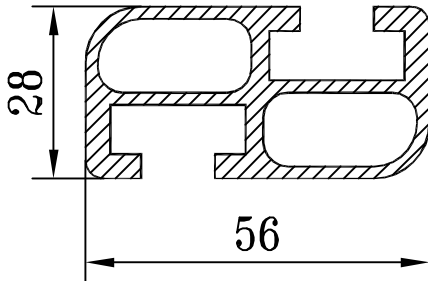
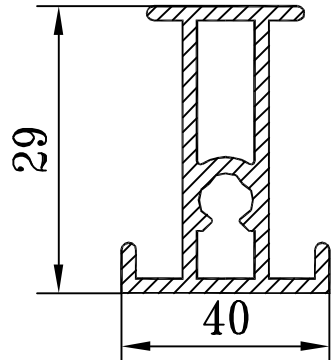
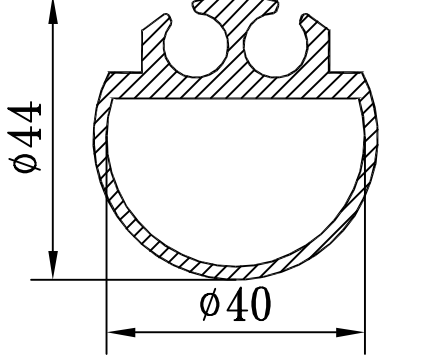
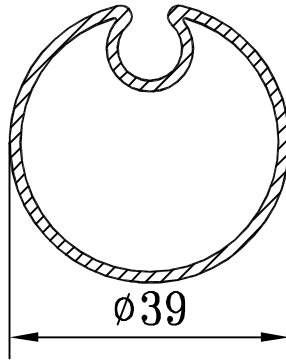
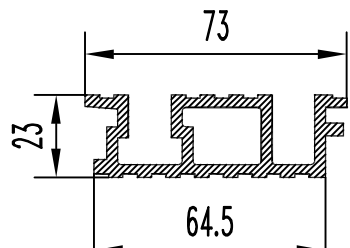
	БПЗ-481 $F \text{ см}^2 = 13.760$ $Q \text{ кг.} = 3.729$ $D \text{ оп.мм} = 134.2$ $P \text{ н.мм} = 360.0$ $P \text{ вн.мм} = 328.0$ Гр. сл. = V Точн. = 0соб.		БПЗ-486 $F \text{ см}^2 = 5.780$ $Q \text{ кг.} = 1.566$ $D \text{ оп.мм} = 50.0$ $P \text{ н.мм} = 157.0$ $P \text{ вн.мм} = 132.0$ Гр. сл. = III Точн. = 0соб.
	БПЗ-482 $F \text{ см}^2 = 12.960$ $Q \text{ кг.} = 3.512$ $D \text{ оп.мм} = 130.0$ $P \text{ н.мм} = 340.0$ $P \text{ вн.мм} = 308.0$ Гр. сл. = V Точн. = 0соб.		БПЗ-487 $F \text{ см}^2 = 2.0$ $Q \text{ кг.} = 0.572$ $D \text{ оп.мм} = 79.0$ $P \text{ н.мм} = 176.4$ $P \text{ вн.мм} = 42.3$ Гр. сл. = IV Точн. = П
	БПЗ-483 $F \text{ см}^2 = 15.360$ $Q \text{ кг.} = 4.163$ $D \text{ оп.мм} = 158.1$ $P \text{ н.мм} = 400.0$ $P \text{ вн.мм} = 368.0$ Гр. сл. = IV Точн. = 0соб.		БПЗ-488 $F \text{ см}^2 = 2.640$ $Q \text{ кг.} = 0.715$ $D \text{ оп.мм} = 36.1$ $P \text{ н.мм} = 100.0$ $P \text{ вн.мм} = 76.0$ Гр. сл. = III Точн. = 0соб.
	БПЗ-484 $F \text{ см}^2 = 2.080$ $Q \text{ кг.} = 0.564$ $D \text{ оп.мм} = 35.0$ $P \text{ н.мм} = 110.0$ $P \text{ вн.мм} = 97.4$ Гр. сл. = IV Точн. = 0соб.		БПЗ-489 $F \text{ см}^2 = 4.560$ $Q \text{ кг.} = 1.236$ $D \text{ оп.мм} = 101.6$ $P \text{ н.мм} = 236.0$ $P \text{ вн.мм} = 220.0$ Гр. сл. = 0соб. Точн. = 0соб.
	БПЗ-485 $F \text{ см}^2 = 3.731$ $Q \text{ кг.} = 1.011$ $D \text{ оп.мм} = 50.0$ $P \text{ н.мм} = 157.1$ $P \text{ вн.мм} = 141.3$ Гр. сл. = IV		БПЗ-490 $F \text{ см}^2 = 0.548$ $Q \text{ кг.} = 0.149$ $D \text{ оп.мм} = 23.5$ $P \text{ н.мм} = 62.6$ $P \text{ вн.мм} = 42.0$ Гр. сл. = VI

	БПЗ-491 $F \text{ см}^2 = 14.560$ $Q \text{ кг.} = 3.946$ $D \text{ оп.мм} = 155.2$ $P \text{ н.мм} = 380.0$ $P_{\text{вн.мм}} = 348.0$ Гр. сл. = V Точн. = DIN		БПЗ-496 $F \text{ см}^2 = 6.240$ $Q \text{ кг.} = 1.691$ $D \text{ оп.мм} = 95.4$ $P \text{ н.мм} = 220.0$ $P_{\text{вн.мм}} = 196.0$ Гр. сл. = V Точн. = DIN
	БПЗ-492 $F \text{ см}^2 = 2.560$ $Q \text{ кг.} = 0.694$ $D \text{ оп.мм} = 48.0$ $P \text{ н.мм} = 136.0$ $P_{\text{вн.мм}} = 120.0$ Гр. сл. = V Точн. = DIN		БПЗ-497 $F \text{ см}^2 = 6.310$ $Q \text{ кг.} = 1.710$ $D \text{ оп.мм} = 70.0$ $P \text{ н.мм} = 219.9$ $P_{\text{вн.мм}} = 201.1$ Гр. сл. = V Точн. = DIN
	БПЗ-493 $F \text{ см}^2 = 3.720$ $Q \text{ кг.} = 1.008$ $D \text{ оп.мм} = 48.1$ $P \text{ н.мм} = 136.0$ $P_{\text{вн.мм}} = 112.0$ Гр. сл. = III Точн. = DIN		БПЗ-498 $F \text{ см}^2 = 18.76$ $Q \text{ кг.} = 5.084$ $D \text{ оп.мм} = 75.0$ $P \text{ н.мм} = 227$ $P_{\text{вн.мм}} = 98.9$ Гр. сл. = V Точн. = П
	БПЗ-494 $F \text{ см}^2 = 11.640$ $Q \text{ кг.} = 3.154$ $D \text{ оп.мм} = 141.4$ $P \text{ н.мм} = 400.0$ $P_{\text{вн.мм}} = 376.0$ Гр. сл. = 0соб. Точн. = DIN		БПЗ-499 $F \text{ см}^2 = 6.240$ $Q \text{ кг.} = 1.691$ $D \text{ оп.мм} = 126.5$ $P \text{ н.мм} = 320.0$ $P_{\text{вн.мм}} = 304.0$ Гр. сл. = 0соб. Точн. = DIN
	БПЗ-495 $F \text{ см}^2 = 3.440$ $Q \text{ кг.} = 0.932$ $D \text{ оп.мм} = 67.0$ $P \text{ н.мм} = 180.0$ $P_{\text{вн.мм}} = 164.0$		БПЗ-500 $F \text{ см}^2 = 7.840$ $Q \text{ кг.} = 2.125$ $D \text{ оп.мм} = 141.4$ $P \text{ н.мм} = 400.0$ $P_{\text{вн.мм}} = 384.0$

Профиль заказчика 	БПЗ-501-3 $F \text{ см}^2 = 1.096$ $Q \text{ кг.} = 0.297$ $D \text{ оп.мм} = 35.5$ $P \text{ н.мм} = 91.2$ $P \text{ вн.мм} = 85.5$ Гр. сл. = 0соб. Точн. = 0соб.		БПЗ-506 $F \text{ см}^2 = 1.677$ $Q \text{ кг.} = 0.454$ $D \text{ оп.мм} = 51.2$ $P \text{ н.мм} = 142.4$ $P \text{ вн.мм} = 76.3$ Гр. сл. = VI Точн. = П
	БПЗ-502 $F \text{ см}^2 = 5.440$ $Q \text{ кг.} = 1.474$ $D \text{ оп.мм} = 121.6$ $P \text{ н.мм} = 280.0$ $P \text{ вн.мм} = 264.0$ Гр. сл. = 0соб. Точн. = DIN		БПЗ-507 $F \text{ см}^2 = 1.874$ $Q \text{ кг.} = 0.508$ $D \text{ оп.мм} = 60.5$ $P \text{ н.мм} = 155.3$ $P \text{ вн.мм} = 103.2$ Гр. сл. = II Точн. = П
	БПЗ-503 $F \text{ см}^2 = 5.150$ $Q \text{ кг.} = 1.396$ $D \text{ оп.мм} = 45.0$ $P \text{ н.мм} = 141.4$ $P \text{ вн.мм} = 116.2$ Гр. сл. = II Точн. = DIN	Профиль заказчика 	БПЗ-508 $F \text{ см}^2 = 2.972$ $Q \text{ кг.} = 0.805$ $D \text{ оп.мм} = 101.1$ $P \text{ н.мм} = 247.4$ $P \text{ вн.мм} = 224.4$ Гр. сл. = 0соб. Точн. = П
	БПЗ-504 $F \text{ см}^2 = 10.440$ $Q \text{ кг.} = 2.829$ $D \text{ оп.мм} = 134.0$ $P \text{ н.мм} = 360.0$ $P \text{ вн.мм} = 336.0$ Гр. сл. = 0соб. Точн. = DIN		БПЗ-0509 $F \text{ см}^2 = 3.806$ $Q \text{ кг.} = 1.031$ $D \text{ оп.мм} = 58.0$ $P \text{ н.мм} = 283.8$ $P \text{ вн.мм} = 85.7$ Гр. сл. = VI Точн. = П
	БПЗ-505 $F \text{ см}^2 = 4.86$ $Q \text{ кг.} = 1.317$ $D \text{ оп.мм} = 63.0$ $P \text{ н.мм} = 176.0$ $P \text{ вн.мм} = 129.7$		БПЗ-510 $F \text{ см}^2 = 9.400$ $Q \text{ кг.} = 2.547$ $D \text{ оп.мм} = 149.0$ $P \text{ н.мм} = 367.0$ $P \text{ вн.мм} = 614.0$

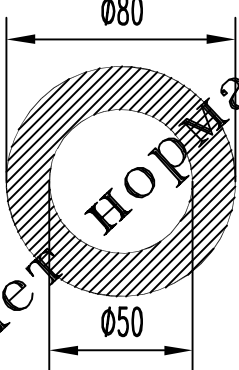
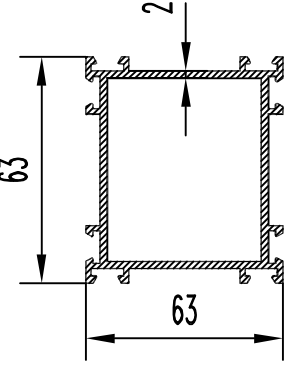
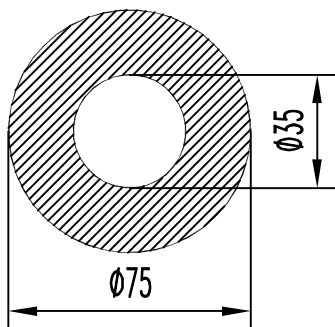
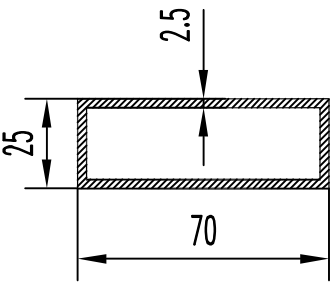
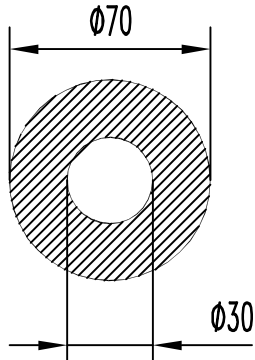
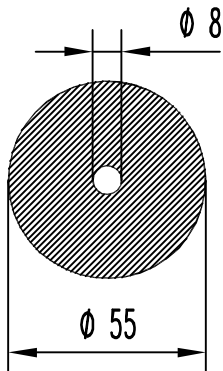
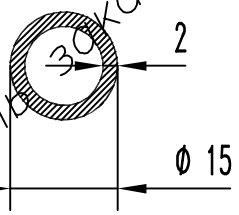
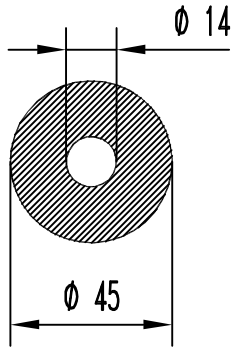
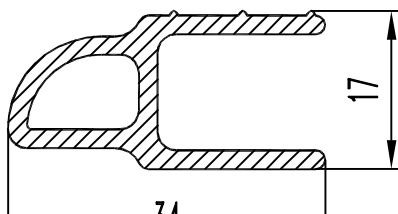
	БПЗ-0511 $F \text{ см}^2 = 3.680$ $Q \text{ кг.} = 0.997$ $D \text{ оп.мм} = 75.1$ $P \text{ н.мм} = 204.4$ $P_{\text{вн.мм}} = 116.7$ $\text{Гр. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		БПЗ-516 $F \text{ см}^2 = 4.28$ $Q \text{ кг.} = 1.16$ $D \text{ оп.мм} = 64$ $P \text{ н.мм} = 340.6$ $P_{\text{вн.мм}} = 0.6$ $\text{Гр. сл.} = \text{Особ.}$ $\text{Точн.} = \text{Н}$
	БПЗ-512 $F \text{ см}^2 = 2.240$ $Q \text{ кг.} = 0.607$ $D \text{ оп.мм} = 43.0$ $P \text{ н.мм} = 120.0$ $P_{\text{вн.мм}} = 104.0$ $\text{Гр. сл.} = \text{V}$ $\text{Точн.} = \text{DIN}$		БПЗ-517 $F \text{ см}^2 = 5.231$ $Q \text{ кг.} = 1.418$ $D \text{ оп.мм} = 75.3$ $P \text{ н.мм} = 277.0$ $P_{\text{вн.мм}} = 209.0$ $\text{Гр. сл.} = \text{Особ.}$ $\text{Точн.} = \text{Н}$
	БПЗ-513 $F \text{ см}^2 = 4.640$ $Q \text{ кг.} = 1.257$ $D \text{ оп.мм} = 102.0$ $P \text{ н.мм} = 240.0$ $P_{\text{вн.мм}} = 224.0$ $\text{Гр. сл.} = \text{Особ.}$ $\text{Точн.} = \text{DIN}$		БПЗ-518 $F \text{ см}^2 = 5.340$ $Q \text{ кг.} = 1.447$ $D \text{ оп.мм} = 96.0$ $P \text{ н.мм} = 273.0$ $P_{\text{вн.мм}} = 260.0$ $\text{Гр. сл.} = \text{Особ.}$ $\text{Точн.} = \text{DIN}$
	БПЗ-514 $F \text{ см}^2 = 5.940$ $Q \text{ кг.} = 1.610$ $D \text{ оп.мм} = 74.3$ $P \text{ н.мм} = 210.0$ $P_{\text{вн.мм}} = 186.0$ $\text{Гр. сл.} = \text{IV}$ $\text{Точн.} = \text{DIN}$		БПЗ-519-01 $F \text{ см}^2 = 5.315$ $Q \text{ кг.} = 1.440$ $D \text{ оп.мм} = 65.0$ $P \text{ н.мм} = 258.1$ $P_{\text{вн.мм}} = 103.4$ $\text{Гр. сл.} = \text{V}$ $\text{Точн.} = \text{Н}$
	БПЗ-515 $F \text{ см}^2 = 3.38$ $Q \text{ кг.} = 0.916$ $D \text{ оп.мм} = 42$ $P \text{ н.мм} = 280$ $P_{\text{вн.мм}} = 10$		БПЗ-520 $F \text{ см}^2 = 1.554$ $Q \text{ кг.} = 0.421$ $D \text{ оп.мм} = 48.0$ $P \text{ н.мм} = 139.0$ $P_{\text{вн.мм}} = 67.0$

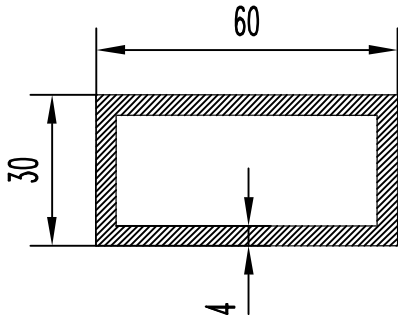
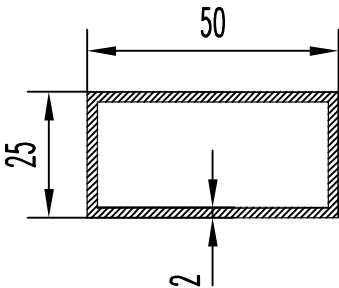
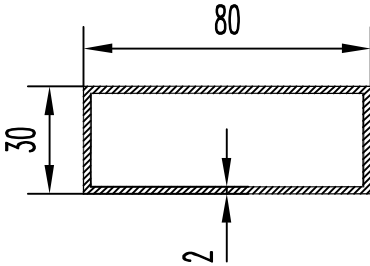
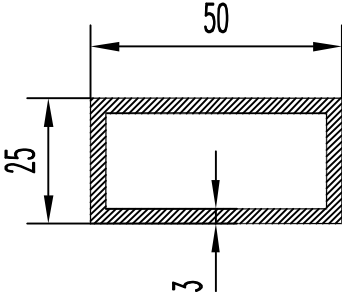
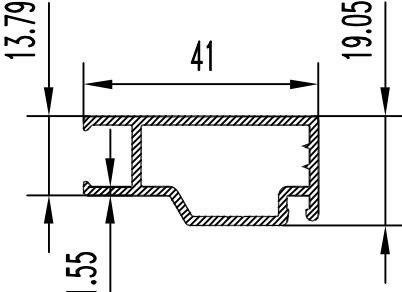
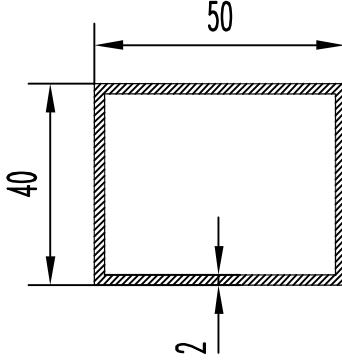
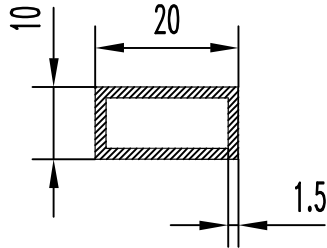
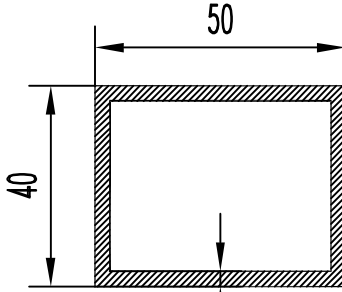
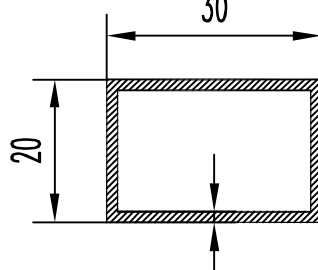
	БПЗ-521 $F \text{ см}^2 = 20.300$ $Q \text{ кг.} = 5.501$ $D \text{ оп.мм} = 57.4$ $P \text{ н.мм} = 229.9$ $P_{\text{вн.мм}} = 100.7$ Гр. сл. = 0соб. Точн. = DIN		БПЗ-526 $F \text{ см}^2 = 3.890$ $Q \text{ кг.} = 1.054$ $D \text{ оп.мм} = 28.0$ $P \text{ н.мм} = 88.0$ $P_{\text{вн.мм}} = 53.4$ Гр. сл. = II Точн. = H
	БПЗ-522 $F \text{ см}^2 = 4.620$ $Q \text{ кг.} = 1.252$ $D \text{ оп.мм} = 25.0$ $P \text{ н.мм} = 78.5$ $P_{\text{вн.мм}} = 18.8$ Гр. сл. = I Точн. = H		БПЗ-527 $F \text{ см}^2 = 5.000$ $Q \text{ кг.} = 1.355$ $D \text{ оп.мм} = 31.0$ $P \text{ н.мм} = 97.4$ $P_{\text{вн.мм}} = 56.6$ Гр. сл. = I Точн. = H
	БПЗ-523 $F \text{ см}^2 = 5.410$ $Q \text{ кг.} = 1.466$ $D \text{ оп.мм} = 33.0$ $P \text{ н.мм} = 103.6$ $P_{\text{вн.мм}} = 62.8$ Гр. сл. = I Точн. = H		БПЗ-528 $F \text{ см}^2 = 3.950$ $Q \text{ кг.} = 1.070$ $D \text{ оп.мм} = 124.0$ $P \text{ н.мм} = 295.0$ $P_{\text{вн.мм}} = 25.0$ Гр. сл. = 0соб. Точн. = H
	БПЗ-524 $F \text{ см}^2 = 1.760$ $Q \text{ кг.} = 0.477$ $D \text{ оп.мм} = 18.0$ $P \text{ н.мм} = 56.6$ $P_{\text{вн.мм}} = 31.4$ Гр. сл. = IV Точн. = H		БПЗ-0529 $F \text{ см}^2 = 3.670$ $Q \text{ кг.} = 0.995$ $D \text{ оп.мм} = 62.9$ $P \text{ н.мм} = 323.0$ $P_{\text{вн.мм}} = 55.9$ Гр. сл. = V Точн. = П
	БПЗ-525 $F \text{ см}^2 = 1.711$ $Q \text{ кг.} = 0.464$ $D \text{ оп.мм} = 23.1$ $P \text{ н.мм} = 77.3$ $P_{\text{вн.мм}} = 34.7$		

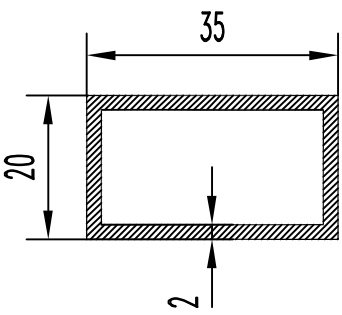
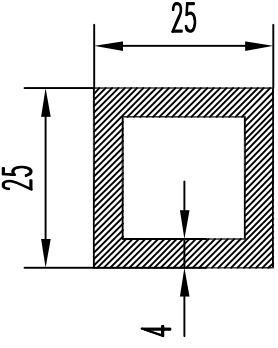
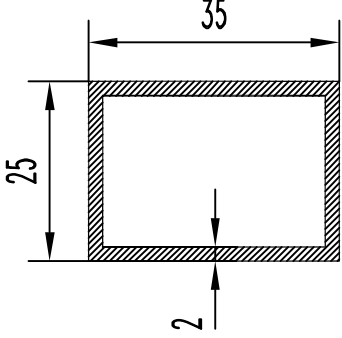
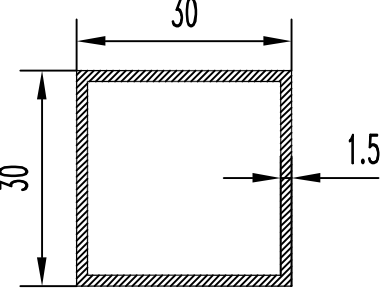
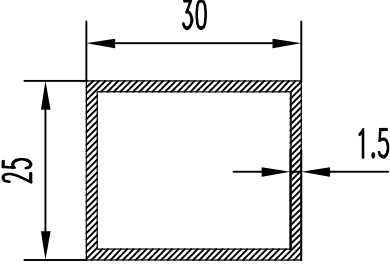
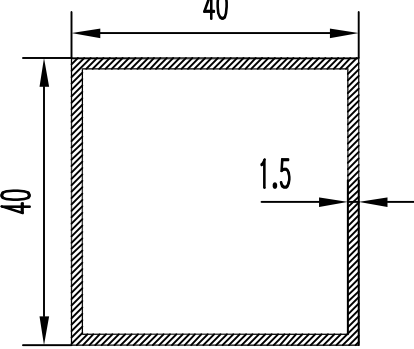
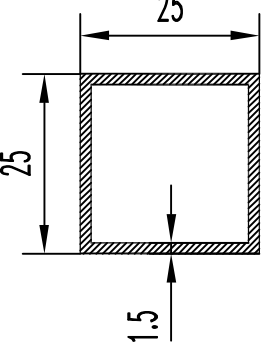
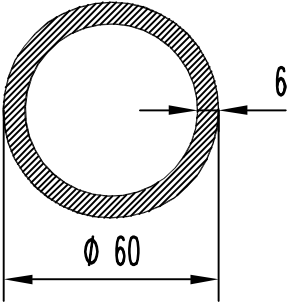
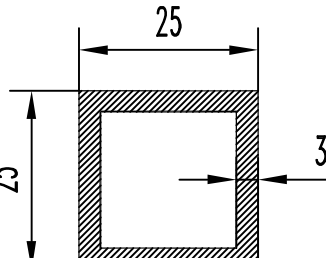
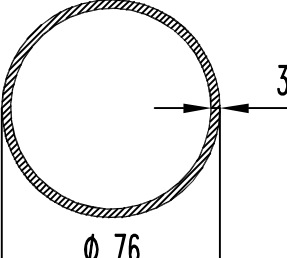
	БПЗ-0531 $F \text{ см}^2 = 5.284$ $Q \text{ кг.} = 1.432$ $D \text{ оп.мм} = 81.0$ $P \text{ н.мм} = 269.8$ $P \text{ вн.мм} = 257.2$ Гр. сл. = 0соб. Точн. = П		БПЗ-536 $F \text{ см}^2 = 2.000$ $Q \text{ кг.} = 0.542$ $D \text{ оп.мм} = 20.0$ $P \text{ н.мм} = 62.8$ $P \text{ вн.мм} = 70.6$ Гр. сл. = 0соб. Точн. = Н
	БПЗ-0532 $F \text{ см}^2 = 1.824$ $Q \text{ кг.} = 0.494$ $D \text{ оп.мм} = 36.1$ $P \text{ н.мм} = 130.5$ $P \text{ вн.мм} = 36.6$ Гр. сл. = VI Точн. = П		БПЗ-0537 $F \text{ см}^2 = 8.400$ $Q \text{ кг.} = 2.276$ $D \text{ оп.мм} = 143.0$ $P \text{ н.мм} = 336.8$ $P \text{ вн.мм} = 251.6$ Гр. сл. = V Точн. = П
	БПЗ-533 $F \text{ см}^2 = 5.23$ $Q \text{ кг.} = 1.417$ $D \text{ оп.мм} = 61$ $P \text{ н.мм} = 245.7$ $P \text{ вн.мм} = 131.7$ Гр. сл. = IV Точн. = Н		БПЗ-0538 $F \text{ см}^2 = 2.980$ $Q \text{ кг.} = 0.808$ $D \text{ оп.мм} = 47.3$ $P \text{ н.мм} = 174.6$ $P \text{ вн.мм} = 102.2$ Гр. сл. = VI Точн. = П
	БПЗ-0534 $F \text{ см}^2 = 4.478$ $Q \text{ кг.} = 1.214$ $D \text{ оп.мм} = 44.0$ $P \text{ н.мм} = 197.4$ $P \text{ вн.мм} = 113.2$ Гр. сл. = V Точн. = П		БПЗ-0539 $F \text{ см}^2 = 2.084$ $Q \text{ кг.} = 0.565$ $D \text{ оп.мм} = 42.0$ $P \text{ н.мм} = 143.4$ $P \text{ вн.мм} = 131.4$ Гр. сл. = IV Точн. = П
			БПЗ-540 $F \text{ см}^2 = 5.820$ $Q \text{ кг.} = 1.577$ $D \text{ оп.мм} = 74.0$ $P \text{ н.мм} = 324.5$ $P \text{ вн.мм} = 73.0$ Гр. сл. = IV Точн. = П

	БПЗ-541 $F \text{ см}^2 = 6.970$ $Q \text{ кг.} = 1.889$ $D \text{ оп.мм} = 160.7$ $P \text{ н.мм} = 510.5$ $P_{\text{вн.мм}} = 132.0$ Гр. сл. = 0соб. Точн. = Н		БПЗ-546 $F \text{ см}^2 = 4.900$ $Q \text{ кг.} = 1.328$ $D \text{ оп.мм} = 32.0$ $P \text{ н.мм} = 100.5$ $P_{\text{вн.мм}} = 62.8$ Гр. сл. = I Точн. = Н
	БПЗ-542 $F \text{ см}^2 = 5.320$ $Q \text{ кг.} = 1.442$ $D \text{ оп.мм} = 43.3$ $P \text{ н.мм} = 353.5$ $P_{\text{вн.мм}} = 46.4$ Гр. сл. = VI Точн. = Н		БПЗ-547 $F \text{ см}^2 = 0.880$ $Q \text{ кг.} = 0.238$ $D \text{ оп.мм} = 16.0$ $P \text{ н.мм} = 50.3$ $P_{\text{вн.мм}} = 37.7$ Гр. сл. = III Точн. = Н
	БПЗ-543 $F \text{ см}^2 = 2.860$ $Q \text{ кг.} = 0.775$ $D \text{ оп.мм} = 52.0$ $P \text{ н.мм} = 184.2$ $P_{\text{вн.мм}} = 96.0$ Гр. сл. = 0соб. Точн. = Н		БПЗ-548 $F \text{ см}^2 = 1.260$ $Q \text{ кг.} = 0.341$ $D \text{ оп.мм} = 22.0$ $P \text{ н.мм} = 69.0$ $P_{\text{вн.мм}} = 56.6$ Гр. сл. = III Точн. = Н
	БПЗ-544 $F \text{ см}^2 = 2.190$ $Q \text{ кг.} = 0.593$ $D \text{ оп.мм} = 40.0$ $P \text{ н.мм} = 131.5$ $P_{\text{вн.мм}} = 84.0$ Гр. сл. = V Точн. = Н		БПЗ-549 $F \text{ см}^2 = 15.480$ $Q \text{ кг.} = 4.195$ $D \text{ оп.мм} = 111.8$ $P \text{ н.мм} = 337.4$ $P_{\text{вн.мм}} = 166.8$ Гр. сл. = VI Точн. = Н
	БПЗ-545 $F \text{ см}^2 = 3.020$ $Q \text{ кг.} = 0.818$ $D \text{ оп.мм} = 52.0$ $P \text{ н.мм} = 225.5$ $P_{\text{вн.мм}} = 66.0$		БПЗ-550 $F \text{ см}^2 = 8.150$ $Q \text{ кг.} = 2.209$ $D \text{ оп.мм} = 92.7$ $P \text{ н.мм} = 328.2$ $P_{\text{вн.мм}} = 132.6$

	БПЗ-551 $F \text{ см}^2 = 13.790$ $Q \text{ кг.} = 3.737$ $D \text{ оп.мм} = 169.0$ $P \text{ н.мм} = 446.1$ $P \text{ вн.мм} = 199.5$ Гр. сл. = VI Точн. = Н		БПЗ-556 $F \text{ см}^2 = 1.310$ $Q \text{ кг.} = 0.355$ $D \text{ оп.мм} = 25.0$ $P \text{ н.мм} = 78.5$ $P \text{ вн.мм} = 67.2$ Гр. сл. = V Точн. = Н
	БПЗ-552 $F \text{ см}^2 = 3.644$ $Q \text{ кг.} = 0.988$ $D \text{ оп.мм} = 60.0$ $P \text{ н.мм} = 188.5$ $P \text{ вн.мм} = 175.9$ Гр. сл. = VI Точн. = DIN		БПЗ-0557 $F \text{ см}^2 = 3.260$ $Q \text{ кг.} = 0.883$ $D \text{ оп.мм} = 102.0$ $P \text{ н.мм} = 223.4$ $P \text{ вн.мм} = 198.3$ Гр. сл. = 0соб. Точн. = П
	БПЗ-0553 $F \text{ см}^2 = 1.323$ $Q \text{ кг.} = 0.359$ $D \text{ оп.мм} = 35.2$ $P \text{ н.мм} = 94.2$ $P \text{ вн.мм} = 82.2$ Гр. сл. = 0соб. Точн. = 0соб.		БПЗ-558 $F \text{ см}^2 = 1.010$ $Q \text{ кг.} = 0.274$ $D \text{ оп.мм} = 38.6$ $P \text{ н.мм} = 116.3$ $P \text{ вн.мм} = 50.2$ Гр. сл. = 0соб. Точн. = Н
	БПЗ-0554 $F \text{ см}^2 = 24.321$ $Q \text{ кг.} = 6.591$ $D \text{ оп.мм} = 100.0$ $P \text{ н.мм} = 812.7$ $P \text{ вн.мм} = 78.5$ Гр. сл. = VI Точн. = П		БПЗ-559 $F \text{ см}^2 = 2.430$ $Q \text{ кг.} = 0.659$ $D \text{ оп.мм} = 70.0$ $P \text{ н.мм} = 192.8$ $P \text{ вн.мм} = 118.0$ Гр. сл. = 0соб. Точн. = Н
	БПЗ-555 $F \text{ см}^2 = 1.110$ $Q \text{ кг.} = 0.301$ $D \text{ оп.мм} = 27.0$ $P \text{ н.мм} = 74.8$ $P \text{ вн.мм} = 64.8$		БПЗ-560 $F \text{ см}^2 = 2.191$ $Q \text{ кг.} = 0.594$ $D \text{ оп.мм} = 46.8$ $P \text{ н.мм} = 127.4$ $P \text{ вн.мм} = 115.6$

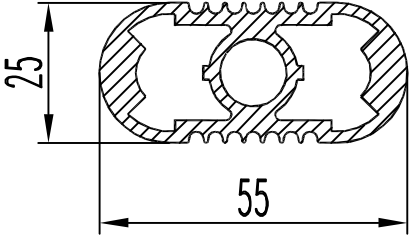
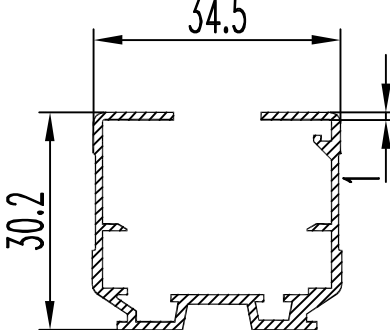
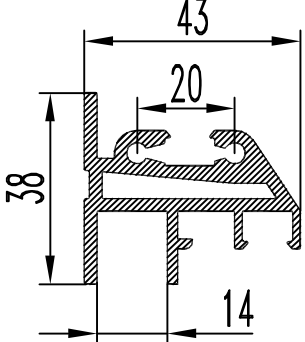
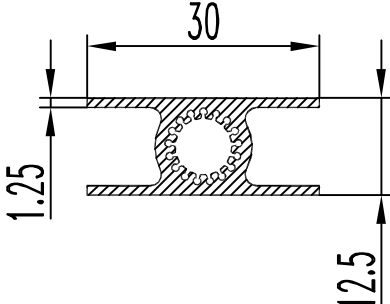
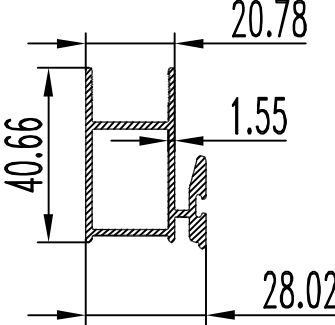
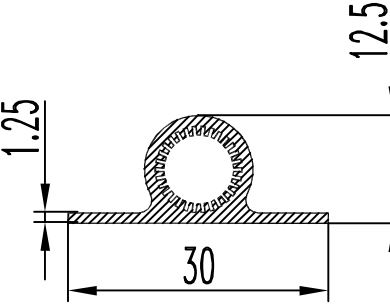
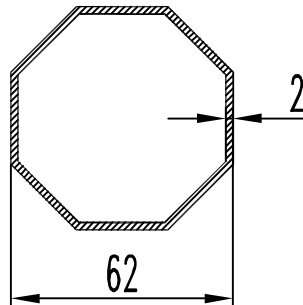
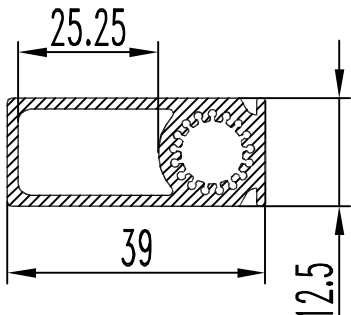
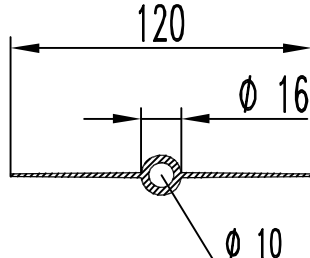
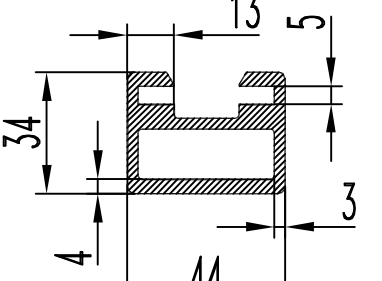
	БПЗ-561 $F \text{ см}^2 = 30.630$ $Q \text{ кг.} = 8.301$ $D \text{ оп.мм} = 80.0$ $P \text{ н.мм} = 251.3$ $P_{\text{вн.мм}} = 157.1$ Гр. сл. = I Точн. = Н		БПЗ-566 $F \text{ см}^2 = 5.236$ $Q \text{ кг.} = 1.419$ $D \text{ оп.мм} = 83.6$ $P \text{ н.мм} = 366.9$ $P_{\text{вн.мм}} = 188$ Гр. сл. = V Точн. = П
	БПЗ-562 $F \text{ см}^2 = 34.560$ $Q \text{ кг.} = 9.366$ $D \text{ оп.мм} = 75.0$ $P \text{ н.мм} = 235.6$ $P_{\text{вн.мм}} = 109.9$ Гр. сл. = I Точн. = Н		БПЗ-567 $F \text{ см}^2 = 4.500$ $Q \text{ кг.} = 1.220$ $D \text{ оп.мм} = 74.3$ $P \text{ н.мм} = 190.0$ $P_{\text{вн.мм}} = 170.0$ Гр. сл. = IV Точн. = DIN
	БПЗ-563 $F \text{ см}^2 = 31.420$ $Q \text{ кг.} = 8.515$ $D \text{ оп.мм} = 70.0$ $P \text{ н.мм} = 219.9$ $P_{\text{вн.мм}} = 94.3$ Гр. сл. = I Точн. = Н		БПЗ-568 $F \text{ см}^2 = 23.256$ $Q \text{ кг.} = 6.302$ $D \text{ оп.мм} = 55.0$ $P \text{ н.мм} = 172.8$ $P_{\text{вн.мм}} = 25.1$ Гр. сл. = I Точн. = П
	БПЗ-564 $F \text{ см}^2 = 0.817$ $Q \text{ кг.} = 0.221$ $D \text{ оп.мм} = 15.0$ $P \text{ н.мм} = 47.1$ $P_{\text{вн.мм}} = 34.6$ Гр. сл. = III Точн. = DIN		БПЗ-569 $F \text{ см}^2 = 14.360$ $Q \text{ кг.} = 3.892$ $D \text{ оп.мм} = 45.0$ $P \text{ н.мм} = 141.4$ $P_{\text{вн.мм}} = 43.9$ Гр. сл. = I Точн. = П
			БПЗ-0570 $F \text{ см}^2 = 1.739$ $Q \text{ кг.} = 0.471$ $D \text{ оп.мм} = 36.1$ $P \text{ н.мм} = 127.1$ $P_{\text{вн.мм}} = 34.6$ Гр. сл. = VI

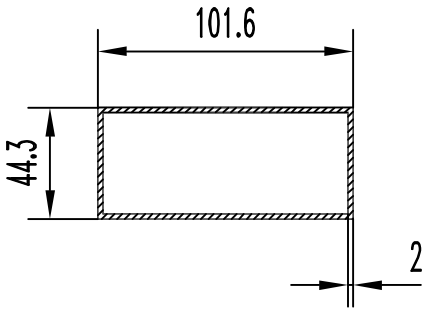
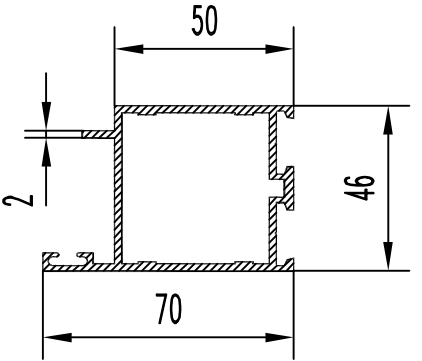
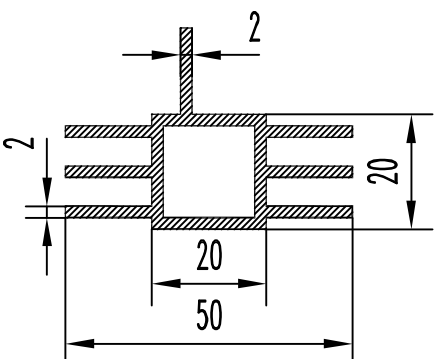
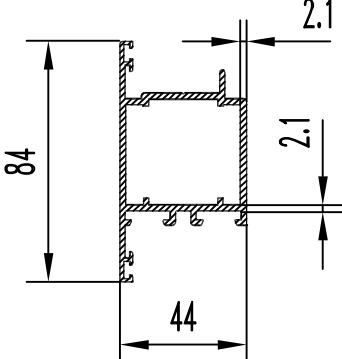
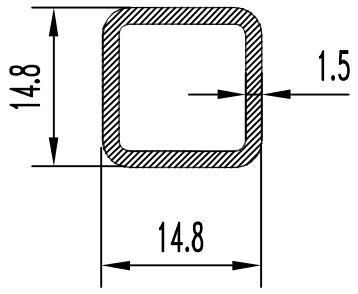
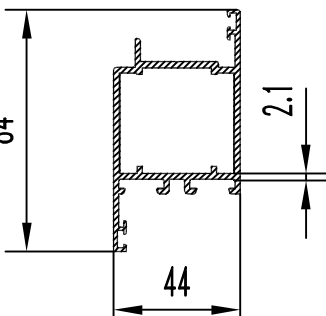
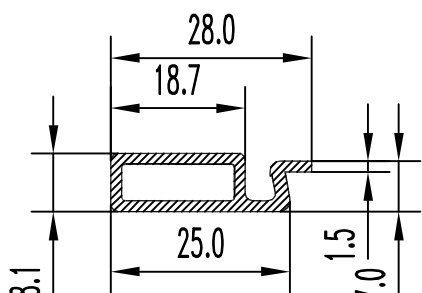
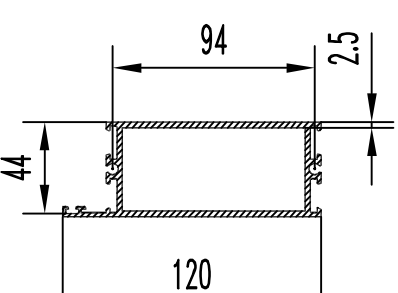
	БПЗ-571 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P_{\text{вн.мм}} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} =$		БПЗ-576 $F \text{ см}^2 = 6.560$ $Q \text{ кг.} = 1.778$ $D \text{ оп.мм} = 67.0$ $P \text{ н.мм} = 180.0$ $P_{\text{вн.мм}} = 148.0$ $\Gamma \text{ р. сл.} = \text{IV}$ $\text{Точн.} = \text{DIN}$
	БПЗ-572 $F \text{ см}^2 = 2.840$ $Q \text{ кг.} = 0.770$ $D \text{ оп.мм} = 56.0$ $P \text{ н.мм} = 150.0$ $P_{\text{вн.мм}} = 134.0$ $\Gamma \text{ р. сл.} = \text{IV}$ $\text{Точн.} = \text{DIN}$		БПЗ-577 $F \text{ см}^2 = 4.240$ $Q \text{ кг.} = 1.149$ $D \text{ оп.мм} = 85.5$ $P \text{ н.мм} = 220.0$ $P_{\text{вн.мм}} = 204.0$ $\Gamma \text{ р. сл.} = \text{IV}$ $\text{Точн.} = \text{DIN}$
	БПЗ-573 $F \text{ см}^2 = 4.140$ $Q \text{ кг.} = 1.122$ $D \text{ оп.мм} = 56.0$ $P \text{ н.мм} = 150.0$ $P_{\text{вн.мм}} = 126.0$ $\Gamma \text{ р. сл.} = \text{IV}$ $\text{Точн.} = \text{DIN}$		БПЗ-578 $F \text{ см}^2 = 1.831$ $Q \text{ кг.} = 0.496$ $D \text{ оп.мм} = 44.2$ $P \text{ н.мм} = 144.6$ $P_{\text{вн.мм}} = 90.4$ $\Gamma \text{ р. сл.} = \text{0соб.}$ $\text{Точн.} = \text{П}$
	БПЗ-574 $F \text{ см}^2 = 3.440$ $Q \text{ кг.} = 0.932$ $D \text{ оп.мм} = 64.0$ $P \text{ н.мм} = 180.0$ $P_{\text{вн.мм}} = 164.0$ $\Gamma \text{ р. сл.} = \text{IV}$ $\text{Точн.} = \text{DIN}$		БПЗ-579 $F \text{ см}^2 = 0.810$ $Q \text{ кг.} = 0.220$ $D \text{ оп.мм} = 22.4$ $P \text{ н.мм} = 60.0$ $P_{\text{вн.мм}} = 48.0$ $\Gamma \text{ р. сл.} = \text{0соб.}$ $\text{Точн.} = \text{DIN}$
	БПЗ-575 $F \text{ см}^2 = 5.040$ $Q \text{ кг.} = 1.366$ $D \text{ оп.мм} = 64.0$ $P \text{ н.мм} = 180.0$ $P_{\text{вн.мм}} = 156.0$ $\Gamma \text{ р. сл.} = \text{IV}$ $\text{Точн.} = \text{DIN}$		БПЗ-580 $F \text{ см}^2 = 1.410$ $Q \text{ кг.} = 0.382$ $D \text{ оп.мм} = 36.0$ $P \text{ н.мм} = 100.0$ $P_{\text{вн.мм}} = 88.0$ $\Gamma \text{ р. сл.} = \text{IV}$ $\text{Точн.} = \text{DIN}$

	БПЗ-581 $F \text{ см}^2 = 2.040$ $Q \text{ кг.} = 0.553$ $D \text{ оп.мм} = 40.3$ $P \text{ н.мм} = 110.0$ $P_{\text{вн.мм}} = 94.0$ Гр. сл. = IV Точн. = DIN		БПЗ-586 $F \text{ см}^2 = 3.360$ $Q \text{ кг.} = 0.911$ $D \text{ оп.мм} = 35.4$ $P \text{ н.мм} = 100.0$ $P_{\text{вн.мм}} = 68.0$ Гр. сл. = IV Точн. = DIN
	БПЗ-582 $F \text{ см}^2 = 2.240$ $Q \text{ кг.} = 0.607$ $D \text{ оп.мм} = 43.0$ $P \text{ н.мм} = 120.0$ $P_{\text{вн.мм}} = 104.0$ Гр. сл. = IV Точн. = DIN		БПЗ-587 $F \text{ см}^2 = 1.710$ $Q \text{ кг.} = 0.463$ $D \text{ оп.мм} = 42.4$ $P \text{ н.мм} = 120.0$ $P_{\text{вн.мм}} = 108.0$ Гр. сл. = 0соб. Точн. = DIN
	БПЗ-583 $F \text{ см}^2 = 1.560$ $Q \text{ кг.} = 0.423$ $D \text{ оп.мм} = 39.0$ $P \text{ н.мм} = 110.0$ $P_{\text{вн.мм}} = 98.0$ Гр. сл. = 0соб. Точн. = DIN		БПЗ-588 $F \text{ см}^2 = 2.310$ $Q \text{ кг.} = 0.626$ $D \text{ оп.мм} = 56.6$ $P \text{ н.мм} = 160.0$ $P_{\text{вн.мм}} = 148.0$ Гр. сл. = 0соб. Точн. = DIN
	БПЗ-584 $F \text{ см}^2 = 1.410$ $Q \text{ кг.} = 0.382$ $D \text{ оп.мм} = 35.4$ $P \text{ н.мм} = 100.0$ $P_{\text{вн.мм}} = 88.0$ Гр. сл. = 0соб. Точн. = DIN		БПЗ-589 $F \text{ см}^2 = 10.180$ $Q \text{ кг.} = 2.759$ $D \text{ оп.мм} = 60.0$ $P \text{ н.мм} = 188.5$ $P_{\text{вн.мм}} = 150.8$ Гр. сл. = II Точн. = DIN
	БПЗ-585 $F \text{ см}^2 = 2.640$ $Q \text{ кг.} = 0.715$ $D \text{ оп.мм} = 35.4$ $P \text{ н.мм} = 100.0$ $P_{\text{вн.мм}} = 76.0$		БПЗ-590 $F \text{ см}^2 = 6.880$ $Q \text{ кг.} = 1.864$ $D \text{ оп.мм} = 76.0$ $P \text{ н.мм} = 238.8$ $P_{\text{вн.мм}} = 219.9$

	БПЗ-591 $F \text{ см}^2 = 0.637$ $Q \text{ кг.} = 0.173$ $D \text{ оп.мм} = 69.4$ $P \text{ н.мм} = 68.4$ $P \text{ в.мм} = 33.40$ Гр. сл. = VI Точн. = П		БПЗ-596 $F \text{ см}^2 = 3.687$ $Q \text{ кг.} = 0.999$ $D \text{ оп.мм} = 61.7$ $P \text{ н.мм} = 209.2$ $P \text{ в.мм} = 243.9$ Гр. сл. = 0соб. Точн. = 0соб.
	БПЗ-592 $F \text{ см}^2 = 4.230$ $Q \text{ кг.} = 1.146$ $D \text{ оп.мм} = 42.0$ $P \text{ н.мм} = 132.0$ $P \text{ в.мм} = 110.0$ Гр. сл. = II Точн. = DIN		БПЗ-597 $F \text{ см}^2 = 3.882$ $Q \text{ кг.} = 1.052$ $D \text{ оп.мм} = 79.0$ $P \text{ н.мм} = 246.2$ $P \text{ в.мм} = 246.5$ Гр. сл. = 0соб. Точн. = П
	БПЗ-593 $F \text{ см}^2 = 5.91$ $Q \text{ кг.} = 1.601$ $D \text{ оп.мм} = 99.0$ $P \text{ н.мм} = 408.4$ $P \text{ в.мм} = 275.8$ Гр. сл. = 0соб. Точн. = Н		БПЗ-598 $F \text{ см}^2 = 2.780$ $Q \text{ кг.} = 0.753$ $D \text{ оп.мм} = 60.0$ $P \text{ н.мм} = 235.7$ $P \text{ в.мм} = 94.4$ Гр. сл. = 0соб. Точн. = П
	БПЗ-594 $F \text{ см}^2 = 2.243$ $Q \text{ кг.} = 0.608$ $D \text{ оп.мм} = 40.2$ $P \text{ н.мм} = 173.2$ $P \text{ в.мм} = 78.9$ Гр. сл. = 0соб. Точн. = 0соб.		БПЗ-599 $F \text{ см}^2 = 2.345$ $Q \text{ кг.} = 0.635$ $D \text{ оп.мм} = 45.3$ $P \text{ н.мм} = 217.3$ $P \text{ в.мм} = 70.9$ Гр. сл. = 0соб. Точн. = 0соб.
	БПЗ-595 $F \text{ см}^2 = 9.64$ $Q \text{ кг.} = 2.612$ $D \text{ оп.мм} = 128.0$ $P \text{ н.мм} = 526.4$ $P \text{ в.мм} = 399.2$ Гр. сл. = VI		БПЗ-600 $F \text{ см}^2 = 10.560$ $Q \text{ кг.} = 2.862$ $D \text{ оп.мм} = 72.1$ $P \text{ н.мм} = 200.0$ $P \text{ в.мм} = 152.0$ Гр. сл. = VI

	БПЗ-611 $F \text{ см}^2 = 2.719$ $Q \text{ кг.} = 0.737$ $D \text{ оп.мм} = 47.0$ $P \text{ н.мм} = 134.7$ $P \text{ вн.мм} = 101.8$ Гр. сл. = V Точн. = П		БПЗ-616 $F \text{ см}^2 = 4.115$ $Q \text{ кг.} = 1.115$ $D \text{ оп.мм} = 25.0$ $P \text{ н.мм} = 78.5$ $P \text{ вн.мм} = 31.4$ Гр. сл. = I Точн. = Н
	БПЗ-612 $F \text{ см}^2 = 2.278$ $Q \text{ кг.} = 0.617$ $D \text{ оп.мм} = 41.0$ $P \text{ н.мм} = 158.4$ $P \text{ вн.мм} = 57.3$ Гр. сл. = 0соб. Точн. = П		БПЗ-617 $F \text{ см}^2 = 1.000$ $Q \text{ кг.} = 0.271$ $D \text{ оп.мм} = 13.0$ $P \text{ н.мм} = 40.8$ $P \text{ вн.мм} = 20.4$ Гр. сл. = II Точн. = Н
	БПЗ-613 $F \text{ см}^2 = 2.810$ $Q \text{ кг.} = 0.762$ $D \text{ оп.мм} = 45.2$ $P \text{ н.мм} = 167.4$ $P \text{ вн.мм} = 111.4$ Гр. сл. = VI Точн. = П		БПЗ-618 $F \text{ см}^2 = 3.110$ $Q \text{ кг.} = 0.843$ $D \text{ оп.мм} = 51.0$ $P \text{ н.мм} = 267.5$ $P \text{ вн.мм} = 81.3$ Гр. сл. = 0соб. Точн. = П
	БПЗ-614 $F \text{ см}^2 = 1.780$ $Q \text{ кг.} = 0.482$ $D \text{ оп.мм} = 31.5$ $P \text{ н.мм} = 125.8$ $P \text{ вн.мм} = 48.0$ Гр. сл. = V Точн. = Н		БПЗ-619 $F \text{ см}^2 = 0.772$ $Q \text{ кг.} = 0.209$ $D \text{ оп.мм} = 21.0$ $P \text{ н.мм} = 56.6$ $P \text{ вн.мм} = 47.1$ Гр. сл. = VI Точн. = DIN
	БПЗ-615 $F \text{ см}^2 = 1.392$ $Q \text{ кг.} = 0.377$ $D \text{ оп.мм} = 27.7$ $P \text{ н.мм} = 76.3$ $P \text{ вн.мм} = 61.5$ Гр. сл. = IV		БПЗ-620 $F \text{ см}^2 = 2.623$ $Q \text{ кг.} = 0.711$ $D \text{ оп.мм} = 68.4$ $P \text{ н.мм} = 243.8$ $P \text{ вн.мм} = 43.8$ Гр. сл. = V

	БПЗ-0621 $F \text{ см}^2 = 5.238$ $Q \text{ кг.} = 1.419$ $D \text{ оп.мм} = 55.0$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} = 0 \text{ особ.}$ $\text{Точн.} = \text{П}$		БПЗ-626 $F \text{ см}^2 = 1.556$ $Q \text{ кг.} = 0.422$ $D \text{ оп.мм} = 43.0$ $P \text{ н.мм} = 265.5$ $P \text{ вн.мм} = 0.0$ $\Gamma \text{ р. сл.} = 0 \text{ особ.}$ $\text{Точн.} = \text{П}$
	БПЗ-622 $F \text{ см}^2 = 4.495$ $Q \text{ кг.} = 1.218$ $D \text{ оп.мм} = 55.0$ $P \text{ н.мм} = 273.7$ $P \text{ вн.мм} = 77.7$ $\Gamma \text{ р. сл.} = 0 \text{ особ.}$ $\text{Точн.} = \text{П}$		БПЗ-627 $F \text{ см}^2 = 1.314$ $Q \text{ кг.} = 0.356$ $D \text{ оп.мм} = 33.0$ $P \text{ н.мм} = 122.0$ $P \text{ вн.мм} = 72.0$ $\Gamma \text{ р. сл.} = 0 \text{ особ.}$ $\text{Точн.} = \text{П}$
	БПЗ-623 $F \text{ см}^2 = 2.445$ $Q \text{ кг.} = 0.663$ $D \text{ оп.мм} = 50.0$ $P \text{ н.мм} = 210.5$ $P \text{ вн.мм} = 81.3$ $\Gamma \text{ р. сл.} = 0 \text{ особ.}$ $\text{Точн.} = \text{П}$		БПЗ-628 $F \text{ см}^2 = 0.977$ $Q \text{ кг.} = 0.265$ $D \text{ оп.мм} = 33$ $P \text{ н.мм} = 81$ $P \text{ вн.мм} = 72$ $\Gamma \text{ р. сл.} = 0 \text{ особ.}$ $\text{Точн.} = \text{П}$
	БПЗ-624 $F \text{ см}^2 = 3.970$ $Q \text{ кг.} = 1.076$ $D \text{ оп.мм} = 67.1$ $P \text{ н.мм} = 205.5$ $P \text{ вн.мм} = 192.2$ $\Gamma \text{ р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		БПЗ-629 $F \text{ см}^2 = 1.646$ $Q \text{ кг.} = 0.446$ $D \text{ оп.мм} = 40.8$ $P \text{ н.мм} = 108.0$ $P \text{ вн.мм} = 145.1$ $\Gamma \text{ р. сл.} = 0 \text{ особ.}$ $\text{Точн.} = \text{П}$
	БПЗ-625 $F \text{ см}^2 = 2.785$ $Q \text{ кг.} = 0.755$ $D \text{ оп.мм} = 120.0$ $P \text{ н.мм} = 256.5$ $P \text{ вн.мм} = 31.4$ $\Gamma \text{ р. сл.} = \text{IV}$		БПЗ-630 $F \text{ см}^2 = 5.312$ $Q \text{ кг.} = 1.440$ $D \text{ оп.мм} = 54.5$ $P \text{ н.мм} = 214.3$ $P \text{ вн.мм} = 102.3$ $\Gamma \text{ р. сл.} = \text{VI}$

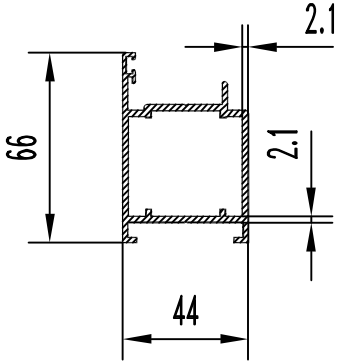
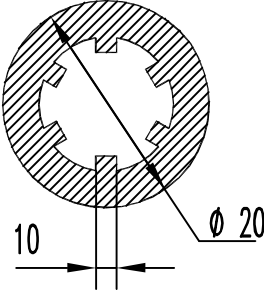
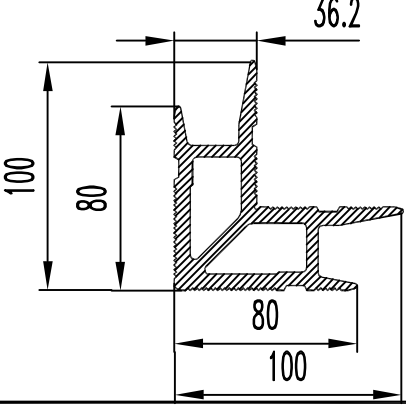
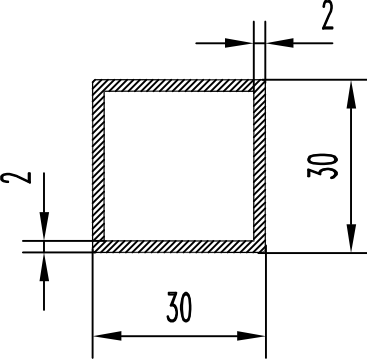
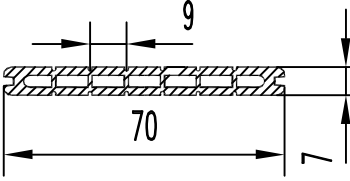
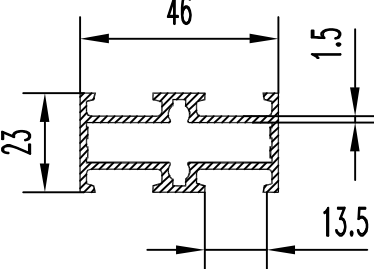
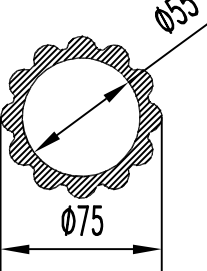
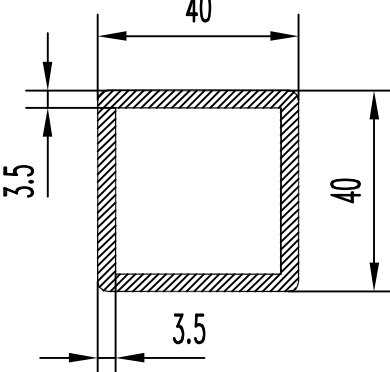
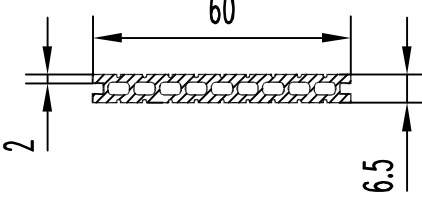
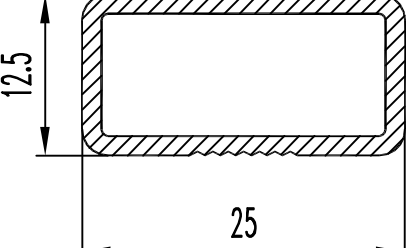
			БПЗ-636 $F \text{ см}^2 = 5.680$ $Q \text{ кг.} = 1.539$ $D \text{ оп.мм} = 112.0$ $P \text{ н.мм} = 291.8$ $P \text{ вн.мм} = 275.8$ Гр. сл. = 0соб. Точн. = П
			БПЗ-637 $F \text{ см}^2 = 4.795$ $Q \text{ кг.} = 1.299$ $D \text{ оп.мм} = 84.0$ $P \text{ н.мм} = 304.4$ $P \text{ вн.мм} = 177.0$ Гр. сл. = 0соб. Точн. = П
	БПЗ-633 $F \text{ см}^2 = 3.544$ $Q \text{ кг.} = 0.96$ $D \text{ оп.мм} = 52.5$ $P \text{ н.мм} = 288.2$ $P \text{ вн.мм} = 63.5$ Гр. сл. = VI Точн. = П		БПЗ-638 $F \text{ см}^2 = 5.054$ $Q \text{ кг.} = 1.37$ $D \text{ оп.мм} = 85.3$ $P \text{ н.мм} = 358.5$ $P \text{ вн.мм} = 164.2$ Гр. сл. = VI Точн. = П
	БПЗ-634 $F \text{ см}^2 = 0.760$ $Q \text{ кг.} = 0.206$ $D \text{ оп.мм} = 19.0$ $P \text{ н.мм} = 54.9$ $P \text{ вн.мм} = 45.5$ Гр. сл. = 0соб. Точн. = П		БПЗ-639 $F \text{ см}^2 = 5.054$ $Q \text{ кг.} = 1.37$ $D \text{ оп.мм} = 94.5$ $P \text{ н.мм} = 358.5$ $P \text{ вн.мм} = 164.2$ Гр. сл. = VI Точн. = П
	БПЗ-635 $F \text{ см}^2 = 0.964$ $Q \text{ кг.} = 0.261$ $D \text{ оп.мм} = 34.2$ $P \text{ н.мм} = 81.7$ $P \text{ вн.мм} = 40.7$ Гр. сл. = V		БПЗ-640 $F \text{ см}^2 = 7.967$ $Q \text{ кг.} = 2.159$ $D \text{ оп.мм} = 127.8$ $P \text{ н.мм} = 443.3$ $P \text{ вн.мм} = 248$ Гр. сл. = VI

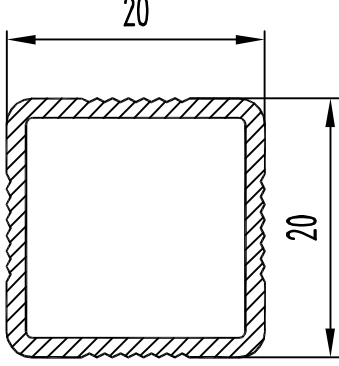
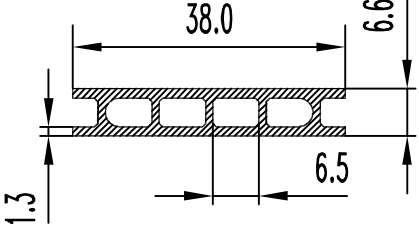
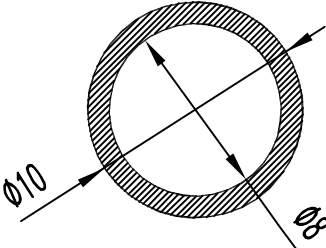
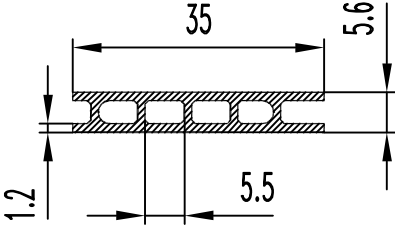
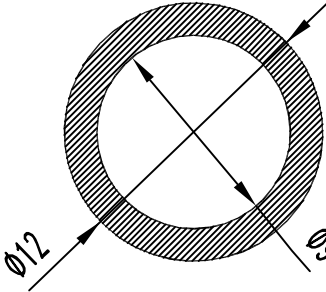
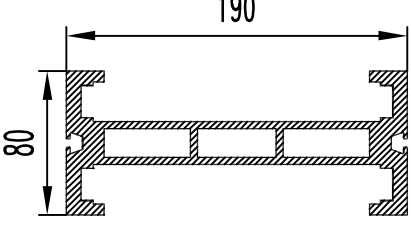
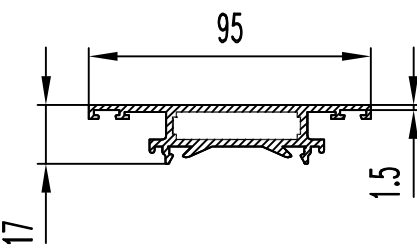
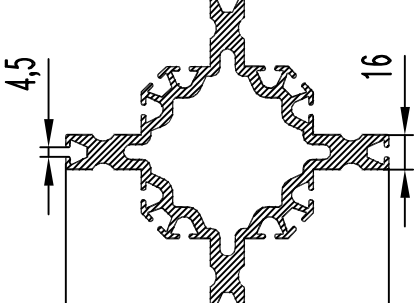
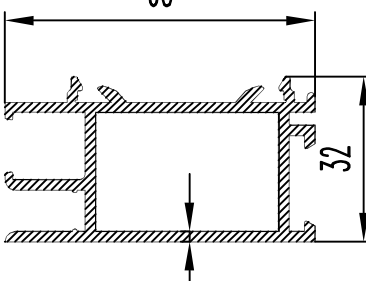
pdfMachine

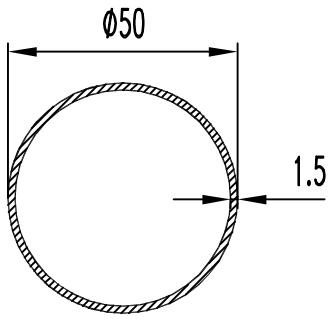
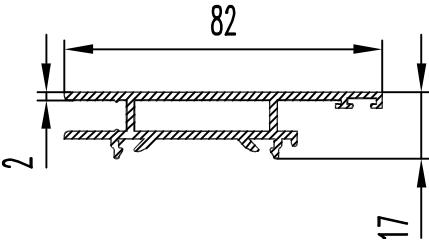
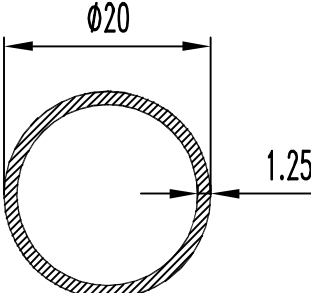
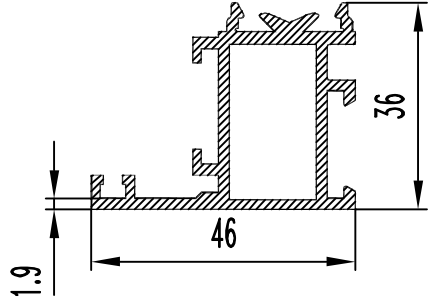
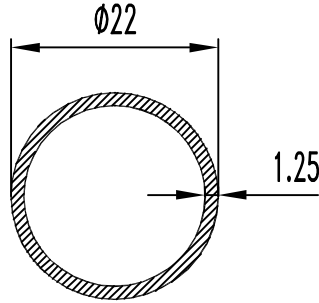
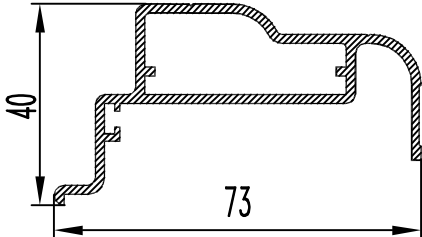
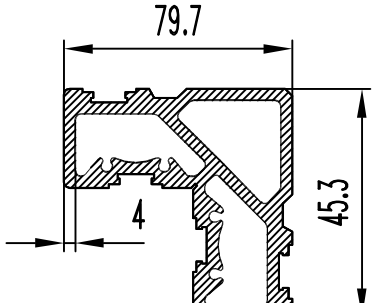
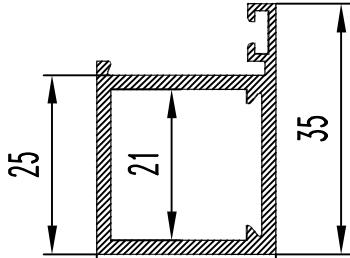
A pdf writer that produces quality PDF files with ease!

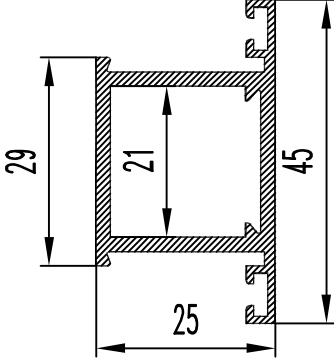
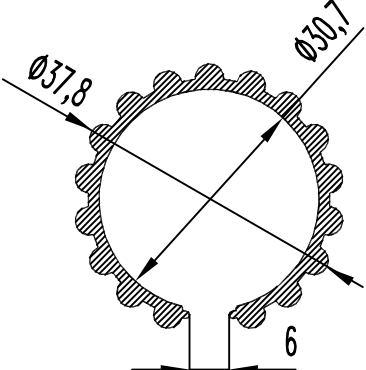
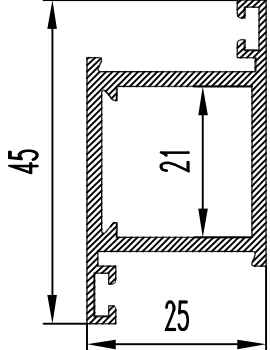
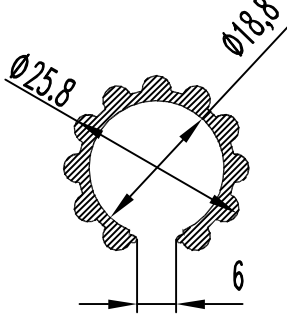
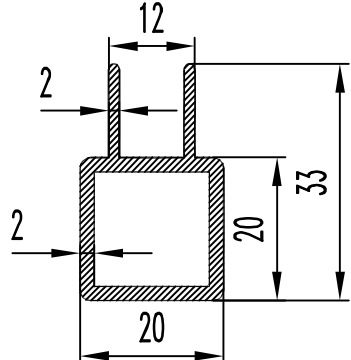
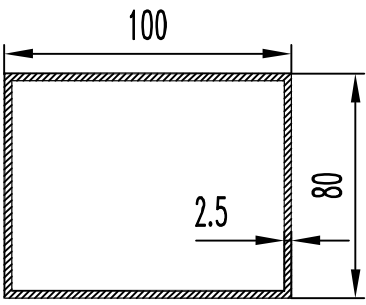
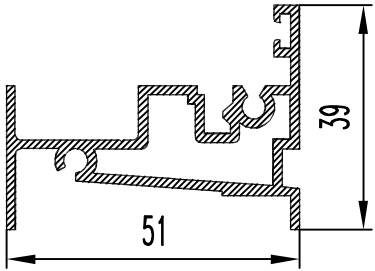
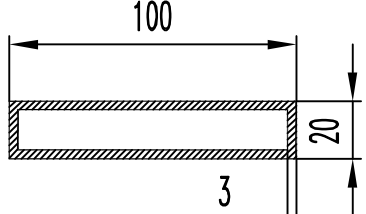
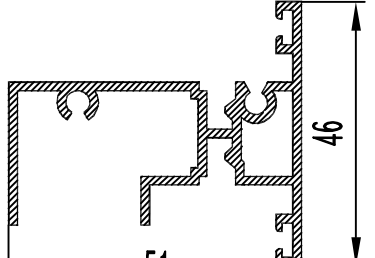
Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

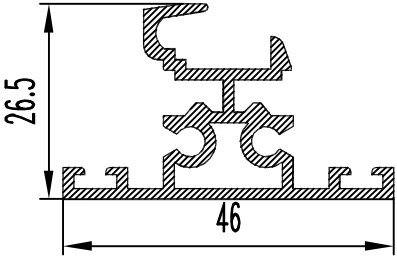
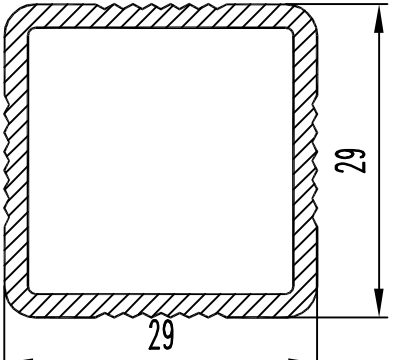
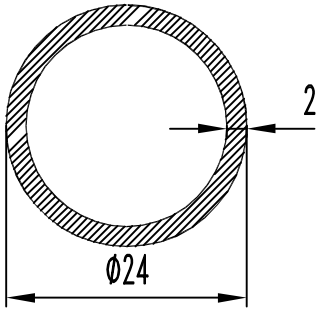
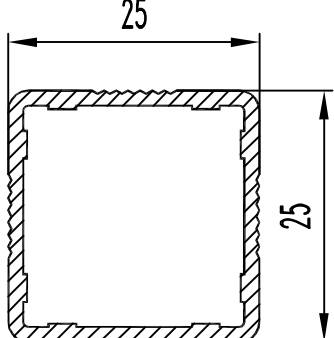
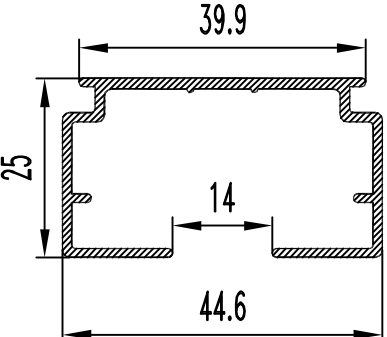
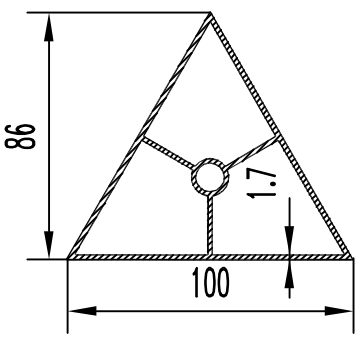
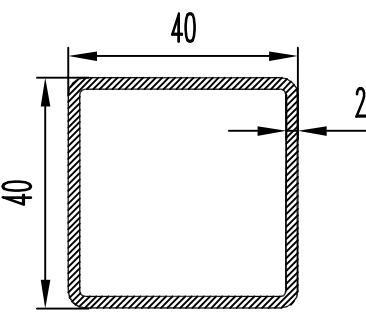
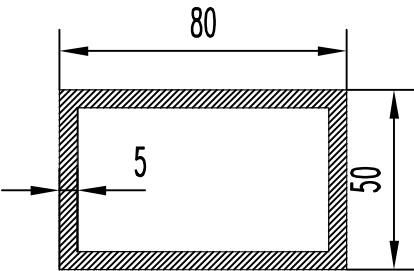
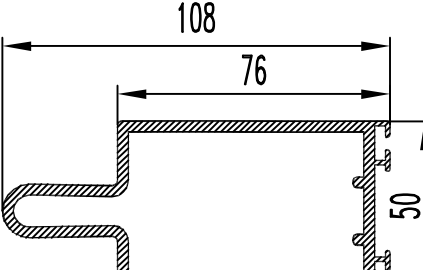
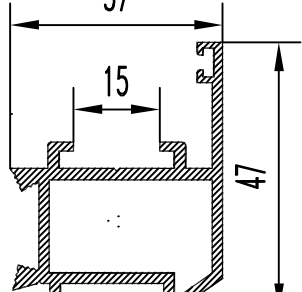
Get yours now!

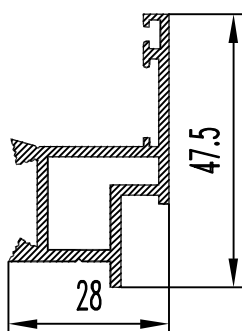
	БПЗ-641 $F \text{ см}^2 = 4.473$ $Q \text{ кг.} = 1.212$ $D \text{ оп.мм} = 80.0$ $P \text{ н.мм} = 284.8$ $P \text{ в.мм} = 164.2$ Гр. сл. = VI Точн. = П		БПЗ-646 $F \text{ см}^2 = 1.992$ $Q \text{ кг.} = 0.540$ $D \text{ оп.мм} = 20.0$ $P \text{ н.мм} = 62.8$ $P \text{ в.мм} = 57.9$ Гр. сл. = VI Точн. = Н
	БПЗ-642 $F \text{ см}^2 = 20.974$ $Q \text{ кг.} = 5.684$ $D \text{ оп.мм} = 116.8$ $P \text{ н.мм} = 525.3$ $P \text{ в.мм} = 237.8$ Гр. сл. = VI Точн. = П		БПЗ-647 $F \text{ см}^2 = 2.238$ $Q \text{ кг.} = 0.606$ $D \text{ оп.мм} = 42.0$ $P \text{ н.мм} = 119.1$ $P \text{ в.мм} = 104.0$ Гр. сл. = V Точн. = DIN
	БПЗ-643 $F \text{ см}^2 = 3.049$ $Q \text{ кг.} = 0.826$ $D \text{ оп.мм} = 70.0$ $P \text{ н.мм} = 178.7$ $P \text{ в.мм} = 147.4$ Гр. сл. = 0соб. Точн. = П		БПЗ-648 $F \text{ см}^2 = 2.717$ $Q \text{ кг.} = 0.736$ $D \text{ оп.мм} = 51.4$ $P \text{ н.мм} = 204.9$ $P \text{ в.мм} = 127.7$ Гр. сл. = 0соб. Точн. = П
	БПЗ-644 $F \text{ см}^2 = 15.740$ $Q \text{ кг.} = 4.266$ $D \text{ оп.мм} = 75.0$ $P \text{ н.мм} = 269.4$ $P \text{ в.мм} = 172.8$ Гр. сл. = I Точн. = Н		БПЗ-649 $F \text{ см}^2 = 5.076$ $Q \text{ кг.} = 1.376$ $D \text{ оп.мм} = 54.9$ $P \text{ н.мм} = 156.6$ $P \text{ в.мм} = 132.0$ Гр. сл. = III Точн. = DIN
	БПЗ-645 $F \text{ см}^2 = 2.408$ $Q \text{ кг.} = 0.653$ $D \text{ оп.мм} = 60.4$ $P \text{ н.мм} = 160.5$ $P \text{ в.мм} = 127.4$		БПЗ-0650 $F \text{ см}^2 = 0.978$ $Q \text{ кг.} = 0.265$ $D \text{ оп.мм} = 28.0$ $P \text{ н.мм} = 73.6$ $P \text{ в.мм} = 62.1$ Гр. сл. = V

	БПЗ-0651 $F \text{ см}^2 = 1.030$ $Q \text{ кг.} = 0.279$ $D \text{ оп.мм} = 27.0$ $P \text{ н.мм} = 80.5$ $P \text{ вн.мм} = 67.1$ Гр. сл. = V Точн. = П		БПЗ-656 $F \text{ см}^2 = 3.420$ $Q \text{ кг.} = 0.927$ $D \text{ оп.мм} = 68.2$ $P \text{ н.мм} = 104.7$ $P \text{ вн.мм} = 327.8$ Гр. сл. = V Точн. = П
	БПЗ-652 $F \text{ см}^2 = 1.242$ $Q \text{ кг.} = 0.337$ $D \text{ оп.мм} = 38.6$ $P \text{ н.мм} = 102.0$ $P \text{ вн.мм} = 77.0$ Гр. сл. = 0соб. Точн. = 0соб.		БПЗ-657 $F \text{ см}^2 = 0.283$ $Q \text{ кг.} = 0.077$ $D \text{ оп.мм} = 10.0$ $P \text{ н.мм} = 31.4$ $P \text{ вн.мм} = 25.1$ Гр. сл. = 0соб. Точн. = П
	БПЗ-653 $F \text{ см}^2 = 1.040$ $Q \text{ кг.} = 0.282$ $D \text{ оп.мм} = 35.4$ $P \text{ н.мм} = 96.8$ $P \text{ вн.мм} = 62.5$ Гр. сл. = 0соб. Точн. = 0соб.		БПЗ-658 $F \text{ см}^2 = 0.495$ $Q \text{ кг.} = 0.134$ $D \text{ оп.мм} = 12.0$ $P \text{ н.мм} = 37.7$ $P \text{ вн.мм} = 28.3$ Гр. сл. = V Точн. = Н
	БПЗ-654 $F \text{ см}^2 = 34.880$ $Q \text{ кг.} = 9.452$ $D \text{ оп.мм} = 206.0$ $P \text{ н.мм} = 809.8$ $P \text{ вн.мм} = 384.0$ Гр. сл. = 0соб. Точн. = П		БПЗ-659 $F \text{ см}^2 = 3.880$ $Q \text{ кг.} = 1.051$ $D \text{ оп.мм} = 95.0$ $P \text{ н.мм} = 309.7$ $P \text{ вн.мм} = 90.4$ Гр. сл. = VI Точн. = Н
	БПЗ-655 $F \text{ см}^2 = 30.100$ $Q \text{ кг.} = 8.157$ $D \text{ оп.мм} = 150.0$ $P \text{ н.мм} = 1024.0$ $P \text{ вн.мм} = 320.6$		БПЗ-660 $F \text{ см}^2 = 4.225$ $Q \text{ кг.} = 1.145$ $D \text{ оп.мм} = 66.4$ $P \text{ н.мм} = 308.5$ $P \text{ вн.мм} = 117.0$

			БПЗ-666 $F \text{ см}^2 = 2.290$ $Q \text{ кг.} = 0.621$ $D \text{ оп.мм} = 50.0$ $P \text{ н.мм} = 157.1$ $P \text{ вн.мм} = 147.7$ $\Gamma \text{р. сл.} = 0 \text{соб.}$ $\text{Точн.} = \text{Н}$
	БПЗ-662 $F \text{ см}^2 = 3.620$ $Q \text{ кг.} = 0.981$ $D \text{ оп.мм} = 82.0$ $P \text{ н.мм} = 289.0$ $P \text{ вн.мм} = 86.0$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{Н}$		БПЗ-667 $F \text{ см}^2 = 0.740$ $Q \text{ кг.} = 0.201$ $D \text{ оп.мм} = 20.0$ $P \text{ н.мм} = 62.8$ $P \text{ вн.мм} = 54.9$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \text{Н}$
	БПЗ-663 $F \text{ см}^2 = 3.352$ $Q \text{ кг.} = 0.908$ $D \text{ оп.мм} = 57.3$ $P \text{ н.мм} = 263.7$ $P \text{ вн.мм} = 84.8$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{Н}$		БПЗ-668 $F \text{ см}^2 = 0.820$ $Q \text{ кг.} = 0.222$ $D \text{ оп.мм} = 22.0$ $P \text{ н.мм} = 69.1$ $P \text{ вн.мм} = 61.3$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \text{Н}$
			БПЗ-669 $F \text{ см}^2 = 3.379$ $Q \text{ кг.} = 0.916$ $D \text{ оп.мм} = 77.0$ $P \text{ н.мм} = 263.8$ $P \text{ вн.мм} = 114.9$ $\Gamma \text{р. сл.} = 0 \text{соб.}$ $\text{Точн.} = \text{П}$
	БПЗ-665 $F \text{ см}^2 = 17.690$ $Q \text{ кг.} = 4.794$ $D \text{ оп.мм} = 111.0$ $P \text{ н.мм} = 372.6$ $P \text{ вн.мм} = 410.0$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{Н}$		БПЗ-670 $F \text{ см}^2 = 2.127$ $Q \text{ кг.} = 0.576$ $D \text{ оп.мм} = 43.0$ $P \text{ н.мм} = 140.9$ $P \text{ вн.мм} = 88.0$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \text{Н}$

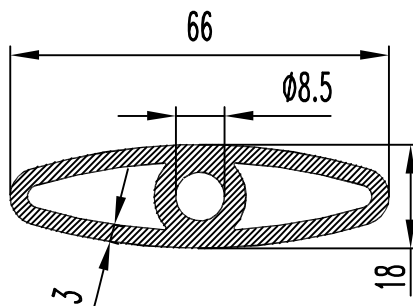
	БПЗ-671 $F \text{ см}^2 = 2.361$ $Q \text{ кг.} = 0.640$ $D \text{ оп.мм} = 46.9$ $P \text{ н.мм} = 181.8$ $P \text{ вн.мм} = 88.0$ Гр. сл. = V Точн. = Н		БПЗ-676 $F \text{ см}^2 = 2.551$ $Q \text{ кг.} = 0.691$ $D \text{ оп.мм} = 37.8$ $P \text{ н.мм} = 238.1$ $P \text{ вн.мм} = 0.0$ Гр. сл. = VI Точн. = П
	БПЗ-672 $F \text{ см}^2 = 2.361$ $Q \text{ кг.} = 0.640$ $D \text{ оп.мм} = 46.9$ $P \text{ н.мм} = 181.8$ $P \text{ вн.мм} = 88.0$ Гр. сл. = V Точн. = Н		БПЗ-677 $F \text{ см}^2 = 1.578$ $Q \text{ кг.} = 0.428$ $D \text{ оп.мм} = 25.8$ $P \text{ н.мм} = 147.6$ $P \text{ вн.мм} = 0.0$ Гр. сл. = VI Точн. = П
			БПЗ-678 $F \text{ см}^2 = 1.810$ $Q \text{ кг.} = 0.491$ $D \text{ оп.мм} = 36.2$ $P \text{ н.мм} = 128.1$ $P \text{ вн.мм} = 64.0$ Гр. сл. = VI Точн. = Н
	БПЗ-674 $F \text{ см}^2 = 8.750$ $Q \text{ кг.} = 2.371$ $D \text{ оп.мм} = 128.0$ $P \text{ н.мм} = 360.0$ $P \text{ вн.мм} = 340.0$ Гр. сл. = 0соб. Точн. = Н		БПЗ-679 $F \text{ см}^2 = 3.216$ $Q \text{ кг.} = 0.872$ $D \text{ оп.мм} = 64.2$ $P \text{ н.мм} = 285.2$ $P \text{ вн.мм} = 114.1$ Гр. сл. = VI Точн. = П
	БПЗ-675 $F \text{ см}^2 = 6.840$ $Q \text{ кг.} = 1.854$ $D \text{ оп.мм} = 102.0$ $P \text{ н.мм} = 240.0$ $P \text{ вн.мм} = 216.0$ Гр. сл. = VI Точн. = Н		БПЗ-680 $F \text{ см}^2 = 3.224$ $Q \text{ кг.} = 0.874$ $D \text{ оп.мм} = 64.8$ $P \text{ н.мм} = 375.5$ $P \text{ вн.мм} = 48.7$ Гр. сл. = VI Точн. = П

	БПЗ-681 $F \text{ см}^2 = 2.438$ $Q \text{ кг.} = 0.661$ $D \text{ оп.мм} = 47.6$ $P \text{ н.мм} = 260.6$ $P \text{ вн.мм} = 49.9$ Гр. сл. = V Точн. = П		БПЗ-0686 $F \text{ см}^2 = 1.567$ $Q \text{ кг.} = 0.425$ $D \text{ оп.мм} = 40.0$ $P \text{ н.мм} = 116.5$ $P \text{ вн.мм} = 103.2$ Гр. сл. = V Точн. = П
	БПЗ-682 $F \text{ см}^2 = 1.382$ $Q \text{ кг.} = 0.375$ $D \text{ оп.мм} = 24.0$ $P \text{ н.мм} = 75.4$ $P \text{ вн.мм} = 62.8$ Гр. сл. = III Точн. = Н		БПЗ-0687 $F \text{ см}^2 = 1.404$ $Q \text{ кг.} = 0.380$ $D \text{ оп.мм} = 34.0$ $P \text{ н.мм} = 100.5$ $P \text{ вн.мм} = 92.7$ Гр. сл. = V Точн. = П
	БПЗ-683 $F \text{ см}^2 = 1.711$ $Q \text{ кг.} = 0.464$ $D \text{ оп.мм} = 50.0$ $P \text{ н.мм} = 256.0$ $P \text{ вн.мм} = 0.0$ Гр. сл. = 0соб. Точн. = П		БПЗ-688 $F \text{ см}^2 = 6.425$ $Q \text{ кг.} = 1.742$ $D \text{ оп.мм} = 116.0$ $P \text{ н.мм} = 298.8$ $P \text{ вн.мм} = 467.3$ Гр. сл. = 0соб. Точн. = Н
	БПЗ-684 $F \text{ см}^2 = 2.970$ $Q \text{ кг.} = 0.805$ $D \text{ оп.мм} = 54.1$ $P \text{ н.мм} = 154.9$ $P \text{ вн.мм} = 142.3$ Гр. сл. = VI Точн. = DIN		БПЗ-689 $F \text{ см}^2 = 12.000$ $Q \text{ кг.} = 3.252$ $D \text{ оп.мм} = 94.3$ $P \text{ н.мм} = 260.0$ $P \text{ вн.мм} = 220.0$ Гр. сл. = III Точн. = DIN
	БПЗ-685 $F \text{ см}^2 = 9.240$ $Q \text{ кг.} = 2.504$ $D \text{ оп.мм} = 114.0$ $P \text{ н.мм} = 361.9$ $P \text{ вн.мм} = 286.9$ Гр. сл. = VI Точн. = П		БПЗ-690 $F \text{ см}^2 = 3.032$ $Q \text{ кг.} = 0.822$ $D \text{ оп.мм} = 56.6$ $P \text{ н.мм} = 237.2$ $P \text{ вн.мм} = 95.2$ Гр. сл. = V Точн. = П



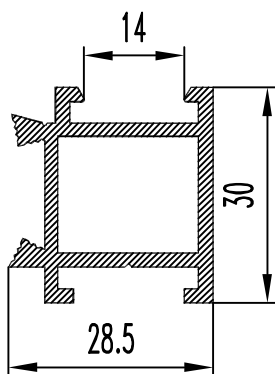
БПЗ-691

$F \text{ см}^2 = 2.330$
 $Q \text{ кг.} = 0.631$
 $D \text{ оп.мм} = 51.4$
 $P \text{ н.мм} = 189.0$
 $P \text{ вн.мм} = 71.2$
 Гр. сл. = V
 Точн. = П



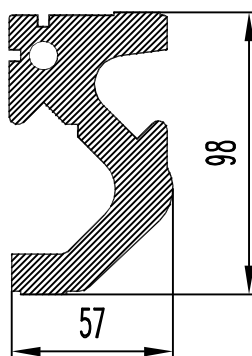
БПЗ-696

$F \text{ см}^2 = 5.213$
 $Q \text{ кг.} = 1.413$
 $D \text{ оп.мм} = 66.0$
 $P \text{ н.мм} = 145.0$
 $P \text{ вн.мм} = 153.5$
 Гр. сл. = IV
 Точн. = Н



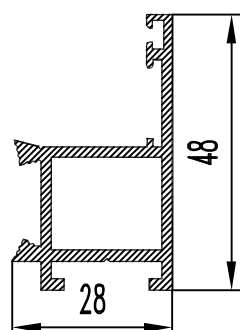
БПЗ-692

$F \text{ см}^2 = 2.301$
 $Q \text{ кг.} = 0.531$
 $D \text{ оп.мм} = 38.7$
 $P \text{ н.мм} = 165.3$
 $P \text{ вн.мм} = 71.8$
 Гр. сл. = V
 Точн. = П



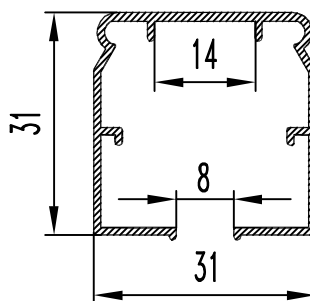
БПЗ-697

$F \text{ см}^2 = 28.190$
 $Q \text{ кг.} = 7.639$
 $D \text{ оп.мм} = 110.0$
 $P \text{ н.мм} = 405.7$
 $P \text{ вн.мм} = 31.4$
 Гр. сл. = IV
 Точн. = Н



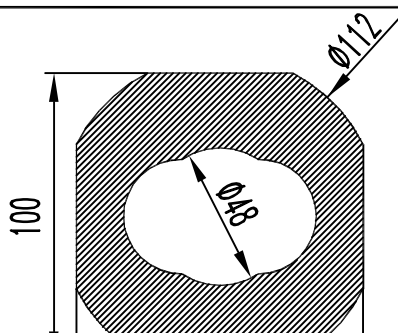
БПЗ-693

$F \text{ см}^2 = 2.510$
 $Q \text{ кг.} = 0.680$
 $D \text{ оп.мм} = 53.2$
 $P \text{ н.мм} = 205.8$
 $P \text{ вн.мм} = 71.2$
 Гр. сл. = V
 Точн. = П



БПЗ-698

$F \text{ см}^2 = 1.317$
 $Q \text{ кг.} = 0.357$
 $D \text{ оп.мм} = 42.0$
 $P \text{ н.мм} = 253.3$
 $P \text{ вн.мм} = 0.0$
 Гр. сл. = 0соб.
 Точн. = П



БПЗ-700

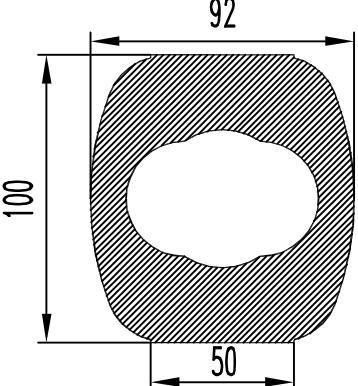
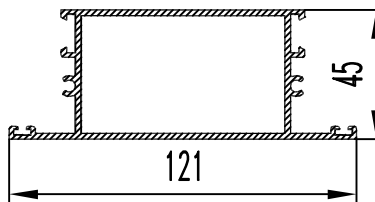
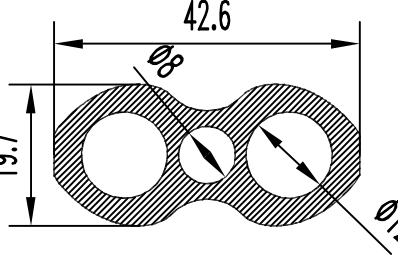
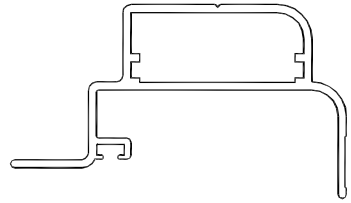
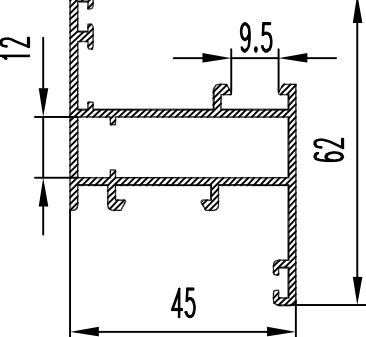
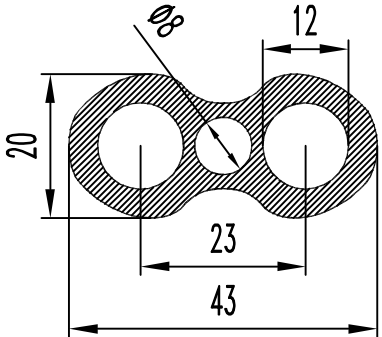
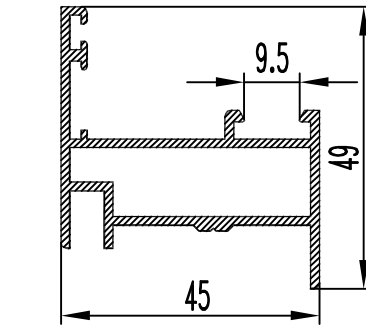
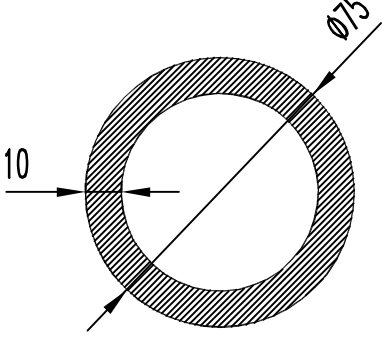
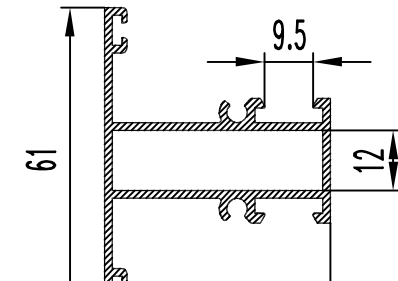
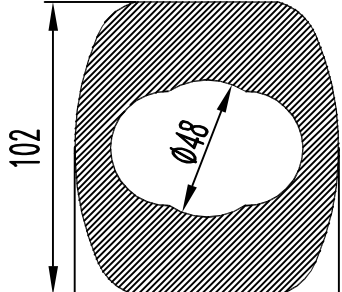
$F \text{ см}^2 = 64.254$
 $Q \text{ кг.} = 17.413$
 $D \text{ оп.мм} = 113.0$
 $P \text{ н.мм} = 344.3$
 $P \text{ вн.мм} = 186.9$

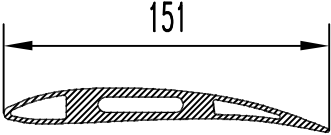
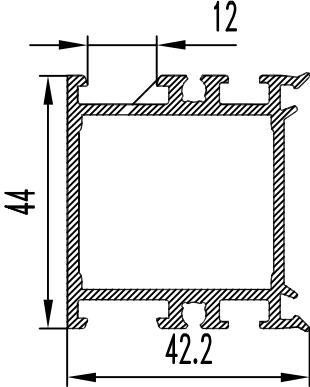
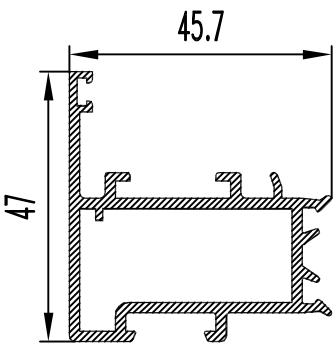
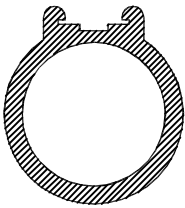
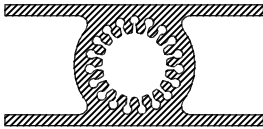

pdfMachine

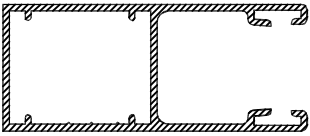
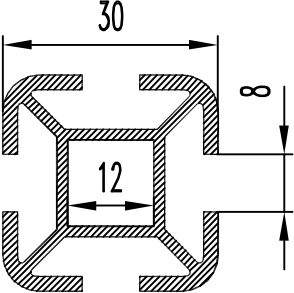
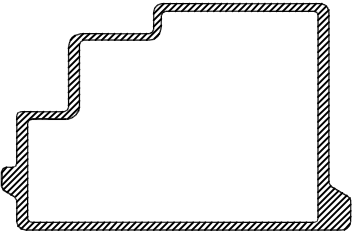
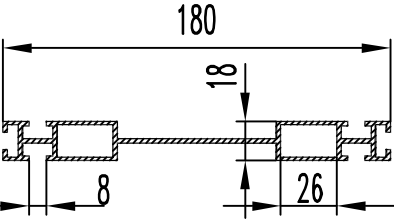
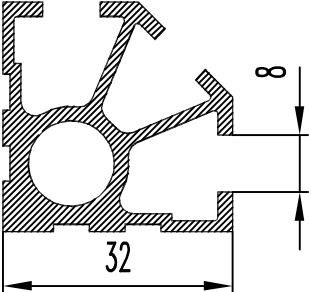
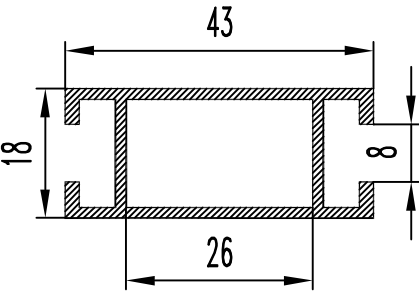
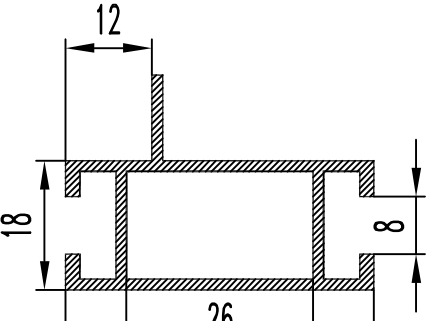
A pdf writer that produces quality PDF files with ease!

Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

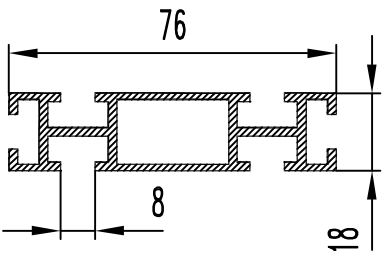
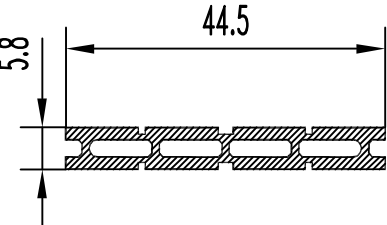
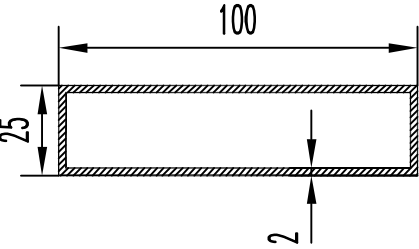
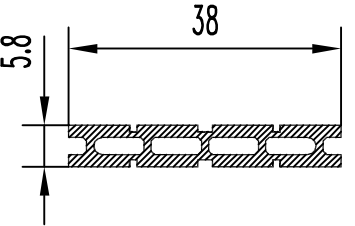
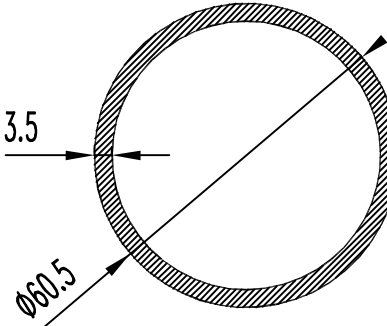
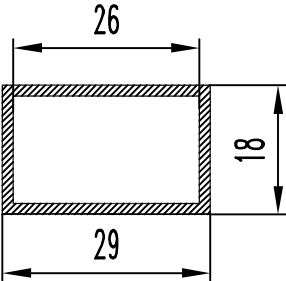
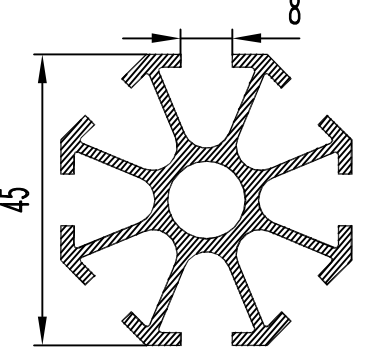
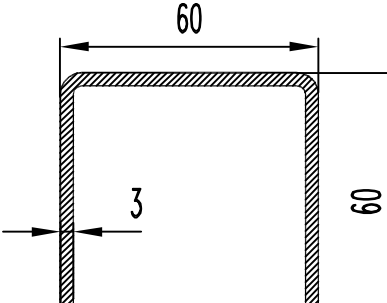
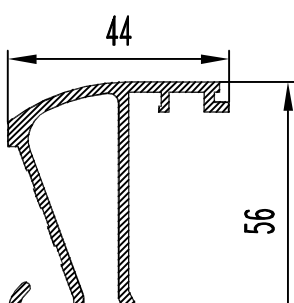
Get yours now!

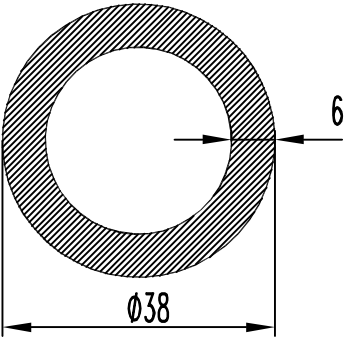
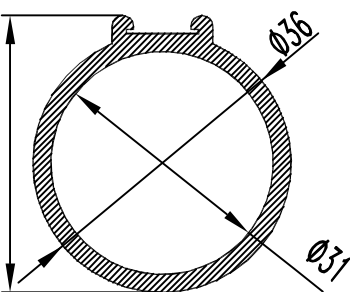
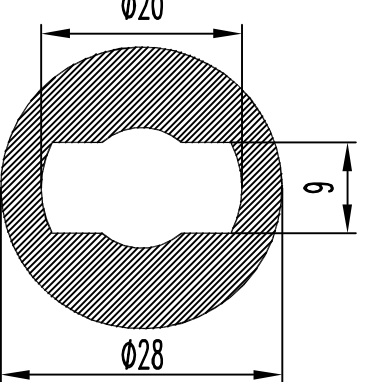
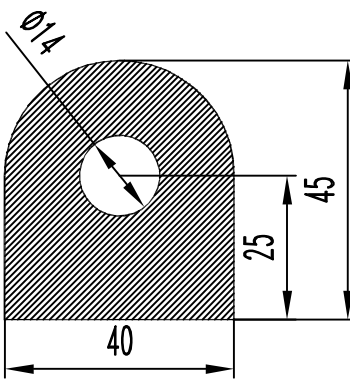
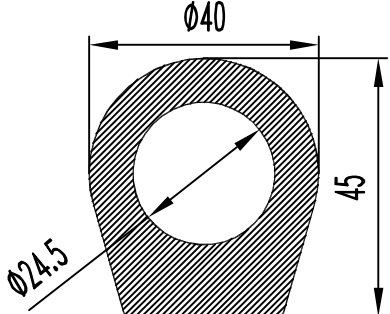
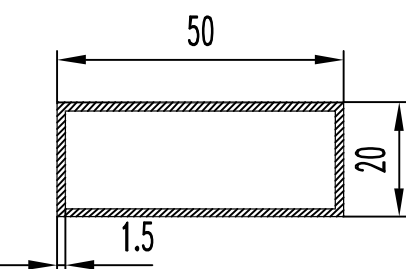
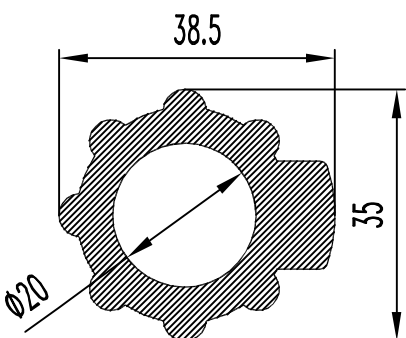
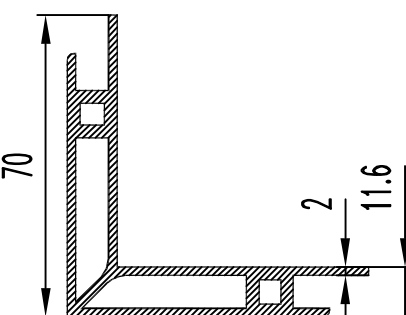
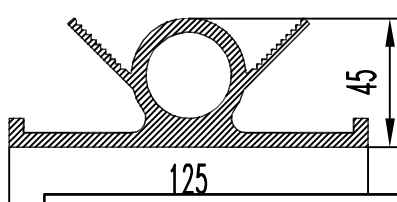
	БПЗ-701 $F \text{ см}^2 = 57.85$ $Q \text{ кг.} = 15.68$ $D \text{ оп.мм} = 111.8$ $P \text{ н.мм} = 332.3$ $P \text{ в.н.мм} = 183.1$ Гр. сл. = 0соб. Точн. = П		БПЗ-706 $F \text{ см}^2 = 6.406$ $Q \text{ кг.} = 1.736$ $D \text{ оп.мм} = 121.5$ $P \text{ н.мм} = 446.0$ $P \text{ в.н.мм} = 224.0$ Гр. сл. = VI Точн. = П
	БПЗ-702 $F \text{ см}^2 = 3.905$ $Q \text{ кг.} = 1.058$ $D \text{ оп.мм} = 43.0$ $P \text{ н.мм} = 110.4$ $P \text{ в.н.мм} = 95.0$ Гр. сл. = 0соб. Точн. = П		
	БПЗ-703 $F \text{ см}^2 = 3.210$ $Q \text{ кг.} = 0.870$ $D \text{ оп.мм} = 76.2$ $P \text{ н.мм} = 314.0$ $P \text{ в.н.мм} = 114.0$ Гр. сл. = V Точн. = П		БПЗ-708 $F \text{ см}^2 = 3.980$ $Q \text{ кг.} = 1.079$ $D \text{ оп.мм} = 43.0$ $P \text{ н.мм} = 112.0$ $P \text{ в.н.мм} = 100.5$ Гр. сл. = 0соб. Точн. = П
	БПЗ-704 $F \text{ см}^2 = 2.855$ $Q \text{ кг.} = 0.774$ $D \text{ оп.мм} = 66.1$ $P \text{ н.мм} = 265.0$ $P \text{ в.н.мм} = 108.0$ Гр. сл. = V Точн. = П		БПЗ-709 $F \text{ см}^2 = 20.421$ $Q \text{ кг.} = 5.534$ $D \text{ оп.мм} = 75.0$ $P \text{ н.мм} = 235.6$ $P \text{ в.н.мм} = 172.8$ Гр. сл. = I Точн. = Н
	БПЗ-705 $F \text{ см}^2 = 3.340$ $Q \text{ кг.} = 0.905$ $D \text{ оп.мм} = 67.0$ $P \text{ н.мм} = 327.0$ $P \text{ в.н.мм} = 108.0$ Гр. сл. = V		БПЗ-710 $F \text{ см}^2 = 59.100$ $Q \text{ кг.} = 16.016$ $D \text{ оп.мм} = 105.0$ $P \text{ н.мм} = 334.2$ $P \text{ в.н.мм} = 183.7$ Гр. сл. = 0соб.

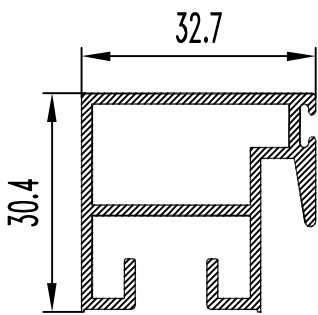
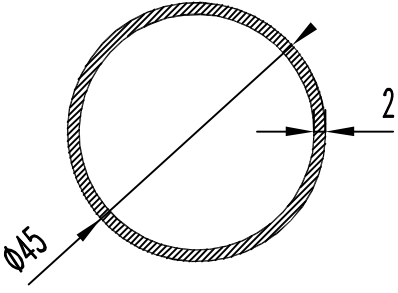
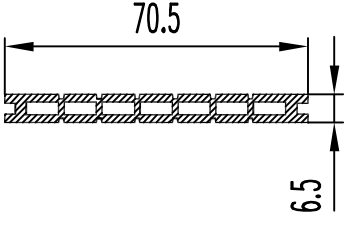
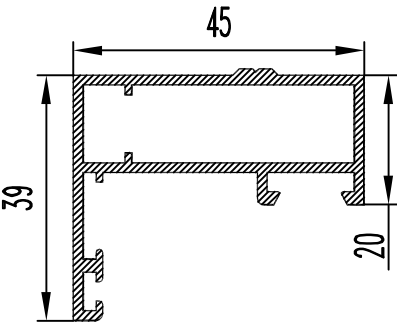
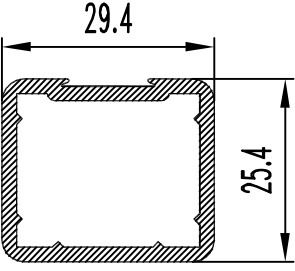
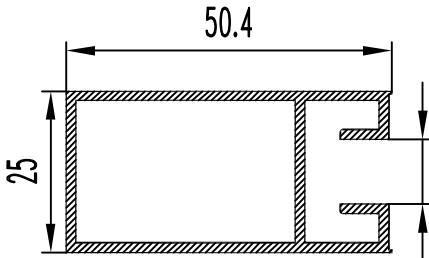
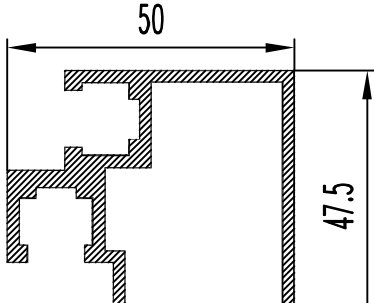
	БПЗ-711 $F \text{ см}^2 = 10.489$ $Q \text{ кг.} = 2.843$ $D \text{ оп.мм} = 151.0$ $P \text{ н.мм} = 311.0$ $P \text{ вн.мм} = 222.7$ Гр. сл. = 0соб. Точн. = П		
			БПЗ-717 $F \text{ см}^2 = 3.884$ $Q \text{ кг.} = 1.053$ $D \text{ оп.мм} = 61.1$ $P \text{ н.мм} = 277.8$ $P \text{ вн.мм} = 127.3$ Гр. сл. = VI Точн. = П
			БПЗ-718 $F \text{ см}^2 = 3.365$ $Q \text{ кг.} = 0.912$ $D \text{ оп.мм} = 62.5$ $P \text{ н.мм} = 267.7$ $P \text{ вн.мм} = 119.8$ Гр. сл. = VI Точн. = П
			
			

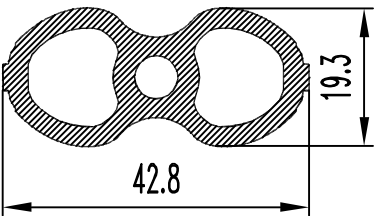
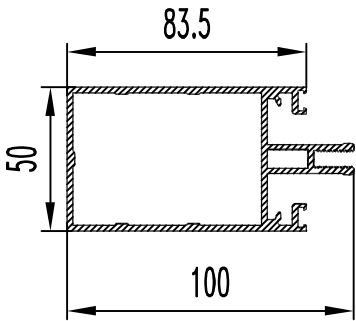
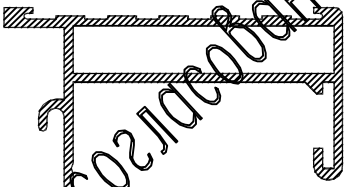
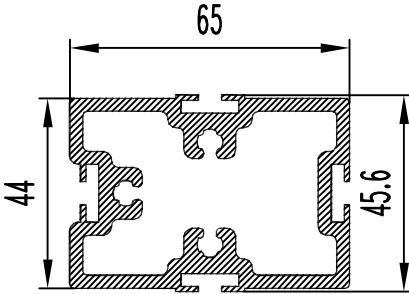
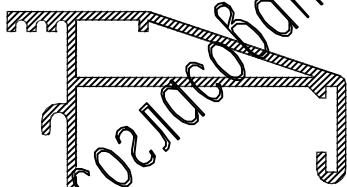
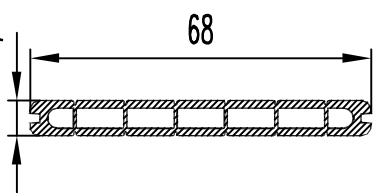
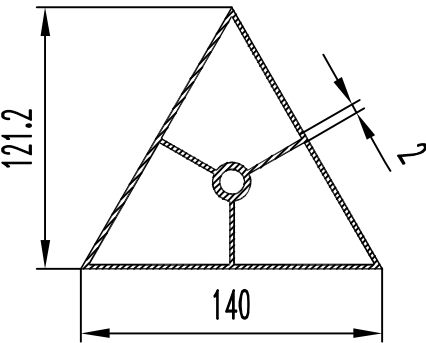
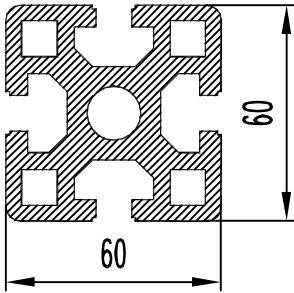
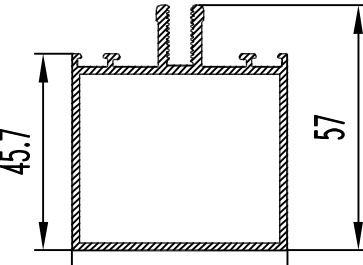
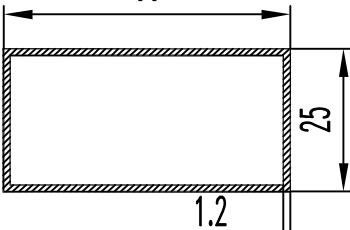
			БПЗ-726 $F \text{ см}^2 = 2.687$ $Q \text{ кг.} = 0.728$ $D \text{ оп.мм} = 38.3$ $P \text{ н.мм} = 262.8$ $P \text{ вн.мм} = 48.0$ Гр. сл. = III Точн. = П
			БПЗ-727 $F \text{ см}^2 = 6.942$ $Q \text{ кг.} = 1.881$ $D \text{ оп.мм} = 180.8$ $P \text{ н.мм} = 596.0$ $P \text{ вн.мм} = 164.0$ Гр. сл. = 0соб. Точн. = П
			БПЗ-728 $F \text{ см}^2 = 3.060$ $Q \text{ кг.} = 0.829$ $D \text{ оп.мм} = 45.3$ $P \text{ н.мм} = 242.0$ $P \text{ вн.мм} = 37.7$ Гр. сл. = 0соб. Точн. = П
	БПЗ-724 $F \text{ см}^2 = 2.021$ $Q \text{ кг.} = 0.548$ $D \text{ оп.мм} = 46.6$ $P \text{ н.мм} = 178.0$ $P \text{ вн.мм} = 82.0$ Гр. сл. = III Точн. = П		
	БПЗ-725 $F \text{ см}^2 = 2.171$ $Q \text{ кг.} = 0.588$ $D \text{ оп.мм} = 46.6$ $P \text{ н.мм} = 198.0$ $P \text{ вн.мм} = 82.0$ Гр. сл. = III		

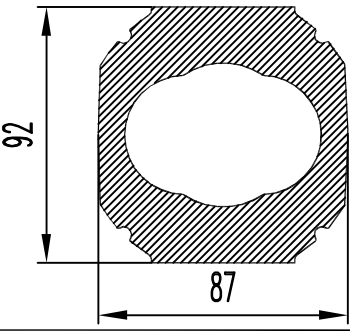
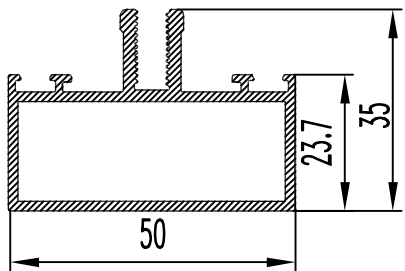
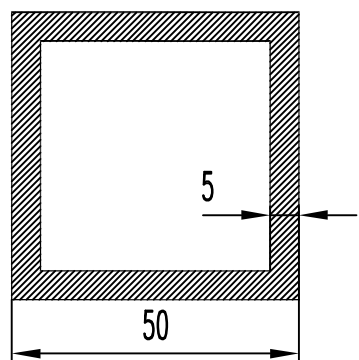
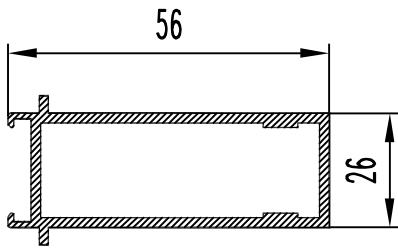
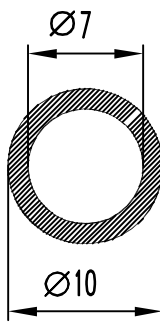
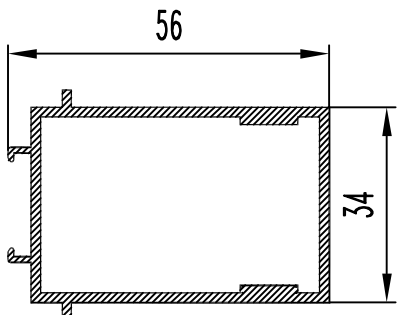
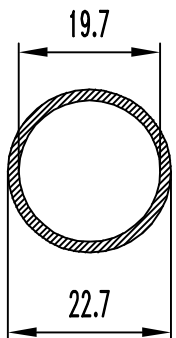
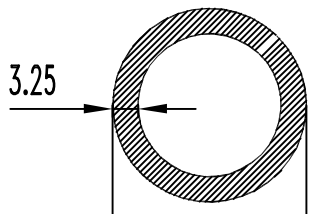
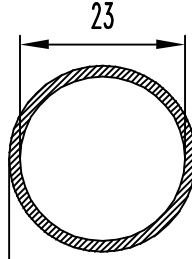
	БПЗ-731 $F \text{ см}^2 = 405.5$ $Q \text{ кг.} = 109.89$ $D \text{ оп.мм} = 79.0$ $P \text{ н.мм} = 246.4$ $P \text{ вн.мм} = 234.7$ Гр. сл. = 0соб. Точн. = П		БПЗ-736 $F \text{ см}^2 = 2.600$ $Q \text{ кг.} = 0.705$ $D \text{ оп.мм} = 42.3$ $P \text{ н.мм} = 205.6$ $P \text{ вн.мм} = 91.4$ Гр. сл. = V Точн. = Н
	БПЗ-732 $F \text{ см}^2 = 3.789$ $Q \text{ кг.} = 1.027$ $D \text{ оп.мм} = 59.9$ $P \text{ н.мм} = 210.8$ $P \text{ вн.мм} = 240.4$ Гр. сл. = 0соб. Точн. = 0соб.		БПЗ-737 $F \text{ см}^2 = 2.509$ $Q \text{ кг.} = 0.680$ $D \text{ оп.мм} = 45.0$ $P \text{ н.мм} = 200.4$ $P \text{ вн.мм} = 85.6$ Гр. сл. = VI Точн. = П
	БПЗ-733 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм} = 0$ $P \text{ н.мм} = 0$ $P \text{ вн.мм} = 0$ Гр. сл. = 0соб. Точн. = 0соб.		БПЗ-738 $F \text{ см}^2 = 3.490$ $Q \text{ кг.} = 0.946$ $D \text{ оп.мм} = 63.1$ $P \text{ н.мм} = 267.8$ $P \text{ вн.мм} = 112.3$ Гр. сл. = V Точн. = Н
	БПЗ-734 $F \text{ см}^2 = 3.267$ $Q \text{ кг.} = 0.885$ $D \text{ оп.мм} = 54.0$ $P \text{ н.мм} = 169.7$ $P \text{ вн.мм} = 157.1$ Гр. сл. = V Точн. = DIN		БПЗ-739 $F \text{ см}^2 = 3.440$ $Q \text{ кг.} = 0.932$ $D \text{ оп.мм} = 64.0$ $P \text{ н.мм} = 180.0$ $P \text{ вн.мм} = 164.0$ Гр. сл. = VI Точн. = DIN
	БПЗ-735 $F \text{ см}^2 = 4.524$ $Q \text{ кг.} = 1.226$ $D \text{ оп.мм} = 40.0$ $P \text{ н.мм} = 125.7$ $P \text{ вн.мм} = 100.5$		БПЗ-740 $F \text{ см}^2 = 2.795$ $Q \text{ кг.} = 0.757$ $D \text{ оп.мм} = 37.0$ $P \text{ н.мм} = 245.2$ $P \text{ вн.мм} = 37.7$

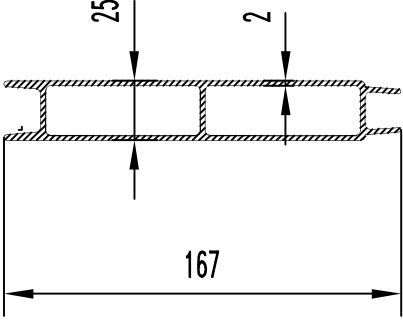
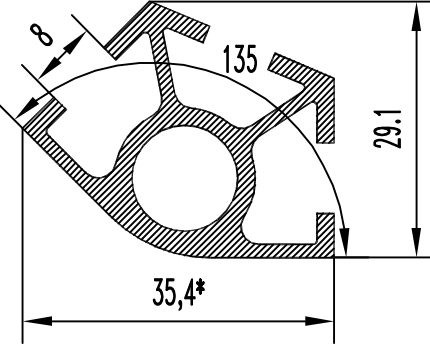
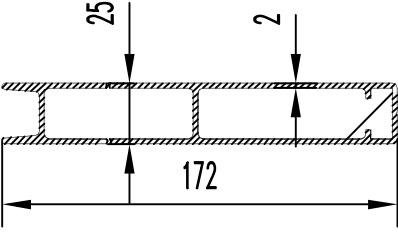
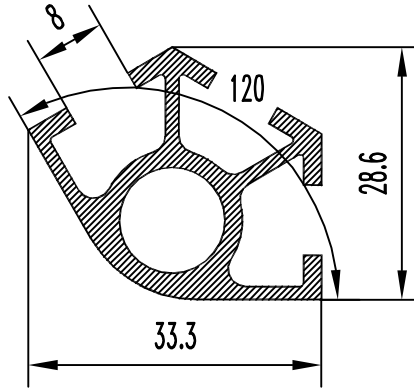
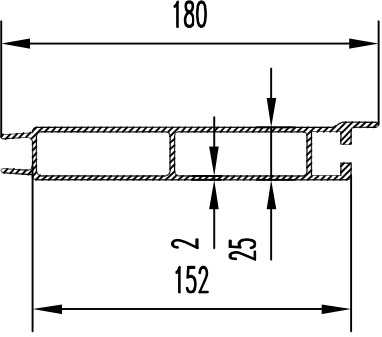
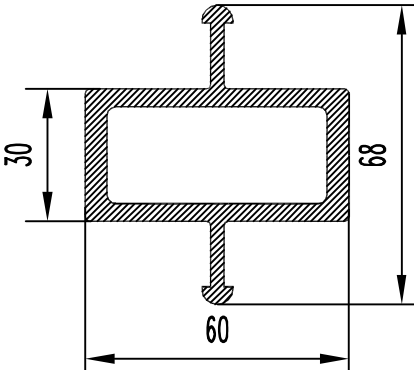
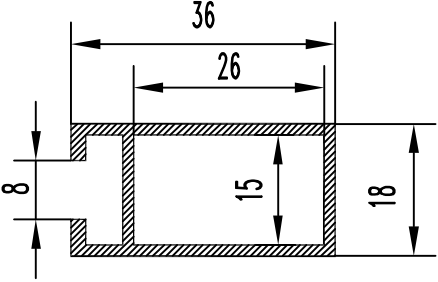
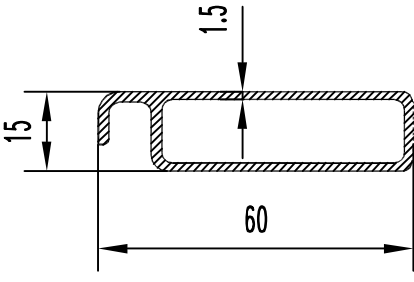
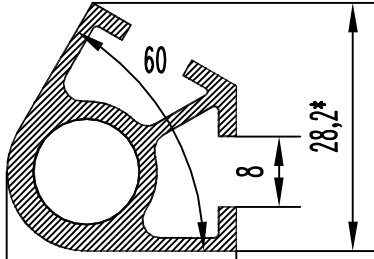
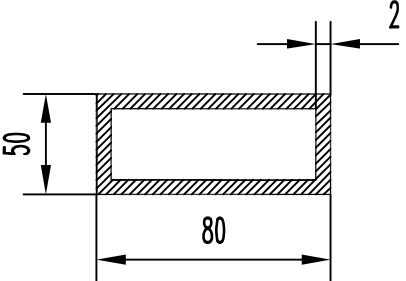
	БПЗ-741 $F \text{ см}^2 = 3.961$ $Q \text{ кг.} = 1.073$ $D \text{ оп.мм} = 78.1$ $P \text{ н.мм} = 356.0$ $P \text{ вн.мм} = 82.0$ Гр. сл. = 0соб. Точн. = П		БПЗ-746 $F \text{ см}^2 = 1.599$ $Q \text{ кг.} = 0.433$ $D \text{ оп.мм} = 46.0$ $P \text{ н.мм} = 118.7$ $P \text{ вн.мм} = 82.7$ Гр. сл. = 0соб. Точн. = П
	БПЗ-742 $F \text{ см}^2 = 4.840$ $Q \text{ кг.} = 1.312$ $D \text{ оп.мм} = 103.0$ $P \text{ н.мм} = 250.0$ $P \text{ вн.мм} = 234.0$ Гр. сл. = 0соб. Точн. = DIN		БПЗ-747 $F \text{ см}^2 = 1.380$ $Q \text{ кг.} = 0.374$ $D \text{ оп.мм} = 38.4$ $P \text{ н.мм} = 106.7$ $P \text{ вн.мм} = 68.7$ Гр. сл. = 0соб. Точн. = П
	БПЗ-743 $F \text{ см}^2 = 6.267$ $Q \text{ кг.} = 1.698$ $D \text{ оп.мм} = 61.0$ $P \text{ н.мм} = 190.0$ $P \text{ вн.мм} = 168.0$ Гр. сл. = IV Точн. = H		БПЗ-748 $F \text{ см}^2 = 1.321$ $Q \text{ кг.} = 0.358$ $D \text{ оп.мм} = 34.1$ $P \text{ н.мм} = 94.0$ $P \text{ вн.мм} = 82.0$ Гр. сл. = III Точн. = П
			БПЗ-749 $F \text{ см}^2 = 4.385$ $Q \text{ кг.} = 1.188$ $D \text{ оп.мм} = 48.7$ $P \text{ н.мм} = 414.7$ $P \text{ вн.мм} = 37.7$ Гр. сл. = 0соб. Точн. = П
	БПЗ-745 $F \text{ см}^2 = 6.660$ $Q \text{ кг.} = 1.805$ $D \text{ оп.мм} = 80.7$ $P \text{ н.мм} = 231.4$ $P \text{ вн.мм} = 212.6$ Гр. сл. = V		БПЗ-750 $F \text{ см}^2 = 3.617$ $Q \text{ кг.} = 0.980$ $D \text{ оп.мм} = 66.0$ $P \text{ н.мм} = 354.6$ $P \text{ вн.мм} = 0.0$ Гр. сл. = 0соб.

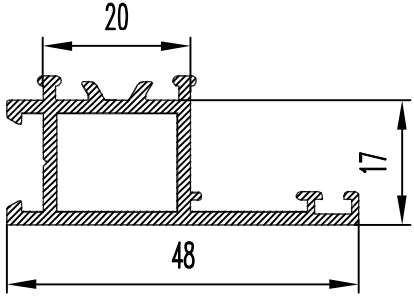
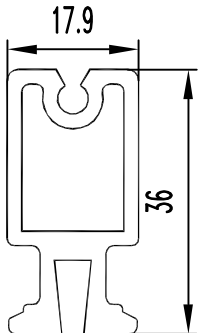
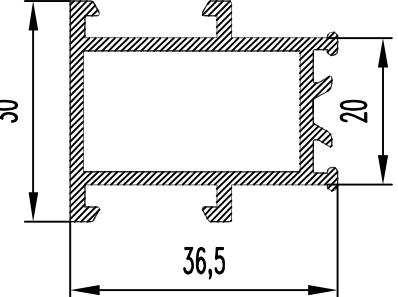
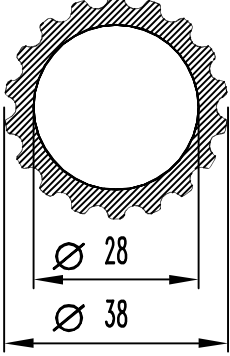
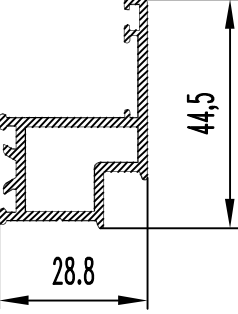
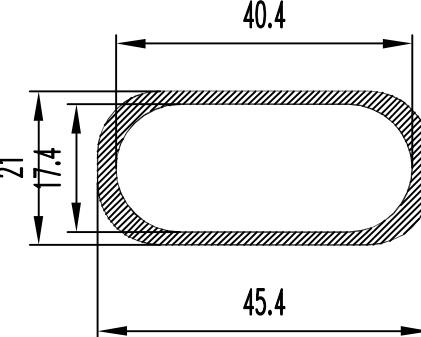
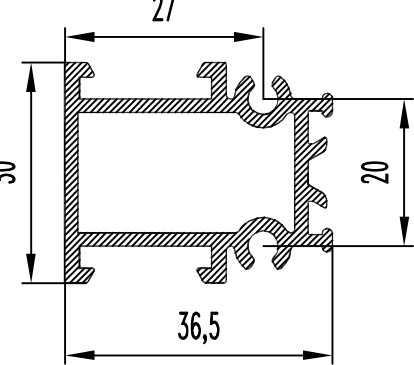
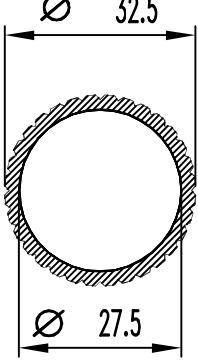
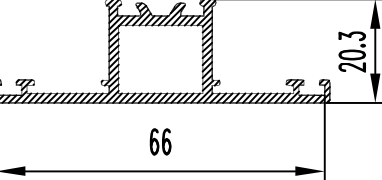
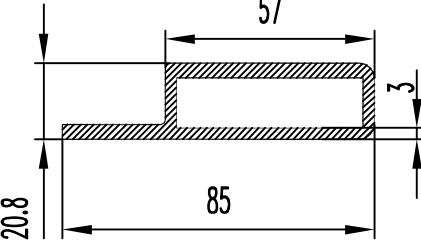
	БПЗ-751 $F \text{ см}^2 = 6.032$ $Q \text{ кг.} = 1.635$ $D \text{ оп.мм} = 38.0$ $P \text{ н.мм} = 119.4$ $P \text{ в.мм} = 81.7$ Гр. сл. = I Точн. = Н		БПЗ-756 $F \text{ см}^2 = 2.820$ $Q \text{ кг.} = 0.764$ $D \text{ оп.мм} = 40.0$ $P \text{ н.мм} = 127.0$ $P \text{ в.мм} = 97.4$ Гр. сл. = V Точн. = П
	БПЗ-752 $F \text{ см}^2 = 4.260$ $Q \text{ кг.} = 1.154$ $D \text{ оп.мм} = 28.0$ $P \text{ н.мм} = 55.9$ $P \text{ в.мм} = 88.0$ Гр. сл. = V Точн. = Н		БПЗ-757 $F \text{ см}^2 = 14.744$ $Q \text{ кг.} = 3.996$ $D \text{ оп.мм} = 53.9$ $P \text{ н.мм} = 152.8$ $P \text{ в.мм} = 44.0$ Гр. сл. = I Точн. = Н
	БПЗ-753 $F \text{ см}^2 = 10.170$ $Q \text{ кг.} = 2.756$ $D \text{ оп.мм} = 48.9$ $P \text{ н.мм} = 141.6$ $P \text{ в.мм} = 77.0$ Гр. сл. = II Точн. = Н		БПЗ-758 $F \text{ см}^2 = 2.010$ $Q \text{ кг.} = 0.545$ $D \text{ оп.мм} = 53.9$ $P \text{ н.мм} = 140.0$ $P \text{ в.мм} = 128.0$ Гр. сл. = 0соб. Точн. = DIN
	БПЗ-754 $F \text{ см}^2 = 6.080$ $Q \text{ кг.} = 1.648$ $D \text{ оп.мм} = 39.0$ $P \text{ н.мм} = 120.3$ $P \text{ в.мм} = 62.8$ Гр. сл. = III Точн. = Н		БПЗ-759 $F \text{ см}^2 = 6.110$ $Q \text{ кг.} = 1.656$ $D \text{ оп.мм} = 88.7$ $P \text{ н.мм} = 313.0$ $P \text{ в.мм} = 215.8$ Гр. сл. = VI Точн. = П
	БПЗ-755 $F \text{ см}^2 = 14.500$ $Q \text{ кг.} = 3.930$ $D \text{ оп.мм} = 125.0$ $P \text{ н.мм} = 485.3$ $P \text{ в.мм} = 94.3$ Гр. сл. = V		

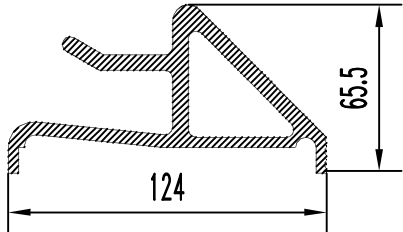
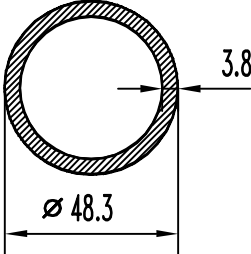
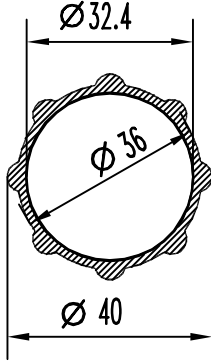
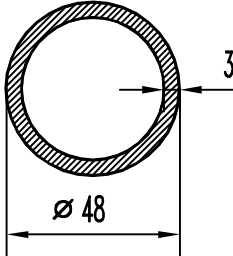
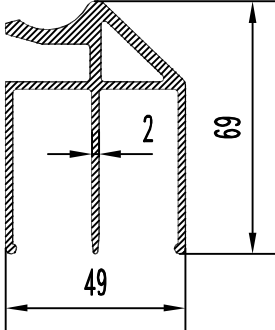
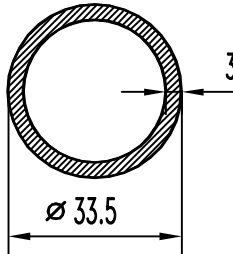
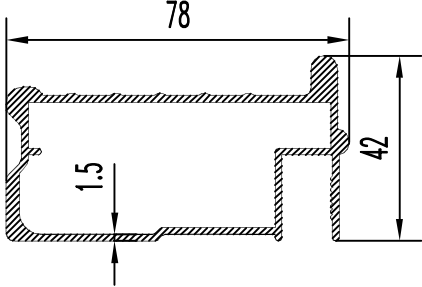
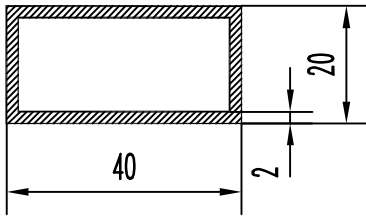
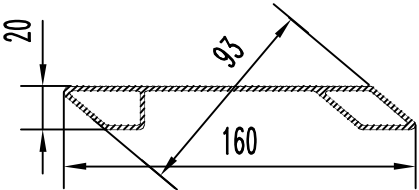
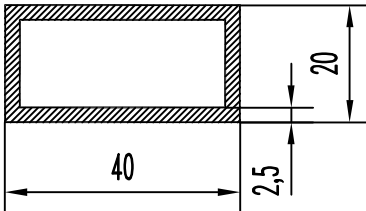
			БПЗ-766 $F \text{ см}^2 = 2.373$ $Q \text{ кг.} = 0.643$ $D \text{ оп.мм} = 45.0$ $P \text{ н.мм} = 223.3$ $P \text{ вн.мм} = 83.0$ $\Gamma \text{р. сл.} = 0 \text{соб.}$ $\text{Точн.} = \Pi$
	БПЗ-762 $F \text{ см}^2 = 2.700$ $Q \text{ кг.} = 0.732$ $D \text{ оп.мм} = 45.0$ $P \text{ н.мм} = 141.4$ $P \text{ вн.мм} = 121.8$ $\Gamma \text{р. сл.} = \text{IV}$ $\text{Точн.} =$		БПЗ-767 $F \text{ см}^2 = 2.744$ $Q \text{ кг.} = 0.744$ $D \text{ оп.мм} = 71.0$ $P \text{ н.мм} = 186.7$ $P \text{ вн.мм} = 147.0$ $\Gamma \text{р. сл.} = 0 \text{соб.}$ $\text{Точн.} = \Pi$
	БПЗ-763 $F \text{ см}^2 = 2.515$ $Q \text{ кг.} = 0.682$ $D \text{ оп.мм} = 58.9$ $P \text{ н.мм} = 215.8$ $P \text{ вн.мм} = 114.0$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \Pi$		
	БПЗ-764 $F \text{ см}^2 = 2.048$ $Q \text{ кг.} = 0.555$ $D \text{ оп.мм} = 37.0$ $P \text{ н.мм} = 109.9$ $P \text{ вн.мм} = 99.1$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \Pi$		
	БПЗ-765 $F \text{ см}^2 = 2.520$ $Q \text{ кг.} = 0.683$ $D \text{ оп.мм} = 56.3$ $P \text{ н.мм} = 225.3$ $P \text{ вн.мм} = 112.0$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \Pi$		БПЗ-770 $F \text{ см}^2 = 4.680$ $Q \text{ кг.} = 1.268$ $D \text{ оп.мм} = 63.0$ $P \text{ н.мм} = 257.8$ $P \text{ вн.мм} = 149.0$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \Pi$

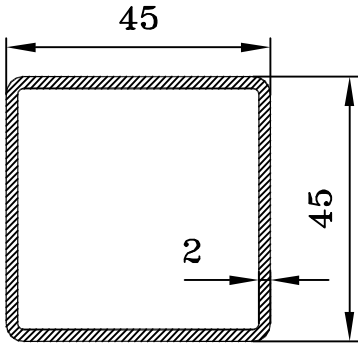
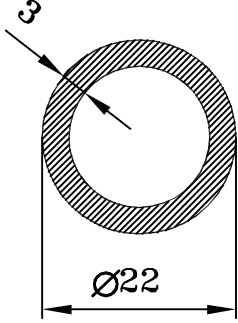
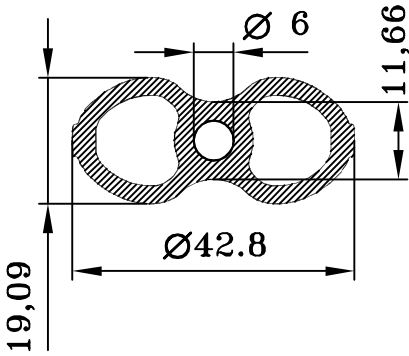
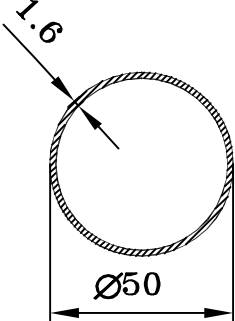
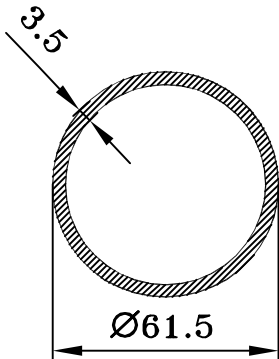
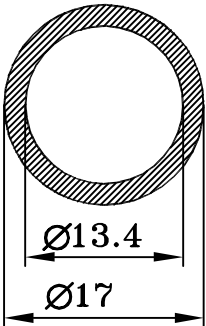
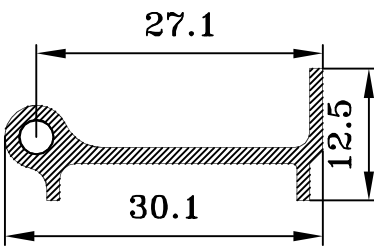
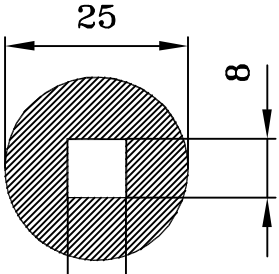
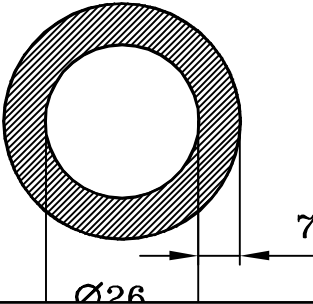
	БПЗ-771 $F \text{ см}^2 = 3.259$ $Q \text{ кг.} = 0.883$ $D \text{ оп.мм} = 43.0$ $P \text{ н.мм} = 111.8$ $P \text{ вн.мм} = 105.8$ Гр. сл. = 0соб. Точн. = П		БПЗ-776 $F \text{ см}^2 = 7.232$ $Q \text{ кг.} = 1.960$ $D \text{ оп.мм} = 108.0$ $P \text{ н.мм} = 454.0$ $P \text{ вн.мм} = 273.0$ Гр. сл. = VI Точн. = П
			БПЗ-777 $F \text{ см}^2 = 9.458$ $Q \text{ кг.} = 2.563$ $D \text{ оп.мм} = 78$ $P \text{ н.мм} = 321.0$ $P \text{ вн.мм} = 297.6$ Гр. сл. = VI Точн. = П
			БПЗ-778 $F \text{ см}^2 = 2.342$ $Q \text{ кг.} = 0.635$ $D \text{ оп.мм} = 68.1$ $P \text{ н.мм} = 167.9$ $P \text{ вн.мм} = 164.8$ Гр. сл. = 0соб. Точн. = П
	БПЗ-774 $F \text{ см}^2 = 11.370$ $Q \text{ кг.} = 3.081$ $D \text{ оп.мм} = 165.0$ $P \text{ н.мм} = 420.0$ $P \text{ вн.мм} = 658.3$ Гр. сл. = 0соб. Точн. = Н		БПЗ-779 $F \text{ см}^2 = 18.940$ $Q \text{ кг.} = 5.133$ $D \text{ оп.мм} = 81.5$ $P \text{ н.мм} = 441.7$ $P \text{ вн.мм} = 207.0$ Гр. сл. = 0соб. Точн. = Н
	БПЗ-775 $F \text{ см}^2 = 3.940$ $Q \text{ кг.} = 1.07$ $D \text{ оп.мм} = 67.0$ $P \text{ н.мм} = 291.3$ $P \text{ вн.мм} = 171.8$ Гр. сл. = VI		БПЗ-780 $F \text{ см}^2 = 1.742$ $Q \text{ кг.} = 0.472$ $D \text{ оп.мм} = 56.0$ $P \text{ н.мм} = 150.0$ $P \text{ вн.мм} = 140.0$ Гр. сл. = 0соб.

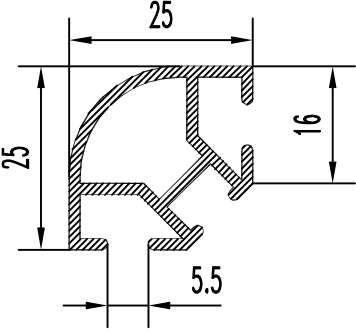
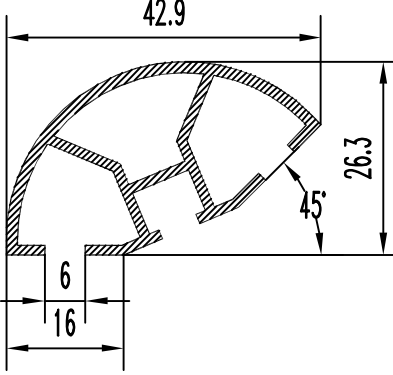
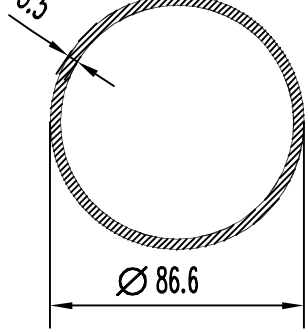
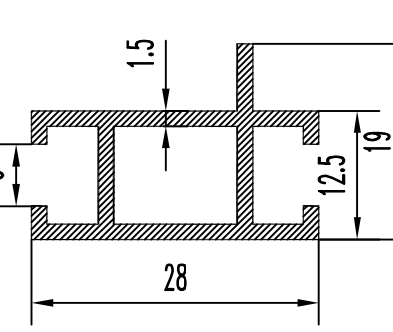
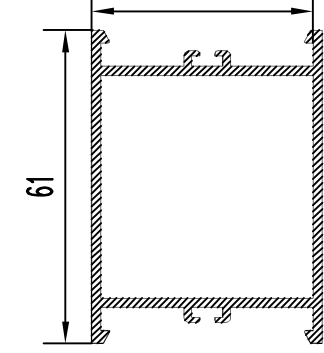
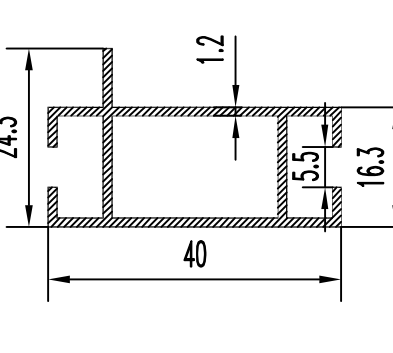
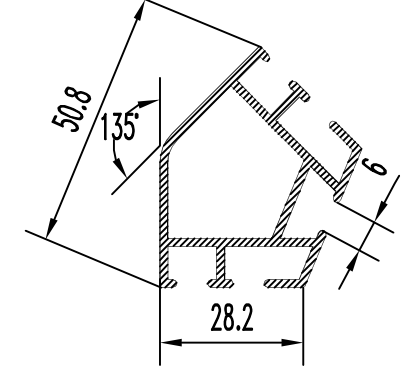
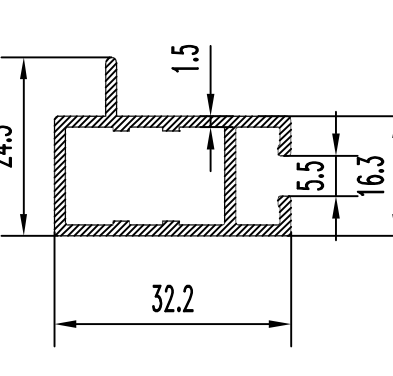
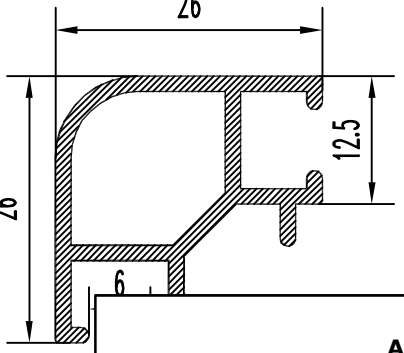
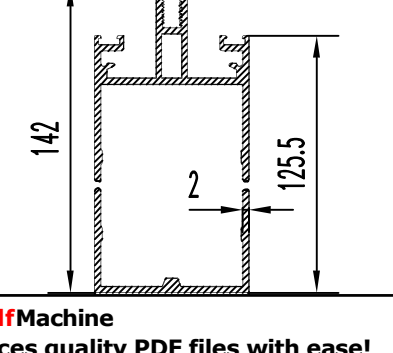
			БПЗ-786 $F \text{ см}^2 = 44.070$ $Q \text{ кг.} = 11.943$ $D \text{ оп.мм} = 105.0$ $P \text{ н.мм} = 323.5$ $P \text{ вн.мм} = 187.9$ Гр. сл. = V Точн. = П
	БПЗ-782 $F \text{ см}^2 = 3.200$ $Q \text{ кг.} = 0.867$ $D \text{ оп.мм} = 55.0$ $P \text{ н.мм} = 247.0$ $P \text{ вн.мм} = 128.0$ Гр. сл. = VI Точн. = П		БПЗ-787 $F \text{ см}^2 = 9.000$ $Q \text{ кг.} = 2.439$ $D \text{ оп.мм} = 71.0$ $P \text{ н.мм} = 200.0$ $P \text{ вн.мм} = 160.0$ Гр. сл. = III Точн. = DIN
	БПЗ-783 $F \text{ см}^2 = 2.620$ $Q \text{ кг.} = 0.710$ $D \text{ оп.мм} = 59.3$ $P \text{ н.мм} = 177.0$ $P \text{ вн.мм} = 134.0$ Гр. сл. = V Точн. = П		БПЗ-788 $F \text{ см}^2 = 0,400$ $Q \text{ кг.} = 0.108$ $D \text{ оп.мм} = 10.0$ $P \text{ н.мм} = 31,4$ $P \text{ вн.мм} = 22$ Гр. сл. = V Точн. = П
	БПЗ-784 $F \text{ см}^2 = 3.260$ $Q \text{ кг.} = 0.883$ $D \text{ оп.мм} = 62.5$ $P \text{ н.мм} = 205.0$ $P \text{ вн.мм} = 164.0$ Гр. сл. = V Точн. = П		БПЗ-789 $F \text{ см}^2 = 4.000$ $Q \text{ кг.} = 1.084$ $D \text{ оп.мм} = 22.7$ $P \text{ н.мм} = 142.6$ $P \text{ вн.мм} = 123.8$ Гр. сл. = VI Точн. = П
	БПЗ-785 $F \text{ см}^2 = 1.710$ $Q \text{ кг.} = 0.463$ $D \text{ оп.мм} = 20.0$ $P \text{ н.мм} = 62.8$ $P \text{ вн.мм} = 42.4$ Гр. сл. = V Точн. = П		БПЗ-790 $F \text{ см}^2 = 4.620$ $Q \text{ кг.} = 1.252$ $D \text{ оп.мм} = 26$ $P \text{ н.мм} = 163.4$ $P \text{ вн.мм} = 144.5$ Гр. сл. = VI Точн. = П

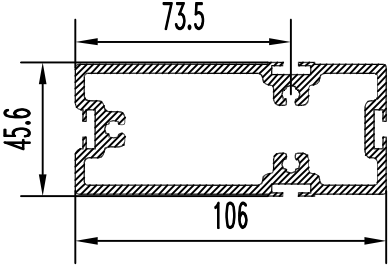
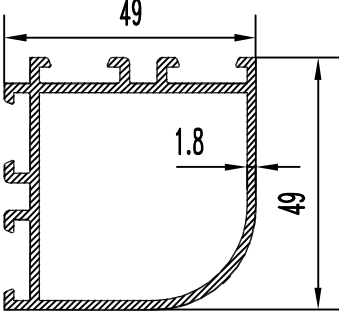
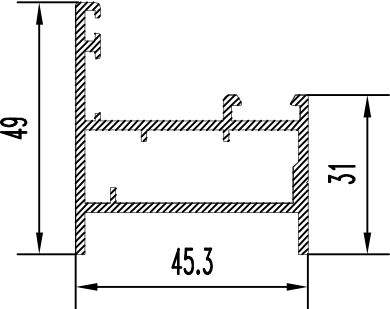
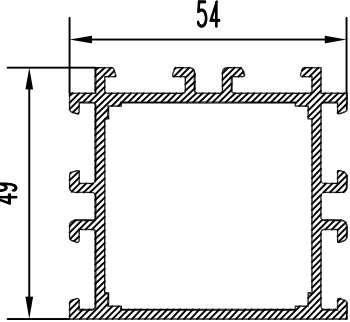
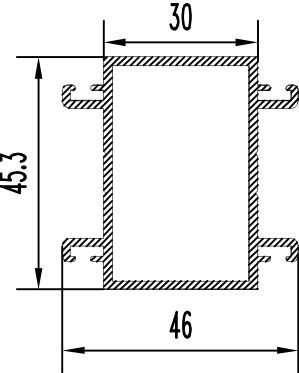
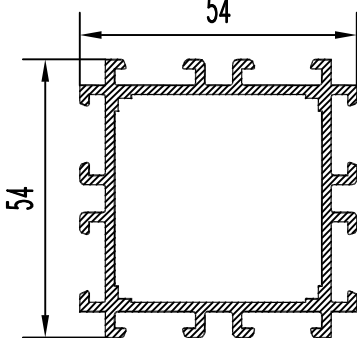
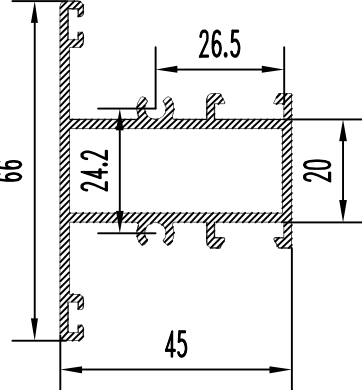
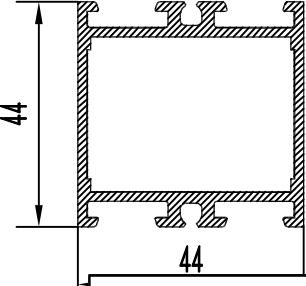
	БПЗ-791 $F \text{ см}^2 = 8.300$ $Q \text{ кг.} = 2.249$ $D \text{ оп.мм} = 168$ $P \text{ н.мм} = 434.2$ $P \text{ вн.мм} = 338.2$ Гр. сл. = Особ. Точн. = Н		БПЗ-796 $F \text{ см}^2 = 2.492$ $Q \text{ кг.} = 0.675$ $D \text{ оп.мм} = 38.3$ $P \text{ н.мм} = 199.3$ $P \text{ вн.мм} = 37.7$ Гр. сл. = Особ. Точн. = П
	БПЗ-792 $F \text{ см}^2 = 8.648$ $Q \text{ кг.} = 2.344$ $D \text{ оп.мм} = 173$ $P \text{ н.мм} = 418.2$ $P \text{ вн.мм} = 394.1$ Гр. сл. = Особ. Точн. = Н		БПЗ-797 $F \text{ см}^2 = 2.352$ $Q \text{ кг.} = 0.638$ $D \text{ оп.мм} = 38.3$ $P \text{ н.мм} = 185.7$ $P \text{ вн.мм} = 37.7$ Гр. сл. = Особ. Точн. = П
	БПЗ-793 $F \text{ см}^2 = 9.055$ $Q \text{ кг.} = 2.454$ $D \text{ оп.мм} = 181.4$ $P \text{ н.мм} = 497.6$ $P \text{ вн.мм} = 331.1$ Гр. сл. = Особ. Точн. = Н		БПЗ-798 $F \text{ см}^2 = 8.389$ $Q \text{ кг.} = 2.273$ $D \text{ оп.мм} = 69$ $P \text{ н.мм} = 262.6$ $P \text{ вн.мм} = 140.6$ Гр. сл. = IV Точн. = Н
	БПЗ-794 $F \text{ см}^2 = 1.671$ $Q \text{ кг.} = 0.453$ $D \text{ оп.мм} = 40.2$ $P \text{ н.мм} = 136.0$ $P \text{ вн.мм} = 82$ Гр. сл. = III Точн. = П		БПЗ-799 $F \text{ см}^2 = 2.287$ $Q \text{ кг.} = 0.620$ $D \text{ оп.мм} = 60.7$ $P \text{ н.мм} = 161.1$ $P \text{ вн.мм} = 112.6$ Гр. сл. = IV Точн. = П
	БПЗ-795 $F \text{ см}^2 = 2.143$ $Q \text{ кг.} = 0.581$ $D \text{ оп.мм} = 33$ $P \text{ н.мм} = 150.1$ $P \text{ вн.мм} = 37.7$ Гр. сл. = Особ. Точн. = П		БПЗ-800 $F \text{ см}^2 = 5.040$ $Q \text{ кг.} = 1.366$ $D \text{ оп.мм} = 95.0$ $P \text{ н.мм} = 260.0$ $P \text{ вн.мм} = 244.0$ Гр. сл. = Особ. Точн. = П

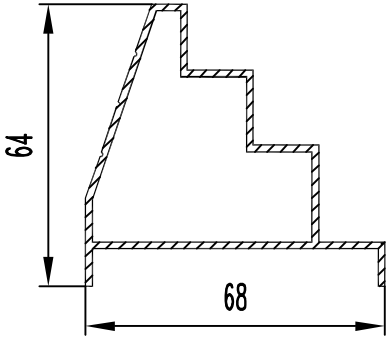
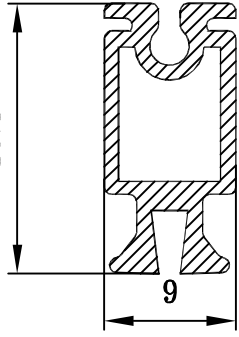
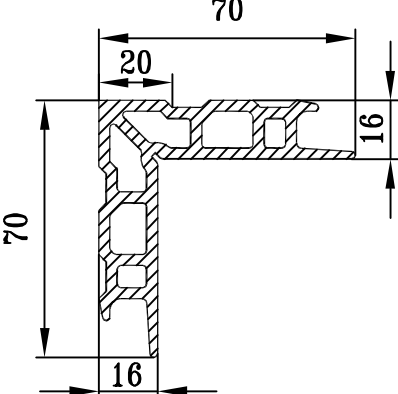
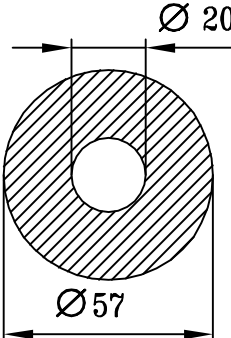
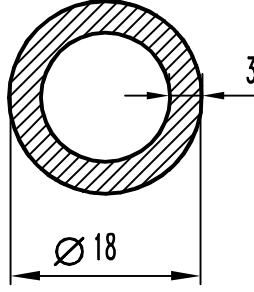
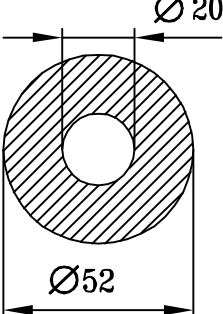
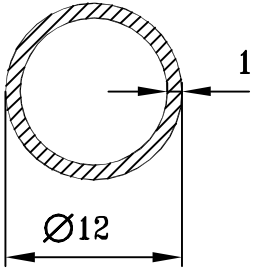
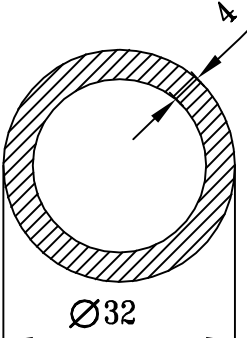
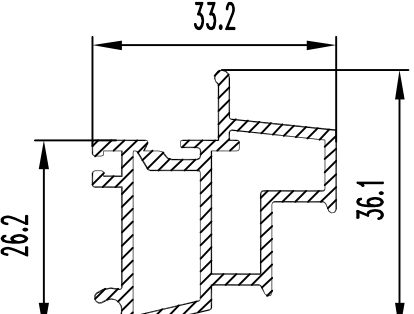
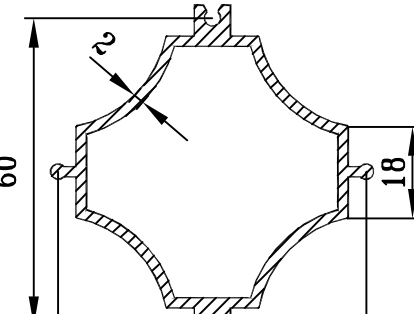
	БПЗ-811 $F \text{ см}^2 = 2.160$ $Q \text{ кг.} = 0.585$ $D \text{ оп.мм} = 50.7$ $P \text{ н.мм} = 194.3$ $P \text{ вн.мм} = 59.6$ Гр. сл. = V Точн. = Н		БПЗ-816 $F \text{ см}^2 = 2.66$ $Q \text{ кг.} = 0.728$ $D \text{ оп.мм} = 39.1$ $P \text{ н.мм} = 147.9$ $P \text{ вн.мм} = 78.9$ Гр. сл. = VI Точн. = Н
	БПЗ-812 $F \text{ см}^2 = 2.560$ $Q \text{ кг.} = 0.694$ $D \text{ оп.мм} = 44.8$ $P \text{ н.мм} = 188.7$ $P \text{ вн.мм} = 92.0$ Гр. сл. = IV Точн. = Н		БПЗ-817 $F \text{ см}^2 = 4.056$ $Q \text{ кг.} = 1.099$ $D \text{ оп.мм} = 38$ $P \text{ н.мм} = 148.6$ $P \text{ вн.мм} = 88$ Гр. сл. = III Точн. = П
	БПЗ-813 $F \text{ см}^2 = 2.280$ $Q \text{ кг.} = 0.618$ $D \text{ оп.мм} = 51.9$ $P \text{ н.мм} = 188.5$ $P \text{ вн.мм} = 76.2$ Гр. сл. = V Точн. = Н		БПЗ-818 $F \text{ см}^2 = 2.534$ $Q \text{ кг.} = 0.687$ $D \text{ оп.мм} = 46$ $P \text{ н.мм} = 118.2$ $P \text{ вн.мм} = 100.7$ Гр. сл. = V Точн. = П
	БПЗ-814 $F \text{ см}^2 = 2.840$ $Q \text{ кг.} = 0.770$ $D \text{ оп.мм} = 44.8$ $P \text{ н.мм} = 215.4$ $P \text{ вн.мм} = 94.5$ Гр. сл. = IV Точн. = Н		БПЗ-819 $F \text{ см}^2 = 2.179$ $Q \text{ кг.} = 0.591$ $D \text{ оп.мм} = 32.5$ $P \text{ н.мм} = 121.5$ $P \text{ вн.мм} = 86.4$ Гр. сл. = IV Точн. = П
	БПЗ-815 $F \text{ см}^2 = 2.440$ $Q \text{ кг.} = 0.661$ $D \text{ оп.мм} = 66.1$ $P \text{ н.мм} = 232.4$ $P \text{ вн.мм} = 59.6$ Гр. сл. = V Точн. = Н		БПЗ-820 $F \text{ см}^2 = 5.869$ $Q \text{ кг.} = 1.590$ $D \text{ оп.мм} = 87$ $P \text{ н.мм} = 207.1$ $P \text{ вн.мм} = 129.6$ Гр. сл. = V Точн. = Н

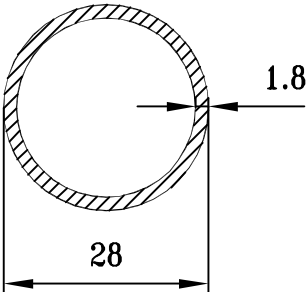
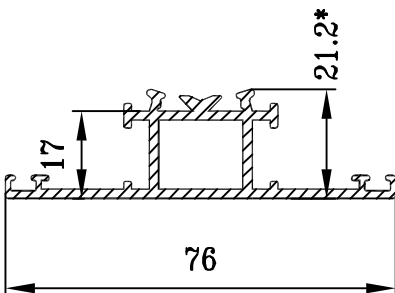
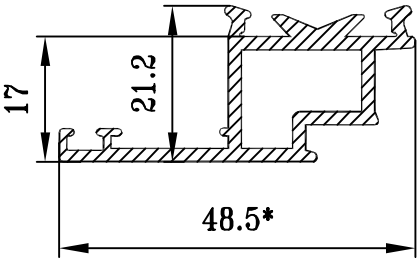
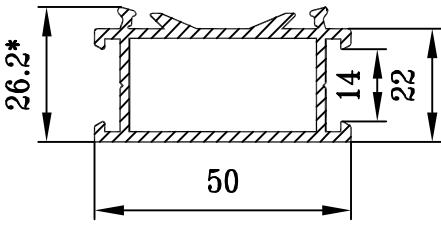
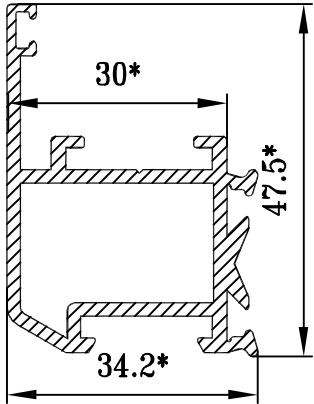
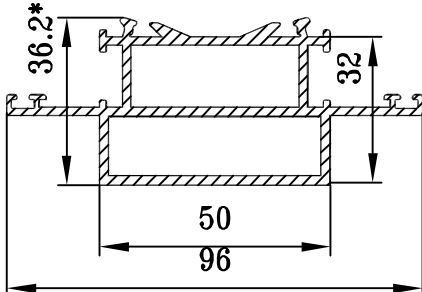
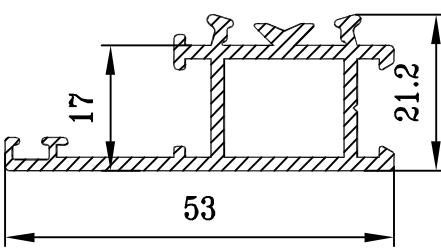
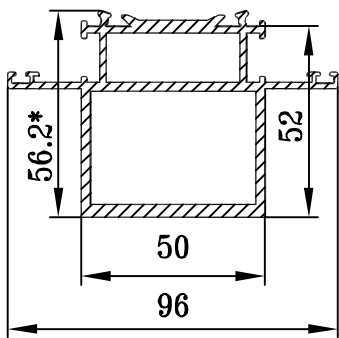
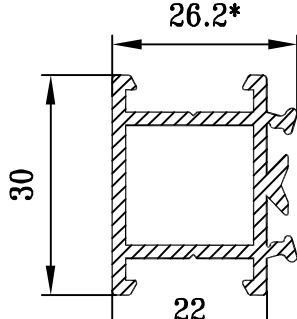
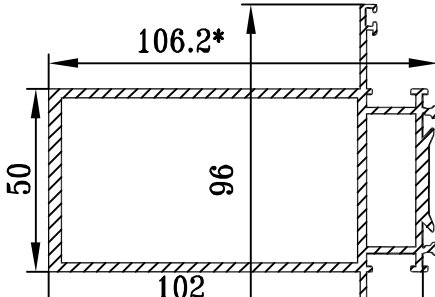
	БПЗ-821 $F \text{ см}^2 = 4.106$ $Q \text{ кг.} = 1.113$ $D \text{ оп.мм} = 63$ $P \text{ н.мм} = 231$ $P \text{ вн.мм} = 69.6$ Гр. сл. = VI Точн. = Н		БПЗ-826 $F \text{ см}^2 = 5.313$ $Q \text{ кг.} = 1.440$ $D \text{ оп.мм} = 48.3$ $P \text{ н.мм} = 151.7$ $P \text{ вн.мм} = 127.9$ Гр. сл. = II Точн. = П
	БПЗ-822 $F \text{ см}^2 = 2.629$ $Q \text{ кг.} = 0.712$ $D \text{ оп.мм} = 40$ $P \text{ н.мм} = 129.5$ $P \text{ вн.мм} = 101.8$ Гр. сл. = V Точн. = Н		БПЗ-827 $F \text{ см}^2 = 4.241$ $Q \text{ кг.} = 1.149$ $D \text{ оп.мм} = 48$ $P \text{ н.мм} = 150.8$ $P \text{ вн.мм} = 132$ Гр. сл. = II Точн. = П
	БПЗ-823 $F \text{ см}^2 = 6.395$ $Q \text{ кг.} = 1.733$ $D \text{ оп.мм} = 79$ $P \text{ н.мм} = 440.1$ $P \text{ вн.мм} = 57$ Гр. сл. = 0соб. Точн. = Н		БПЗ-828 $F \text{ см}^2 = 2.875$ $Q \text{ кг.} = 0.779$ $D \text{ оп.мм} = 33.5$ $P \text{ н.мм} = 105.2$ $P \text{ вн.мм} = 86.4$ Гр. сл. = II Точн. = П
	БПЗ-824 $F \text{ см}^2 = 4.709$ $Q \text{ кг.} = 1.276$ $D \text{ оп.мм} = 84$ $P \text{ н.мм} = 281.1$ $P \text{ вн.мм} = 202.2$ Гр. сл. = 0соб. Точн. = Н		БПЗ-829 $F \text{ см}^2 = 2.240$ $Q \text{ кг.} = 0.607$ $D \text{ оп.мм} = 45$ $P \text{ н.мм} = 120$ $P \text{ вн.мм} = 104$ Гр. сл. = V Точн. = П
	БПЗ-825 $F \text{ см}^2 = 5.835$ $Q \text{ кг.} = 1.581$ $D \text{ оп.мм} = 161$ $P \text{ н.мм} = 371.3$ $P \text{ вн.мм} = 171.3$ Гр. сл. = 0соб. Точн. = Н		БПЗ-830 $F \text{ см}^2 = 2.750$ $Q \text{ кг.} = 0.745$ $D \text{ оп.мм} = 45$ $P \text{ н.мм} = 120$ $P \text{ вн.мм} = 100$ Гр. сл. = V Точн. = П

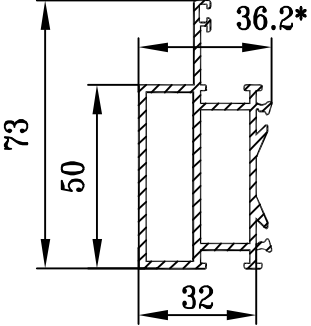
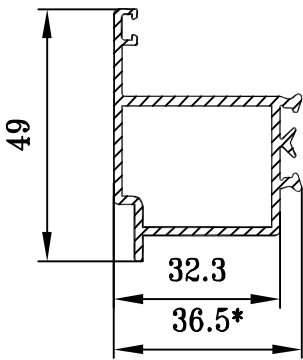
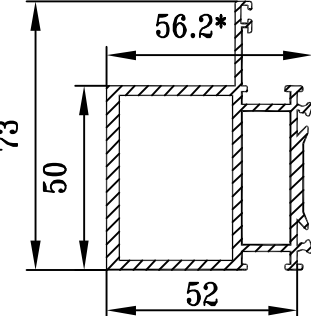
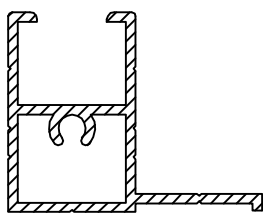
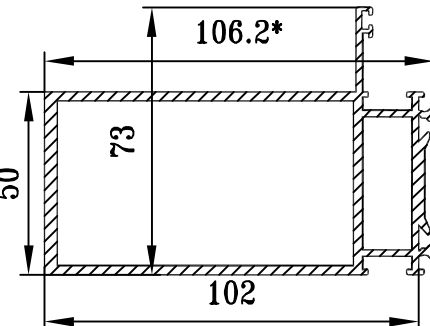
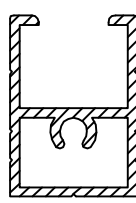
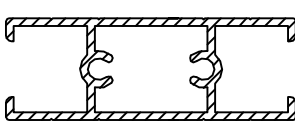
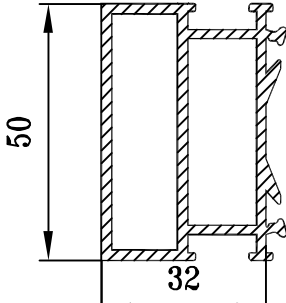
	БПЗ-831 $F \text{ см}^2 = 1.9$ $Q \text{ кг.} = 0.515$ $D \text{ оп.мм} = 70.01$ $P \text{ н.мм} = 199.2$ $P \text{ вн.мм} = 49.8$ Гр. сл. = IV Точн. = Н		БПЗ-836 $F \text{ см}^2 = 3.372$ $Q \text{ кг.} = 0.914$ $D \text{ оп.мм} = 61.2$ $P \text{ н.мм} = 174.9$ $P \text{ вн.мм} = 162.3$ Гр. сл. = VI Точн. = DIN
	БПЗ-832 $F \text{ см}^2 = 1.790$ $Q \text{ кг.} = 0.485$ $D \text{ оп.мм} = 22$ $P \text{ н.мм} = 69.1$ $P \text{ вн.мм} = 50.3$ Гр. сл. = II Точн. = Н		БПЗ-837 $F \text{ см}^2 = 3.237$ $Q \text{ кг.} = 0.877$ $D \text{ оп.мм} = 43$ $P \text{ н.мм} = 109.6$ $P \text{ вн.мм} = 105.8$ Гр. сл. = Особ. Точн. = П
	БПЗ-833 $F \text{ см}^2 = 2.433$ $Q \text{ кг.} = 0.659$ $D \text{ оп.мм} = 50$ $P \text{ н.мм} = 157.1$ $P \text{ вн.мм} = 147$ Гр. сл. = V Точн. = П		БПЗ-838 $F \text{ см}^2 = 6.378$ $Q \text{ кг.} = 1.728$ $D \text{ оп.мм} = 62$ $P \text{ н.мм} = 193.2$ $P \text{ вн.мм} = 171.2$ Гр. сл. = IV Точн. = Н
	БПЗ-834 $F \text{ см}^2 = 0.859$ $Q \text{ кг.} = 0.233$ $D \text{ оп.мм} = 17$ $P \text{ н.мм} = 53.4$ $P \text{ вн.мм} = 42.1$ Гр. сл. = VI Точн. = П		БПЗ-839 $F \text{ см}^2 = 0.775$ $Q \text{ кг.} = 0.210$ $D \text{ оп.мм} = 31$ $P \text{ н.мм} = 92.2$ $P \text{ вн.мм} = 10.1$ Гр. сл. = V Точн. = П
	БПЗ-835 $F \text{ см}^2 = 4.269$ $Q \text{ кг.} = 1.157$ $D \text{ оп.мм} = 25$ $P \text{ н.мм} = 78.5$ $P \text{ вн.мм} = 32$ Гр. сл. = IV		БПЗ-840 $F \text{ см}^2 = 7.270$ $Q \text{ кг.} = 1.970$ $D \text{ оп.мм} = 40$ $P \text{ н.мм} = 125.7$ $P \text{ вн.мм} = 81.7$ Гр. сл. = II

	БПЗ-841 $F \text{ см}^2 = 1.616$ $Q \text{ кг.} = 0.438$ $D \text{ оп.мм} = 35.4$ $P \text{ н.мм} = 159$ $P \text{ вн.мм} = 54.8$ $\Gamma \text{р. сл.} = \text{Особ.}$ $\text{Точн.} = \text{П}$		БПЗ-846 $F \text{ см}^2 = 1.890$ $Q \text{ кг.} = 0.590$ $D \text{ оп.мм} = 46.4$ $P \text{ н.мм} = 215.5$ $P \text{ вн.мм} = 57.2$ $\Gamma \text{р. сл.} = \text{Особ.}$ $\text{Точн.} = \text{П}$
	БПЗ-842 $F \text{ см}^2 = 9.137$ $Q \text{ кг.} = 2.476$ $D \text{ оп.мм} = 86.6$ $P \text{ н.мм} = 272.1$ $P \text{ вн.мм} = 250.1$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$		БПЗ-847 $F \text{ см}^2 = 1.328$ $Q \text{ кг.} = 0.360$ $D \text{ оп.мм} = 32$ $P \text{ н.мм} = 134$ $P \text{ вн.мм} = 43$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$
	БПЗ-843 $F \text{ см}^2 = 4.033$ $Q \text{ кг.} = 1.093$ $D \text{ оп.мм} = 75.8$ $P \text{ н.мм} = 283$ $P \text{ вн.мм} = 170$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$		БПЗ-848 $F \text{ см}^2 = 1.592$ $Q \text{ кг.} = 0.431$ $D \text{ оп.мм} = 45.9$ $P \text{ н.мм} = 192.2$ $P \text{ вн.мм} = 73.0$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$
	БПЗ-844 $F \text{ см}^2 = 2.837$ $Q \text{ кг.} = 0.770$ $D \text{ оп.мм} = 51.5$ $P \text{ н.мм} = 282.8$ $P \text{ вн.мм} = 91.7$ $\Gamma \text{р. сл.} = \text{Особ.}$ $\text{Точн.} = \text{П}$		БПЗ-849 $F \text{ см}^2 = 1.650$ $Q \text{ кг.} = 0.447$ $D \text{ оп.мм} = 40$ $P \text{ н.мм} = 141.8$ $P \text{ вн.мм} = 73.5$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$
	БПЗ-845 $F \text{ см}^2 = 1.590$ $Q \text{ кг.} = 0.431$ $D \text{ оп.мм} = 37.2$ $P \text{ н.мм} = 155.6$ $P \text{ вн.мм} = 54.3$ $\Gamma \text{р. сл.} = \text{Особ.}$ $\text{Точн.} = \text{П}$		БПЗ-850 $F \text{ см}^2 = 9.024$ $Q \text{ кг.} = 2.446$ $D \text{ оп.мм} = 147.0$ $P \text{ н.мм} = 538.6$ $P \text{ вн.мм} = 355.2$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$

	БПЗ-851 $F \text{ см}^2 = 11.920$ $Q \text{ кг.} = 3.23$ $D \text{ оп.мм} = 114$ $P \text{ н.мм} = 402.4$ $P \text{ вн.мм} = 379,6$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		
	БПЗ-852 $F \text{ см}^2 = 3.909$ $Q \text{ кг.} = 1.059$ $D \text{ оп.мм} = 69.3$ $P \text{ н.мм} = 275.6$ $P \text{ вн.мм} = 153.8$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		БПЗ-857 $F \text{ см}^2 = 3.386$ $Q \text{ кг.} = 0.918$ $D \text{ оп.мм} = 66.4$ $P \text{ н.мм} = 254$ $P \text{ вн.мм} = 126$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$
	БПЗ-853 $F \text{ см}^2 = 4.730$ $Q \text{ кг.} = 1.28$ $D \text{ оп.мм} = 69.6$ $P \text{ н.мм} = 338.1$ $P \text{ вн.мм} = 161.6$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		БПЗ-858 $F \text{ см}^2 = 3.201$ $Q \text{ кг.} = 0.867$ $D \text{ оп.мм} = 56.5$ $P \text{ н.мм} = 261$ $P \text{ вн.мм} = 137$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$
	БПЗ-854 $F \text{ см}^2 = 5.240$ $Q \text{ кг.} = 1.420$ $D \text{ оп.мм} = 62.2$ $P \text{ н.мм} = 392.1$ $P \text{ вн.мм} = 161.6$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		БПЗ-859 $F \text{ см}^2 = 3.920$ $Q \text{ кг.} = 1.061$ $D \text{ оп.мм} = 70$ $P \text{ н.мм} = 336$ $P \text{ вн.мм} = 115$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$
	БПЗ-855 $F \text{ см}^2 = 3.980$ $Q \text{ кг.} = 1.070$ $D \text{ оп.мм} = 62.1$ $P \text{ н.мм} = 267.4$ $P \text{ вн.мм} = 141.3$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		

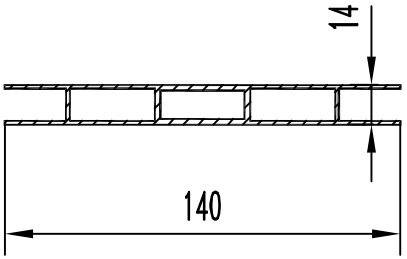
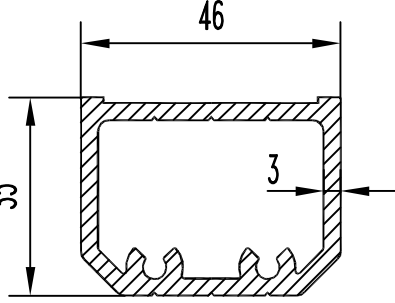
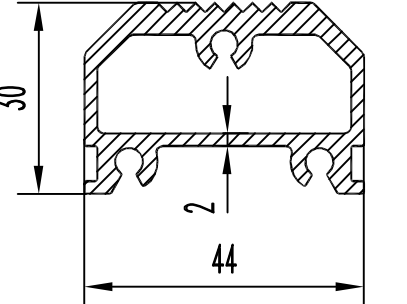
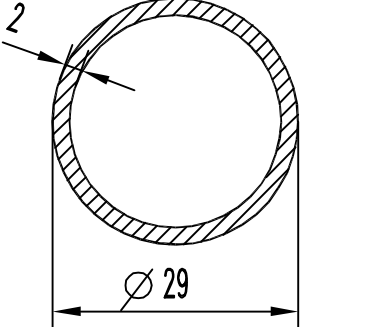
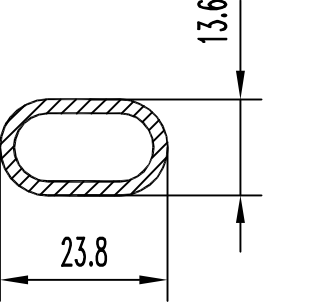
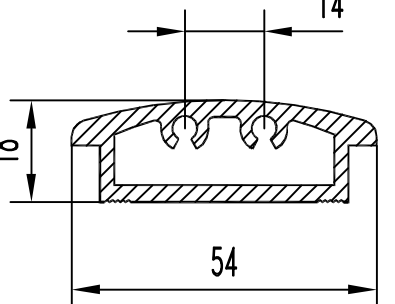
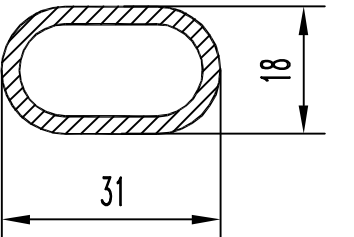
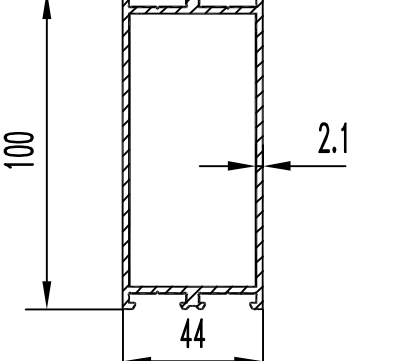
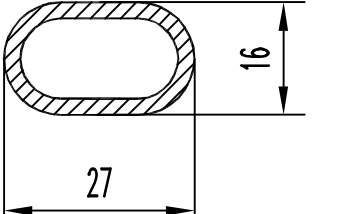
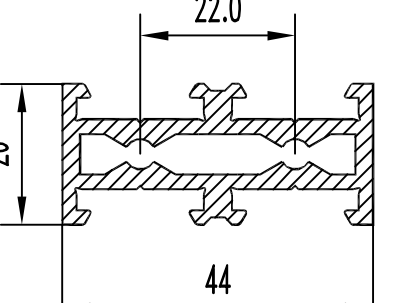
	БПЗ-861 $F \text{ см}^2 = 3.867$ $Q \text{ кг.} = 1.048$ $D \text{ оп.мм} = 85$ $P \text{ н.мм} = 270.2$ $P \text{ вн.мм} = 191.3$ $\text{Гр. сл.} = \text{Особ.}$ $\text{Точн.} = \text{П}$		БПЗ-866-1 $F \text{ см}^2 = 3.867$ $Q \text{ кг.} = 1.048$ $D \text{ оп.мм} = 85$ $P \text{ н.мм} = 270.2$ $P \text{ вн.мм} = 191.3$ $\text{Гр. сл.} = \text{Особ.}$ $\text{Точн.} = \text{П}$
	БПЗ-862 $F \text{ см}^2 = 8.84$ $Q \text{ кг.} = 2.396$ $D \text{ оп.мм} = 85.3$ $P \text{ н.мм} = 304$ $P \text{ вн.мм} = 239.8$ $\text{Гр. сл.} = \text{Особ.}$ $\text{Точн.} = \text{П}$		БПЗ-867 $F \text{ см}^2 = 22.38$ $Q \text{ кг.} = 6.065$ $D \text{ оп.мм} = 57$ $P \text{ н.мм} = 179.1$ $P \text{ вн.мм} = 62.8$ $\text{Гр. сл.} = \text{III}$ $\text{Точн.} = \text{H}$
	БПЗ-863 $F \text{ см}^2 = 1.414$ $Q \text{ кг.} = 0.383$ $D \text{ оп.мм} = 18$ $P \text{ н.мм} = 56.6$ $P \text{ вн.мм} = 37.7$ $\text{Гр. сл.} = \text{IV}$ $\text{Точн.} = \text{H}$		БПЗ-868 $F \text{ см}^2 = 18.09$ $Q \text{ кг.} = 4.902$ $D \text{ оп.мм} = 52$ $P \text{ н.мм} = 163.4$ $P \text{ вн.мм} = 62.8$ $\text{Гр. сл.} = \text{III}$ $\text{Точн.} = \text{H}$
	БПЗ-864 $F \text{ см}^2 = 0.346$ $Q \text{ кг.} = 0.094$ $D \text{ оп.мм} = 12$ $P \text{ н.мм} = 37.7$ $P \text{ вн.мм} = 31.4$ $\text{Гр. сл.} = \text{VI}$ $\text{Точн.} = \text{H}$		БПЗ-869 $F \text{ см}^2 = 0.352$ $Q \text{ кг.} = 0.095$ $D \text{ оп.мм} = 32$ $P \text{ н.мм} = 100.5$ $P \text{ вн.мм} = 75.4$ $\text{Гр. сл.} = \text{II}$ $\text{Точн.} = \text{H}$
	БПЗ-865 $F \text{ см}^2 = 2.33$ $Q \text{ кг.} = 0.631$ $D \text{ оп.мм} = 42.3$ $P \text{ н.мм} = 170.6$ $P \text{ вн.мм} = 131.1$ $\text{Гр. сл.} = \text{Особ.}$ $\text{Точн.} = \text{П}$		БПЗ-870 $F \text{ см}^2 = 4.219$ $Q \text{ кг.} = 1.119$ $D \text{ оп.мм} = 66$ $P \text{ н.мм} = 235.5$ $P \text{ вн.мм} = 160.6$ $\text{Гр. сл.} = \text{Особ.}$ $\text{Точн.} = \text{П}$

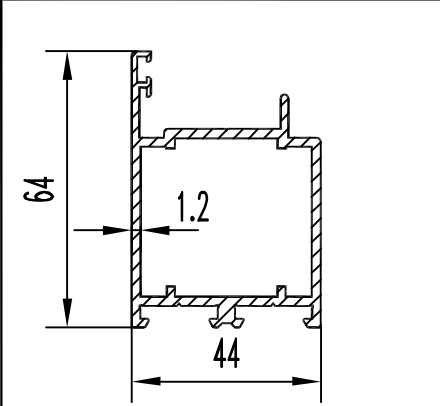
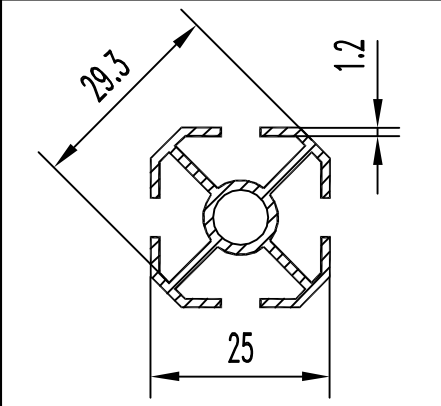
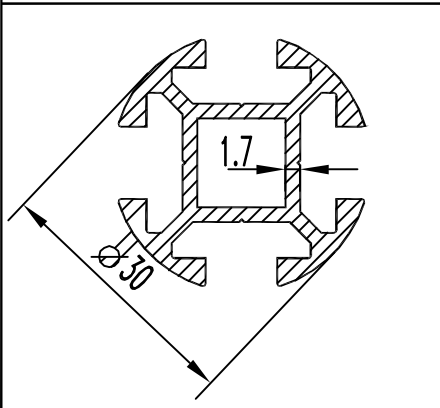
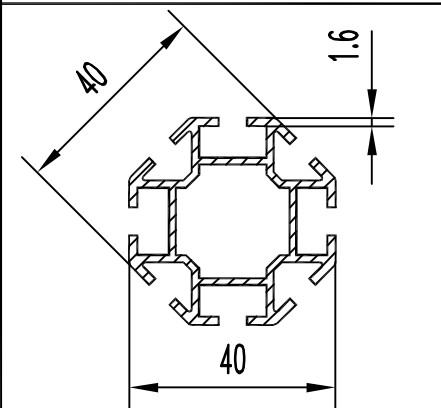
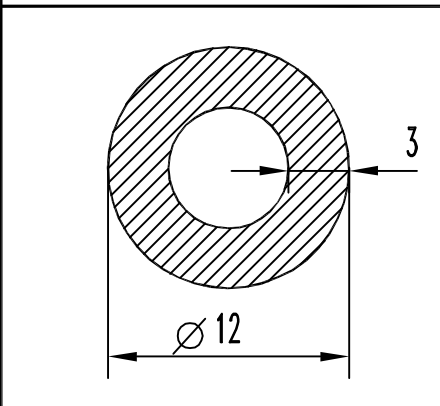
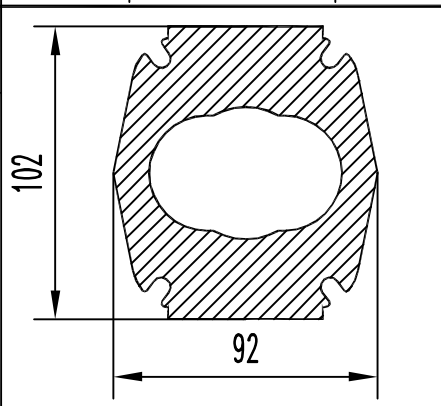
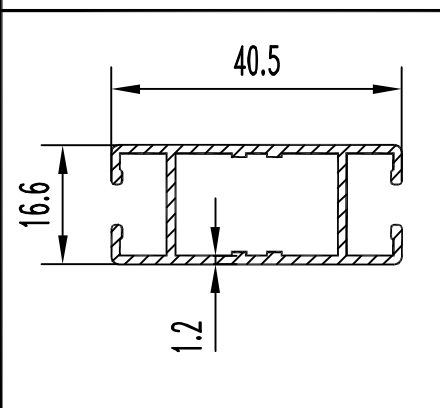
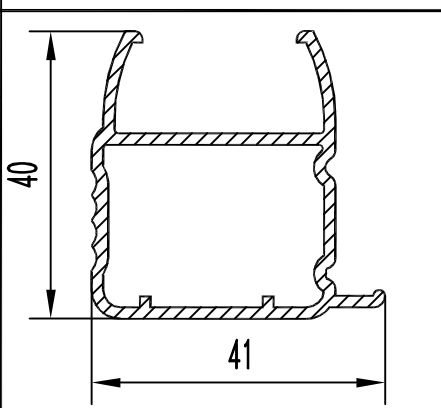
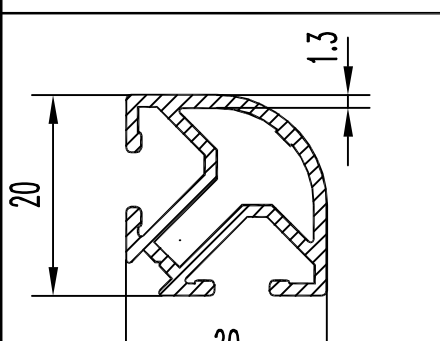
	БПЗ-871 $F \text{ см}^2 = 1.482$ $Q \text{ кг.} = 0.402$ $D \text{ оп.мм} = 28$ $P \text{ н.мм} = 87.9$ $P \text{ вн.мм} = 76.6$ $\Gamma \text{ р. сл.} = \text{Особ.}$ $\text{Точн.} = \text{Н}$		БПЗ-876 $F \text{ см}^2 = 3.00$ $Q \text{ кг.} = 0.813$ $D \text{ оп.мм} = 76.1$ $P \text{ н.мм} = 290$ $P \text{ вн.мм} = 60$ $\Gamma \text{ р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$
	БПЗ-872 $F \text{ см}^2 = 2.212$ $Q \text{ кг.} = 0.599$ $D \text{ оп.мм} = 52$ $P \text{ н.мм} = 187$ $P \text{ вн.мм} = 59$ $\Gamma \text{ р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$		БПЗ-877 $F \text{ см}^2 = 3.14$ $Q \text{ кг.} = 0.851$ $D \text{ оп.мм} = 55$ $P \text{ н.мм} = 212$ $P \text{ вн.мм} = 109$ $\Gamma \text{ р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$
	БПЗ-873 $F \text{ см}^2 = 3.029$ $Q \text{ кг.} = 0.821$ $D \text{ оп.мм} = 58$ $P \text{ н.мм} = 241$ $P \text{ вн.мм} = 92$ $\Gamma \text{ р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$		БПЗ-878 $F \text{ см}^2 = 5.42$ $Q \text{ кг.} = 1.470$ $D \text{ оп.мм} = 96$ $P \text{ н.мм} = 361$ $P \text{ вн.мм} = 217$ $\Gamma \text{ р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$
	БПЗ-874 $F \text{ см}^2 = 2.487$ $Q \text{ кг.} = 0.674$ $D \text{ оп.мм} = 55$ $P \text{ н.мм} = 223$ $P \text{ вн.мм} = 60$ $\Gamma \text{ р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$		БПЗ-879 $F \text{ см}^2 = 7.70$ $Q \text{ кг.} = 2.087$ $D \text{ оп.мм} = 96$ $P \text{ н.мм} = 400$ $P \text{ вн.мм} = 251$ $\Gamma \text{ р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$
	БПЗ-875 $F \text{ см}^2 = 2.27$ $Q \text{ кг.} = 0.616$ $D \text{ оп.мм} = 37$ $P \text{ н.мм} = 172$ $P \text{ вн.мм} = 69$ $\Gamma \text{ р. сл.} = \text{V}$		БПЗ-880 $F \text{ см}^2 = 10.20$ $Q \text{ кг.} = 2.838$ $D \text{ оп.мм} = 119$ $P \text{ н.мм} = 500$ $P \text{ вн.мм} = 351$ $\Gamma \text{ р. сл.} = \text{VI}$

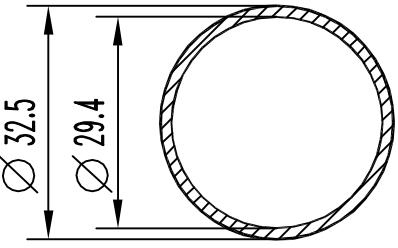
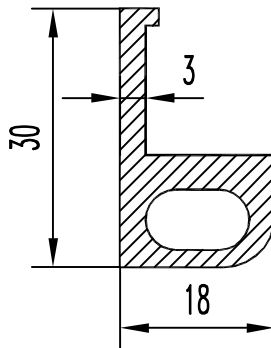
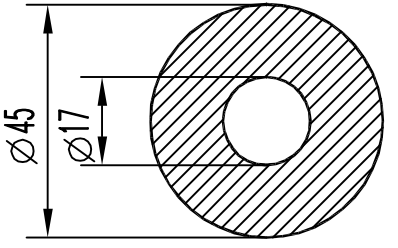
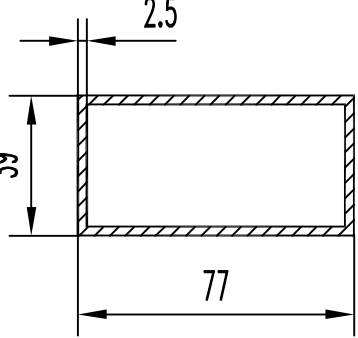
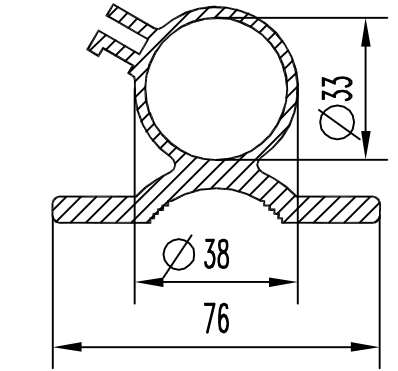
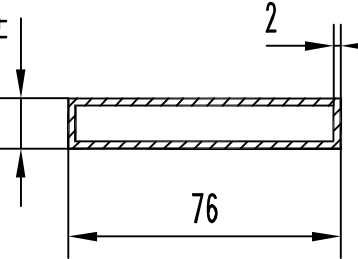
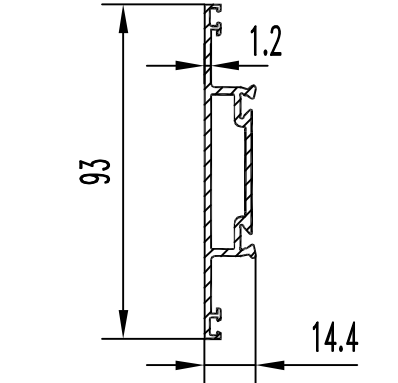
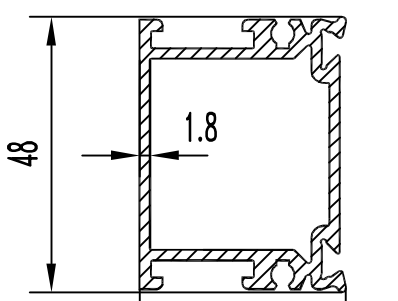
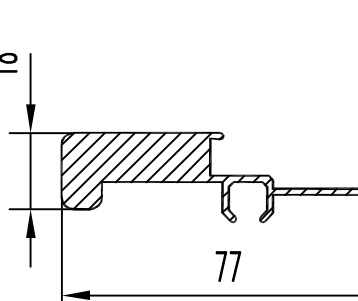
	БПЗ-881 $F \text{ см}^2 = 4.96$ $Q \text{ кг.} = 1.34$ $D \text{ оп.мм} = 76.8$ $P \text{ н.мм} = 299$ $P \text{ вн.мм} = 217$ Гр. сл. = VI Точн. = II		БПЗ-886 $F \text{ см}^2 = 2.53$ $Q \text{ кг.} = 0.684$ $D \text{ оп.мм} = 52.5$ $P \text{ н.мм} = 207.9$ $P \text{ вн.мм} = 104.5$ Гр. сл. = VI Точн. = II
	БПЗ-882 $F \text{ см}^2 = 7.22$ $Q \text{ кг.} = 1.96$ $D \text{ оп.мм} = 84.3$ $P \text{ н.мм} = 336$ $P \text{ вн.мм} = 251$ Гр. сл. = VI Точн. = II		БПЗ-887 $F \text{ см}^2 = 1.50$ $Q \text{ кг.} = 0.407$ $D \text{ оп.мм} = 44$ $P \text{ н.мм} = 161.5$ $P \text{ вн.мм} = 69.4$ Гр. сл. = 0соб. Точн. = DIN
	БПЗ-883 $F \text{ см}^2 = 9.71$ $Q \text{ кг.} = 2.63$ $D \text{ оп.мм} = 117.5$ $P \text{ н.мм} = 438$ $P \text{ вн.мм} = 351$ Гр. сл. = VI Точн. = II		БПЗ-888 $F \text{ см}^2 = 1.20$ $Q \text{ кг.} = 0.33$ $D \text{ оп.мм} = 30$ $P \text{ н.мм} = 120.1$ $P \text{ вн.мм} = 64.4$ Гр. сл. = 0соб. Точн. = DIN
	БПЗ-884		БПЗ-889 $F \text{ см}^2 = 2.021$ $Q \text{ кг.} = 0.548$ $D \text{ оп.мм} = 52.3$ $P \text{ н.мм} = 222$ $P \text{ вн.мм} = 130.3$ Гр. сл. = 0соб. Точн. = DIN
	БПЗ-885		БПЗ-890 $F \text{ см}^2 = 4.45$ $Q \text{ кг.} = 1.20$ $D \text{ оп.мм} = 59.9$ $P \text{ н.мм} = 253.5$ $P \text{ вн.мм} = 217.2$ Гр. сл. = VI

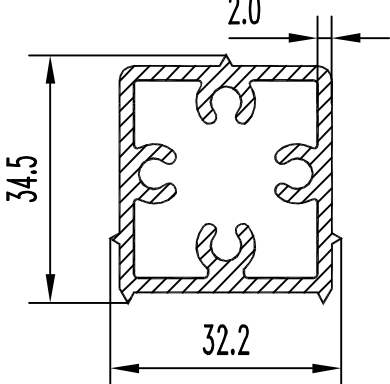
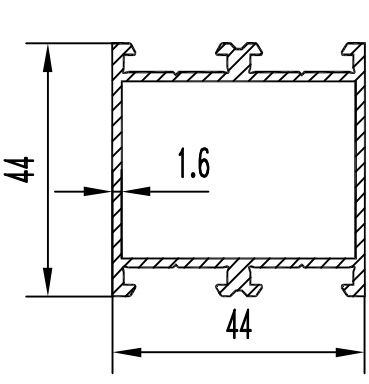
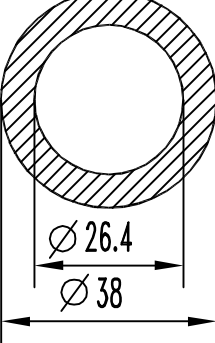
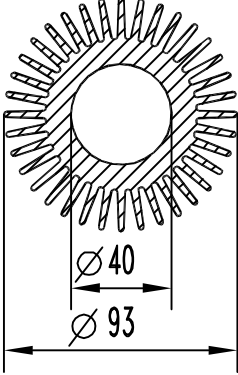
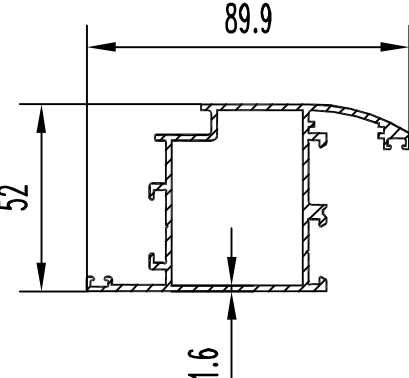
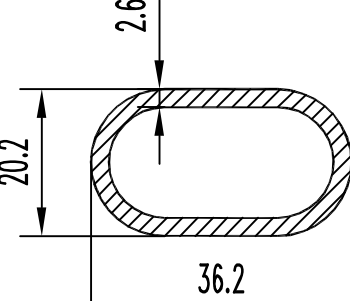
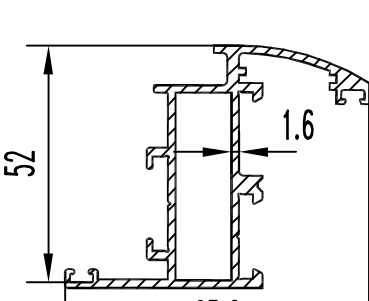
	БПЗ-891 $F \text{ см}^2 = 1.081$ $Q \text{ кг.} = 0.293$ $D \text{ оп.мм} = 25$ $P \text{ н.мм} = 102.5$ $P \text{ вн.мм} = 31.9$ Гр. сл. = Особ. Точн. = DIN		БПЗ-896 $F \text{ см}^2 = 3.345$ $Q \text{ кг.} = 0.906$ $D \text{ оп.мм} = 43$ $P \text{ н.мм} = 110.4$ $P \text{ вн.мм} = 112.1$ Гр. сл. = Особ. Точн. = II
	БПЗ-892 $F \text{ см}^2 = 3.102$ $Q \text{ кг.} = 0.841$ $D \text{ оп.мм} = 43$ $P \text{ н.мм} = 109.2$ $P \text{ вн.мм} = 108.3$ Гр. сл. = Особ. Точн. = II		БПЗ-897
	БПЗ-893 $F \text{ см}^2 = 4.812$ $Q \text{ кг.} = 1.304$ $D \text{ оп.мм} = 141$ $P \text{ н.мм} = 394.8$ $P \text{ вн.мм} = 254.6$ Гр. сл. = Особ. Точн. = II		БПЗ-898 $F \text{ см}^2 = 4.89$ $Q \text{ кг.} = 1.32$ $D \text{ оп.мм} = 85$ $P \text{ н.мм} = 417$ $P \text{ вн.мм} = 136$ Гр. сл. = VI Точн. = II
	БПЗ-894 $F \text{ см}^2 = 19.067$ $Q \text{ кг.} = 5.167$ $D \text{ оп.мм} = 111.0$ $P \text{ н.мм} = 284.5$ $P \text{ вн.мм} = 301.2$ Гр. сл. = Особ. Точн. = II		БПЗ-899 $F \text{ см}^2 = 8.469$ $Q \text{ кг.} = 2.287$ $D \text{ оп.мм} = 150$ $P \text{ н.мм} = 501$ $P \text{ вн.мм} = 248$ Гр. сл. = VI Точн. = II
	БПЗ-895 $F \text{ см}^2 = 4.843$ $Q \text{ кг.} = 1.312$ $D \text{ оп.мм} = 57.0$ $P \text{ н.мм} = 146.1$ $P \text{ вн.мм} = 158.8$ Гр. сл. = Особ.		БПЗ-900 $F \text{ см}^2 = 4.843$ $Q \text{ кг.} = 1.312$ $D \text{ оп.мм} = 57$ $P \text{ н.мм} = 146.1$ $P \text{ вн.мм} = 158.8$ Гр. сл. = Особ.

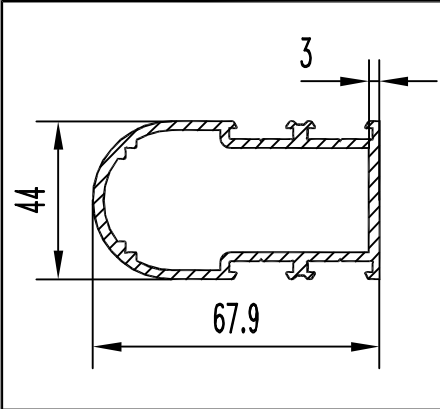
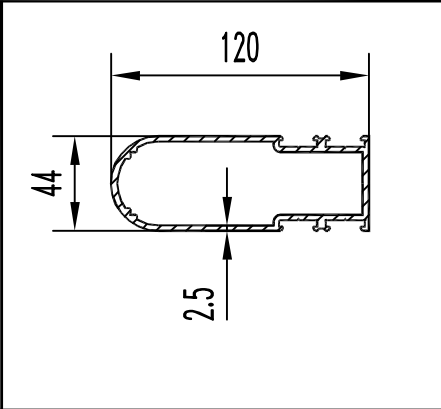
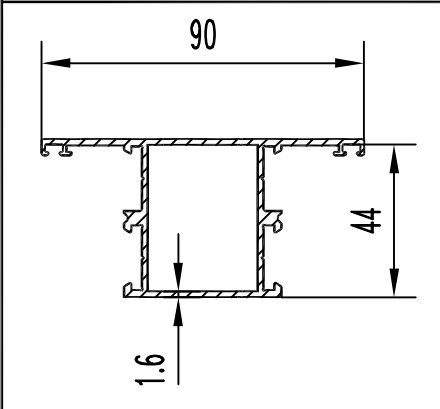
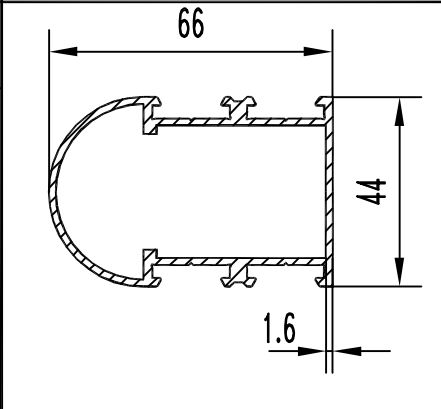
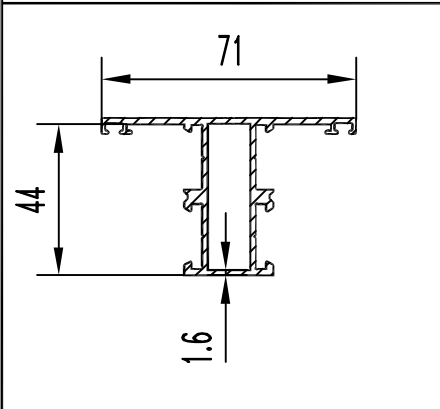
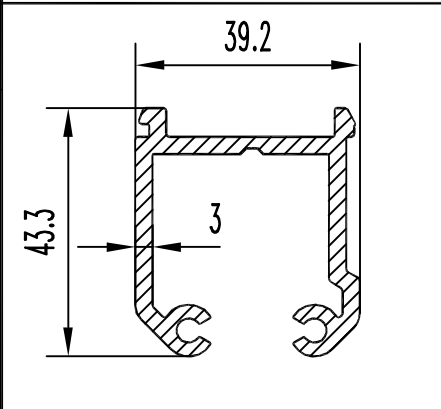
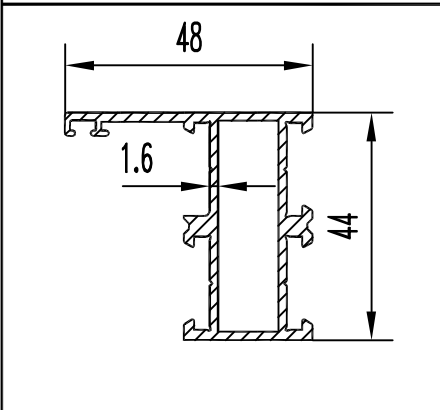
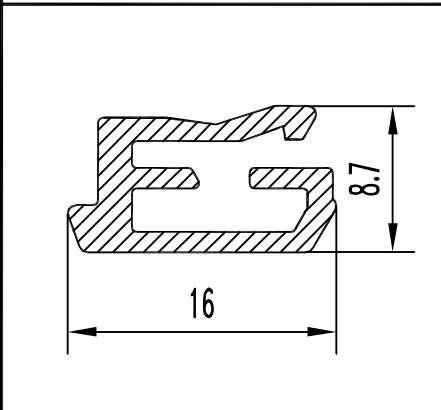
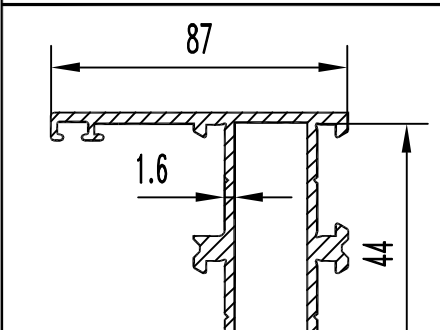
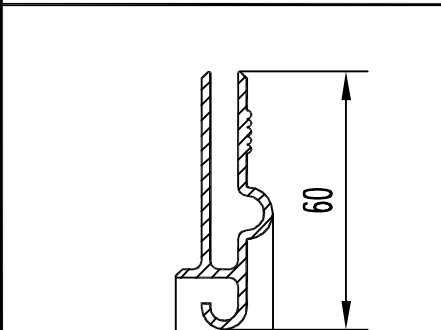
	БПЗ-0901 $F \text{ см}^2 = 7.42$ $Q \text{ кг.} = 2$ $D \text{ оп.мм} = 88$ $P \text{ н.мм} = 410.7$ $P \text{ вн.мм} = 181$ Гр. сл. = VI Точн. = П		БПЗ-0906 $F \text{ см}^2 = 3.09$ $Q \text{ кг.} = 0.83$ $D \text{ оп.мм} = 54$ $P \text{ н.мм} = 241$ $P \text{ вн.мм} = 121$ Гр. сл. = VI Точн. = П
	БПЗ-0902 $F \text{ см}^2 = 7.530$ $Q \text{ кг.} = 2.041$ $D \text{ оп.мм} = 106.0$ $P \text{ н.мм} = 447.5$ $P \text{ вн.мм} = 224.0$ Гр. сл. = VI Точн. = П		БПЗ-0907 $F \text{ см}^2 = 5.07$ $Q \text{ кг.} = 1.37$ $D \text{ оп.мм} = 97$ $P \text{ н.мм} = 357.3$ $P \text{ вн.мм} = 237.8$ Гр. сл. = VI Точн. = П
	БПЗ-0903 $F \text{ см}^2 = 9.97$ $Q \text{ кг.} = 2.69$ $D \text{ оп.мм} = 136.1$ $P \text{ н.мм} = 512.9$ $P \text{ вн.мм} = 283$ Гр. сл. = VI Точн. = П		БПЗ-0908 $F \text{ см}^2 = 4.38$ $Q \text{ кг.} = 2.27$ $D \text{ оп.мм} = 93$ $P \text{ н.мм} = 285.5$ $P \text{ вн.мм} = 237.8$ Гр. сл. = VI Точн. = П
	БПЗ-0904 $F \text{ см}^2 = 11.17$ $Q \text{ кг.} = 3.02$ $D \text{ оп.мм} = 159.3$ $P \text{ н.мм} = 560.9$ $P \text{ вн.мм} = 331$ Гр. сл. = VI Точн. = П		БПЗ-0909 $F \text{ см}^2 = 10.200$ $Q \text{ кг.} = 2.764$ $D \text{ оп.мм} = 96.0$ $P \text{ н.мм} = 659.7$ $P \text{ вн.мм} = 183.6$ Гр. сл. = 0соб. Точн. = П
	БПЗ-0905 $F \text{ см}^2 = 12.37$ $Q \text{ кг.} = 3.34$ $D \text{ оп.мм} = 182.6$ $P \text{ н.мм} = 608.9$ $P \text{ вн.мм} = 379$ Гр. сл. = VI Точн. = П		БПЗ-0910 $F \text{ см}^2 = 2.124$ $Q \text{ кг.} = 0.576$ $D \text{ оп.мм} = 55.0$ $P \text{ н.мм} = 226.7$ $P \text{ вн.мм} = 59.4$ Гр. сл. = VI Точн. = П

	БПЗ-911 $F \text{ см}^2 = 4.813$ $Q \text{ кг.} = 1.304$ $D \text{ оп.мм} = 141.0$ $P \text{ н.мм} = 394.8$ $P \text{ вн.мм} = 245.6$ Гр. сл. = VI Точн. = П		БПЗ-916 $F \text{ см}^2 = 4.890$ $Q \text{ кг.} = 1.325$ $D \text{ оп.мм} = 53.6$ $P \text{ н.мм} = 156.5$ $P \text{ вн.мм} = 160.6$ Гр. сл. = IV Точн. = П
	БПЗ-912 $F \text{ см}^2 = 4.270$ $Q \text{ кг.} = 1.157$ $D \text{ оп.мм} = 49.0$ $P \text{ н.мм} = 186.7$ $P \text{ вн.мм} = 122.6$ Гр. сл. = VI Точн. = П		БПЗ-917 $F \text{ см}^2 = 1.696$ $Q \text{ кг.} = 0.460$ $D \text{ оп.мм} = 29.0$ $P \text{ н.мм} = 91.1$ $P \text{ вн.мм} = 78.5$ Гр. сл. = II Точн. = Н
	БПЗ-913 $F \text{ см}^2 = 1.137$ $Q \text{ кг.} = 0.308$ $D \text{ оп.мм} = 24.0$ $P \text{ н.мм} = 63.1$ $P \text{ вн.мм} = 50.6$ Гр. сл. = IV Точн. = П		БПЗ-918 $F \text{ см}^2 = 3.950$ $Q \text{ кг.} = 1.070$ $D \text{ оп.мм} = 55.9$ $P \text{ н.мм} = 139.3$ $P \text{ вн.мм} = 134.3$ Гр. сл. = Точн. = П
	БПЗ-914 $F \text{ см}^2 = 1.867$ $Q \text{ кг.} = 0.506$ $D \text{ оп.мм} = 31.0$ $P \text{ н.мм} = 82.6$ $P \text{ вн.мм} = 66.8$ Гр. сл. = IV Точн. = П		БПЗ-919 $F \text{ см}^2 = 6.420$ $Q \text{ кг.} = 1.740$ $D \text{ оп.мм} = 109.0$ $P \text{ н.мм} = 359.4$ $P \text{ вн.мм} = 251.2$ Гр. сл. = Точн. = П
	БПЗ-915 $F \text{ см}^2 = 1.496$ $Q \text{ кг.} = 0.405$ $D \text{ оп.мм} = 27.0$ $P \text{ н.мм} = 72.3$ $P \text{ вн.мм} = 57.8$ Гр. сл. = IV		БПЗ-920 $F \text{ см}^2 = 3.440$ $Q \text{ кг.} = 0.932$ $D \text{ оп.мм} = 48.3$ $P \text{ н.мм} = 199.5$ $P \text{ вн.мм} = 97.9$ Гр. сл. =

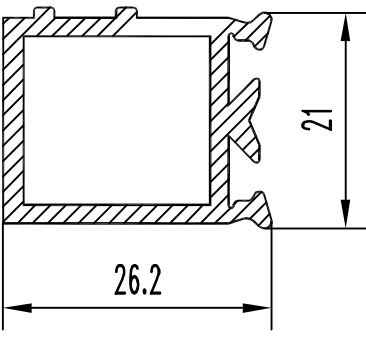
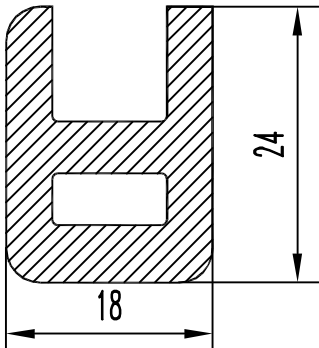
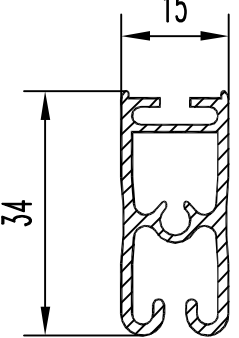
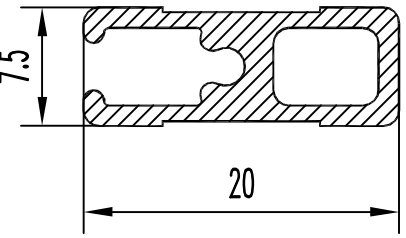
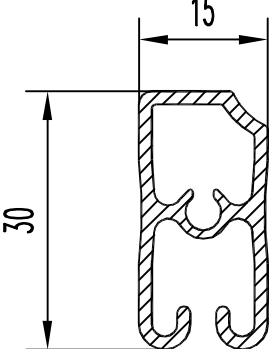
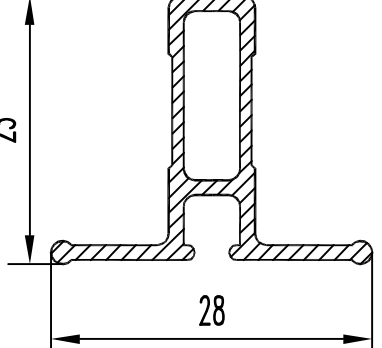
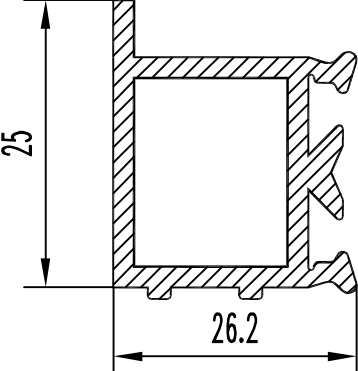
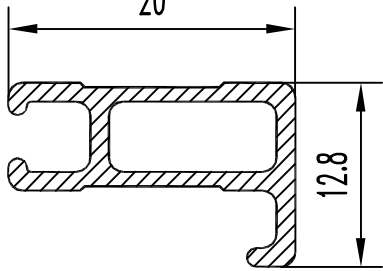
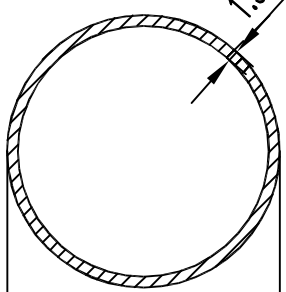
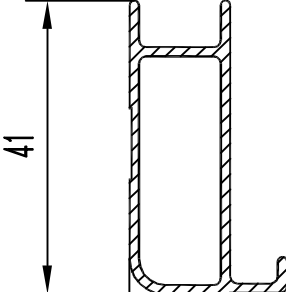
	БПЗ-921 $F \text{ см}^2 = 4.600$ $Q \text{ кг.} = 1.247$ $D \text{ оп.мм} = 77.1$ $P \text{ н.мм} = 289.1$ $P \text{ вн.мм} = 164.2$ Гр. сл. = 0соб. Точн. = П		БПЗ-926 $F \text{ см}^2 = 1.511$ $Q \text{ кг.} = 0.409$ $D \text{ оп.мм} = 30.0$ $P \text{ н.мм} = 226.9$ $P \text{ вн.мм} = 25.1$ Гр. сл. = VI Точн. = П
	БПЗ-922 $F \text{ см}^2 = 2.262$ $Q \text{ кг.} = 0.613$ $D \text{ оп.мм} = 30.0$ $P \text{ н.мм} = 203.3$ $P \text{ вн.мм} = 41.2$ Гр. сл. = VI Точн. = Н		БПЗ-927 $F \text{ см}^2 = 3.202$ $Q \text{ кг.} = 0.868$ $D \text{ оп.мм} = 43.0$ $P \text{ н.мм} = 348.6$ $P \text{ вн.мм} = 82.0$ Гр. сл. = VI Точн. = П
	БПЗ-923 $F \text{ см}^2 = 0.848$ $Q \text{ кг.} = 0.230$ $D \text{ оп.мм} = 12.0$ $P \text{ н.мм} = 37.7$ $P \text{ вн.мм} = 18.9$ Гр. сл. = II Точн. = Н		БПЗ-928 $F \text{ см}^2 = 54.336$ $Q \text{ кг.} = 14.725$ $D \text{ оп.мм} = 116.0$ $P \text{ н.мм} = 388.6$ $P \text{ вн.мм} = 182.1$ Гр. сл. = V Точн. = П
	БПЗ-924 $F \text{ см}^2 = 1.570$ $Q \text{ кг.} = 0.425$ $D \text{ оп.мм} = 44.0$ $P \text{ н.мм} = 177.9$ $P \text{ вн.мм} = 77.8$ Гр. сл. = 0соб. Точн. = Н		БПЗ-929 $F \text{ см}^2 = 2.500$ $Q \text{ кг.} = 0.678$ $D \text{ оп.мм} = 52.3$ $P \text{ н.мм} = 195.0$ $P \text{ вн.мм} = 112.3$ Гр. сл. = VI Точн. = П
	БПЗ-925 $F \text{ см}^2 = 1.198$ $Q \text{ кг.} = 0.325$ $D \text{ оп.мм} = 28.0$ $P \text{ н.мм} = 124.8$ $P \text{ вн.мм} = 61.5$ Гр. сл. = 0соб. Точн. = П		

	БПЗ-931 $F \text{ см}^2 = 1.507$ $Q \text{ кг.} = 0.408$ $D \text{ оп.мм} = 32.5$ $P \text{ н.мм} = 102.1$ $P \text{ вн.мм} = 92.4$ Гр. сл. = III Точн. = П		БПЗ-936 $F \text{ см}^2 = 2.070$ $Q \text{ кг.} = 0.561$ $D \text{ оп.мм} = 34.0$ $P \text{ н.мм} = 96.4$ $P \text{ вн.мм} = 32.0$ Гр. сл. = V Точн. = П
	БПЗ-932 $F \text{ см}^2 = 13.630$ $Q \text{ кг.} = 3.694$ $D \text{ оп.мм} = 45.0$ $P \text{ н.мм} = 141.4$ $P \text{ вн.мм} = 53.4$ Гр. сл. = II Точн. = П		БПЗ-937 $F \text{ см}^2 = 5.550$ $Q \text{ кг.} = 1.504$ $D \text{ оп.мм} = 86.3$ $P \text{ н.мм} = 232.0$ $P \text{ вн.мм} = 212.0$ Гр. сл. = V Точн. = П
	БПЗ-933 $F \text{ см}^2 = 8.359$ $Q \text{ кг.} = 2.265$ $D \text{ оп.мм} = 83.0$ $P \text{ н.мм} = 310.7$ $P \text{ вн.мм} = 103.7$ Гр. сл. = V Точн. = П		БПЗ-938 $F \text{ см}^2 = 3.360$ $Q \text{ кг.} = 0.911$ $D \text{ оп.мм} = 75.0$ $P \text{ н.мм} = 180.0$ $P \text{ вн.мм} = 164.0$ Гр. сл. = V Точн. = П
	БПЗ-934 $F \text{ см}^2 = 3.324$ $Q \text{ кг.} = 0.901$ $D \text{ оп.мм} = 94.0$ $P \text{ н.мм} = 273.6$ $P \text{ вн.мм} = 402.9$ Гр. сл. = V Точн. = П		
	БПЗ-935 $F \text{ см}^2 = 3.730$ $Q \text{ кг.} = 1.011$ $D \text{ оп.мм} = 59.5$ $P \text{ н.мм} = 241.6$ $P \text{ вн.мм} = 148.9$ Гр. сл. = V Точн. = П		БПЗ-940 $F \text{ см}^2 = 2.770$ $Q \text{ кг.} = 0.751$ $D \text{ оп.мм} = 77.8$ $P \text{ н.мм} = 306.8$ $P \text{ вн.мм} = 0.0$ Гр. сл. = V Точн. = П

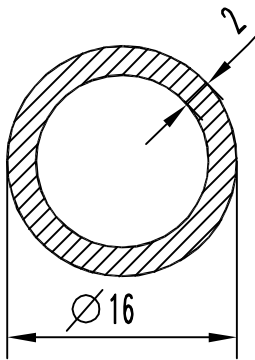
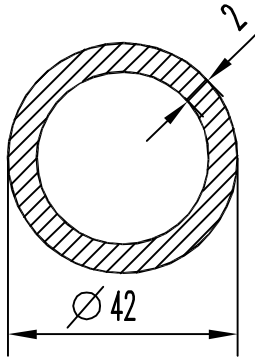
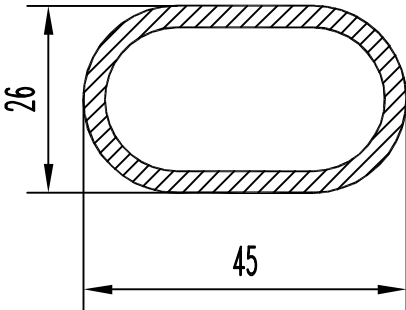
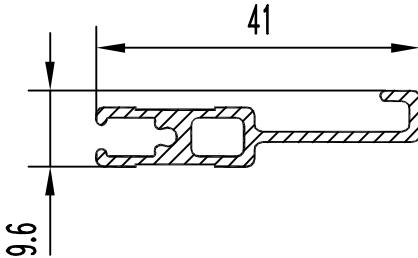
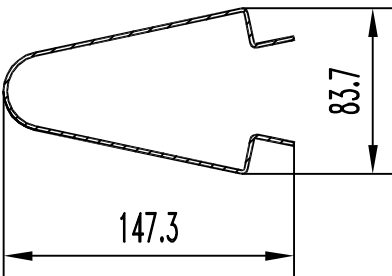
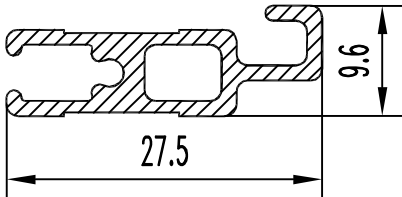
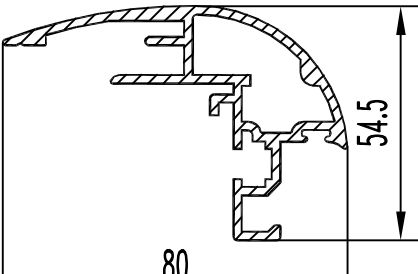
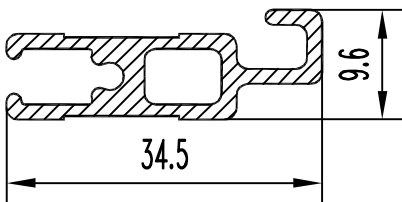
	БПЗ-941 $F \text{ см}^2 = 3.489$ $Q \text{ кг.} = 0.946$ $D \text{ оп.мм} = 43.0$ $P \text{ н.мм} = 128.3$ $P \text{ вн.мм} = 193.6$ Гр. сл. = VI Точн. = П		БПЗ-946 $F \text{ см}^2 = 3.380$ $Q \text{ кг.} = 0.916$ $D \text{ оп.мм} = 62.2$ $P \text{ н.мм} = 247.5$ $P \text{ вн.мм} = 143.2$ Гр. сл. = V Точн. = П
	БПЗ-942 $F \text{ см}^2 = 5.870$ $Q \text{ кг.} = 1.591$ $D \text{ оп.мм} = 38.0$ $P \text{ н.мм} = 119.4$ $P \text{ вн.мм} = 82.9$ Гр. сл. = III Точн. = П		
			БПЗ-948 $F \text{ см}^2 = 30.530$ $Q \text{ кг.} = 8.274$ $D \text{ оп.мм} = 93.0$ $P \text{ н.мм} = 1289.3$ $P \text{ вн.мм} = 125.7$ Гр. сл. = 0соб. Точн. = П
			БПЗ-949 $F \text{ см}^2 = 4.830$ $Q \text{ кг.} = 1.309$ $D \text{ оп.мм} = 100.0$ $P \text{ н.мм} = 416.3$ $P \text{ вн.мм} = 170.4$ Гр. сл. = VI Точн. = П
	БПЗ-945 $F \text{ см}^2 = 2.150$ $Q \text{ кг.} = 0.583$ $D \text{ оп.мм} = 36.2$ $P \text{ н.мм} = 95.5$ $P \text{ вн.мм} = 79.1$ Гр. сл. = III		БПЗ-950 $F \text{ см}^2 = 3.930$ $Q \text{ кг.} = 1.065$ $D \text{ оп.мм} = 79.0$ $P \text{ н.мм} = 362.5$ $P \text{ вн.мм} = 104.6$ Гр. сл. = 0соб.

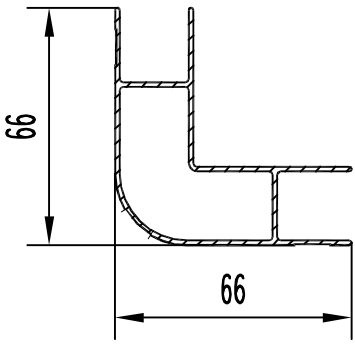
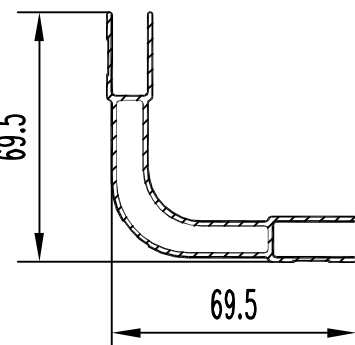
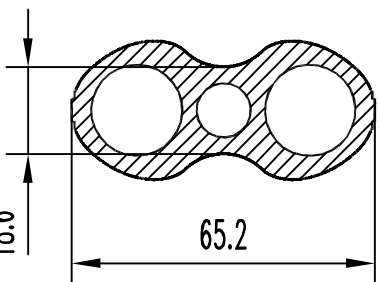
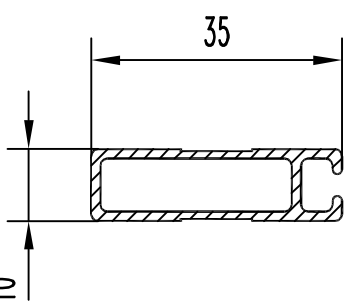
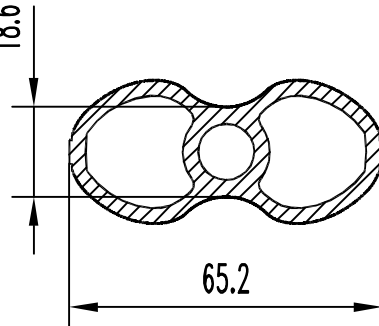
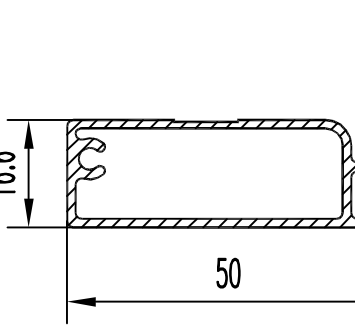
	БПЗ-951 $F \text{ см}^2 = 6.680$ $Q \text{ кг.} = 1.810$ $D \text{ оп.мм} = 86.0$ $P \text{ н.мм} = 299.0$ $P \text{ вн.мм} = 213.0$ Гр. сл. = VI Точн. = П		БПЗ-956 $F \text{ см}^2 = 8.680$ $Q \text{ кг.} = 2.352$ $D \text{ оп.мм} = 124.0$ $P \text{ н.мм} = 379.0$ $P \text{ вн.мм} = 293.0$ Гр. сл. = VI Точн. = П
	БПЗ-952 $F \text{ см}^2 = 4.290$ $Q \text{ кг.} = 1.163$ $D \text{ оп.мм} = 90.0$ $P \text{ н.мм} = 364.3$ $P \text{ вн.мм} = 143.2$ Гр. сл. = V Точн. = П		БПЗ-957 $F \text{ см}^2 = 4.060$ $Q \text{ кг.} = 1.100$ $D \text{ оп.мм} = 73.3$ $P \text{ н.мм} = 272.6$ $P \text{ вн.мм} = 197.7$ Гр. сл. = VI Точн. = П
	БПЗ-953 $F \text{ см}^2 = 3.690$ $Q \text{ кг.} = 1.000$ $D \text{ оп.мм} = 73.3$ $P \text{ н.мм} = 326.3$ $P \text{ вн.мм} = 105.2$ Гр. сл. = V Точн. = П		БПЗ-958 $F \text{ см}^2 = 4.200$ $Q \text{ кг.} = 1.138$ $D \text{ оп.мм} = 53.7$ $P \text{ н.мм} = 296.4$ $P \text{ вн.мм} = 0.0$ Гр. сл. = IV Точн. = П
	БПЗ-954 $F \text{ см}^2 = 3.230$ $Q \text{ кг.} = 0.875$ $D \text{ оп.мм} = 64.9$ $P \text{ н.мм} = 267.7$ $P \text{ вн.мм} = 105.2$ Гр. сл. = V Точн. = П		БПЗ-959 $F \text{ см}^2 = 0.633$ $Q \text{ кг.} = 0.172$ $D \text{ оп.мм} = 16.5$ $P \text{ н.мм} = 88.6$ $P \text{ вн.мм} = 0.0$ Гр. сл. = V Точн. = П
	БПЗ-955 $F \text{ см}^2 = 3.840$ $Q \text{ кг.} = 1.041$ $D \text{ оп.мм} = 40.0$ $P \text{ н.мм} = 305.7$ $P \text{ вн.мм} = 143.2$ Гр. сл. = V Точн. = П		БПЗ-960 $F \text{ см}^2 = 2.799$ $Q \text{ кг.} = 0.759$ $D \text{ оп.мм} = 61.0$ $P \text{ н.мм} = 275.3$ $P \text{ вн.мм} = 0.0$ Гр. сл. = V Точн. = П

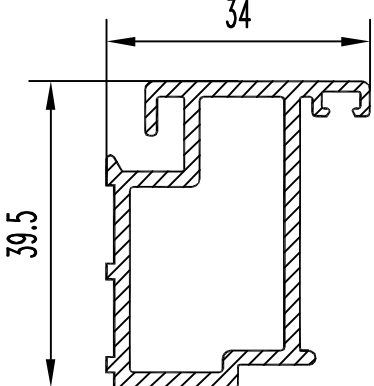
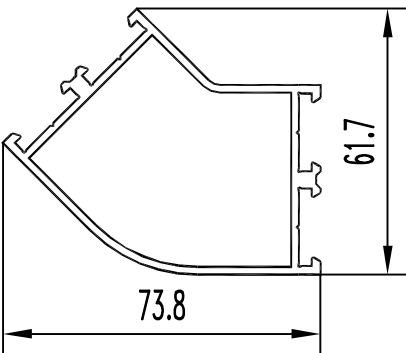
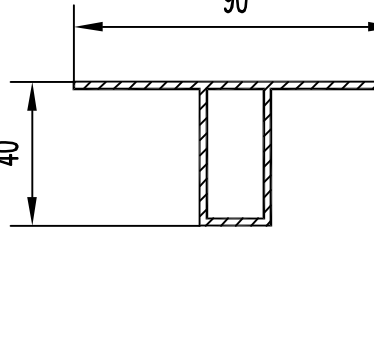
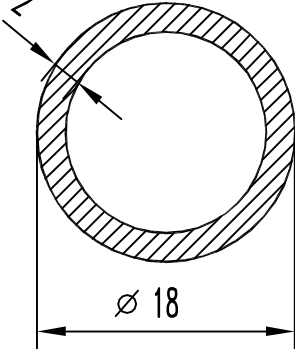
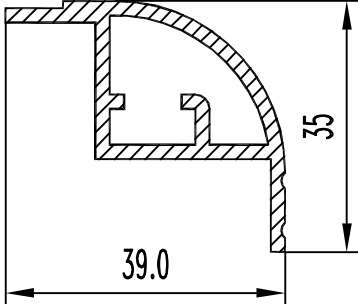
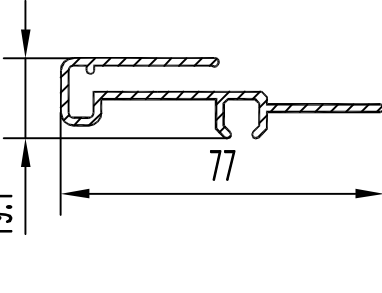
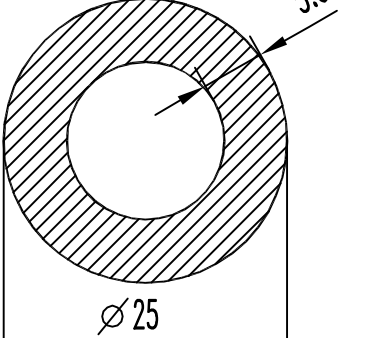
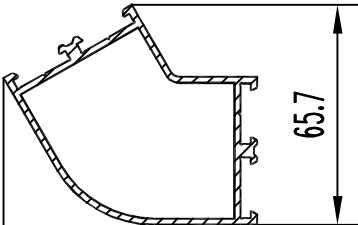
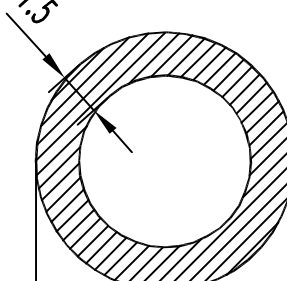
	БПЗ-961 $F \text{ см}^2 = 3.860$ $Q \text{ кг.} = 1.046$ $D \text{ оп.мм} = 69.3$ $P \text{ н.мм} = 258.9$ $P \text{ вн.мм} = 153.6$ Гр. сл. = VI Точн. = П		БПЗ-966 $F \text{ см}^2 = 7.358$ $Q \text{ кг.} = 1.994$ $D \text{ оп.мм} = 79.0$ $P \text{ н.мм} = 335.9$ $P \text{ вн.мм} = 144.6$ Гр. сл. = 0соб. Точн. = П
	БПЗ-962 $F \text{ см}^2 = 4.790$ $Q \text{ кг.} = 1.298$ $D \text{ оп.мм} = 101.4$ $P \text{ н.мм} = 375.7$ $P \text{ вн.мм} = 153.8$ Гр. сл. = VI Точн. = П		БПЗ-967 $F \text{ см}^2 = 2.250$ $Q \text{ кг.} = 0.610$ $D \text{ оп.мм} = 76.0$ $P \text{ н.мм} = 206.0$ $P \text{ вн.мм} = 146.0$ Гр. сл. = 0соб. Точн. = П
	БПЗ-963 $F \text{ см}^2 = 2.038$ $Q \text{ кг.} = 0.552$ $D \text{ оп.мм} = 40.3$ $P \text{ н.мм} = 173.4$ $P \text{ вн.мм} = 76.7$ Гр. сл. = 0соб. Точн. = П		БПЗ-968 $F \text{ см}^2 = 1.384$ $Q \text{ кг.} = 0.375$ $D \text{ оп.мм} = 42.0$ $P \text{ н.мм} = 144.4$ $P \text{ вн.мм} = 60.1$ Гр. сл. = 0соб. Точн. = П
	БПЗ-964 $F \text{ см}^2 = 7.416$ $Q \text{ кг.} = 2.010$ $D \text{ оп.мм} = 71.1$ $P \text{ н.мм} = 295.3$ $P \text{ вн.мм} = 154.6$ Гр. сл. = IV Точн. = П		БПЗ-969 $F \text{ см}^2 = 1.576$ $Q \text{ кг.} = 0.427$ $D \text{ оп.мм} = 35.0$ $P \text{ н.мм} = 110.6$ $P \text{ вн.мм} = 59.6$ Гр. сл. = V Точн. = П
	БПЗ-965 $F \text{ см}^2 = 6.558$ $Q \text{ кг.} = 1.777$ $D \text{ оп.мм} = 74.0$ $P \text{ н.мм} = 260.5$ $P \text{ вн.мм} = 154.6$ Гр. сл. = 0соб. Точн. = П		БПЗ-970 $F \text{ см}^2 = 1.665$ $Q \text{ кг.} = 0.451$ $D \text{ оп.мм} = 35.0$ $P \text{ н.мм} = 120.6$ $P \text{ вн.мм} = 59.6$ Гр. сл. = V Точн. = П

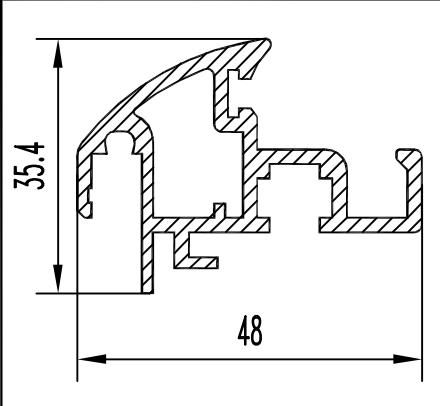
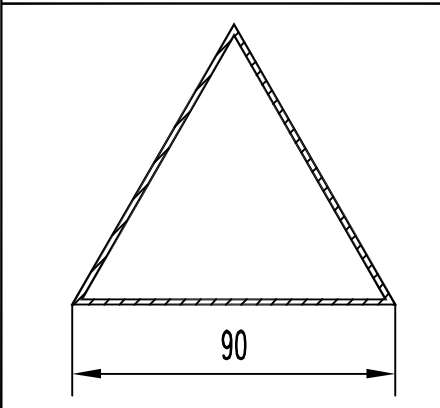
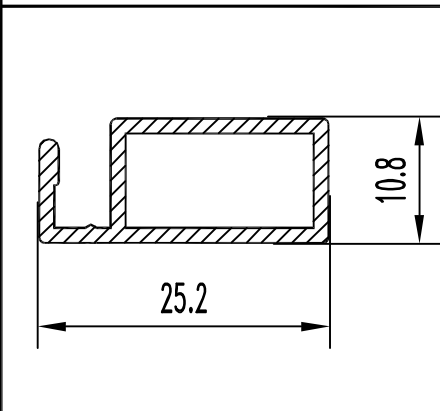
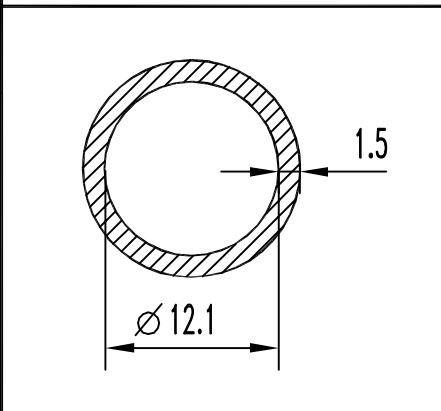
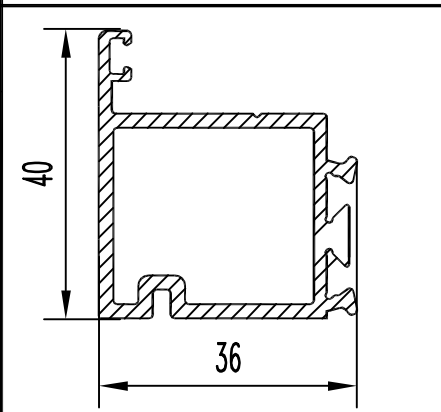
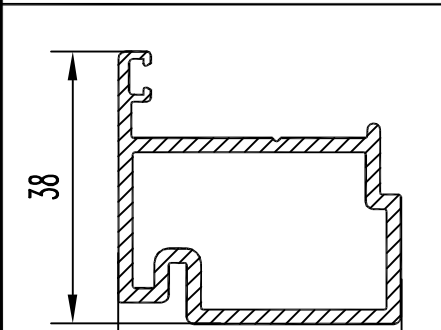
	БПЗ-971 $F \text{ см}^2 = 1.789$ $Q \text{ кг.} = 0.485$ $D \text{ оп.мм} = 35.0$ $P \text{ н.мм} = 120.6$ $P \text{ вн.мм} = 69.2$ Гр. сл. = V Точн. = П		БПЗ-976 $F \text{ см}^2 = 2.820$ $Q \text{ кг.} = 0.764$ $D \text{ оп.мм} = 28.9$ $P \text{ н.мм} = 99.7$ $P \text{ вн.мм} = 28.1$ Гр. сл. = 0соб. Точн. = П
	БПЗ-972 $F \text{ см}^2 = 1.652$ $Q \text{ кг.} = 0.448$ $D \text{ оп.мм} = 37.0$ $P \text{ н.мм} = 172.9$ $P \text{ вн.мм} = 56.3$ Гр. сл. = 0соб. Точн. = П		БПЗ-977 $F \text{ см}^2 = 0.712$ $Q \text{ кг.} = 0.193$ $D \text{ оп.мм} = 21.0$ $P \text{ н.мм} = 78.2$ $P \text{ вн.мм} = 21.5$ Гр. сл. = 0соб. Точн. = П
	БПЗ-973 $F \text{ см}^2 = 1.468$ $Q \text{ кг.} = 0.398$ $D \text{ оп.мм} = 33.0$ $P \text{ н.мм} = 140.2$ $P \text{ вн.мм} = 54.3$ Гр. сл. = 0соб. Точн. = П		БПЗ-978 $F \text{ см}^2 = 0.943$ $Q \text{ кг.} = 0.256$ $D \text{ оп.мм} = 31.4$ $P \text{ н.мм} = 44.4$ $P \text{ вн.мм} = 37.5$ Гр. сл. = VI Точн. = П
	БПЗ-974 $F \text{ см}^2 = 1.889$ $Q \text{ кг.} = 0.512$ $D \text{ оп.мм} = 35.0$ $P \text{ н.мм} = 130.6$ $P \text{ вн.мм} = 69.2$ Гр. сл. = V Точн. = П		БПЗ-979 $F \text{ см}^2 = 0.677$ $Q \text{ кг.} = 0.183$ $D \text{ оп.мм} = 23.0$ $P \text{ н.мм} = 80.5$ $P \text{ вн.мм} = 31.5$ Гр. сл. = VI Точн. = П
	БПЗ-975 $F \text{ см}^2 = 1.720$ $Q \text{ кг.} = 0.466$ $D \text{ оп.мм} = 38.0$ $P \text{ н.мм} = 119.4$ $P \text{ вн.мм} = 110.0$ Гр. сл. = IV Точн. = П		БПЗ-980 $F \text{ см}^2 = 1.330$ $Q \text{ кг.} = 0.360$ $D \text{ оп.мм} = 43.0$ $P \text{ н.мм} = 140.2$ $P \text{ вн.мм} = 83.7$ Гр. сл. = V Точн. = П

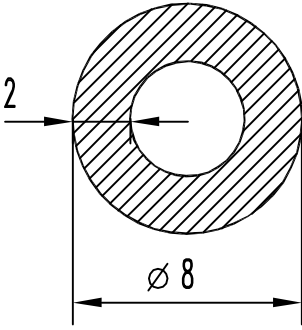
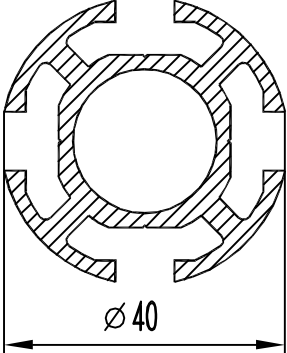
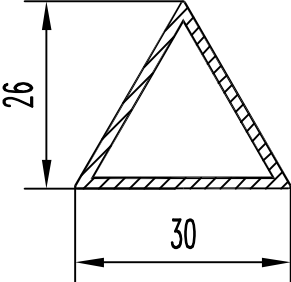
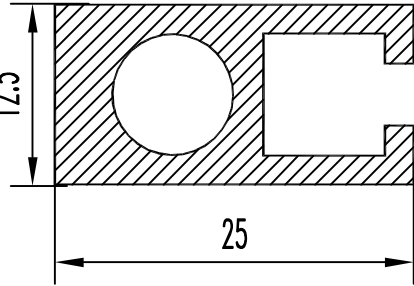
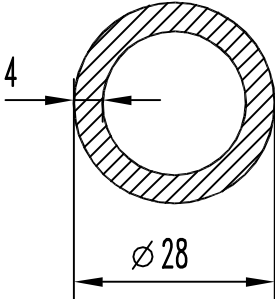
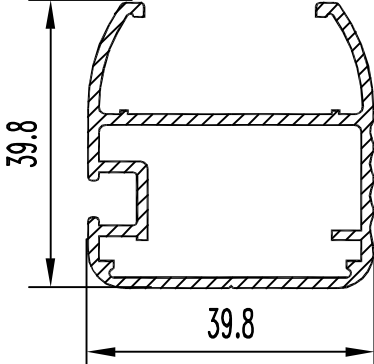
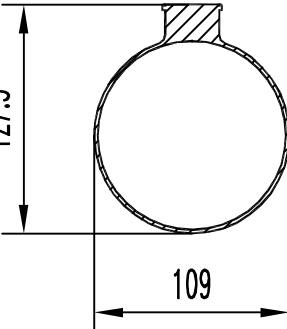
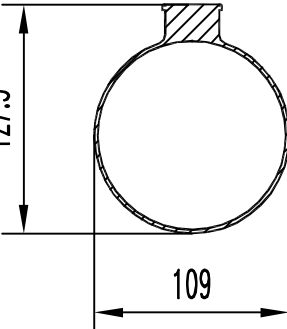
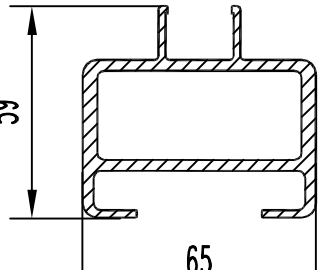
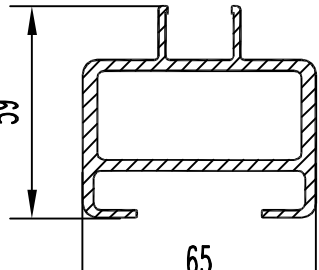
	БПЗ-981 $F \text{ см}^2 = 2.270$ $Q \text{ кг.} = 0.615$ $D \text{ оп.мм} = 51.2$ $P \text{ н.мм} = 184.5$ $P \text{ вн.мм} = 143.5$ Гр. сл. = V Точн. = П		БПЗ-986 $F \text{ см}^2 = 0.911$ $Q \text{ кг.} = 0.247$ $D \text{ оп.мм} = 26.0$ $P \text{ н.мм} = 92.0$ $P \text{ вн.мм} = 41.2$ Гр. сл. = V Точн. = П
	БПЗ-982 $F \text{ см}^2 = 2.832$ $Q \text{ кг.} = 0.767$ $D \text{ оп.мм} = 51.4$ $P \text{ н.мм} = 257.5$ $P \text{ вн.мм} = 144.7$ Гр. сл. = V Точн. = П		БПЗ-987 $F \text{ см}^2 = 4.720$ $Q \text{ кг.} = 1.279$ $D \text{ оп.мм} = 87.8$ $P \text{ н.мм} = 337.0$ $P \text{ вн.мм} = 217.0$ Гр. сл. = VI Точн. = П
	БПЗ-983 $F \text{ см}^2 = 0.891$ $Q \text{ кг.} = 0.241$ $D \text{ оп.мм} = 26.0$ $P \text{ н.мм} = 87.2$ $P \text{ вн.мм} = 49.2$ Гр. сл. = V Точн. = П		БПЗ-988 $F \text{ см}^2 = 1.269$ $Q \text{ кг.} = 0.344$ $D \text{ оп.мм} = 49.0$ $P \text{ н.мм} = 150.3$ $P \text{ вн.мм} = 41.2$ Гр. сл. = VI Точн. = П
	БПЗ-984 $F \text{ см}^2 = 1.185$ $Q \text{ кг.} = 0.321$ $D \text{ оп.мм} = 26.0$ $P \text{ н.мм} = 116.6$ $P \text{ вн.мм} = 58.4$ Гр. сл. = V Точн. = П		БПЗ-989 $F \text{ см}^2 = 0.935$ $Q \text{ кг.} = 0.253$ $D \text{ оп.мм} = 38.0$ $P \text{ н.мм} = 108.6$ $P \text{ вн.мм} = 21.5$ Гр. сл. = V Точн. = П
	БПЗ-985 $F \text{ см}^2 = 1.169$ $Q \text{ кг.} = 0.317$ $D \text{ оп.мм} = 42.0$ $P \text{ н.мм} = 135.2$ $P \text{ вн.мм} = 41.2$ Гр. сл. = V Точн. = П		БПЗ-990 $F \text{ см}^2 = 0.864$ $Q \text{ кг.} = 0.234$ $D \text{ оп.мм} = 33.0$ $P \text{ н.мм} = 97.6$ $P \text{ вн.мм} = 21.5$ Гр. сл. = V Точн. = П

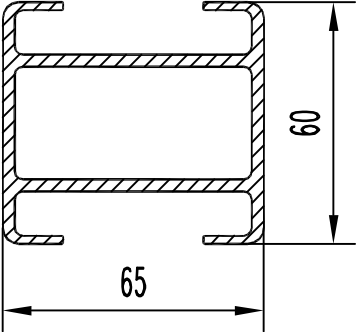
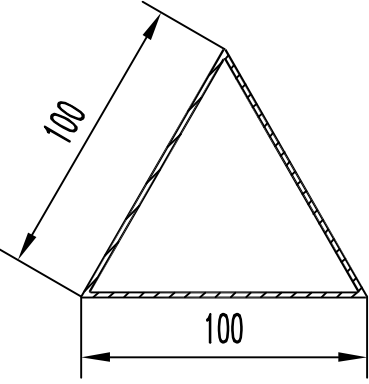
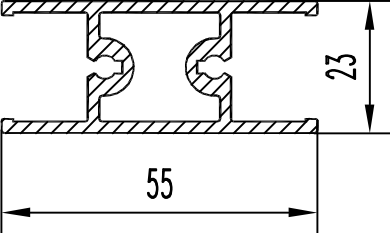
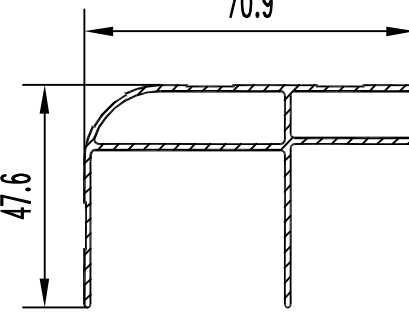
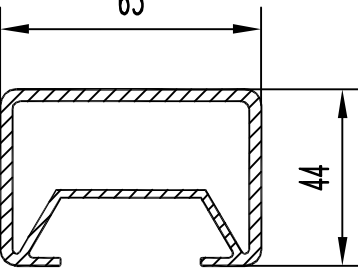
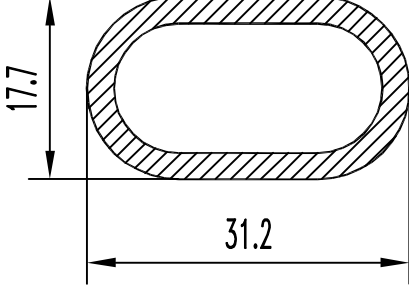
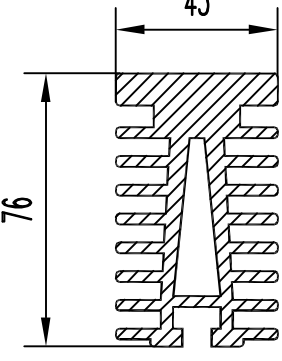
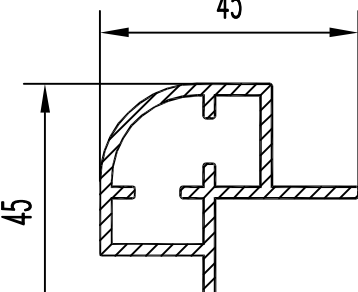
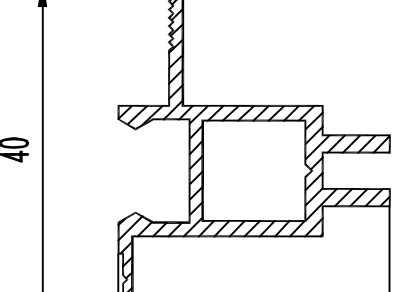
			БПЗ-996
			$F \text{ см}^2 = 0.880$ $Q \text{ кг.} = 0.238$ $D \text{ оп.мм} = 16.0$ $P \text{ н.мм} = 50.3$ $P \text{ вн.мм} = 37.7$ Гр. сл. = III Точн. = Н
			БПЗ-997
			$F \text{ см}^2 = 2.513$ $Q \text{ кг.} = 0.681$ $D \text{ оп.мм} = 42.0$ $P \text{ н.мм} = 131.9$ $P \text{ вн.мм} = 119.4$ Гр. сл. = III Точн. = Н
	БПЗ-993		БПЗ-998
	$F \text{ см}^2 = 3.308$ $Q \text{ кг.} = 0.896$ $D \text{ оп.мм} = 45.0$ $P \text{ н.мм} = 119.7$ $P \text{ вн.мм} = 100.8$ Гр. сл. = IV Точн. = Н		$F \text{ см}^2 = 1.103$ $Q \text{ кг.} = 0.299$ $D \text{ оп.мм} = 42.0$ $P \text{ н.мм} = 132.6$ $P \text{ вн.мм} = 21.5$ Гр. сл. = V Точн. = П
	БПЗ-994		БПЗ-999
	$F \text{ см}^2 = 6.240$ $Q \text{ кг.} = 1.691$ $D \text{ оп.мм} = 153.0$ $P \text{ н.мм} = 752.5$ $P \text{ вн.мм} = 0.0$ Гр. сл. = V Точн. = Н		$F \text{ см}^2 = 0.928$ $Q \text{ кг.} = 0.251$ $D \text{ оп.мм} = 29.0$ $P \text{ н.мм} = 105.7$ $P \text{ вн.мм} = 21.5$ Гр. сл. = V Точн. = П
	БПЗ-995		БПЗ-1000
	$F \text{ см}^2 = 5.374$ $Q \text{ кг.} = 1.456$ $D \text{ оп.мм} = 85.0$ $P \text{ н.мм} = 379.3$ $P \text{ вн.мм} = 110.8$ Гр. сл. = V Точн. = Н		$F \text{ см}^2 = 1.019$ $Q \text{ кг.} = 0.276$ $D \text{ оп.мм} = 36.0$ $P \text{ н.мм} = 119.7$ $P \text{ вн.мм} = 21.5$ Гр. сл. = V Точн. = П

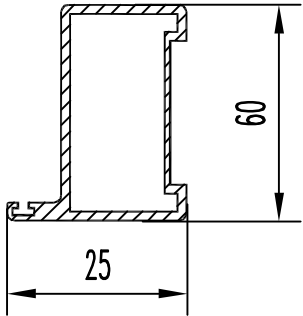
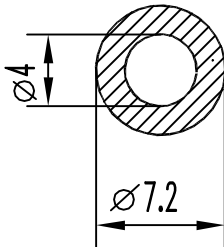
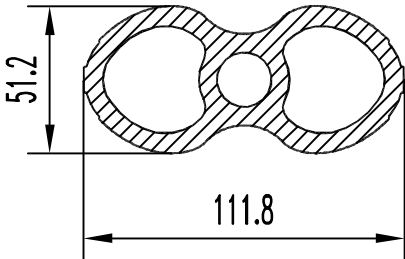
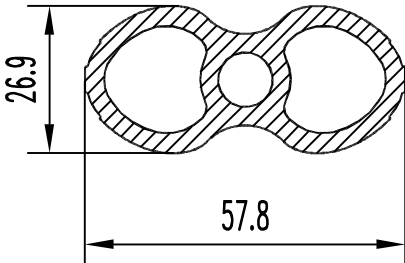
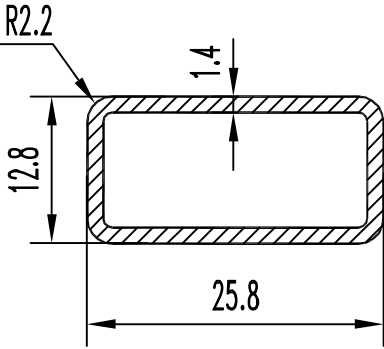
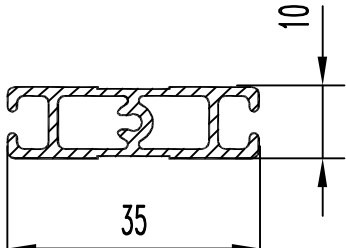
	БПЗ-1001 $F \text{ см}^2 = 3.200$ $Q \text{ кг.} = 0.867$ $D \text{ оп.мм} = 92.8$ $P \text{ н.мм} = 340.2$ $P \text{ вн.мм} = 154.9$ Гр. сл. = V Точн. = П		
	БПЗ-1002 $F \text{ см}^2 = 3.260$ $Q \text{ кг.} = 0.883$ $D \text{ оп.мм} = 97.7$ $P \text{ н.мм} = 355.3$ $P \text{ вн.мм} = 152.3$ Гр. сл. = V Точн. = П		БПЗ-1007 $F \text{ см}^2 = 8.130$ $Q \text{ кг.} = 2.203$ $D \text{ оп.мм} = 66.0$ $P \text{ н.мм} = 168.4$ $P \text{ вн.мм} = 159.0$ Гр. сл. = 0соб. Точн. = П
	БПЗ-1003 $F \text{ см}^2 = 1.105$ $Q \text{ кг.} = 0.299$ $D \text{ оп.мм} = 37.0$ $P \text{ н.мм} = 106.8$ $P \text{ вн.мм} = 66.5$ Гр. сл. = V Точн. = П		БПЗ-1008 $F \text{ см}^2 = 5.924$ $Q \text{ кг.} = 1.605$ $D \text{ оп.мм} = 66.0$ $P \text{ н.мм} = 168.4$ $P \text{ вн.мм} = 188.0$ Гр. сл. = 0соб. Точн. = П
	БПЗ-1004 $F \text{ см}^2 = 1.840$ $Q \text{ кг.} = 0.499$ $D \text{ оп.мм} = 53.0$ $P \text{ н.мм} = 147.9$ $P \text{ вн.мм} = 123.1$ Гр. сл. = V Точн. = П		

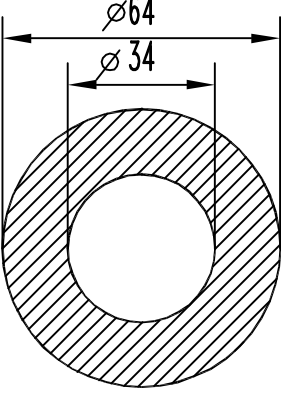
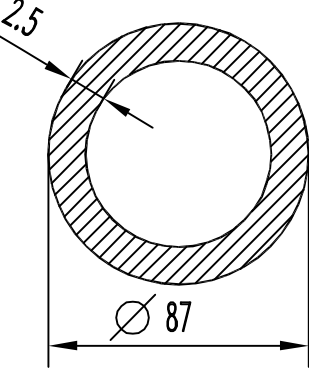
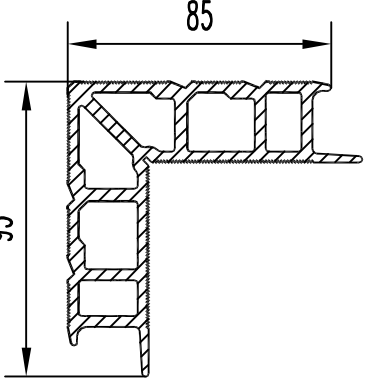
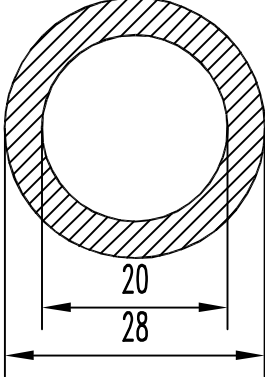
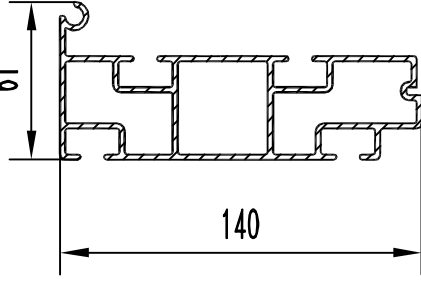
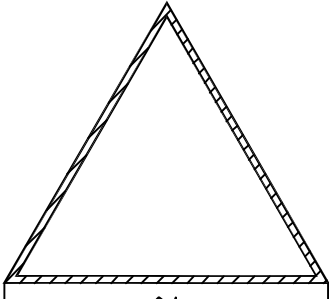
	БПЗ-1011 $F \text{ см}^2 = 2.870$ $Q \text{ кг.} = 0.778$ $D \text{ оп.мм} = 51.2$ $P \text{ н.мм} = 190.8$ $P \text{ вн.мм} = 108.8$ Гр. сл. = V Точн. = П		БПЗ-1016 $F \text{ см}^2 = 4.490$ $Q \text{ кг.} = 1.217$ $D \text{ оп.мм} = 81.2$ $P \text{ н.мм} = 294.2$ $P \text{ вн.мм} = 188.4$ Гр. сл. = VI Точн. = П
	БПЗ-1012 $F \text{ см}^2 = 3.640$ $Q \text{ кг.} = 0.986$ $D \text{ оп.мм} = 90.0$ $P \text{ н.мм} = 260.0$ $P \text{ вн.мм} = 104.0$ Гр. сл. = IV Точн. = П		БПЗ-1017 $F \text{ см}^2 = 1.006$ $Q \text{ кг.} = 0.273$ $D \text{ оп.мм} = 18.0$ $P \text{ н.мм} = 56.6$ $P \text{ вн.мм} = 44.0$ Гр. сл. = III Точн. = Н
	БПЗ-1013 $F \text{ см}^2 = 2.332$ $Q \text{ кг.} = 0.632$ $D \text{ оп.мм} = 52.0$ $P \text{ н.мм} = 138.4$ $P \text{ вн.мм} = 92.5$ Гр. сл. = VI Точн. = П		БПЗ-1018 $F \text{ см}^2 = 2.730$ $Q \text{ кг.} = 0.740$ $D \text{ оп.мм} = 77.6$ $P \text{ н.мм} = 302.8$ $P \text{ вн.мм} = 0.0$ Гр. сл. = V Точн. = П
			БПЗ-1019 $F \text{ см}^2 = 3.370$ $Q \text{ кг.} = 0.913$ $D \text{ оп.мм} = 25.0$ $P \text{ н.мм} = 78.5$ $P \text{ вн.мм} = 44.0$ Гр. сл. = IV Точн. = Н
	БПЗ-1015 $F \text{ см}^2 = 4.710$ $Q \text{ кг.} = 1.276$ $D \text{ оп.мм} = 87.3$ $P \text{ н.мм} = 306.3$ $P \text{ вн.мм} = 200.5$ Гр. сл. = VI Точн. = П		БПЗ-1020 $F \text{ см}^2 = 0.353$ $Q \text{ кг.} = 0.096$ $D \text{ оп.мм} = 9.0$ $P \text{ н.мм} = 28.3$ $P \text{ вн.мм} = 18.9$ Гр. сл. = III Точн. = Н

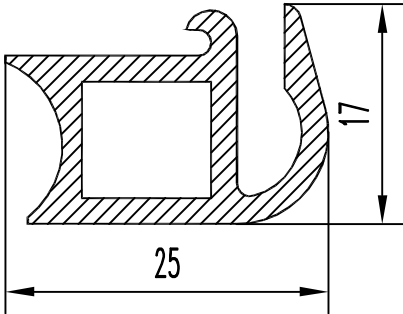
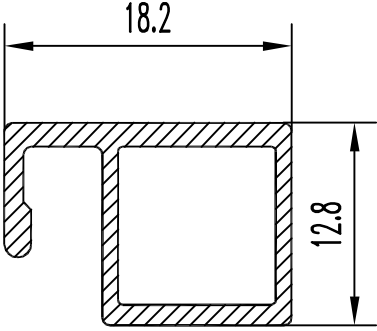
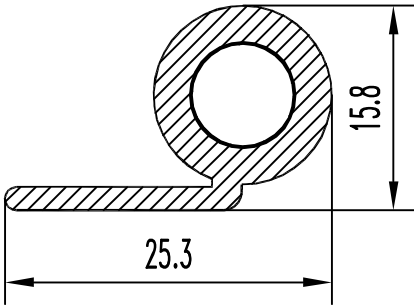
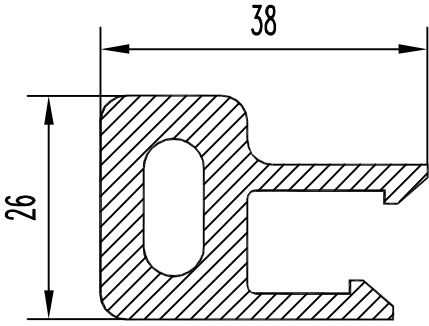
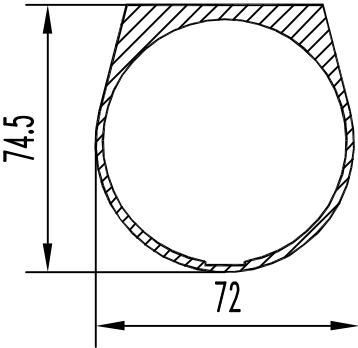
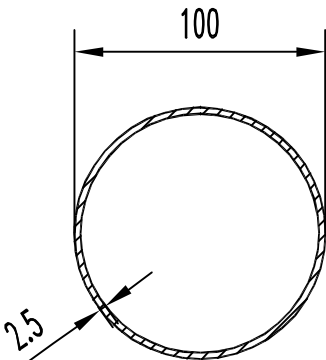
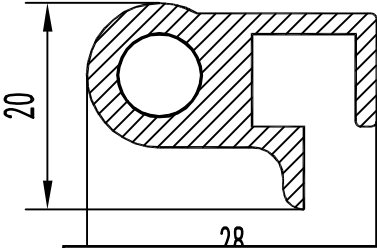
	БПЗ-1021 $F \text{ см}^2 = 3.371$ $Q \text{ кг.} = 0.914$ $D \text{ оп.мм} = 49$ $P \text{ н.мм} = 257.1$ $P \text{ вн.мм} = 69.3$ Гр. сл. = V Точн. = особая		БПЗ-1026 $F \text{ см}^2 = 1$ $Q \text{ кг.} = 1$ $D \text{ оп.мм} = 1$ $P \text{ н.мм} = 1$ $P \text{ вн.мм} = 1$ Гр. сл. = особая Точн. = П
	БПЗ-1022 $F \text{ см}^2 = 3.933$ $Q \text{ кг.} = 1.066$ $D \text{ оп.мм} = 103.9$ $P \text{ н.мм} = 270$ $P \text{ вн.мм} = 254.4$ Гр. сл. = IV Точн. = П		БПЗ-1027 $F \text{ см}^2 = 1$ $Q \text{ кг.} = 1$ $D \text{ оп.мм} = 1$ $P \text{ н.мм} = 1$ $P \text{ вн.мм} = 1$ Гр. сл. = особая Точн. = П
	БПЗ-1023 $F \text{ см}^2 = 0.9$ $Q \text{ кг.} = 0.244$ $D \text{ оп.мм} = 27$ $P \text{ н.мм} = 86.7$ $P \text{ вн.мм} = 49.2$ Гр. сл. = VI Точн. = П		БПЗ-1028 $F \text{ см}^2 = 0.641$ $Q \text{ кг.} = 0.174$ $D \text{ оп.мм} = 15$ $P \text{ н.мм} = 142.1$ $P \text{ вн.мм} = 38.1$ Гр. сл. = III Точн. = П
	БПЗ-1024 $F \text{ см}^2 = 1$ $Q \text{ кг.} = 1$ $D \text{ оп.мм} = 1$ $P \text{ н.мм} = 1$ $P \text{ вн.мм} = 1$ Гр. сл. = III Точн. = П		БПЗ-1029 $F \text{ см}^2 = 2.99$ $Q \text{ кг.} = 0.807$ $D \text{ оп.мм} = 53$ $P \text{ н.мм} = 212.1$ $P \text{ вн.мм} = 110.4$ Гр. сл. = VI Точн. = П
	БПЗ-1025 $F \text{ см}^2 = 1.840$ $Q \text{ кг.} = 0.499$ $D \text{ оп.мм} = 53.0$ $P \text{ н.мм} = 147.9$ $P \text{ вн.мм} = 123.1$ Гр. сл. = V Точн. = П		БПЗ-1030 $F \text{ см}^2 = 2.95$ $Q \text{ кг.} = 0.798$ $D \text{ оп.мм} = 54$ $P \text{ н.мм} = 180.4$ $P \text{ вн.мм} = 122.7$ Гр. сл. = VI Точн. = П

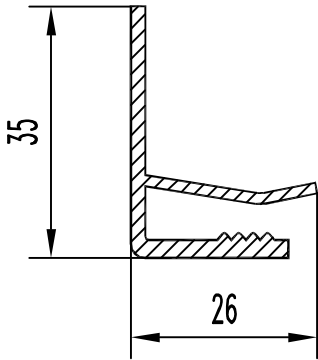
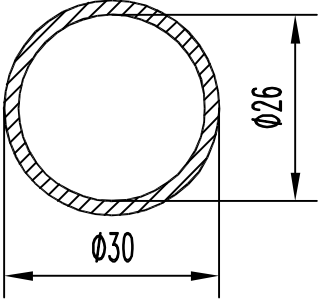
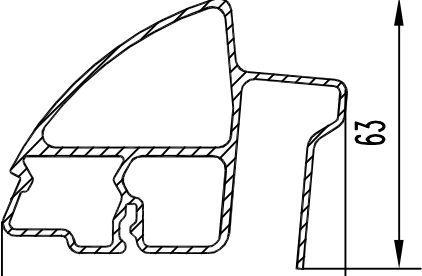
	БПЗ-1031 $F \text{ см}^2 = 0.377$ $Q \text{ кг.} = 0.102$ $D \text{ оп.мм} = 8$ $P \text{ н.мм} = 25.1$ $P \text{ вн.мм} = 12.6$ Гр. сл. = VI Точн. = Н		БПЗ-1036 $F \text{ см}^2 = 4.469$ $Q \text{ кг.} = 1.21$ $D \text{ оп.мм} = 40$ $P \text{ н.мм} = 62.8$ $P \text{ вн.мм} = 159$ Гр. сл. = VI Точн. = П
	БПЗ-1032 $F \text{ см}^2 = 1.25$ $Q \text{ кг.} = 0.339$ $D \text{ оп.мм} = 35$ $P \text{ н.мм} = 90$ $P \text{ вн.мм} = 75.7$ Гр. сл. = IV Точн. = П		БПЗ-1037 $F \text{ см}^2 = 1.789$ $Q \text{ кг.} = 0.485$ $D \text{ оп.мм} = 28$ $P \text{ н.мм} = 104.4$ $P \text{ вн.мм} = 25.8$ Гр. сл. = V Точн. = П
	БПЗ-1033 $F \text{ см}^2 = 3.016$ $Q \text{ кг.} = 0.817$ $D \text{ оп.мм} = 28$ $P \text{ н.мм} = 88$ $P \text{ вн.мм} = 62.8$ Гр. сл. = III Точн. = Н		БПЗ-1038 $F \text{ см}^2 = 2.684$ $Q \text{ кг.} = 0.727$ $D \text{ оп.мм} = 51$ $P \text{ н.мм} = 217$ $P \text{ вн.мм} = 138.7$ Гр. сл. = V Точн. = П
	БПЗ-1034 $F \text{ см}^2 = 1$ $Q \text{ кг.} = 1$ $D \text{ оп.мм} = 1$ $P \text{ н.мм} = 1$ $P \text{ вн.мм} = 1$ Гр. сл. = III Точн. = П		БПЗ-1039 $F \text{ см}^2 = 12.552$ $Q \text{ кг.} = 3.402$ $D \text{ оп.мм} = 130$ $P \text{ н.мм} = 389.2$ $P \text{ вн.мм} = 329.9$ Гр. сл. = V Точн. = П
	БПЗ-1035 $F \text{ см}^2 = 1$ $Q \text{ кг.} = 1$ $D \text{ оп.мм} = 1$ $P \text{ н.мм} = 1$ $P \text{ вн.мм} = 1$ Гр. сл. = V Точн. = П		БПЗ-1040 $F \text{ см}^2 = 7.7$ $Q \text{ кг.} = 2.08$ $D \text{ оп.мм} = 76$ $P \text{ н.мм} = 340.4$ $P \text{ вн.мм} = 160.6$ Гр. сл. = V Точн. = П

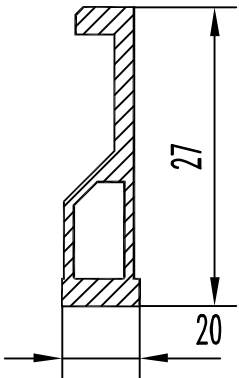
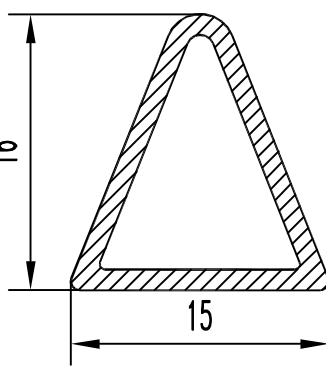
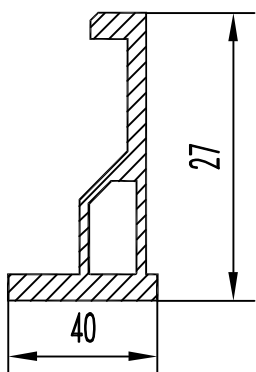
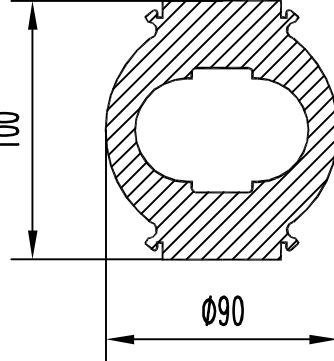
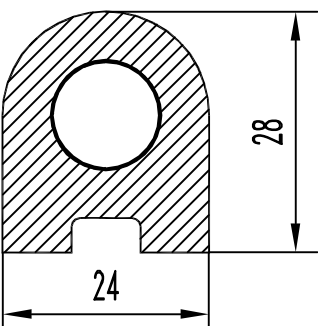
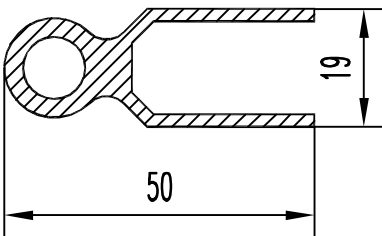
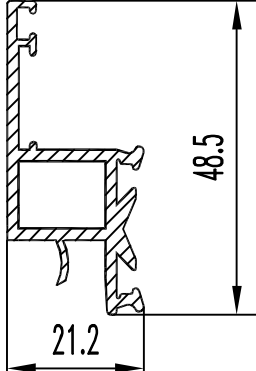
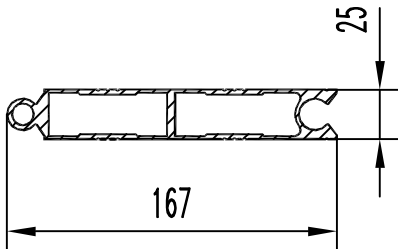
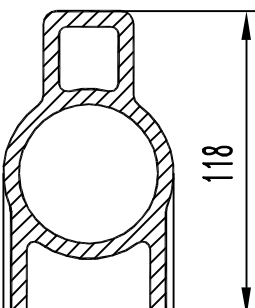
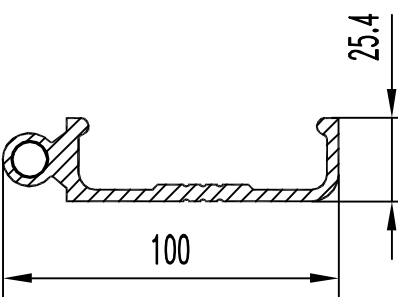
	БПЗ-1041 $F \text{ см}^2 = 8.060$ $Q \text{ кг.} = 2.184$ $D \text{ оп.мм} = 85.2$ $P \text{ н.мм} = 383.2$ $P \text{ вн.мм} = 170.6$ Гр. сл. = V Точн. = П		БПЗ-1046 $F \text{ см}^2 = 4.95$ $Q \text{ кг.} = 1.341$ $D \text{ оп.мм} = 114.9$ $P \text{ н.мм} = 298$ $P \text{ вн.мм} = 281.1$ Гр. сл. = V Точн. = П
	БПЗ-1042 $F \text{ см}^2 = 3.610$ $Q \text{ кг.} = 0.978$ $D \text{ оп.мм} = 59.5$ $P \text{ н.мм} = 243.1$ $P \text{ вн.мм} = 93.8$ Гр. сл. = V Точн. = П		БПЗ-1047 $F \text{ см}^2 = 2.814$ $Q \text{ кг.} = 0.763$ $D \text{ оп.мм} = 86.0$ $P \text{ н.мм} = 348.3$ $P \text{ вн.мм} = 97.2$ Гр. сл. = V Точн. = П
	БПЗ-1043 $F \text{ см}^2 = 6.270$ $Q \text{ кг.} = 1.699$ $D \text{ оп.мм} = 75.6$ $P \text{ н.мм} = 263.8$ $P \text{ вн.мм} = 209.8$ Гр. сл. = V Точн. = П		БПЗ-1048 $F \text{ см}^2 = 1.940$ $Q \text{ кг.} = 0.526$ $D \text{ оп.мм} = 31.2$ $P \text{ н.мм} = 82.6$ $P \text{ вн.мм} = 66.3$ Гр. сл. = III Точн. = П
			БПЗ-1049 $F \text{ см}^2 = 18.000$ $Q \text{ кг.} = 4.878$ $D \text{ оп.мм} = 85.8$ $P \text{ н.мм} = 679.8$ $P \text{ вн.мм} = 105.7$ Гр. сл. = VI Точн. = П
	БПЗ-1045 $F \text{ см}^2 = 3.020$ $Q \text{ кг.} = 0.818$ $D \text{ оп.мм} = 48.0$ $P \text{ н.мм} = 171.9$ $P \text{ вн.мм} = 128.5$ Гр. сл. = V Точн. = П		БПЗ-1050 $F \text{ см}^2 = 1.920$ $Q \text{ кг.} = 0.520$ $D \text{ оп.мм} = 42.6$ $P \text{ н.мм} = 179.3$ $P \text{ вн.мм} = 47.8$ Гр. сл. = V Точн. = П

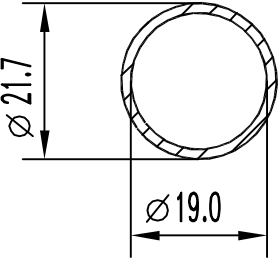
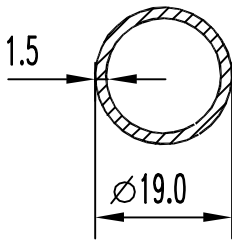
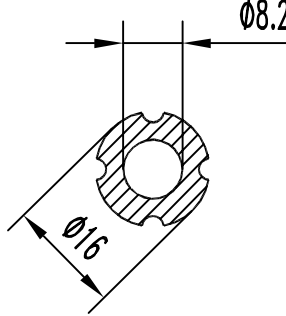
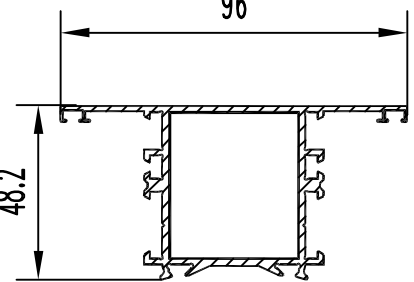
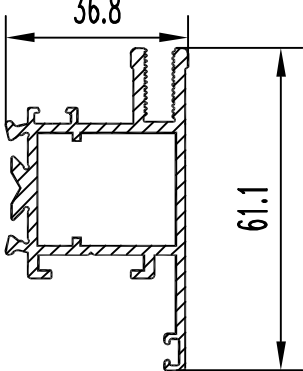
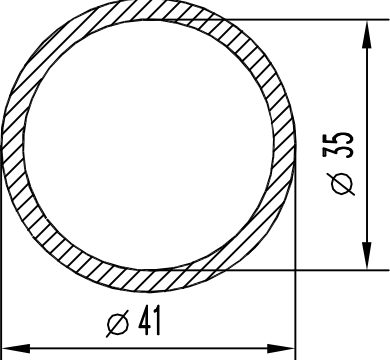
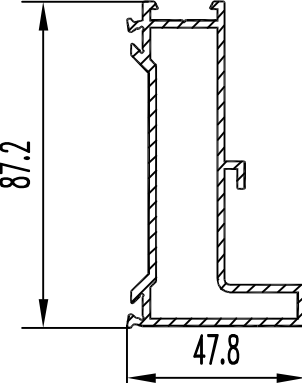
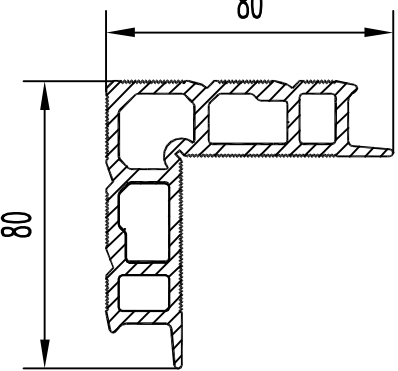
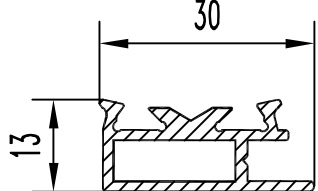
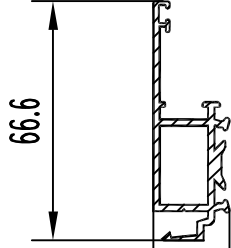
	БПЗ-1051 $F \text{ см}^2 = 4.83$ $Q \text{ кг.} = 1.309$ $D \text{ оп.мм} = 77$ $P \text{ н.мм} = 237.3$ $P \text{ вн.мм} = 177$ Гр. сл. = V Точн. = П		БПЗ-1056 $F \text{ см}^2 = 0.282$ $Q \text{ кг.} = 0.076$ $D \text{ оп.мм} = 7.2$ $P \text{ н.мм} = 22.6$ $P \text{ вн.мм} = 12.6$ Гр. сл. = IV Точн. = П
	БПЗ-1052 $F \text{ см}^2 = 1$ $Q \text{ кг.} = 1$ $D \text{ оп.мм} = 1$ $P \text{ н.мм} = 1$ $P \text{ вн.мм} = 1$ Гр. сл. = IV Точн. = П		БПЗ-1057 $F \text{ см}^2 = 21.14$ $Q \text{ кг.} = 5.729$ $D \text{ оп.мм} = 112$ $P \text{ н.мм} = 288.8$ $P \text{ вн.мм} = 296.3$ Гр. сл. = особая Точн. = П
	БПЗ-1053 $F \text{ см}^2 = 1$ $Q \text{ кг.} = 1$ $D \text{ оп.мм} = 1$ $P \text{ н.мм} = 1$ $P \text{ вн.мм} = 1$ Гр. сл. = III Точн. = Н		БПЗ-1058 $F \text{ см}^2 = 5.81$ $Q \text{ кг.} = 1.574$ $D \text{ оп.мм} = 57$ $P \text{ н.мм} = 149.9$ $P \text{ вн.мм} = 154.6$ Гр. сл. = особая Точн. = П
	БПЗ-1054 $F \text{ см}^2 = 1$ $Q \text{ кг.} = 1$ $D \text{ оп.мм} = 1$ $P \text{ н.мм} = 1$ $P \text{ вн.мм} = 1$ Гр. сл. = III Точн. = П		БПЗ-1059 $F \text{ см}^2 = 0.966$ $Q \text{ кг.} = 0.262$ $D \text{ оп.мм} = 30$ $P \text{ н.мм} = 73.4$ $P \text{ вн.мм} = 64.6$ Гр. сл. = IV Точн. = П
	БПЗ-1055 $F \text{ см}^2 = 1$ $Q \text{ кг.} = 1$ $D \text{ оп.мм} = 1$ $P \text{ н.мм} = 1$ $P \text{ вн.мм} = 1$ Гр. сл. = V Точн. = П		БПЗ-1060 $F \text{ см}^2 = 1.351$ $Q \text{ кг.} = 0.366$ $D \text{ оп.мм} = 36$ $P \text{ н.мм} = 124.2$ $P \text{ вн.мм} = 74.4$ Гр. сл. = V Точн. = П

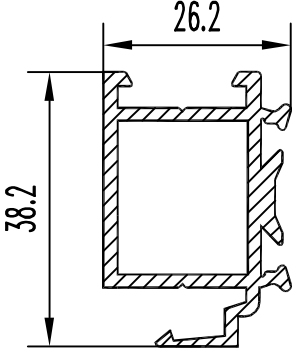
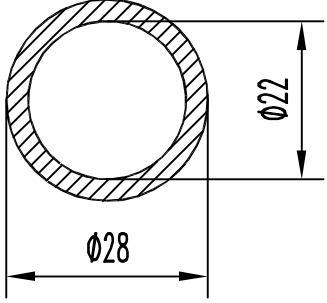
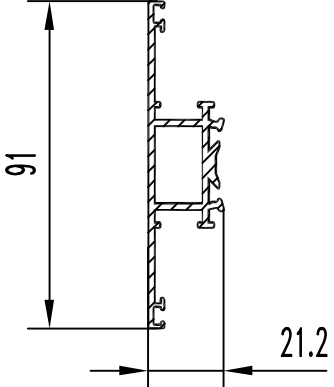
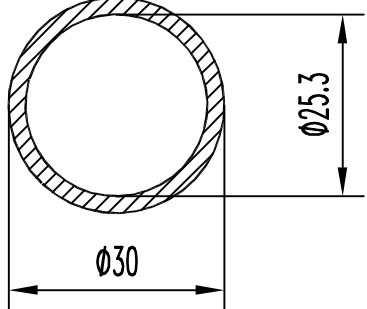
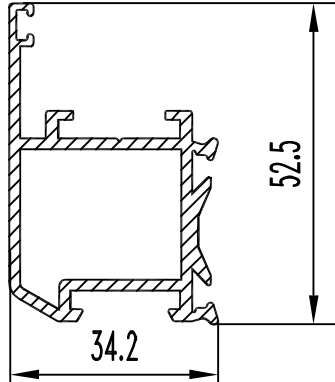
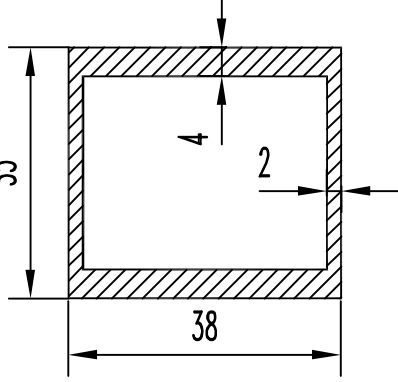
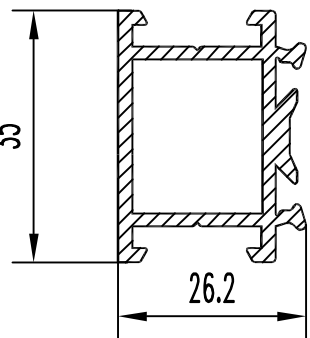
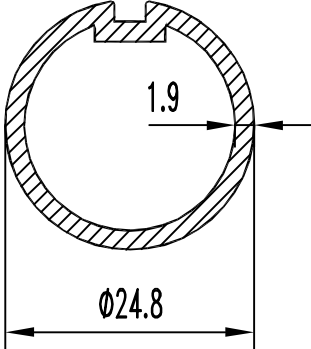
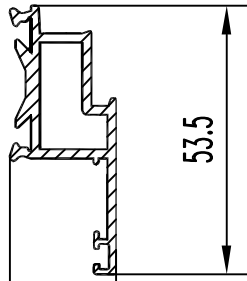
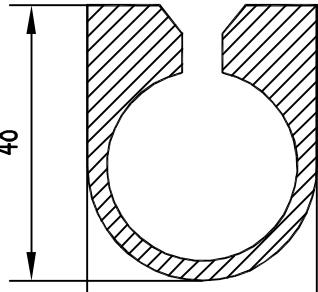
	БПЗ-1061 $F \text{ см}^2 = 23.090$ $Q \text{ кг.} = 6.257$ $D \text{ оп.мм} = 64.0$ $P \text{ н.мм} = 201.1$ $P \text{ вн.мм} = 106.8$ Гр. сл. = III Точн. = Н		БПЗ-1066 $F \text{ см}^2 = 7.637$ $Q \text{ кг.} = 2.070$ $D \text{ оп.мм} = 87.0$ $P \text{ н.мм} = 273.3$ $P \text{ вн.мм} = 257.6$ Гр. сл. = IV Точн. = Н
	БПЗ-1062 $F \text{ см}^2 = 15.620$ $Q \text{ кг.} = 4.233$ $D \text{ оп.мм} = 118.0$ $P \text{ н.мм} = 494.1$ $P \text{ вн.мм} = 430.9$ Гр. сл. = V Точн. = П		
	БПЗ-1063 $F \text{ см}^2 = 3.016$ $Q \text{ кг.} = 0.817$ $D \text{ оп.мм} = 28.0$ $P \text{ н.мм} = 87.9$ $P \text{ вн.мм} = 62.8$ Гр. сл. = IV Точн. = П		
	БПЗ-1064 $F \text{ см}^2 = 11.110$ $Q \text{ кг.} = 3.011$ $D \text{ оп.мм} = 148.0$ $P \text{ н.мм} = 607.2$ $P \text{ вн.мм} = 472.6$ Гр. сл. = 0соб. Точн. = П		
	БПЗ-1065 $F \text{ см}^2 = 5.430$ $Q \text{ кг.} = 1.472$ $D \text{ оп.мм} = 104.5$ $P \text{ н.мм} = 282.0$ $P \text{ вн.мм} = 261.2$ Гр. сл. = V		

			БПЗ-1076 $F \text{ см}^2 = 1.490$ $Q \text{ кг.} = 0.404$ $D \text{ оп.мм} = 26.6$ $P \text{ н.мм} = 108.7$ $P \text{ вн.мм} = 38.0$ $\Gamma \text{р. сл.} = v$ $\text{Точн.} = \Pi$
	БПЗ-1072 $F \text{ см}^2 = 0.726$ $Q \text{ кг.} = 0.197$ $D \text{ оп.мм} = 22.0$ $P \text{ н.мм} = 74.7$ $P \text{ вн.мм} = 39.5$ $\Gamma \text{р. сл.} = iv$ $\text{Точн.} = \Pi$		БПЗ-1077 $F \text{ см}^2 = 1.330$ $Q \text{ кг.} = 0.360$ $D \text{ оп.мм} = 27.0$ $P \text{ н.мм} = 78.4$ $P \text{ вн.мм} = 25.1$ $\Gamma \text{р. сл.} = V$ $\text{Точн.} = \Pi$
	БПЗ-1073 $F \text{ см}^2 = 4.556$ $Q \text{ кг.} = 1.235$ $D \text{ оп.мм} = 42.0$ $P \text{ н.мм} = 158.2$ $P \text{ вн.мм} = 40.0$ $\Gamma \text{р. сл.} = vi$ $\text{Точн.} = \Pi$		БПЗ-1078 $F \text{ см}^2 = 8.729$ $Q \text{ кг.} = 2.366$ $D \text{ оп.мм} = 84.0$ $P \text{ н.мм} = 246.9$ $P \text{ вн.мм} = 215.7$ $\Gamma \text{р. сл.} = VI$ $\text{Точн.} = \Pi$
	БПЗ-1074 $F \text{ см}^2 = 7.657$ $Q \text{ кг.} = 2.075$ $D \text{ оп.мм} = 100.0$ $P \text{ н.мм} = 314.2$ $P \text{ вн.мм} = 298.5$ $\Gamma \text{р. сл.} = v$ $\text{Точн.} = \Pi$		
	БПЗ-1075 $F \text{ см}^2 = 2.110$ $Q \text{ кг.} = 0.572$ $D \text{ оп.мм} = 29.1$ $P \text{ н.мм} = 114.4$ $P \text{ вн.мм} = 25.1$ $\Gamma \text{р. сл.} = v$ $\text{Точн.} = \Pi$		

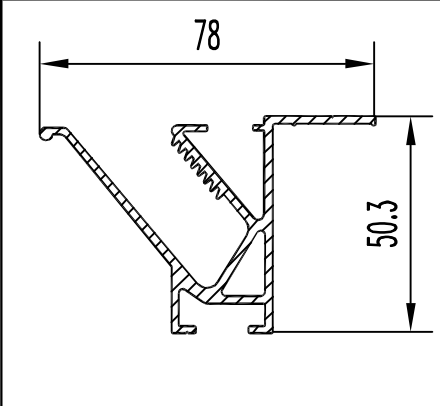
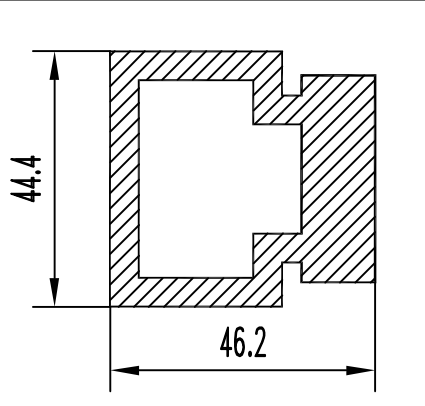
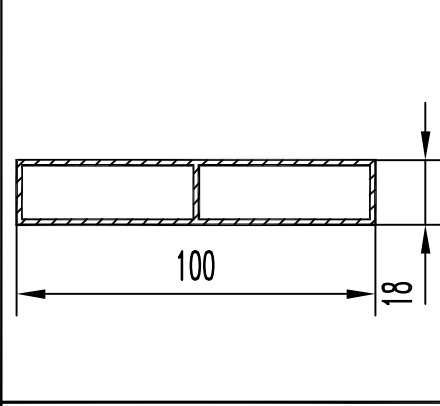
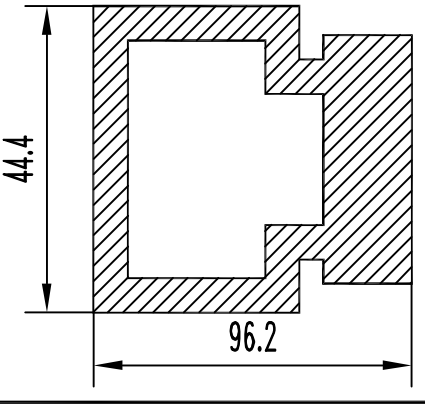
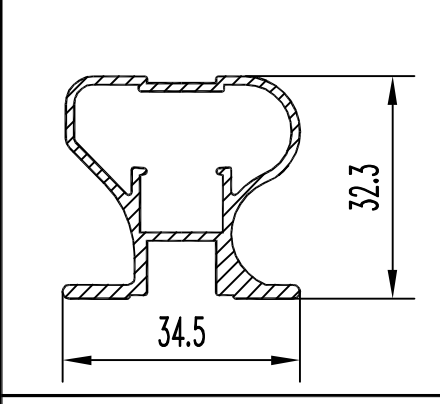
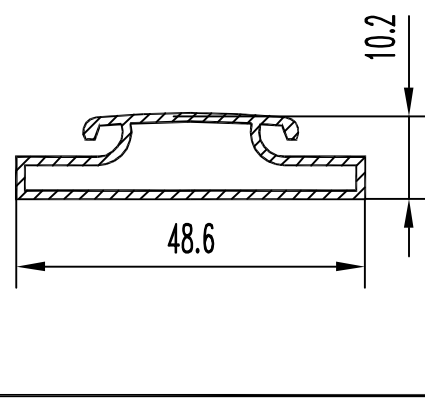
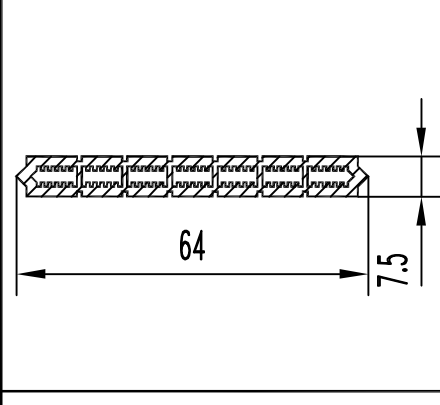
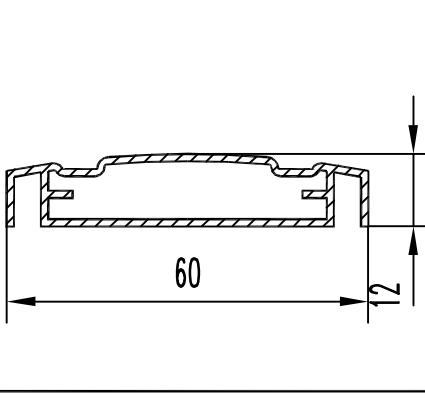
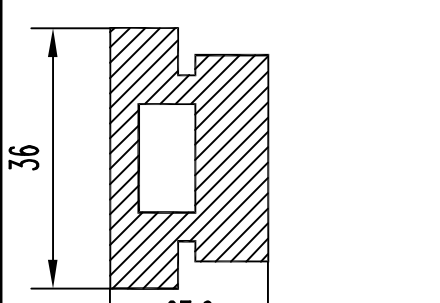
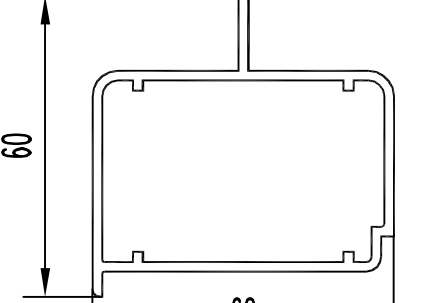
	БПЗ-1081		БПЗ-1086
	$F \text{ см}^2 = 1$ $Q \text{ кг.} = 1$ $D \text{ оп.мм} = 1$ $P \text{ н.мм} = 1$ $P \text{ вн.мм} = 1$ Гр. сл. = V Точн. = П		$F \text{ см}^2 = 1.6$ $Q \text{ кг.} = 0.434$ $D \text{ оп.мм} = 44.3$ $P \text{ н.мм} = 165.1$ $P \text{ вн.мм} = 0$ Гр. сл. = VI Точн. = П
	БПЗ-1082		БПЗ-1087
	$F \text{ см}^2 = 1$ $Q \text{ кг.} = 1$ $D \text{ оп.мм} = 1$ $P \text{ н.мм} = 1$ $P \text{ вн.мм} = 1$ Гр. сл. = IV Точн. = П		$F \text{ см}^2 = 1$ $Q \text{ кг.} = 1$ $D \text{ оп.мм} = 1$ $P \text{ н.мм} = 1$ $P \text{ вн.мм} = 1$ Гр. сл. = IV Точн. = П
	БПЗ-1083		БПЗ-1088
	$F \text{ см}^2 = 1$ $Q \text{ кг.} = 1$ $D \text{ оп.мм} = 1$ $P \text{ н.мм} = 1$ $P \text{ вн.мм} = 1$ Гр. сл. = III Точн. = Н		$F \text{ см}^2 = 1.769$ $Q \text{ кг.} = 0.479$ $D \text{ оп.мм} = 30$ $P \text{ н.мм} = 94.3$ $P \text{ вн.мм} = 81.7$ Гр. сл. = IV Точн. = П
	БПЗ-1084		БПЗ-1089
	$F \text{ см}^2 = 1$ $Q \text{ кг.} = 1$ $D \text{ оп.мм} = 1$ $P \text{ н.мм} = 1$ $P \text{ вн.мм} = 1$ Гр. сл. = III Точн. = П		$F \text{ см}^2 = 1$ $Q \text{ кг.} = 1$ $D \text{ оп.мм} = 1$ $P \text{ н.мм} = 1$ $P \text{ вн.мм} = 1$ Гр. сл. = IV Точн. = П
	БПЗ-1085		БПЗ-1090
	$F \text{ см}^2 = 1$ $Q \text{ кг.} = 1$ $D \text{ оп.мм} = 1$ $P \text{ н.мм} = 1$ $P \text{ вн.мм} = 1$ Гр. сл. = V Точн. = П		$F \text{ см}^2 = 5.82$ $Q \text{ кг.} = 1.577$ $D \text{ оп.мм} = 87$ $P \text{ н.мм} = 354.4$ $P \text{ вн.мм} = 299.1$ Гр. сл. = VI Точн. = П

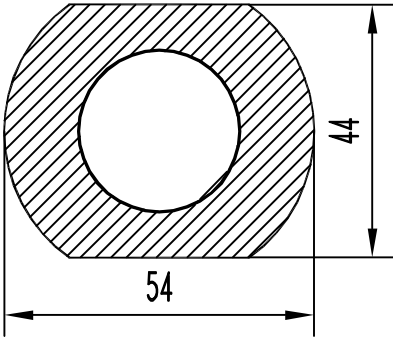
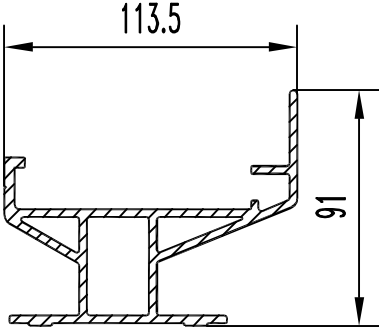
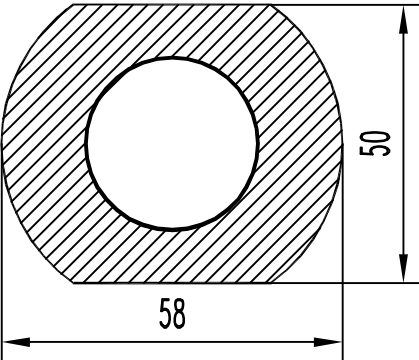
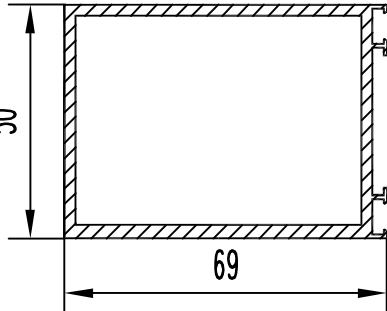
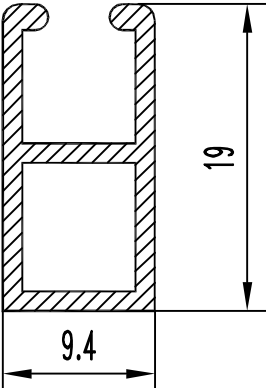
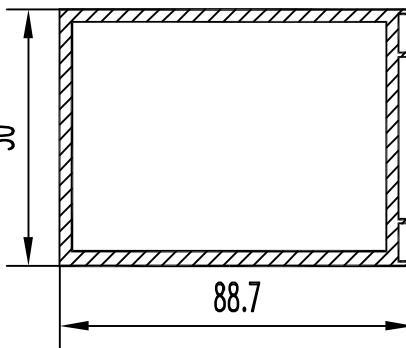
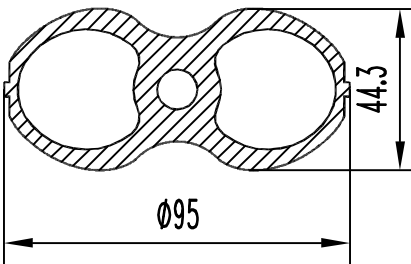
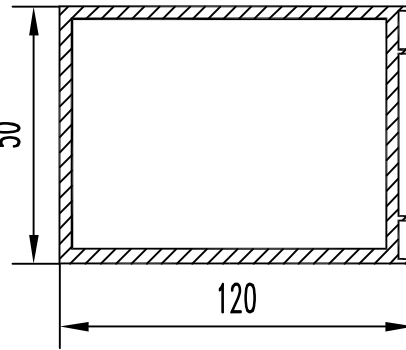
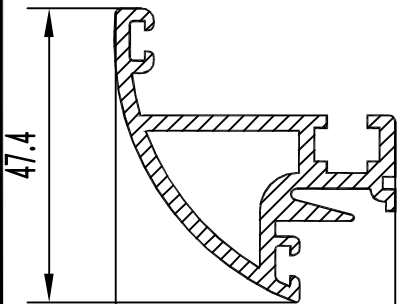
	БПЗ-1091 $F \text{ см}^2 = 5.958$ $Q \text{ кг.} = 1.615$ $D \text{ оп.мм} = 80.0$ $P \text{ н.мм} = 205.2$ $P \text{ вн.мм} = 72.0$ Гр. сл. = IV Точн. = П		БПЗ-1096 $F \text{ см}^2 = 0.563$ $Q \text{ кг.} = 0.153$ $D \text{ оп.мм} = 20.0$ $P \text{ н.мм} = 51.0$ $P \text{ вн.мм} = 41.4$ Гр. сл. = IV Точн. = Н
	БПЗ-1092 $F \text{ см}^2 = 7.358$ $Q \text{ кг.} = 1.994$ $D \text{ оп.мм} = 86.0$ $P \text{ н.мм} = 245.2$ $P \text{ вн.мм} = 72.0$ Гр. сл. = IV Точн. = П		БПЗ-1097 $F \text{ см}^2 = 46.000$ $Q \text{ кг.} = 12.466$ $D \text{ оп.мм} = 111.6$ $P \text{ н.мм} = 368.7$ $P \text{ вн.мм} = 193.5$ Гр. сл. = V Точн. = П
	БПЗ-1093 $F \text{ см}^2 = 4.460$ $Q \text{ кг.} = 1.209$ $D \text{ оп.мм} = 30.0$ $P \text{ н.мм} = 100.8$ $P \text{ вн.мм} = 40.8$ Гр. сл. = IV Точн. = П		БПЗ-1098 $F \text{ см}^2 = 2.993$ $Q \text{ кг.} = 0.811$ $D \text{ оп.мм} = 52.0$ $P \text{ н.мм} = 188.6$ $P \text{ вн.мм} = 31.4$ Гр. сл. = VI Точн. = П
	БПЗ-1094 $F \text{ см}^2 = 2.152$ $Q \text{ кг.} = 0.583$ $D \text{ оп.мм} = 52.0$ $P \text{ н.мм} = 188.2$ $P \text{ вн.мм} = 47.5$ Гр. сл. = V Точн. = П		БПЗ-1099 $F \text{ см}^2 = 10.210$ $Q \text{ кг.} = 2.767$ $D \text{ оп.мм} = 168.0$ $P \text{ н.мм} = 428.7$ $P \text{ вн.мм} = 372.0$ Гр. сл. = VI Точн. = П
	БПЗ-1095 $F \text{ см}^2 = 21.250$ $Q \text{ кг.} = 5.759$ $D \text{ оп.мм} = 120.0$ $P \text{ н.мм} = 399.3$ $P \text{ вн.мм} = 260.7$ Гр. сл. = IV		БПЗ-1100 $F \text{ см}^2 = 6.507$ $Q \text{ кг.} = 1.763$ $D \text{ оп.мм} = 102.0$ $P \text{ н.мм} = 291.7$ $P \text{ вн.мм} = 34.5$ Гр. сл. = VI

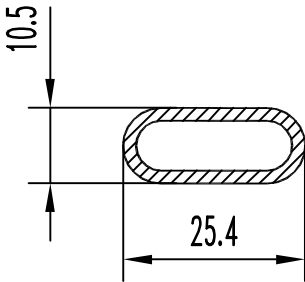
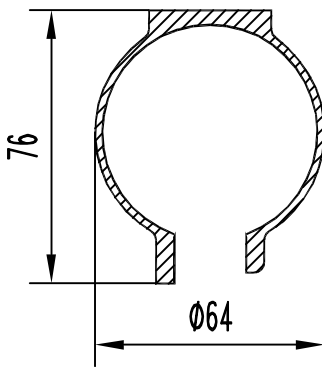
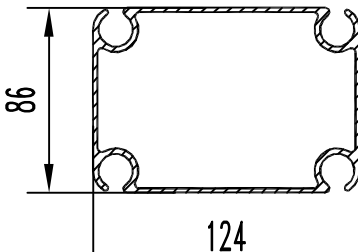
	БПЗ-1101 $F \text{ см}^2 = 0.863$ $Q \text{ кг.} = 0.234$ $D \text{ оп.мм} = 22$ $P \text{ н.мм} = 68.2$ $P \text{ вн.мм} = 59.7$ Гр. сл. = IV Точн. = П		БПЗ-1106 $F \text{ см}^2 = 0.825$ $Q \text{ кг.} = 0.224$ $D \text{ оп.мм} = 19$ $P \text{ н.мм} = 59.7$ $P \text{ вн.мм} = 50.3$ Гр. сл. = IV Точн. = П
	БПЗ-1102 $F \text{ см}^2 = 1.347$ $Q \text{ кг.} = 0.365$ $D \text{ оп.мм} = 16$ $P \text{ н.мм} = 56$ $P \text{ вн.мм} = 25.8$ Гр. сл. = V Точн. = П		БПЗ-1107 $F \text{ см}^2 = 5.266$ $Q \text{ кг.} = 1.427$ $D \text{ оп.мм} = 96$ $P \text{ н.мм} = 445.2$ $P \text{ вн.мм} = 155.2$ Гр. сл. = V Точн. = П
	БПЗ-1103 $F \text{ см}^2 = 3.78$ $Q \text{ кг.} = 1.02$ $D \text{ оп.мм} = 62$ $P \text{ н.мм} = 315.7$ $P \text{ вн.мм} = 101.5$ Гр. сл. = V Точн. = П		БПЗ-1108 $F \text{ см}^2 = 3.582$ $Q \text{ кг.} = 0.971$ $D \text{ оп.мм} = 41$ $P \text{ н.мм} = 128.8$ $P \text{ вн.мм} = 110$ Гр. сл. = III Точн. = П
	БПЗ-1104 $F \text{ см}^2 = 5.77$ $Q \text{ кг.} = 1.557$ $D \text{ оп.мм} = 97$ $P \text{ н.мм} = 335.3$ $P \text{ вн.мм} = 234.4$ Гр. сл. = V Точн. = П		БПЗ-1109 $F \text{ см}^2 = 11.87$ $Q \text{ кг.} = 3.217$ $D \text{ оп.мм} = 100$ $P \text{ н.мм} = 399.3$ $P \text{ вн.мм} = 305.6$ Гр. сл. = V Точн. = П
	БПЗ-1105 $F \text{ см}^2 = 1.65$ $Q \text{ кг.} = 0.45$ $D \text{ оп.мм} = 33$ $P \text{ н.мм} = 126$ $P \text{ вн.мм} = 42.4$ Гр. сл. = V Точн. = П		БПЗ-1110 $F \text{ см}^2 = 3.45$ $Q \text{ кг.} = 0.936$ $D \text{ оп.мм} = 91$ $P \text{ н.мм} = 319.6$ $P \text{ вн.мм} = 69.6$ Гр. сл. = V Точн. = П

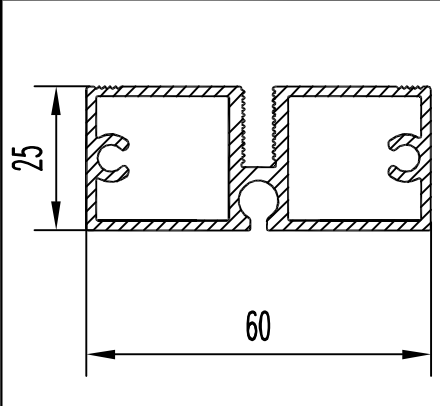
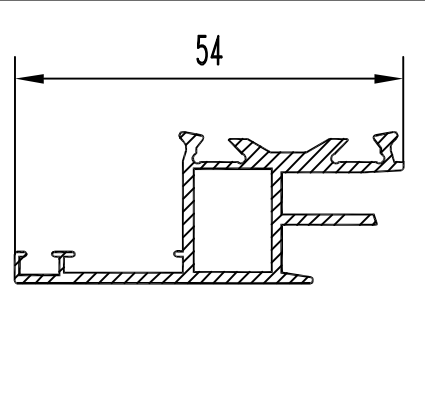
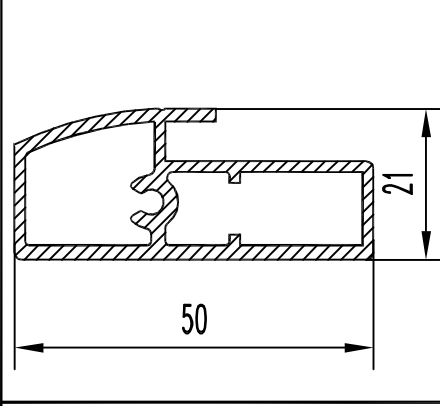
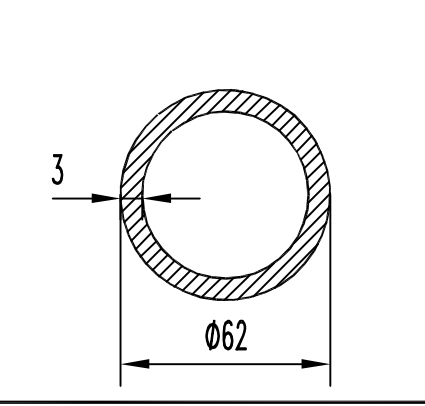
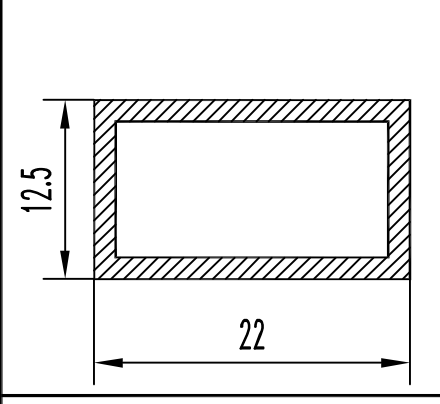
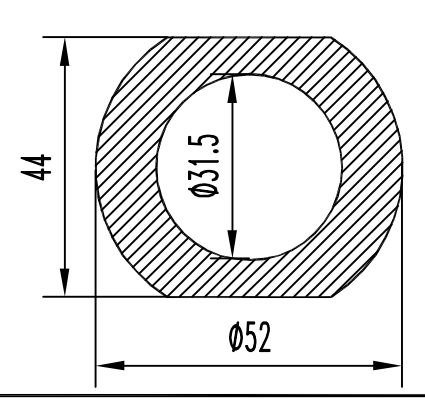
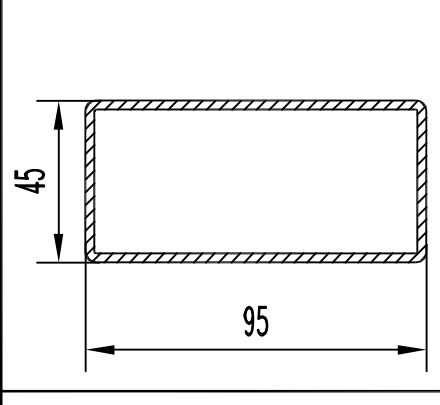
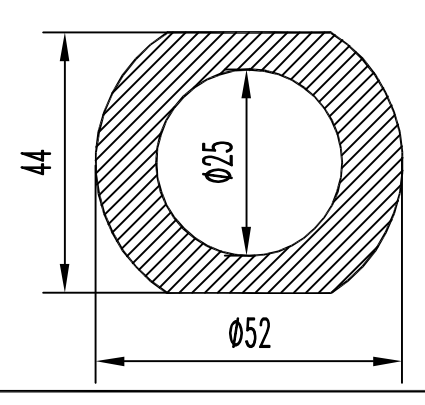
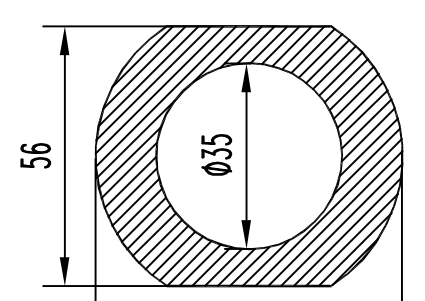
	БПЗ-1111 $F \text{ см}^2 = 2.598$ $Q \text{ кг.} = 0.704$ $D \text{ оп.мм} = 43$ $P \text{ н.мм} = 196$ $P \text{ вн.мм} = 79.2$ $\Gamma \text{р. сл.} = V$ $\text{Точн.} = П$		БПЗ-1116 $F \text{ см}^2 = 2.356$ $Q \text{ кг.} = 0.638$ $D \text{ оп.мм} = 28$ $P \text{ н.мм} = 88$ $P \text{ вн.мм} = 69.1$ $\Gamma \text{р. сл.} = III$ $\text{Точн.} = П$
	БПЗ-1112 $F \text{ см}^2 = 3.454$ $Q \text{ кг.} = 0.936$ $D \text{ оп.мм} = 91$ $P \text{ н.мм} = 319.6$ $P \text{ вн.мм} = 69.6$ $\Gamma \text{р. сл.} = V$ $\text{Точн.} = П$		БПЗ-1117 $F \text{ см}^2 = 2.04$ $Q \text{ кг.} = 0.552$ $D \text{ оп.мм} = 30$ $P \text{ н.мм} = 94.3$ $P \text{ вн.мм} = 79.5$ $\Gamma \text{р. сл.} = III$ $\text{Точн.} = П$
	БПЗ-1113 $F \text{ см}^2 = 3.259$ $Q \text{ кг.} = 0.883$ $D \text{ оп.мм} = 62$ $P \text{ н.мм} = 251.4$ $P \text{ вн.мм} = 102$ $\Gamma \text{р. сл.} = V$ $\text{Точн.} = П$		БПЗ-1118 $F \text{ см}^2 = 4.12$ $Q \text{ кг.} = 1.116$ $D \text{ оп.мм} = 53$ $P \text{ н.мм} = 146$ $P \text{ вн.мм} = 122$ $\Gamma \text{р. сл.} = III$ $\text{Точн.} = \text{особая}$
	БПЗ-1114 $F \text{ см}^2 = 2.562$ $Q \text{ кг.} = 0.694$ $D \text{ оп.мм} = 41$ $P \text{ н.мм} = 181.5$ $P \text{ вн.мм} = 79.2$ $\Gamma \text{р. сл.} = V$ $\text{Точн.} = П$		БПЗ-1119 $F \text{ см}^2 = 1.444$ $Q \text{ кг.} = 0.391$ $D \text{ оп.мм} = 25$ $P \text{ н.мм} = 81.6$ $P \text{ вн.мм} = 69.1$ $\Gamma \text{р. сл.} = IV$ $\text{Точн.} = П$
	БПЗ-1115 $F \text{ см}^2 = 2.62$ $Q \text{ кг.} = 0.71$ $D \text{ оп.мм} = 57$ $P \text{ н.мм} = 196.7$ $P \text{ вн.мм} = 69.2$ $\Gamma \text{р. сл.} = V$ $\text{Точн.} = П$		БПЗ-1120 $F \text{ см}^2 = 7.82$ $Q \text{ кг.} = 2.12$ $D \text{ оп.мм} = 57$ $P \text{ н.мм} = 267.4$ $P \text{ вн.мм} =$ $\Gamma \text{р. сл.} = V$ $\text{Точн.} = П$

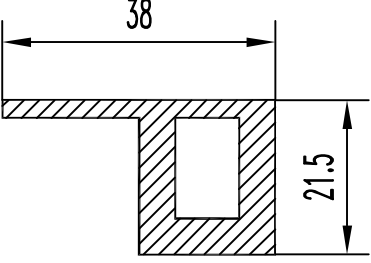
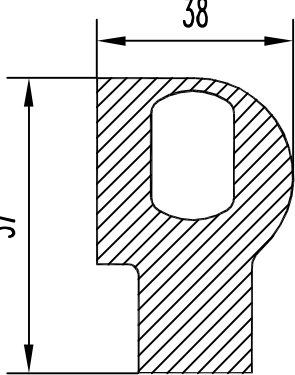
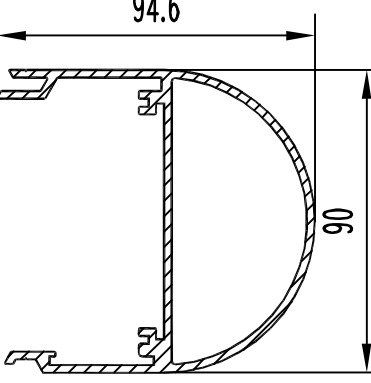
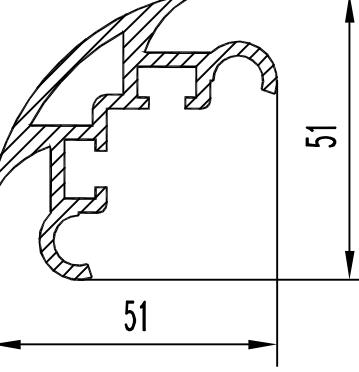
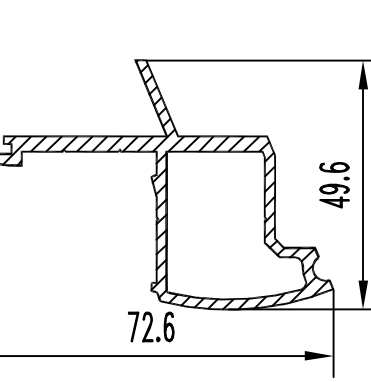
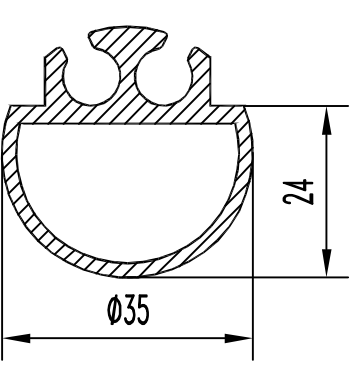
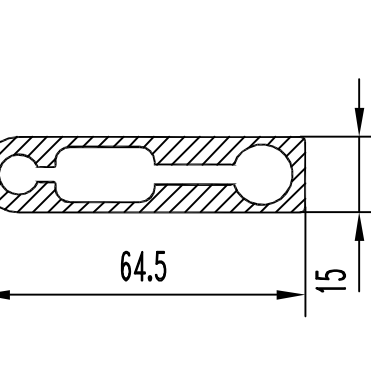
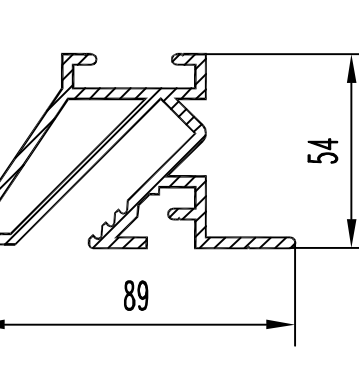
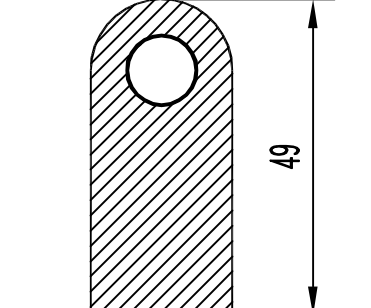
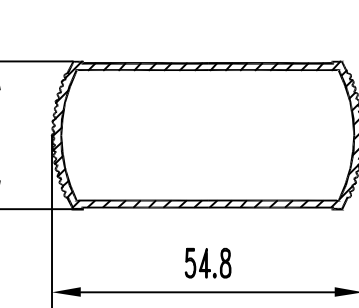
	БПЗ-1121 $F \text{ см}^2 = 4.799$ $Q \text{ кг.} = 1.301$ $D \text{ оп.мм} = 52.0$ $P \text{ н.мм} = 264.9$ $P \text{ вн.мм} = 0.0$ Гр. сл. = V Точн. = П		БПЗ-1126 $F \text{ см}^2 = 24.540$ $Q \text{ кг.} = 6.650$ $D \text{ оп.мм} = 75.0$ $P \text{ н.мм} = 235.6$ $P \text{ вн.мм} = 157.1$ Гр. сл. = III Точн. = П
	БПЗ-1122 $F \text{ см}^2 = 13.274$ $Q \text{ кг.} = 3.597$ $D \text{ оп.мм} = 78.0$ $P \text{ н.мм} = 245.0$ $P \text{ вн.мм} = 227.3$ Гр. сл. = IV Точн. = П		БПЗ-1127 $F \text{ см}^2 = 32.990$ $Q \text{ кг.} = 8.940$ $D \text{ оп.мм} = 85.0$ $P \text{ н.мм} = 267.0$ $P \text{ вн.мм} = 172.8$ Гр. сл. = III Точн. = П
	БПЗ-1123 $F \text{ см}^2 = 5.797$ $Q \text{ кг.} = 1.571$ $D \text{ оп.мм} = 101.0$ $P \text{ н.мм} = 277.0$ $P \text{ вн.мм} = 165.6$ Гр. сл. = 0соб. Точн. = П		
	БПЗ-1124 $F \text{ см}^2 = 82.000$ $Q \text{ кг.} = 22.222$ $D \text{ оп.мм} = 43.5$ $P \text{ н.мм} = 121.3$ $P \text{ вн.мм} = 53.4$ Гр. сл. = III Точн. = Н		БПЗ-1129 $F \text{ см}^2 = 4.074$ $Q \text{ кг.} = 1.104$ $D \text{ оп.мм} = 105.0$ $P \text{ н.мм} = 320.8$ $P \text{ вн.мм} = 219.0$ Гр. сл. = V Точн. = П
	БПЗ-1125 $F \text{ см}^2 = 17.300$ $Q \text{ кг.} = 4.688$ $D \text{ оп.мм} = 65.0$ $P \text{ н.мм} = 204.2$ $P \text{ вн.мм} = 141.4$ Гр. сл. = III Точн. = П		БПЗ-1130 $F \text{ см}^2 = 3.642$ $Q \text{ кг.} = 0.987$ $D \text{ оп.мм} = 100.0$ $P \text{ н.мм} = 319.1$ $P \text{ вн.мм} = 165.1$ Гр. сл. = V Точн. = П

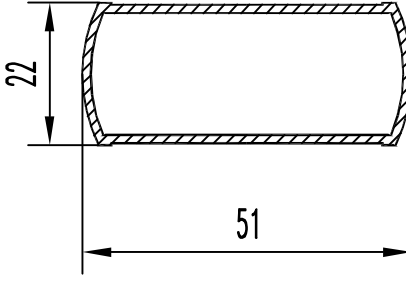
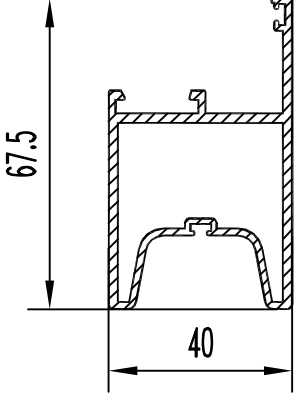
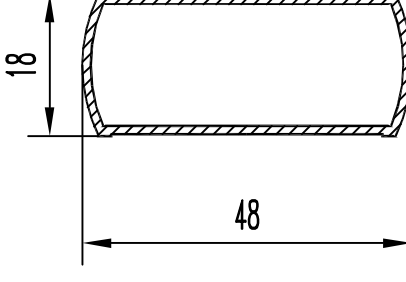
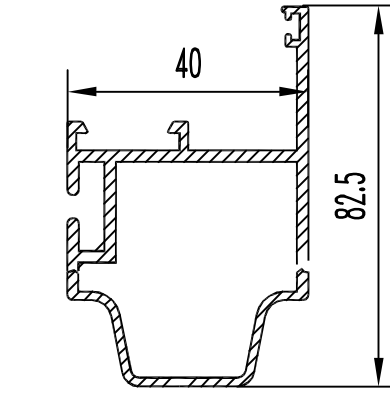
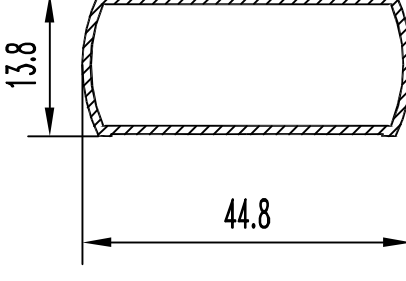
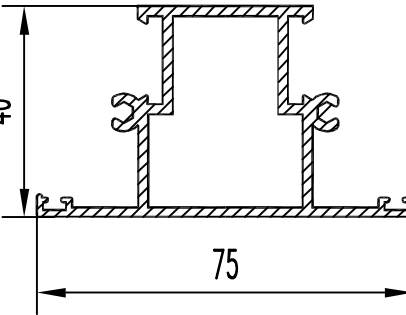
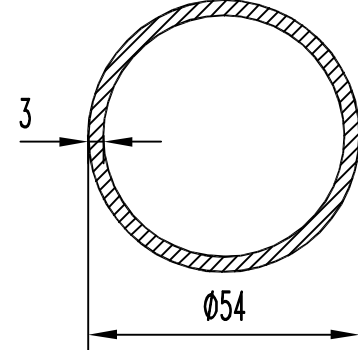
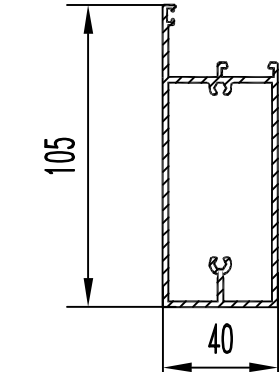
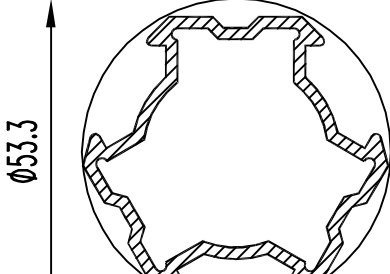
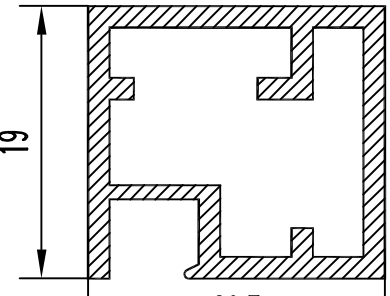
	БПЗ-1131 $F \text{ см}^2 = 4.343$ $Q \text{ кг.} = 1.177$ $D \text{ оп.мм} = 42.0$ $P \text{ н.мм} = 416.2$ $P \text{ в.н.мм} = 43.2$ Гр. сл. = 0соб. Точн. = П		БПЗ-1136 $F \text{ см}^2 = 10.430$ $Q \text{ кг.} = 2.827$ $D \text{ оп.мм} = 61.5$ $P \text{ н.мм} = 195.2$ $P \text{ в.н.мм} = 125.6$ Гр. сл. = III Точн. = П
	БПЗ-1132 $F \text{ см}^2 = 3.675$ $Q \text{ кг.} = 0.996$ $D \text{ оп.мм} = 102.0$ $P \text{ н.мм} = 236.0$ $P \text{ в.н.мм} = 251.0$ Гр. сл. = 0соб. Точн. = П		БПЗ-1137 $F \text{ см}^2 = 15.440$ $Q \text{ кг.} = 4.184$ $D \text{ оп.мм} = 104.5$ $P \text{ н.мм} = 295.2$ $P \text{ в.н.мм} = 225.6$ Гр. сл. = III Точн. = П
	БПЗ-1133 $F \text{ см}^2 = 2.175$ $Q \text{ кг.} = 0.589$ $D \text{ оп.мм} = 45.0$ $P \text{ н.мм} = 169.1$ $P \text{ в.н.мм} = 112.6$ Гр. сл. = 0соб. Точн. = П		БПЗ-1138 $F \text{ см}^2 = 1.729$ $Q \text{ кг.} = 0.469$ $D \text{ оп.мм} = 50.0$ $P \text{ н.мм} = 143.5$ $P \text{ в.н.мм} = 110.4$ Гр. сл. = VI Точн. = П
	БПЗ-1134 $F \text{ см}^2 = 2.613$ $Q \text{ кг.} = 0.708$ $D \text{ оп.мм} = 64.0$ $P \text{ н.мм} = 152.5$ $P \text{ в.н.мм} = 277.1$ Гр. сл. = 0соб. Точн. = П		БПЗ-1139 $F \text{ см}^2 = 1.820$ $Q \text{ кг.} = 0.493$ $D \text{ оп.мм} = 60.7$ $P \text{ н.мм} = 176.1$ $P \text{ в.н.мм} = 127.4$ Гр. сл. = VI Точн. = П
	БПЗ-1135 $F \text{ см}^2 = 8.970$ $Q \text{ кг.} = 2.431$ $D \text{ оп.мм} = 49.9$ $P \text{ н.мм} = 160.0$ $P \text{ в.н.мм} = 57.6$ Гр. сл. = III Точн. = П		БПЗ-1140 $F \text{ см}^2 = 4.129$ $Q \text{ кг.} = 1.119$ $D \text{ оп.мм} = 61.0$ $P \text{ н.мм} = 233.6$ $P \text{ в.н.мм} = 197.2$ Гр. сл. = VI Точн. = П

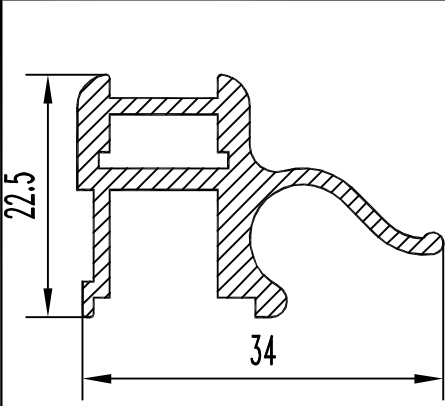
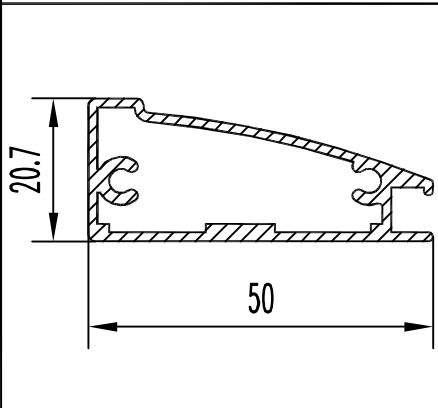
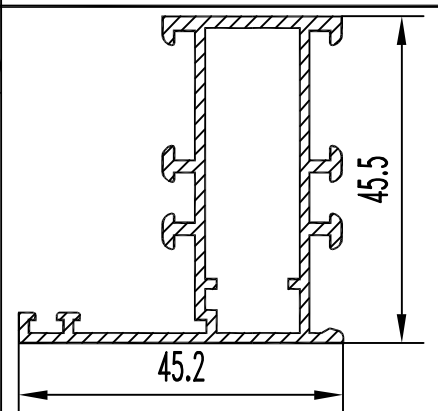
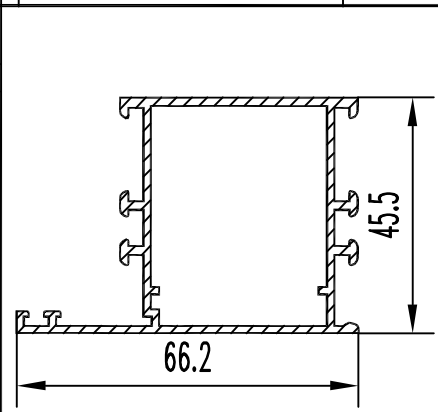
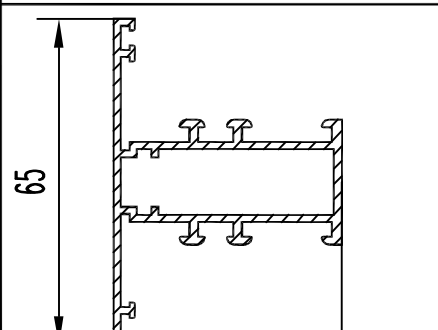
	БПЗ-1141 $F \text{ см}^2 = 14.610$ $Q \text{ кг.} = 3.959$ $D \text{ оп.мм} = 54.0$ $P \text{ н.мм} = 165.5$ $P \text{ вн.мм} = 88.0$ Гр. сл. = III Точн. = Н		БПЗ-1146 $F \text{ см}^2 = 13.380$ $Q \text{ кг.} = 3.626$ $D \text{ оп.мм} = 145.0$ $P \text{ н.мм} = 553.6$ $P \text{ вн.мм} = 166.3$ Гр. сл. = 0соб. Точн. = П
	БПЗ-1142 $F \text{ см}^2 = 17.040$ $Q \text{ кг.} = 4.618$ $D \text{ оп.мм} = 58.0$ $P \text{ н.мм} = 179.4$ $P \text{ вн.мм} = 99.0$ Гр. сл. = III Точн. = Н		БПЗ-1147 $F \text{ см}^2 = 4.050$ $Q \text{ кг.} = 1.098$ $D \text{ оп.мм} = 85.0$ $P \text{ н.мм} = 266.0$ $P \text{ вн.мм} = 218.0$ Гр. сл. = V Точн. = П
	БПЗ-1143 $F \text{ см}^2 = 0.665$ $Q \text{ кг.} = 0.180$ $D \text{ оп.мм} = 20.0$ $P \text{ н.мм} = 78.2$ $P \text{ вн.мм} = 30.0$ Гр. сл. = VI Точн. = Н		БПЗ-1148 $F \text{ см}^2 = 4.720$ $Q \text{ кг.} = 1.279$ $D \text{ оп.мм} = 101.0$ $P \text{ н.мм} = 305.0$ $P \text{ вн.мм} = 258.0$ Гр. сл. = V Точн. = П
	БПЗ-1144 $F \text{ см}^2 = 14.474$ $Q \text{ кг.} = 3.922$ $D \text{ оп.мм} = 95.0$ $P \text{ н.мм} = 248.9$ $P \text{ вн.мм} = 251.0$ Гр. сл. = 0соб. Точн. = П		БПЗ-1149 $F \text{ см}^2 = 7.050$ $Q \text{ кг.} = 1.911$ $D \text{ оп.мм} = 130.0$ $P \text{ н.мм} = 466.9$ $P \text{ вн.мм} = 317.2$ Гр. сл. = V Точн. = П
	БПЗ-1145 $F \text{ см}^2 = 4.193$ $Q \text{ кг.} = 1.136$ $D \text{ оп.мм} = 57.0$ $P \text{ н.мм} = 257.9$ $P \text{ вн.мм} = 80.2$ Гр. сл. = VI Точн. = Н		

	БПЗ-1151		БПЗ-1156
	$F \text{ см}^2 = 2.34$ $Q \text{ кг.} = 0.632$ $D \text{ оп.мм} = 53$ $P \text{ н.мм} = 195.6$ $P \text{ вн.мм} = 65$ $\Gamma \text{р. сл.} = V$ $\text{Точн.} = \text{особой}$		$F \text{ см}^2 = 11.92$ $Q \text{ кг.} = 3.23$ $D \text{ оп.мм} = 127$ $P \text{ н.мм} = 552$ $P \text{ вн.мм} = 552$ $\Gamma \text{р. сл.} =$ $\text{Точн.} = П$
	БПЗ-1152		БПЗ-1157
	$F \text{ см}^2 = 2.59$ $Q \text{ кг.} = 0.699$ $D \text{ оп.мм} = 56$ $P \text{ н.мм} = 229.5$ $P \text{ вн.мм} = 65.6$ $\Gamma \text{р. сл.} = V$ $\text{Точн.} = \text{особой}$		$F \text{ см}^2 = 11.45$ $Q \text{ кг.} = 3.1$ $D \text{ оп.мм} = 134$ $P \text{ н.мм} = 462$ $P \text{ вн.мм} = 593$ $\Gamma \text{р. сл.} = \text{особая}$ $\text{Точн.} = П$
	БПЗ-1153		БПЗ-1158
	$F \text{ см}^2 = 3.1$ $Q \text{ кг.} = 0.837$ $D \text{ оп.мм} = 77$ $P \text{ н.мм} = 295.6$ $P \text{ вн.мм} = 65.6$ $\Gamma \text{р. сл.} = V$ $\text{Точн.} = \text{особой}$		$F \text{ см}^2 = 12.49$ $Q \text{ кг.} = 3.38$ $D \text{ оп.мм} = 134$ $P \text{ н.мм} = 566$ $P \text{ вн.мм} = 593$ $\Gamma \text{р. сл.} = \text{особая}$ $\text{Точн.} = П$
	БПЗ-1154		БПЗ-1159
	$F \text{ см}^2 = 1.03$ $Q \text{ кг.} = 0.279$ $D \text{ оп.мм} = 26$ $P \text{ н.мм} = 62.8$ $P \text{ вн.мм} = 51.5$ $\Gamma \text{р. сл.} = IV$ $\text{Точн.} = H$		$F \text{ см}^2 = 5.81$ $Q \text{ кг.} = 1.575$ $D \text{ оп.мм} = 83$ $P \text{ н.мм} = 406.3$ $P \text{ вн.мм} = 0$ $\Gamma \text{р. сл.} = VI$ $\text{Точн.} = П$
	БПЗ-1155		БПЗ-1160
	$F \text{ см}^2 = 10.88$ $Q \text{ кг.} = 2.94$ $D \text{ оп.мм} = 127$ $P \text{ н.мм} = 448$ $P \text{ вн.мм} = 552$		$F \text{ см}^2 = 11.31$ $Q \text{ кг.} = 3.065$ $D \text{ оп.мм} = 144$ $P \text{ н.мм} = 559.6$ $P \text{ вн.мм} = 395.2$

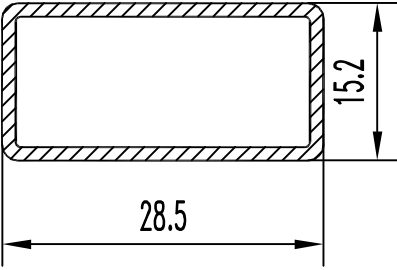
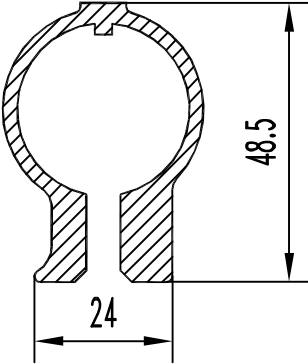
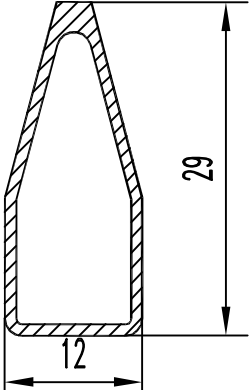
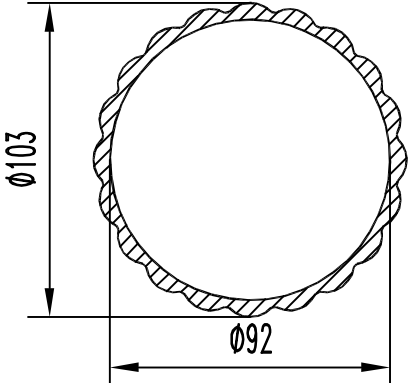
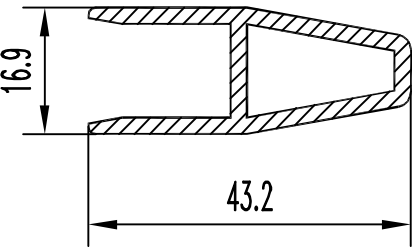
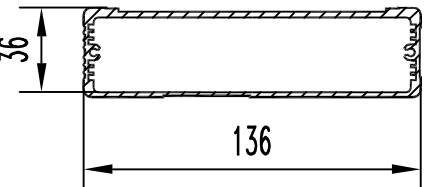
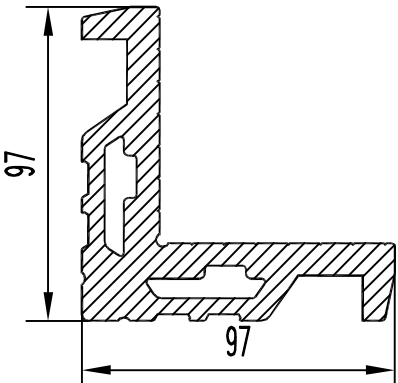
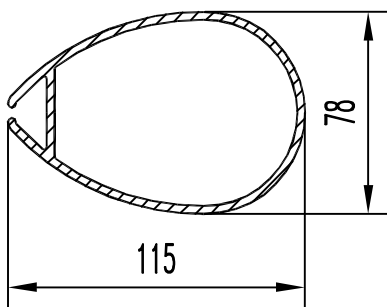
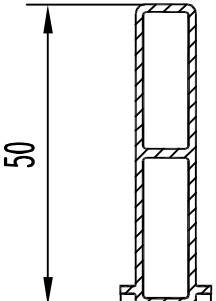
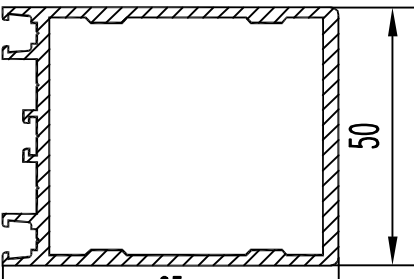
	БПЗ-1161 $F \text{ см}^2 = 4.252$ $Q \text{ кг.} = 1.152$ $D \text{ оп.мм} = 66$ $P \text{ н.мм} = 234.5$ $P \text{ в.н.мм} = 289.3$ Гр. сл. = особой Точн. = П		БПЗ-1166 $F \text{ см}^2 = 2.49$ $Q \text{ кг.} = 0.673$ $D \text{ оп.мм} = 57$ $P \text{ н.мм} = 224.7$ $P \text{ в.н.мм} = 47.6$ Гр. сл. = V Точн. = особой
	БПЗ-1162 $F \text{ см}^2 = 2.776$ $Q \text{ кг.} = 0.752$ $D \text{ оп.мм} = 56$ $P \text{ н.мм} = 150.6$ $P \text{ в.н.мм} = 158$ Гр. сл. = VI Точн. = П		БПЗ-1167 $F \text{ см}^2 = 5.561$ $Q \text{ кг.} = 1.507$ $D \text{ оп.мм} = 62$ $P \text{ н.мм} = 194.8$ $P \text{ в.н.мм} = 175.9$ Гр. сл. = VI Точн. = П
	БПЗ-1163 $F \text{ см}^2 = 0.945$ $Q \text{ кг.} = 0.256$ $D \text{ оп.мм} = 25$ $P \text{ н.мм} = 69$ $P \text{ в.н.мм} = 57$ Гр. сл. = IV Точн. = особой		БПЗ-1168 $F \text{ см}^2 = 11.942$ $Q \text{ кг.} = 3.236$ $D \text{ оп.мм} = 52$ $P \text{ н.мм} = 160.3$ $P \text{ в.н.мм} = 99$ Гр. сл. = III Точн. = H
	БПЗ-1164 $F \text{ см}^2 = 6.67$ $Q \text{ кг.} = 1.808$ $D \text{ оп.мм} = 104$ $P \text{ н.мм} = 274.9$ $P \text{ в.н.мм} = 259.1$ Гр. сл. = V Точн. = П		БПЗ-1169 $F \text{ см}^2 = 14.896$ $Q \text{ кг.} = 4.037$ $D \text{ оп.мм} = 52$ $P \text{ н.мм} = 160.3$ $P \text{ в.н.мм} = 99$ Гр. сл. = III Точн. = H
	БПЗ-1165 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм} = 0$ $P \text{ н.мм} = 0$ $P \text{ в.н.мм} = 0$ Гр. сл. = V Точн. = П		БПЗ-1170 $F \text{ см}^2 = 21.553$ $Q \text{ кг.} = 5.84$ $D \text{ оп.мм} = 65$ $P \text{ н.мм} = 201$ $P \text{ в.н.мм} = 110$ Гр. сл. = V Точн. = П

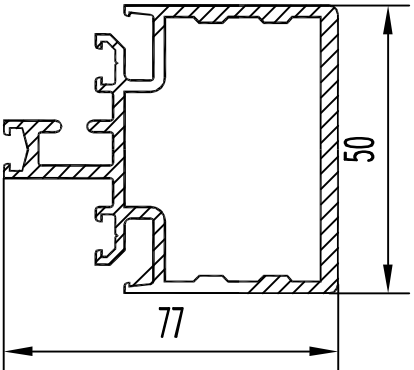
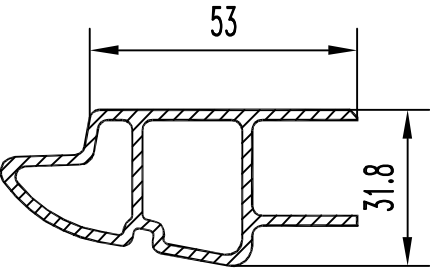
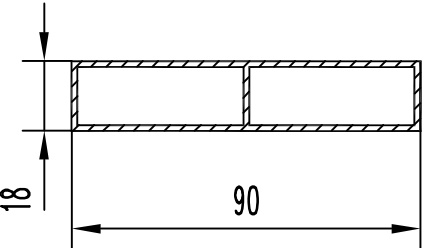
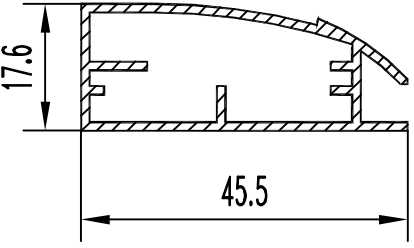
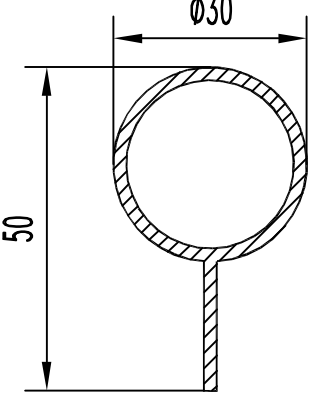
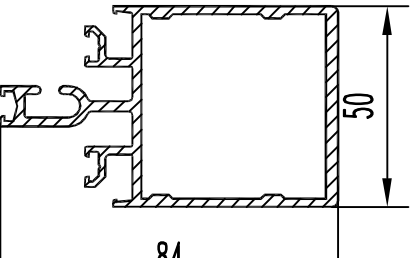
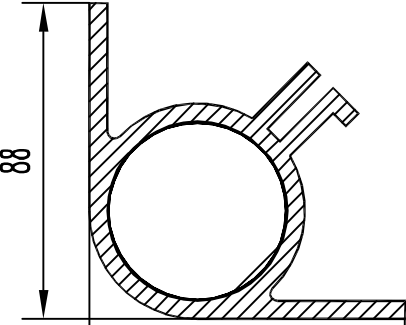
	БПЗ-1171 $F \text{ см}^2 = 3.300$ $Q \text{ кг.} = 0.894$ $D \text{ оп.мм} = 44.0$ $P \text{ н.мм} = 119.0$ $P \text{ вн.мм} = 46.0$ Гр. сл. = V Точн. = П		БПЗ-1176 $F \text{ см}^2 = 13.358$ $Q \text{ кг.} = 3.620$ $D \text{ оп.мм} = 15.0$ $P \text{ н.мм} = 175.3$ $P \text{ вн.мм} = 72.2$ Гр. сл. = IV Точн. = П
	БПЗ-1172 $F \text{ см}^2 = 8.830$ $Q \text{ кг.} = 2.393$ $D \text{ оп.мм} = 113.0$ $P \text{ н.мм} = 213.8$ $P \text{ вн.мм} = 510.2$ Гр. сл. = 0соб. Точн. = П		БПЗ-1177 $F \text{ см}^2 = 4.481$ $Q \text{ кг.} = 1.214$ $D \text{ оп.мм} = 56.0$ $P \text{ н.мм} = 269.2$ $P \text{ вн.мм} = 56.4$ Гр. сл. = VI Точн. = П
	БПЗ-1173 $F \text{ см}^2 = 4.253$ $Q \text{ кг.} = 1.153$ $D \text{ оп.мм} = 78.7$ $P \text{ н.мм} = 263.0$ $P \text{ вн.мм} = 108.0$ Гр. сл. = 0соб. Точн. = П		БПЗ-1178 $F \text{ см}^2 = 3.083$ $Q \text{ кг.} = 0.835$ $D \text{ оп.мм} = 35.0$ $P \text{ н.мм} = 157.9$ $P \text{ вн.мм} = 86.7$ Гр. сл. = V Точн. = П
	БПЗ-1174 $F \text{ см}^2 = 4.972$ $Q \text{ кг.} = 1.347$ $D \text{ оп.мм} = 66.0$ $P \text{ н.мм} = 151.7$ $P \text{ вн.мм} = 142.3$ Гр. сл. = VI Точн. = П		БПЗ-1179 $F \text{ см}^2 = 9.420$ $Q \text{ кг.} = 2.553$ $D \text{ оп.мм} = 92.0$ $P \text{ н.мм} = 500.2$ $P \text{ вн.мм} = 124.3$ Гр. сл. = 0соб. Точн. = П
	БПЗ-1175 $F \text{ см}^2 = 9.470$ $Q \text{ кг.} = 2.566$ $D \text{ оп.мм} = 51.5$ $P \text{ н.мм} = 132.6$ $P \text{ вн.мм} = 31.4$ Гр. сл. = IV Точн. = П		БПЗ-1180 $F \text{ см}^2 = 1.845$ $Q \text{ кг.} = 0.500$ $D \text{ оп.мм} = 55.0$ $P \text{ н.мм} = 167.3$ $P \text{ вн.мм} = 140.1$ Гр. сл. = VI Точн. = П

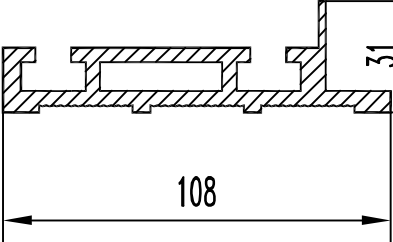
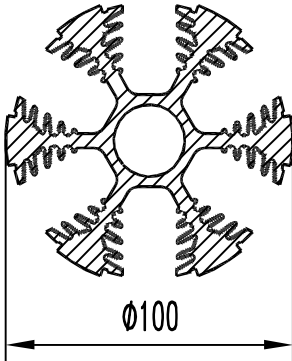
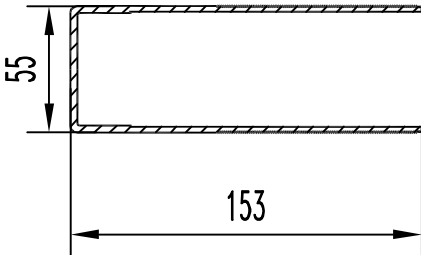
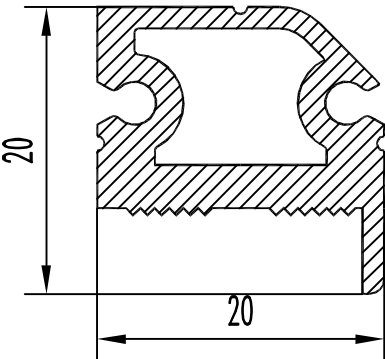
	БПЗ-1181 $F \text{ см}^2 = 1.745$ $Q \text{ кг.} = 0.473$ $D \text{ оп.мм} = 51$ $P \text{ н.мм} = 138.7$ $P \text{ вн.мм} = 127.8$ Гр. сл. = VI Точн. = П		БПЗ-1186 $F \text{ см}^2 = 4.124$ $Q \text{ кг.} = 1.118$ $D \text{ оп.мм} = 56$ $P \text{ н.мм} = 285.1$ $P \text{ вн.мм} = 176.6$ Гр. сл. = VI Точн. = П
	БПЗ-1182 $F \text{ см}^2 = 1.589$ $Q \text{ кг.} = 0.431$ $D \text{ оп.мм} = 48$ $P \text{ н.мм} = 127.1$ $P \text{ вн.мм} = 116$ Гр. сл. = VI Точн. = П		БПЗ-1187 $F \text{ см}^2 = 4.393$ $Q \text{ кг.} = 1.19$ $D \text{ оп.мм} = 86$ $P \text{ н.мм} = 309.2$ $P \text{ вн.мм} = 171.2$ Гр. сл. = VI Точн. = П
	БПЗ-1183 $F \text{ см}^2 = 1.416$ $Q \text{ кг.} = 0.384$ $D \text{ оп.мм} = 46$ $P \text{ н.мм} = 114.5$ $P \text{ вн.мм} = 103.1$ Гр. сл. = VI Точн. = П		БПЗ-1188 $F \text{ см}^2 = 4.56$ $Q \text{ кг.} = 1.236$ $D \text{ оп.мм} = 77$ $P \text{ н.мм} = 332.7$ $P \text{ вн.мм} = 137.6$ Гр. сл. = особая Точн. = П
	БПЗ-1184 $F \text{ см}^2 = 4.806$ $Q \text{ кг.} = 1.302$ $D \text{ оп.мм} = 54$ $P \text{ н.мм} = 169.7$ $P \text{ вн.мм} = 150.8$ Гр. сл. = III Точн. = П		БПЗ-1189 $F \text{ см}^2 = 6.017$ $Q \text{ кг.} = 1.631$ $D \text{ оп.мм} = 113$ $P \text{ н.мм} = 329.8$ $P \text{ вн.мм} = 284.3$ Гр. сл. = VI Точн. = П
	БПЗ-1185 $F \text{ см}^2 = 3.753$ $Q \text{ кг.} = 1.017$ $D \text{ оп.мм} = 53.3$ $P \text{ н.мм} = 198.2$ $P \text{ вн.мм} = 164.8$ Гр. сл. = VI Точн. = П		БПЗ-1190 $F \text{ см}^2 = 1.318$ $Q \text{ кг.} = 0.357$ $D \text{ оп.мм} = 29$ $P \text{ н.мм} = 91.8$ $P \text{ вн.мм} = 89.6$ Гр. сл. = VI Точн. = П

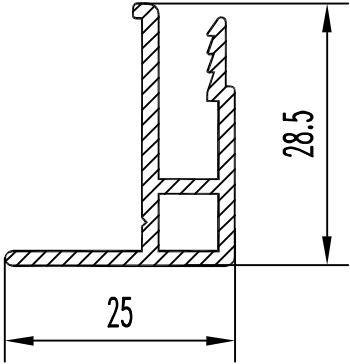
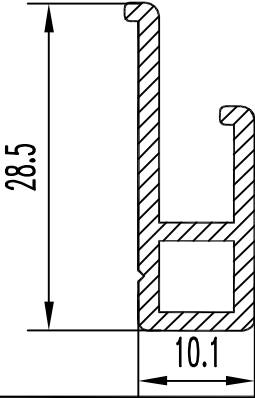
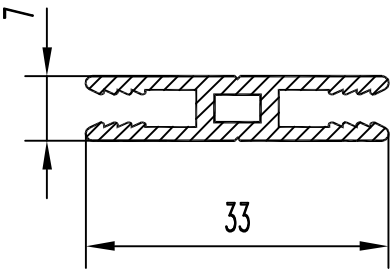
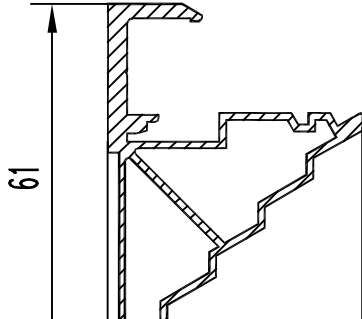
	БПЗ-1191 $F \text{ см}^2 = 1.885$ $Q \text{ кг.} = 0.511$ $D \text{ оп.мм} = 38.0$ $P \text{ н.мм} = 145.5$ $P \text{ вн.мм} = 34.0$ Гр. сл. = VI Точн. = П		БПЗ-1196 $F \text{ см}^2 = 3.462$ $Q \text{ кг.} = 0.938$ $D \text{ оп.мм} = 90.8$ $P \text{ н.мм} = 310.0$ $P \text{ вн.мм} = 79.6$ Гр. сл. = V Точн. = П
	БПЗ-1192 $F \text{ см}^2 = 3.000$ $Q \text{ кг.} = 0.813$ $D \text{ оп.мм} = 65.6$ $P \text{ н.мм} = 250.5$ $P \text{ вн.мм} = 79.6$ Гр. сл. = V Точн. = П		БПЗ-1197 $F \text{ см}^2 = 2.237$ $Q \text{ кг.} = 0.606$ $D \text{ оп.мм} = 70.0$ $P \text{ н.мм} = 144.4$ $P \text{ вн.мм} = 144.4$ Гр. сл. = VI Точн. = П
	БПЗ-1193 $F \text{ см}^2 = 3.119$ $Q \text{ кг.} = 0.845$ $D \text{ оп.мм} = 45.6$ $P \text{ н.мм} = 241.9$ $P \text{ вн.мм} = 89.2$ Гр. сл. = V Точн. = П		БПЗ-1198 $F \text{ см}^2 = 3.173$ $Q \text{ кг.} = 0.860$ $D \text{ оп.мм} = 70.0$ $P \text{ н.мм} = 281.8$ $P \text{ вн.мм} = 117.8$ Гр. сл. = V Точн. = П
	БПЗ-1194 $F \text{ см}^2 = 2.855$ $Q \text{ кг.} = 0.774$ $D \text{ оп.мм} = 61.0$ $P \text{ н.мм} = 247.3$ $P \text{ вн.мм} = 59.6$ Гр. сл. = V Точн. = П		БПЗ-1199 $F \text{ см}^2 = 3.603$ $Q \text{ кг.} = 0.976$ $D \text{ оп.мм} = 88.0$ $P \text{ н.мм} = 323.8$ $P \text{ вн.мм} = 159.9$ Гр. сл. = V Точн. = П
	БПЗ-1195 $F \text{ см}^2 = 3.656$ $Q \text{ кг.} = 0.991$ $D \text{ оп.мм} = 62.0$ $P \text{ н.мм} = 291.4$ $P \text{ вн.мм} = 105.6$ Гр. сл. = V Точн. = П		БПЗ-1200 $F \text{ см}^2 = 3.369$ $Q \text{ кг.} = 0.913$ $D \text{ оп.мм} = 50.0$ $P \text{ н.мм} = 340.7$ $P \text{ вн.мм} = 117.8$ Гр. сл. = V Точн. = П

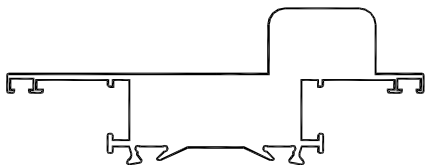
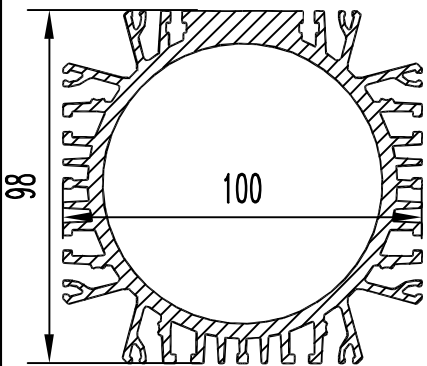
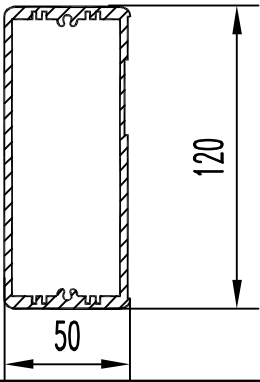
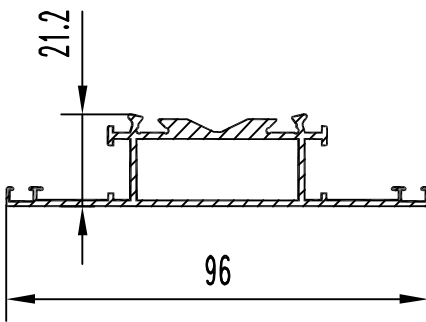
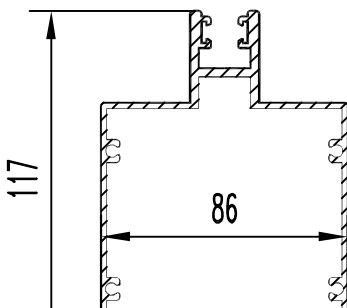
	БПЗ-1201 $F \text{ см}^2 = 3.998$ $Q \text{ кг.} = 1.083$ $D \text{ оп.мм} = 88$ $P \text{ н.мм} = 382.7$ $P \text{ вн.мм} = 159.8$ Гр. сл. = VI Точн. = П		БПЗ-1206 $F \text{ см}^2 = 8.398$ $Q \text{ кг.} = 2.276$ $D \text{ оп.мм} = 75$ $P \text{ н.мм} = 196.3$ $P \text{ вн.мм} = 188.3$ Гр. сл. = особая Точн. = П
	БПЗ-1202 $F \text{ см}^2 = 4.119$ $Q \text{ кг.} = 1.116$ $D \text{ оп.мм} = 100$ $P \text{ н.мм} = 399.7$ $P \text{ вн.мм} = 178.9$ Гр. сл. = VI Точн. = П		БПЗ-1207 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм} = 0$ $P \text{ н.мм} = 0$ $P \text{ вн.мм} = 0$ Гр. сл. = 0 Точн. = 0
	БПЗ-1203 $F \text{ см}^2 = 3.414$ $Q \text{ кг.} = 0.925$ $D \text{ оп.мм} = 82$ $P \text{ н.мм} = 343.8$ $P \text{ вн.мм} = 122.9$ Гр. сл. = VI Точн. = П		БПЗ-1208 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм} = 0$ $P \text{ н.мм} = 0$ $P \text{ вн.мм} = 0$ Гр. сл. = 0 Точн. = 0
	БПЗ-1204 $F \text{ см}^2 = 2.865$ $Q \text{ кг.} = 0.776$ $D \text{ оп.мм} = 70$ $P \text{ н.мм} = 365.7$ $P \text{ вн.мм} = 0$ Гр. сл. = особая Точн. = Н		БПЗ-1209 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм} = 0$ $P \text{ н.мм} = 0$ $P \text{ вн.мм} = 0$ Гр. сл. = 0 Точн. = 0
	БПЗ-1205 $F \text{ см}^2 = 19.419$ $Q \text{ кг.} = 5.263$ $D \text{ оп.мм} = 111$ $P \text{ н.мм} = 292.8$ $P \text{ вн.мм} = 276$ Гр. сл. = особая Точн. = П		БПЗ-1210 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм} = 0$ $P \text{ н.мм} = 0$ $P \text{ вн.мм} = 0$ Гр. сл. = 0 Точн. = 0

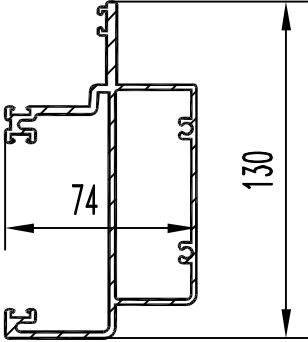
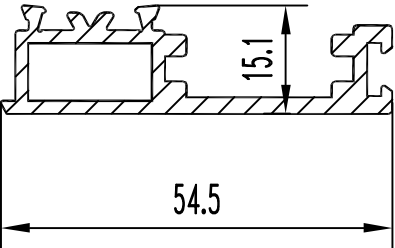
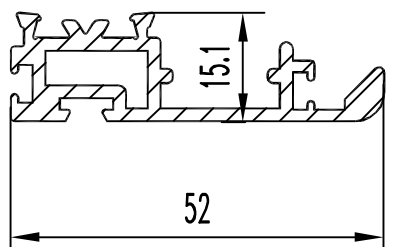
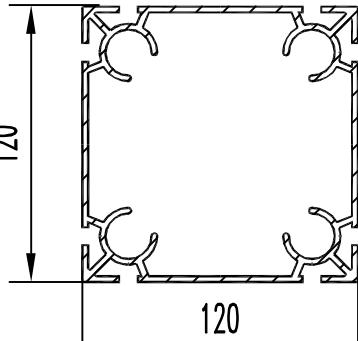
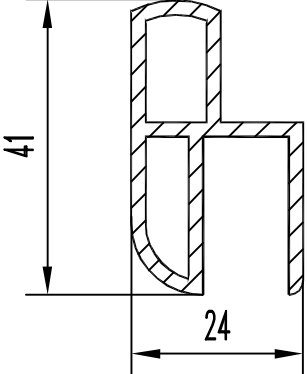
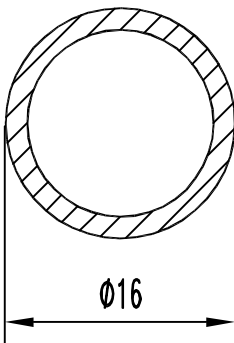
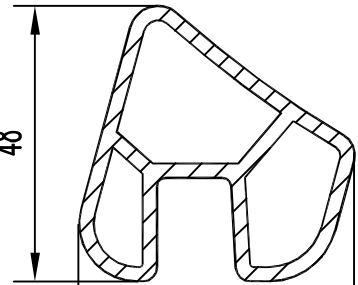
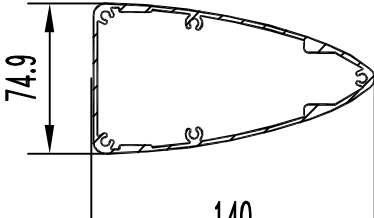
	БПЗ-1211 $F \text{ см}^2 = 1.120$ $Q \text{ кг.} = 0.304$ $D \text{ оп.мм} = 33.7$ $P \text{ н.мм} = 90.0$ $P \text{ вн.мм} = 81.3$ Гр. сл. = V Точн. = П		БПЗ-1216 $F \text{ см}^2 = 4.724$ $Q \text{ кг.} = 1.280$ $D \text{ оп.мм} = 52.0$ $P \text{ н.мм} = 259.9$ $P \text{ вн.мм} = 0.0$ Гр. сл. = V Точн. = 0соб.
	БПЗ-1212 $F \text{ см}^2 = 0.730$ $Q \text{ кг.} = 0.198$ $D \text{ оп.мм} = 30.0$ $P \text{ н.мм} = 72.9$ $P \text{ вн.мм} = 63.0$ Гр. сл. = V Точн. = П		БПЗ-1217 $F \text{ см}^2 = 13.766$ $Q \text{ кг.} = 3.731$ $D \text{ оп.мм} = 103.0$ $P \text{ н.мм} = 340.2$ $P \text{ вн.мм} = 289.0$ Гр. сл. = V Точн. = Н
	БПЗ-1213 $F \text{ см}^2 = 2.248$ $Q \text{ кг.} = 0.609$ $D \text{ оп.мм} = 45.0$ $P \text{ н.мм} = 147.6$ $P \text{ вн.мм} = 58.0$ Гр. сл. = V Точн. = Н		БПЗ-1218 $F \text{ см}^2 = 7.903$ $Q \text{ кг.} = 2.142$ $D \text{ оп.мм} = 140.0$ $P \text{ н.мм} = 348.3$ $P \text{ вн.мм} = 387.5$ Гр. сл. = VI Точн. = П
	БПЗ-1214 $F \text{ см}^2 = 27.200$ $Q \text{ кг.} = 7.371$ $D \text{ оп.мм} = 133.0$ $P \text{ н.мм} = 442.9$ $P \text{ вн.мм} = 72.0$ Гр. сл. = V Точн. = Н		БПЗ-1219 $F \text{ см}^2 = 9.704$ $Q \text{ кг.} = 2.630$ $D \text{ оп.мм} = 115.0$ $P \text{ н.мм} = 367.0$ $P \text{ вн.мм} = 271.8$ Гр. сл. = 0соб. Точн. = П
	БПЗ-1215 $F \text{ см}^2 = 1.610$ $Q \text{ кг.} = 0.436$ $D \text{ оп.мм} = 51.0$ $P \text{ н.мм} = 129.2$ $P \text{ вн.мм} = 120.3$ Гр. сл. = VI		БПЗ-1220 $F \text{ см}^2 = 5.683$ $Q \text{ кг.} = 1.540$ $D \text{ оп.мм} = 82.0$ $P \text{ н.мм} = 291.7$ $P \text{ вн.мм} = 201.3$ Гр. сл. = V

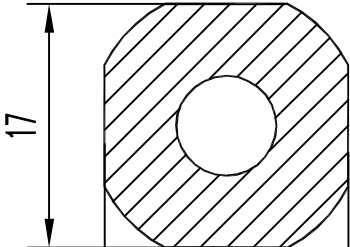
	БПЗ-1221 $F \text{ см}^2 = 4.090$ $Q \text{ кг.} = 1.108$ $D \text{ оп.мм} = 70.2$ $P \text{ н.мм} = 329.0$ $P \text{ вн.мм} = 119.6$ Гр. сл. = V Точн. = П		БПЗ-1226 $F \text{ см}^2 = 6.154$ $Q \text{ кг.} = 1.668$ $D \text{ оп.мм} = 84.7$ $P \text{ н.мм} = 373.6$ $P \text{ вн.мм} = 199.2$ Гр. сл. = V Точн. = П
			БПЗ-1227 $F \text{ см}^2 = 4.187$ $Q \text{ кг.} = 1.135$ $D \text{ оп.мм} = 73.0$ $P \text{ н.мм} = 229.3$ $P \text{ вн.мм} = 164.5$ Гр. сл. = 0соб. Точн. = П
	БПЗ-1223 $F \text{ см}^2 = 2.751$ $Q \text{ кг.} = 0.746$ $D \text{ оп.мм} = 45.5$ $P \text{ н.мм} = 191.5$ $P \text{ вн.мм} = 89.2$ Гр. сл. = V Точн. = П		БПЗ-1228 $F \text{ см}^2 = 3.374$ $Q \text{ кг.} = 0.914$ $D \text{ оп.мм} = 92.0$ $P \text{ н.мм} = 216.0$ $P \text{ вн.мм} = 231.0$ Гр. сл. = 0соб. Точн. = П
	БПЗ-1224 $F \text{ см}^2 = 1.706$ $Q \text{ кг.} = 0.462$ $D \text{ оп.мм} = 49.0$ $P \text{ н.мм} = 139.2$ $P \text{ вн.мм} = 141.7$ Гр. сл. = V Точн. = П		БПЗ-1229 $F \text{ см}^2 = 2.160$ $Q \text{ кг.} = 0.585$ $D \text{ оп.мм} = 51.0$ $P \text{ н.мм} = 134.3$ $P \text{ вн.мм} = 81.7$ Гр. сл. = V Точн. = Н
	БПЗ-1225 $F \text{ см}^2 = 6.808$ $Q \text{ кг.} = 1.845$ $D \text{ оп.мм} = 92.0$ $P \text{ н.мм} = 431.4$ $P \text{ вн.мм} = 187.3$ Гр. сл. = V Точн. = П		БПЗ-1230 $F \text{ см}^2 = 15.845$ $Q \text{ кг.} = 4.294$ $D \text{ оп.мм} = 125.0$ $P \text{ н.мм} = 445.4$ $P \text{ вн.мм} = 157.4$ Гр. сл. = 0соб. Точн. = П

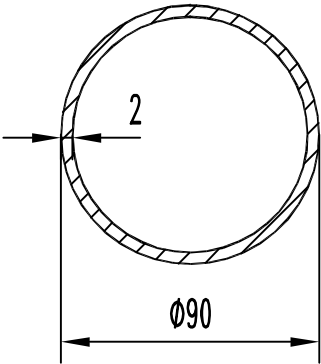
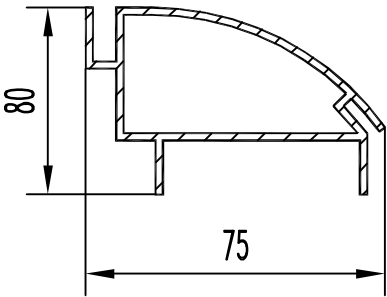
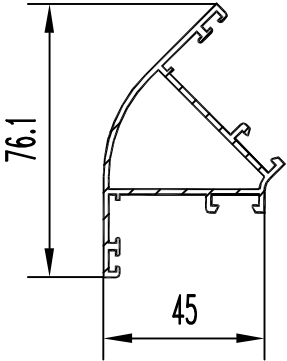
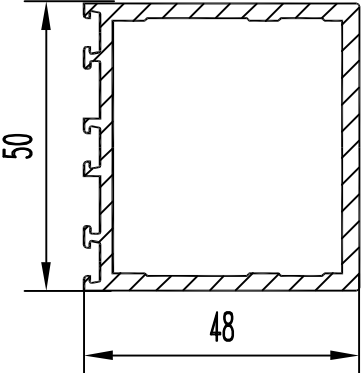
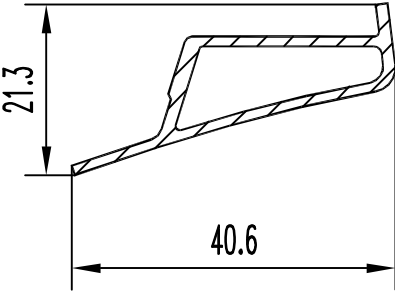
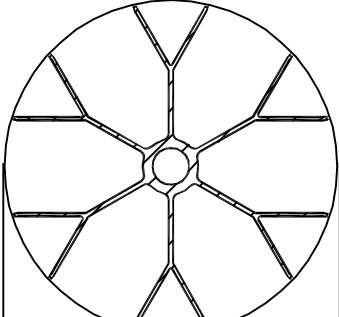
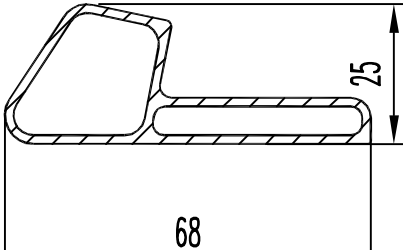
	БПЗ-1231		БПЗ-1236
	$F \text{ см}^2 = 9.697$ $Q \text{ кг.} = 2.628$ $D \text{ оп.мм} = 111$ $P \text{ н.мм} = 373.4$ $P \text{ вн.мм} = 84$ Гр. сл. = V Точн. = Н		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. =
	БПЗ-1232		БПЗ-1237
	$F \text{ см}^2 = 25.341$ $Q \text{ кг.} = 6.867$ $D \text{ оп.мм} = 100$ $P \text{ н.мм} = 1371$ $P \text{ вн.мм} = 78.5$ Гр. сл. = Особ. Точн. = П		$F \text{ см}^2 = 8.98$ $Q \text{ кг.} = 2.434$ $D \text{ оп.мм} = 164$ $P \text{ н.мм} = 784.3$ $P \text{ вн.мм} =$ Гр. сл. = VI Точн. = П
	БПЗ-1233		БПЗ-1238
	$F \text{ см}^2 = 1.586$ $Q \text{ кг.} = 0.43$ $D \text{ оп.мм} = 28$ $P \text{ н.мм} = 97.5$ $P \text{ вн.мм} = 46.9$ Гр. сл. = VI Точн. = П		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. =
	БПЗ-1234		БПЗ-1239
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. =		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. =
	БПЗ-1235		БПЗ-1240
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. =		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. =

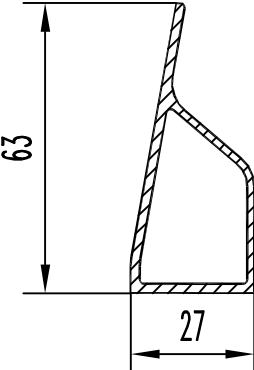
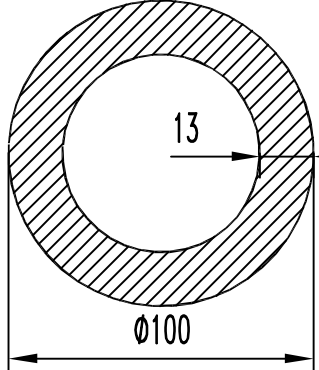
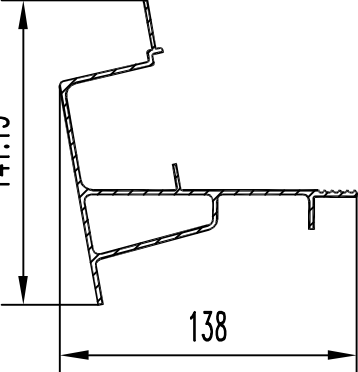
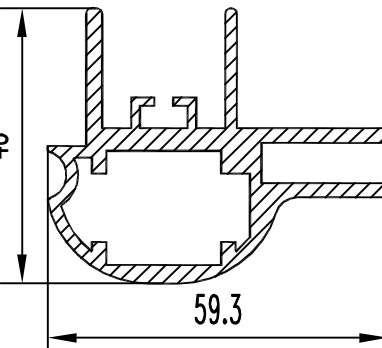
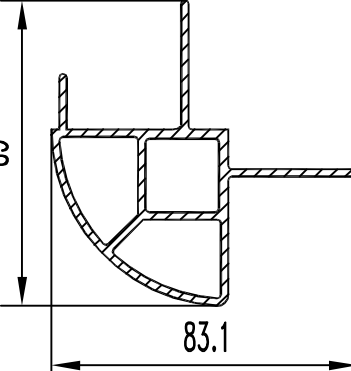
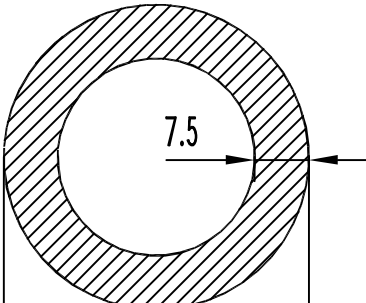
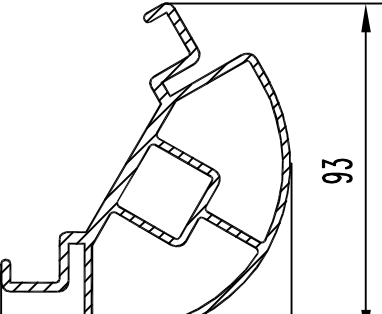
	БПЗ-1241		БПЗ-1246
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} =$		$F \text{ см}^2 = 1.45$ $Q \text{ кг.} = 0.393$ $D \text{ оп.мм} = 36$ $P \text{ н.мм} = 146$ $P \text{ вн.мм} = 25.4$ $\Gamma \text{ р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$
	БПЗ-1242		БПЗ-1247
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} =$		$F \text{ см}^2 = 1.096$ $Q \text{ кг.} = 0.297$ $D \text{ оп.мм} = 30$ $P \text{ н.мм} = 100$ $P \text{ вн.мм} = 25.4$ $\Gamma \text{ р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$
	БПЗ-1243		БПЗ-1248
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} =$		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} =$
	БПЗ-1244		БПЗ-1249
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} =$		$F \text{ см}^2 = 1.259$ $Q \text{ кг.} = 0.341$ $D \text{ оп.мм} = 35$ $P \text{ н.мм} = 133.6$ $P \text{ вн.мм} = 16$ $\Gamma \text{ р. сл.} = \text{VI}$ $\text{Точн.} = \text{H}$
	БПЗ-1245		БПЗ-1250
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} =$		$F \text{ см}^2 = 3.391$ $Q \text{ кг.} = 0.919$ $D \text{ оп.мм} = 67$ $P \text{ н.мм} = 246.7$ $P \text{ вн.мм} = 177.1$ $\Gamma \text{ р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$

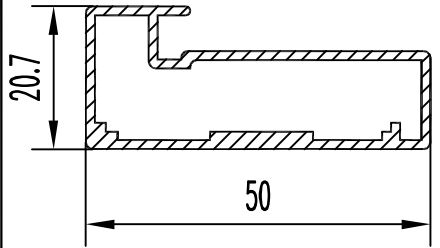
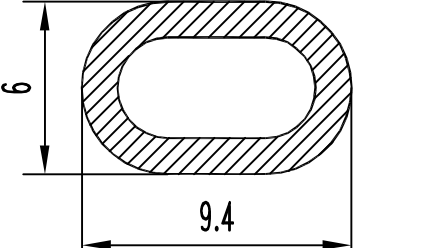
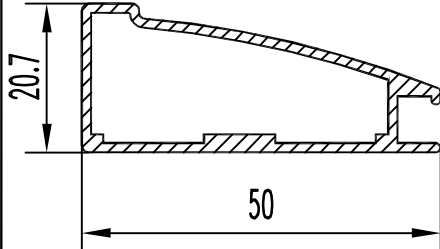
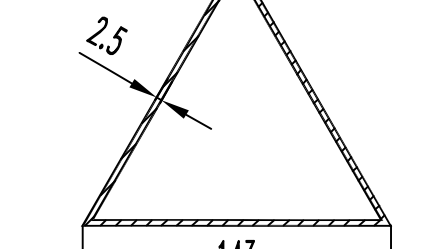
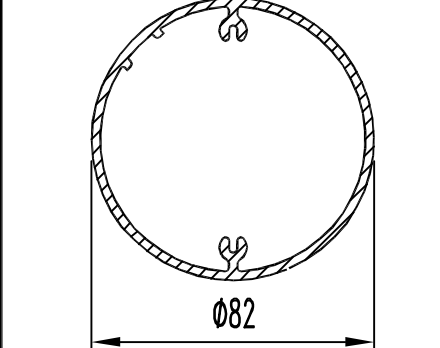
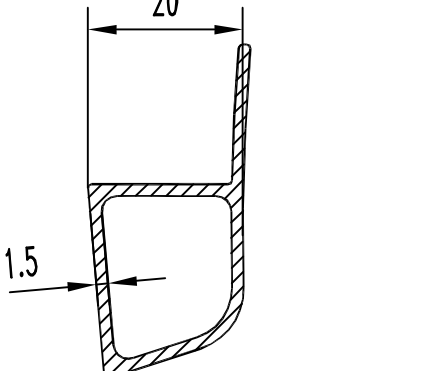
	БПЗ-1251		БПЗ-1256
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} =$		$F \text{ см}^2 = 21.773$ $Q \text{ кг.} = 5.9$ $D \text{ оп.мм} = 120$ $P \text{ н.мм} = 1106$ $P \text{ вн.мм} = 245$ $\Gamma \text{ р. сл.} = \text{особая}$ $\text{Точн.} = \text{особая}$
	БПЗ-1252		БПЗ-1257
	$F \text{ см}^2 = 10.833$ $Q \text{ кг.} = 2.936$ $D \text{ оп.мм} = 128$ $P \text{ н.мм} = 337.5$ $P \text{ вн.мм} = 377.6$ $\Gamma \text{ р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} =$
	БПЗ-1253		БПЗ-1258
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} =$		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} =$
	БПЗ-1254		БПЗ-1259
	$F \text{ см}^2 = 3.8$ $Q \text{ кг.} = 1.03$ $D \text{ оп.мм} = 96.5$ $P \text{ н.мм} = 330.6$ $P \text{ вн.мм} = 99.6$ $\Gamma \text{ р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} =$
	БПЗ-1255		БПЗ-1260
	$F \text{ см}^2 = 6.808$ $Q \text{ кг.} = 1.845$ $D \text{ оп.мм} = 92.0$ $P \text{ н.мм} = 431.4$ $P \text{ вн.мм} = 187.3$ $\Gamma \text{ р. сл.} = \text{V}$ $\text{Точн.} =$		$F \text{ см}^2 = 10.062$ $Q \text{ кг.} = 2.727$ $D \text{ оп.мм} = 134$ $P \text{ н.мм} = 480.1$ $P \text{ вн.мм} = 420.2$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} =$

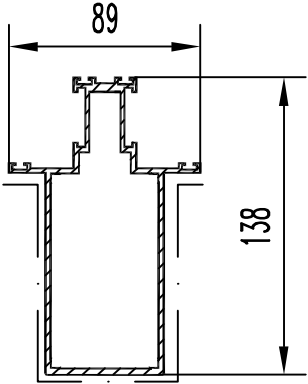
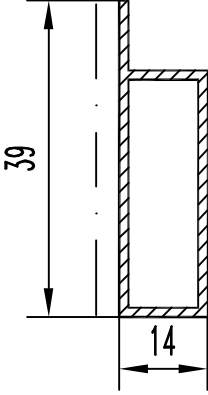
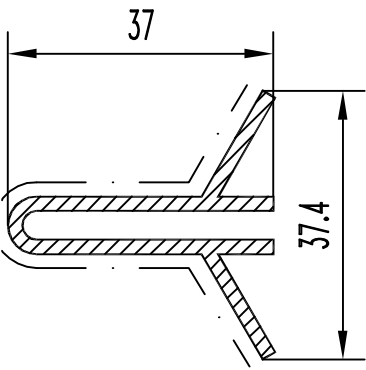
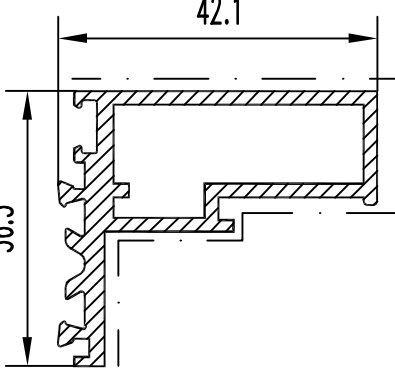
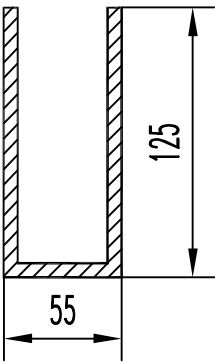
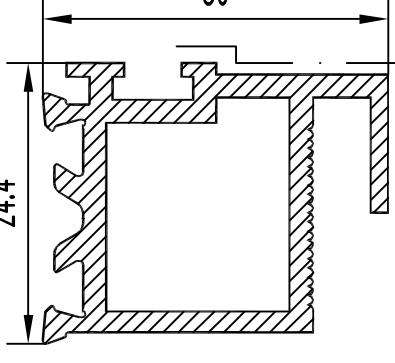
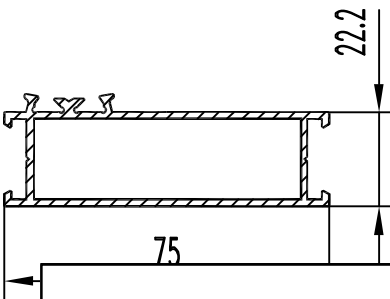
	БПЗ-1261 $F \text{ см}^2 = 10.578$ $Q \text{ кг.} = 2.867$ $D \text{ оп.мм} = 134$ $P \text{ н.мм} = 609.8$ $P \text{ вн.мм} = 255.7$ Гр. сл. = особая Точн. = П		БПЗ-1266 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. =
	БПЗ-1262 $F \text{ см}^2 = 2.67$ $Q \text{ кг.} = 0.723$ $D \text{ оп.мм} = 56$ $P \text{ н.мм} = 200$ $P \text{ вн.мм} = 50.4$ Гр. сл. = VI Точн. = П		БПЗ-1267 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. =
	БПЗ-1263 $F \text{ см}^2 = 2.54$ $Q \text{ кг.} = 0.688$ $D \text{ оп.мм} = 53$ $P \text{ н.мм} = 219.8$ $P \text{ вн.мм} = 43.9$ Гр. сл. = VI Точн. = П		БПЗ-1268 $F \text{ см}^2 = 18.24$ $Q \text{ кг.} = 4.943$ $D \text{ оп.мм} = 170$ $P \text{ н.мм} = 783.3$ $P \text{ вн.мм} = 631.9$ Гр. сл. = особая Точн. = П
	БПЗ-1264 $F \text{ см}^2 = 2.643$ $Q \text{ кг.} = 0.716$ $D \text{ оп.мм} = 46$ $P \text{ н.мм} = 166.3$ $P \text{ вн.мм} = 93.9$ Гр. сл. = VI Точн. = особая		БПЗ-1269 $F \text{ см}^2 = 0.683$ $Q \text{ кг.} = 0.185$ $D \text{ оп.мм} = 16$ $P \text{ н.мм} = 50.3$ $P \text{ вн.мм} = 40.8$ Гр. сл. = II Точн. = П
	БПЗ-1265 $F \text{ см}^2 = 4.98$ $Q \text{ кг.} = 1.35$ $D \text{ оп.мм} = 56$ $P \text{ н.мм} = 185.6$ $P \text{ вн.мм} = 200.2$		БПЗ-1270 $F \text{ см}^2 = 10.447$ $Q \text{ кг.} = 2.831$ $D \text{ оп.мм} = 148$ $P \text{ н.мм} = 367.7$ $P \text{ вн.мм} = 458.2$

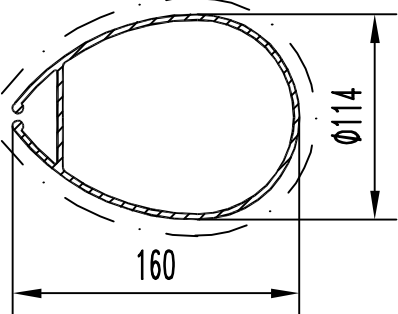
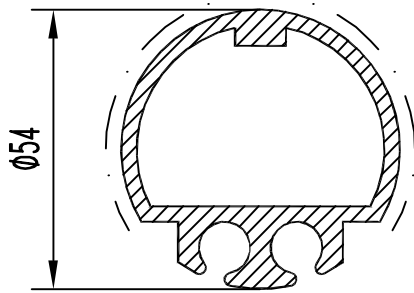
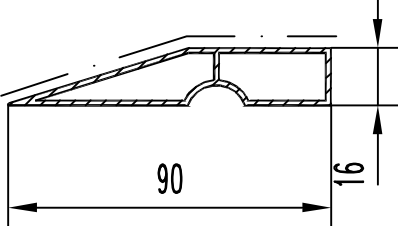
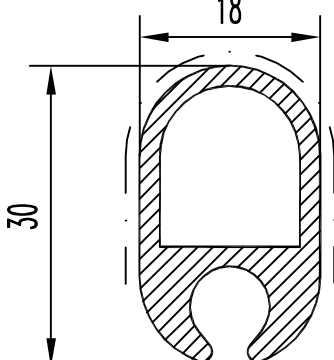
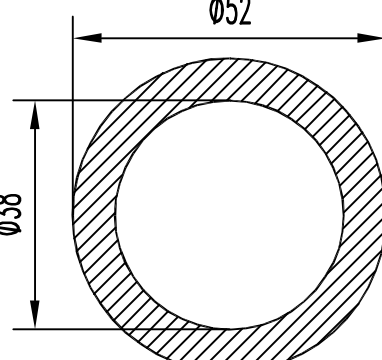
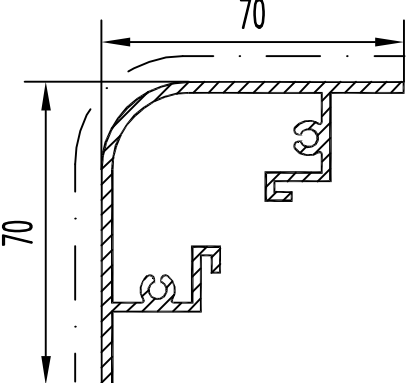
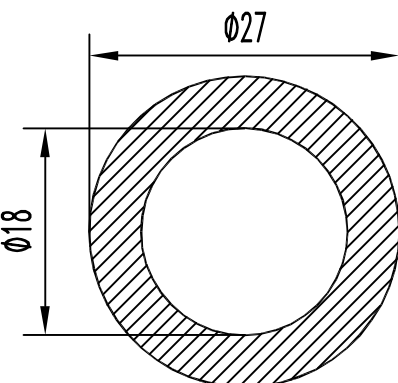
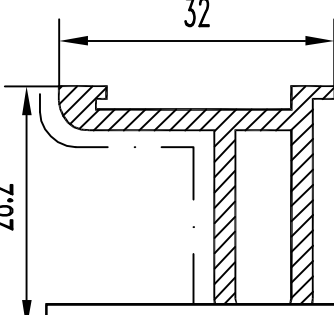
			БПЗ-1276
			$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{р. сл.} =$ $\text{Точн.} =$
	БПЗ-1272		БПЗ-1277
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{р. сл.} =$ $\text{Точн.} =$		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{р. сл.} =$ $\text{Точн.} =$
	БПЗ-1273		БПЗ-1278
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{р. сл.} =$ $\text{Точн.} =$		$F \text{ см}^2 = 5.32$ $Q \text{ кг.} = 1.436$ $D \text{ оп.мм} = 83$ $P \text{ н.мм} = 236.2$ $P \text{ вн.мм} = 204.4$ $\Gamma \text{р. сл.} = \text{IV}$ $\text{Точн.} = \text{П}$
	БПЗ-1274		БПЗ-1279
	$F \text{ см}^2 = 2.643$ $Q \text{ кг.} = 0.716$ $D \text{ оп.мм} = 46$ $P \text{ н.мм} = 166.3$ $P \text{ вн.мм} = 93.9$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{особая}$		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{р. сл.} =$ $\text{Точн.} =$
	БПЗ-1275		БПЗ-1280
	$F \text{ см}^2 = 2.222$ $Q \text{ кг.} = 0.602$ $D \text{ оп.мм} = 19$ $P \text{ н.мм} = 58.5$ $P \text{ вн.мм} = 22$ $\Gamma \text{р. сл.} = \text{III}$		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{р. сл.} =$

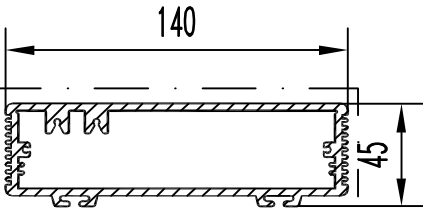
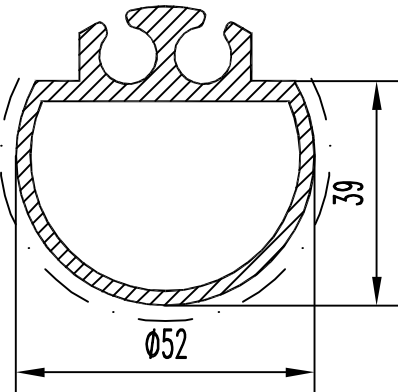
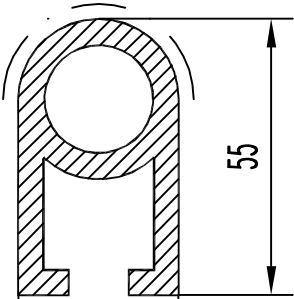
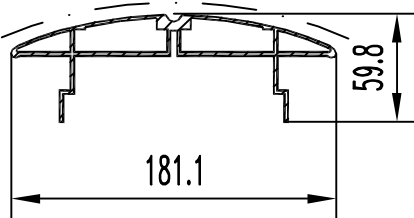
	БПЗ-1281 $F \text{ см}^2 = 5.529$ $Q \text{ кг.} = 1.498$ $D \text{ оп.мм} = 90$ $P \text{ н.мм} = 282.7$ $P \text{ вн.мм} = 270.2$ Гр. сл. = IV Точн. = Н		БПЗ-1286 $F \text{ см}^2 = 5.111$ $Q \text{ кг.} = 1.385$ $D \text{ оп.мм} = 95$ $P \text{ н.мм} = 328.9$ $P \text{ вн.мм} = 181.6$ Гр. сл. = VI Точн. = П
	БПЗ-1282 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. =		БПЗ-1287 $F \text{ см}^2 = 3.4$ $Q \text{ кг.} = 0.92$ $D \text{ оп.мм} = 83$ $P \text{ н.мм} = 125.1$ $P \text{ вн.мм} = 83$ Гр. сл. = VI Точн. = П
	БПЗ-1283 $F \text{ см}^2 = 5.073$ $Q \text{ кг.} = 1.375$ $D \text{ оп.мм} = 70$ $P \text{ н.мм} = 238.2$ $P \text{ вн.мм} = 169.7$ Гр. сл. = V Точн. = П		БПЗ-1288 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. =
	БПЗ-1284 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. =		БПЗ-1289 $F \text{ см}^2 = 1.136$ $Q \text{ кг.} = 0.308$ $D \text{ оп.мм} = 45$ $P \text{ н.мм} = 105.8$ $P \text{ вн.мм} = 63.1$ Гр. сл. = VI Точн. = П
	БПЗ-1285 $F \text{ см}^2 = 13.057$ $Q \text{ кг.} = 3.538$ $D \text{ оп.мм} = 152$ $P \text{ н.мм} = 1243$ $P \text{ вн.мм} = 53.4$ Гр. сл. = IV Точн. = Н		БПЗ-1290 $F \text{ см}^2 = 2.546$ $Q \text{ кг.} = 0.69$ $D \text{ оп.мм} = 64$ $P \text{ н.мм} = 162.2$ $P \text{ вн.мм} = 156.5$ Гр. сл. = VI Точн. = П

	БПЗ-1291 $F \text{ см}^2 = 2.535$ $Q \text{ кг.} = 0.687$ $D \text{ оп.мм} = 66$ $P \text{ н.мм} = 162.9$ $P \text{ вн.мм} = 107.3$ Гр. сл. = IV Точн. = П		БПЗ-1296 $F \text{ см}^2 = 34.74$ $Q \text{ кг.} = 9.415$ $D \text{ оп.мм} = 100$ $P \text{ н.мм} = 314.2$ $P \text{ вн.мм} = 232.5$ Гр. сл. = III Точн. = Н
	БПЗ-1292 $F \text{ см}^2 = 8.28$ $Q \text{ кг.} = 2.244$ $D \text{ оп.мм} = 159$ $P \text{ н.мм} = 649.4$ $P \text{ вн.мм} = 154.4$ Гр. сл. = VI Точн. = П		БПЗ-1297 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. =
	БПЗ-1293 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. =		БПЗ-1298 $F \text{ см}^2 = 5.761$ $Q \text{ кг.} = 1.561$ $D \text{ оп.мм} = 63$ $P \text{ н.мм} = 316$ $P \text{ вн.мм} = 111.9$ Гр. сл. = V Точн. = П
	БПЗ-1294 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. =		БПЗ-1299 $F \text{ см}^2 = 6.359$ $Q \text{ кг.} = 1.723$ $D \text{ оп.мм} = 87$ $P \text{ н.мм} = 336.3$ $P \text{ вн.мм} = 251.5$ Гр. сл. = VI Точн. = П
	БПЗ-1295 $F \text{ см}^2 = 18.26$ $Q \text{ кг.} = 4.948$ $D \text{ оп.мм} = 85$ $P \text{ н.мм} = 267$ $P \text{ вн.мм} = 219.9$ Гр. сл. = III		БПЗ-1300 $F \text{ см}^2 = 8.53$ $Q \text{ кг.} = 2.312$ $D \text{ оп.мм} = 95$ $P \text{ н.мм} = 379.8$ $P \text{ вн.мм} = 354.7$ Гр. сл. = IV

	БПЗ-1301 $F \text{ см}^2 = 2.139$ $Q \text{ кг.} = 0.580$ $D \text{ оп.мм} = 70.0$ $P \text{ н.мм} = 150.5$ $P \text{ вн.мм} = 139.9$ Гр. сл. = VI Точн. = П		БПЗ-1306 $F \text{ см}^2 = 0.272$ $Q \text{ кг.} = 0.074$ $D \text{ оп.мм} = 9.4$ $P \text{ н.мм} = 25.7$ $P \text{ вн.мм} = 17.8$ Гр. сл. = V Точн. = П
	БПЗ-1302 $F \text{ см}^2 = 1.894$ $Q \text{ кг.} = 0.513$ $D \text{ оп.мм} = 70.0$ $P \text{ н.мм} = 144.4$ $P \text{ вн.мм} = 114.2$ Гр. сл. = VI Точн. = П		БПЗ-1307 $F \text{ см}^2 = 10.400$ $Q \text{ кг.} = 2.818$ $D \text{ оп.мм} = 166.0$ $P \text{ н.мм} = 429.0$ $P \text{ вн.мм} = 403.0$ Гр. сл. = IV Точн. = П
	БПЗ-1303 $F \text{ см}^2 = 7.231$ $Q \text{ кг.} = 1.960$ $D \text{ оп.мм} = 82.0$ $P \text{ н.мм} = 257.6$ $P \text{ вн.мм} = 311.2$ Гр. сл. = VI Точн. = П		
			БПЗ-1309 $F \text{ см}^2 = 1.441$ $Q \text{ кг.} = 0.391$ $D \text{ оп.мм} = 47.0$ $P \text{ н.мм} = 116.7$ $P \text{ вн.мм} = 66.6$ Гр. сл. = IV Точн. = П

	БПЗ-1321 $F \text{ см}^2 = 10.570$ $Q \text{ кг.} = 2.864$ $D \text{ оп.мм} = 145.0$ $P \text{ н.мм} = 554.1$ $P \text{ вн.мм} = 362.8$ Гр. сл. = V Точн. = П		БПЗ-1326 $F \text{ см}^2 = 1.665$ $Q \text{ кг.} = 0.451$ $D \text{ оп.мм} = 52.0$ $P \text{ н.мм} = 128.0$ $P \text{ вн.мм} = 94.0$ Гр. сл. = V Точн. = П
	БПЗ-1323 $F \text{ см}^2 = 2.165$ $Q \text{ кг.} = 0.587$ $D \text{ оп.мм} = 46.0$ $P \text{ н.мм} = 219.9$ $P \text{ вн.мм} = 0.0$ Гр. сл. = VI Точн. = П		БПЗ-1328 $F \text{ см}^2 = 2.970$ $Q \text{ кг.} = 0.805$ $D \text{ оп.мм} = 54.0$ $P \text{ н.мм} = 198.8$ $P \text{ вн.мм} = 99.8$ Гр. сл. = V Точн. = П
	БПЗ-1324 $F \text{ см}^2 = 18.980$ $Q \text{ кг.} = 5.144$ $D \text{ оп.мм} = 137.0$ $P \text{ н.мм} = 597.0$ $P \text{ вн.мм} = 0.0$ Гр. сл. = VI Точн. = Н		БПЗ-1329 $F \text{ см}^2 = 2.170$ $Q \text{ кг.} = 0.588$ $D \text{ оп.мм} = 38.0$ $P \text{ н.мм} = 170.4$ $P \text{ вн.мм} = 69.2$ Гр. сл. = V Точн. = П
	БПЗ-1325 $F \text{ см}^2 = 3.981$ $Q \text{ кг.} = 1.079$ $D \text{ оп.мм} = 78.0$ $P \text{ н.мм} = 261.0$ $P \text{ вн.мм} = 159.2$ Гр. сл. = V		

			БПЗ-1336 $F \text{ см}^2 = 14.800$ $Q \text{ кг.} = 4.011$ $D \text{ оп.мм} = 160.0$ $P \text{ н.мм} = 550.5$ $P \text{ вн.мм} = 388.8$ Гр. сл. = 0соб. Точн. = П
	БПЗ-1332 $F \text{ см}^2 = 6.787$ $Q \text{ кг.} = 1.839$ $D \text{ оп.мм} = 54.0$ $P \text{ н.мм} = 229.9$ $P \text{ вн.мм} = 147.8$ Гр. сл. = VI Точн. = П		БПЗ-1337 $F \text{ см}^2 = 2.540$ $Q \text{ кг.} = 0.688$ $D \text{ оп.мм} = 92.0$ $P \text{ н.мм} = 183.5$ $P \text{ вн.мм} = 174.1$ Гр. сл. = IV Точн. = П
	БПЗ-1333 $F \text{ см}^2 = 2.083$ $Q \text{ кг.} = 0.564$ $D \text{ оп.мм} = 30.0$ $P \text{ н.мм} = 100.8$ $P \text{ вн.мм} = 54.0$ Гр. сл. = V Точн. = П		БПЗ-1338 $F \text{ см}^2 = 9.896$ $Q \text{ кг.} = 2.682$ $D \text{ оп.мм} = 52.0$ $P \text{ н.мм} = 163.4$ $P \text{ вн.мм} = 119.4$ Гр. сл. = III Точн. = П
	БПЗ-1334 $F \text{ см}^2 = 5.502$ $Q \text{ кг.} = 1.491$ $D \text{ оп.мм} = 99.0$ $P \text{ н.мм} = 479.9$ $P \text{ вн.мм} = 0.0$ Гр. сл. = VI Точн. = П		БПЗ-1339 $F \text{ см}^2 = 3.181$ $Q \text{ кг.} = 0.862$ $D \text{ оп.мм} = 27.0$ $P \text{ н.мм} = 84.8$ $P \text{ вн.мм} = 56.6$ Гр. сл. = III Точн. = П
	БПЗ-1335 $F \text{ см}^2 = 2.160$ $Q \text{ кг.} = 0.585$ $D \text{ оп.мм} = 40.0$ $P \text{ н.мм} = 176.8$ $P \text{ вн.мм} = 0.0$ Гр. сл. = V Точн. = П		

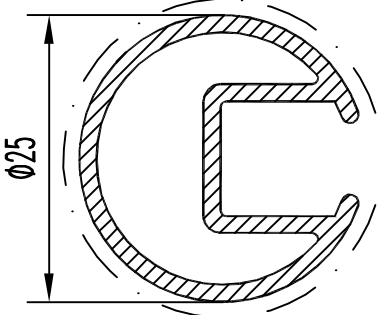
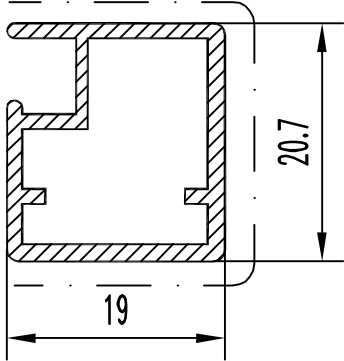
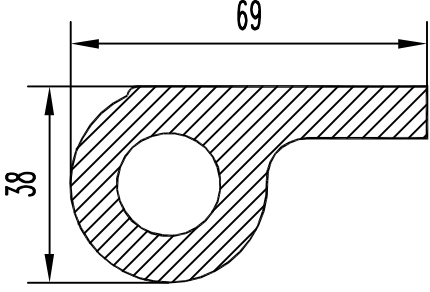
	БПЗ-1343		
	$F \text{ см}^2 = 15.538$ $Q \text{ кг.} = 4.211$ $D \text{ оп.мм} = 154.0$ $P \text{ н.мм} = 532.4$ $P \text{ в.н.мм} = 452.0$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		
	БПЗ-1344		
	$F \text{ см}^2 = 5.732$ $Q \text{ кг.} = 1.553$ $D \text{ оп.мм} = 52.0$ $P \text{ н.мм} = 227.1$ $P \text{ в.н.мм} = 136.4$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \text{Особ.}$		
	БПЗ-1345		БПЗ-1350
	$F \text{ см}^2 = 7.830$ $Q \text{ кг.} = 2.122$ $D \text{ оп.мм} = 60.0$ $P \text{ н.мм} = 237.3$ $P \text{ в.н.мм} = 69.1$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 10.310$ $Q \text{ кг.} = 2.794$ $D \text{ оп.мм} = 182.0$ $P \text{ н.мм} = 577.6$ $P \text{ в.н.мм} = 424.8$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$

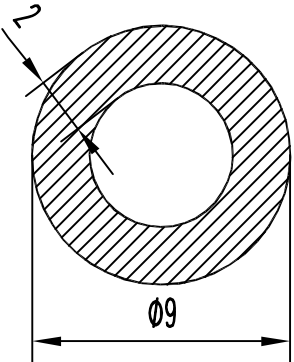
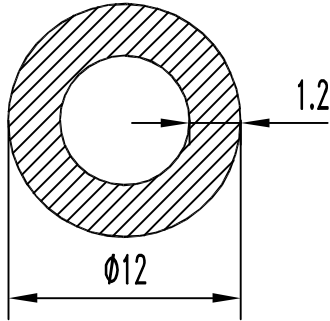
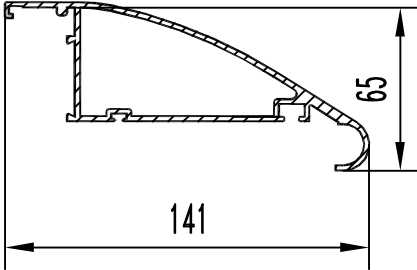
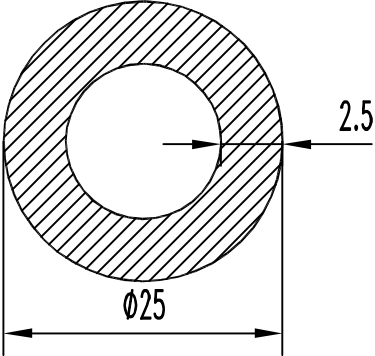
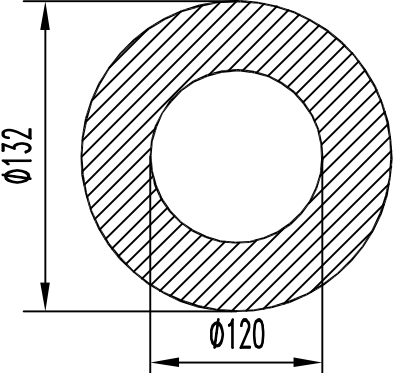
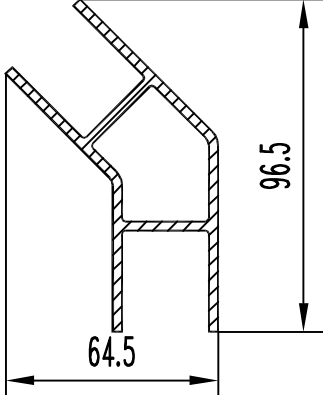
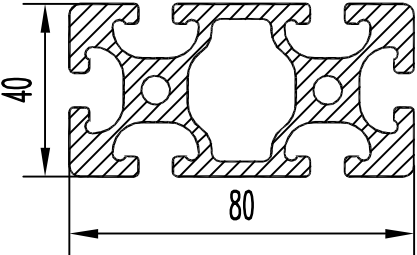
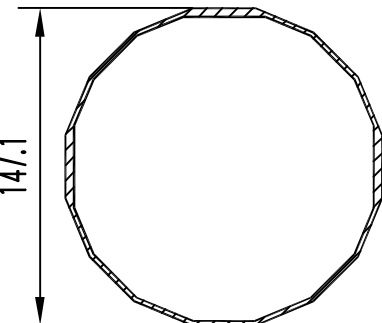
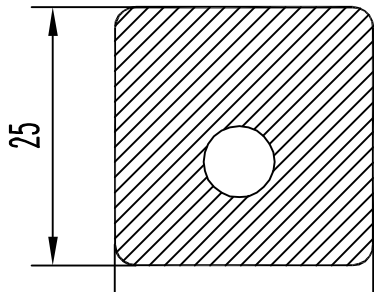
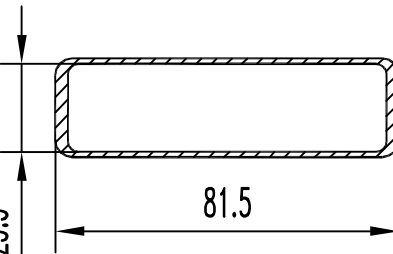
pdfMachine

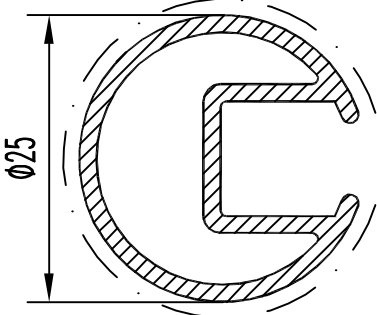
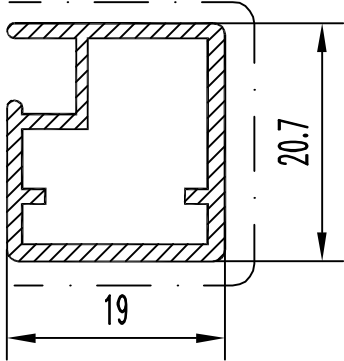
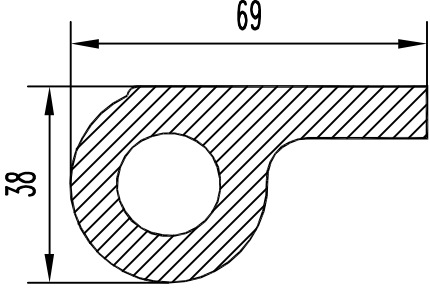
A pdf writer that produces quality PDF files with ease!

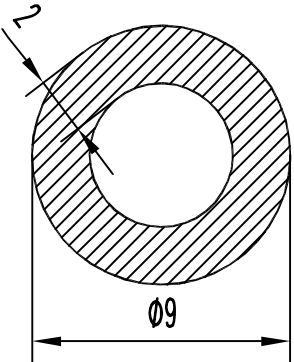
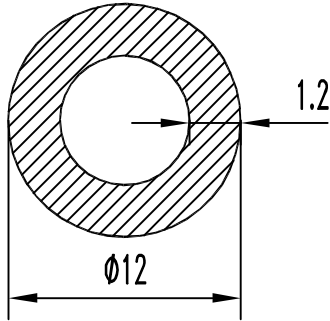
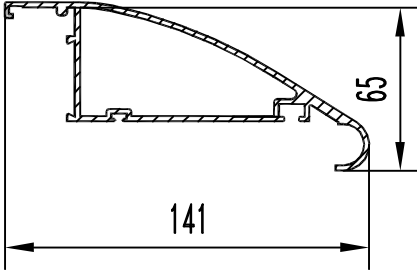
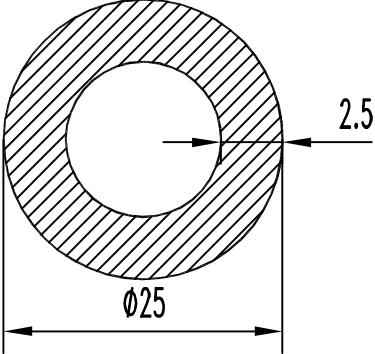
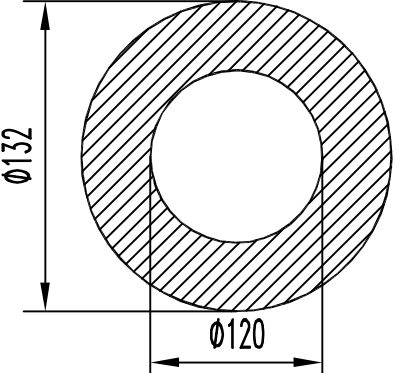
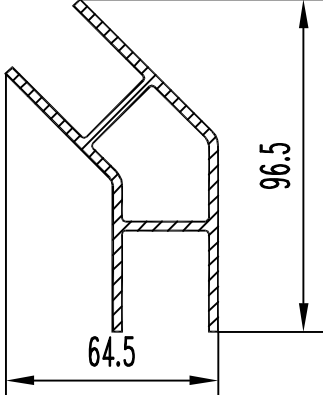
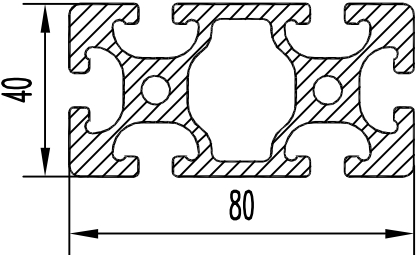
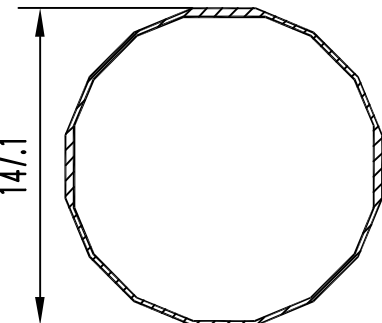
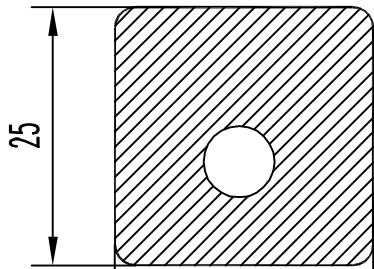
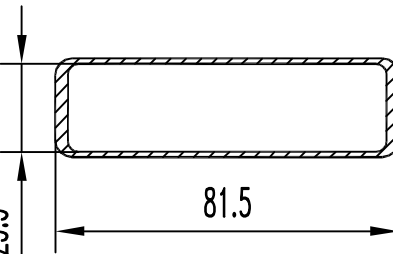
Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

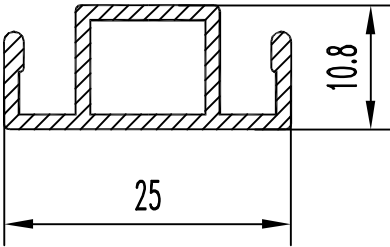
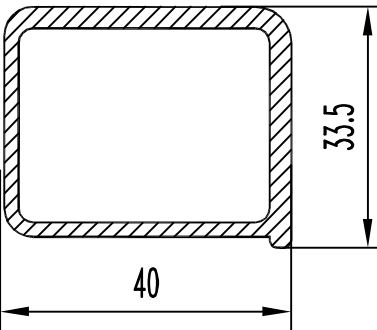
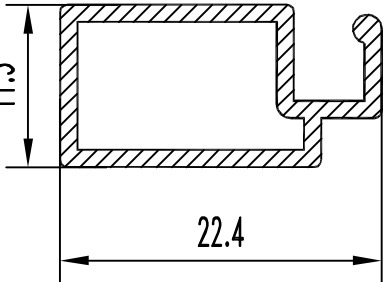
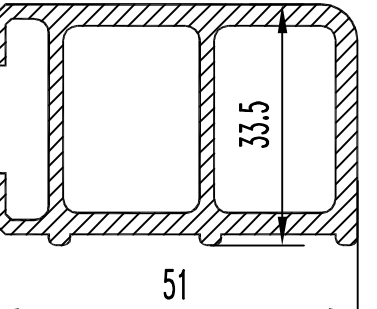
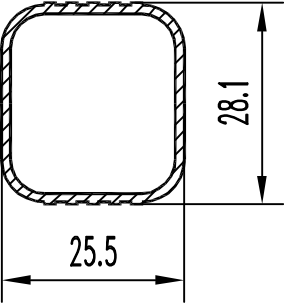
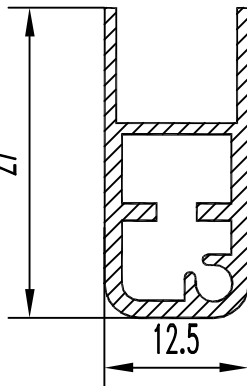
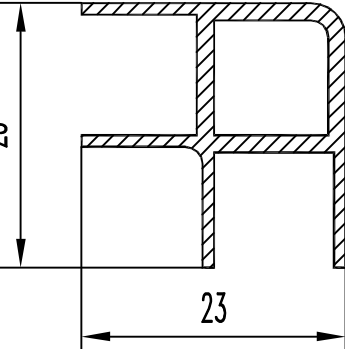
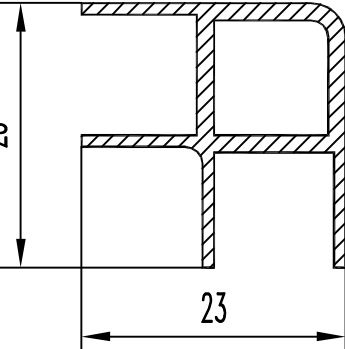
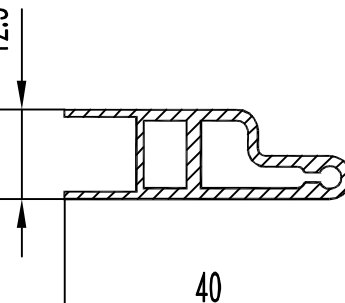
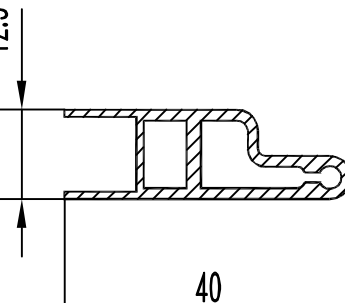
Get yours now!

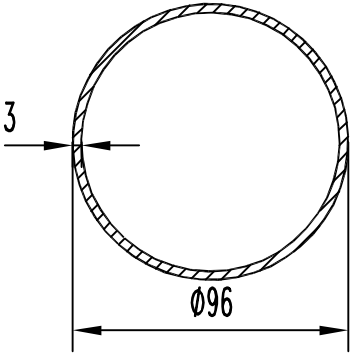
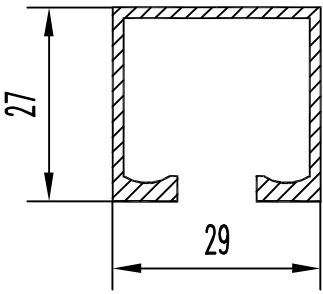
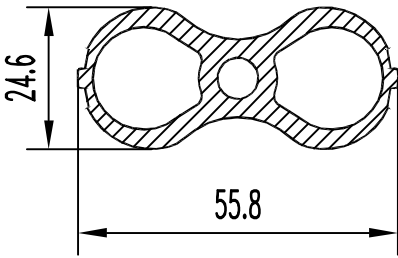
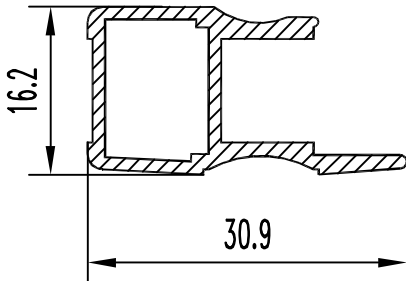
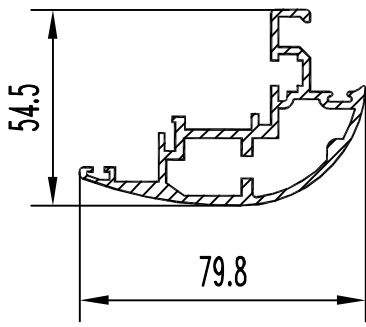
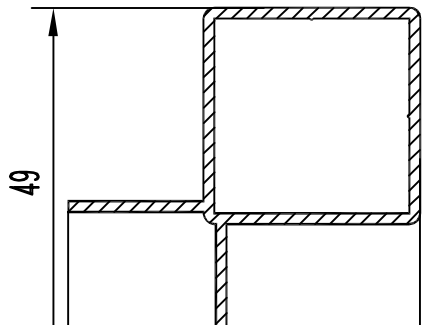
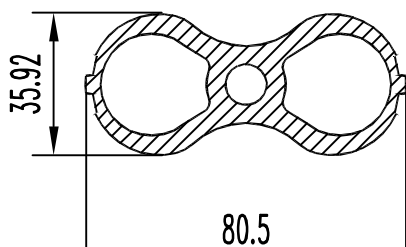
	БПЗ-1351		
	БПЗ-1353 $F \text{ см}^2 = 1.490$ $Q \text{ кг.} = 0.404$ $D \text{ оп.мм} = 25.0$ $P \text{ н.мм} = 107.5$ $P \text{ в.н.мм} = 86.1$ Гр. сл. = VI Точн. = П		
	БПЗ-1354 $F \text{ см}^2 = 1.145$ $Q \text{ кг.} = 0.310$ $D \text{ оп.мм} = 28.0$ $P \text{ н.мм} = 91.4$ $P \text{ в.н.мм} = 76.2$ Гр. сл. = VI Точн. = П		
	БПЗ-1355		БПО-1360 $F \text{ см}^2 = 12.554$ $Q \text{ кг.} = 3.402$ $D \text{ оп.мм} = 70.0$ $P \text{ н.мм} = 186.8$ $P \text{ в.н.мм} = 59.7$ Гр. сл. = V

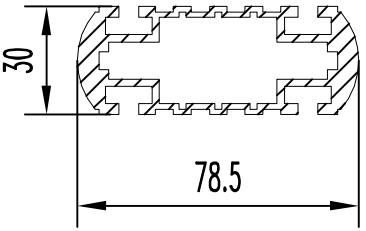
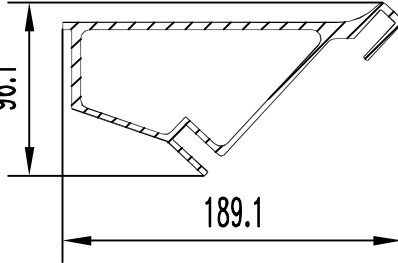
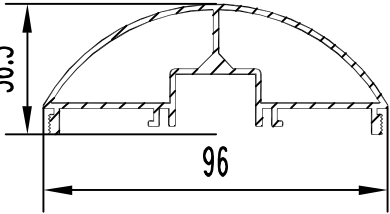
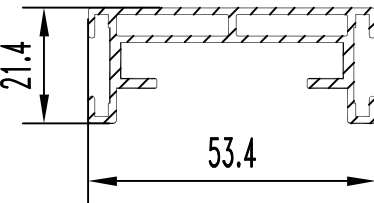
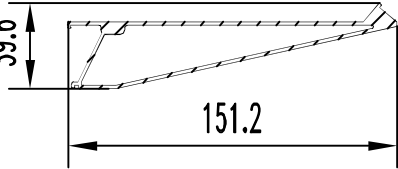
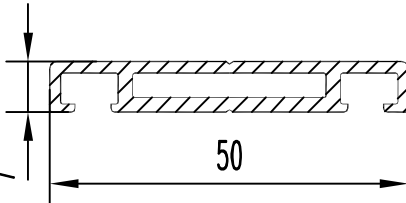
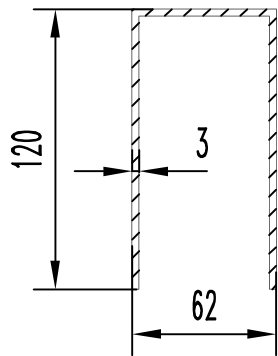
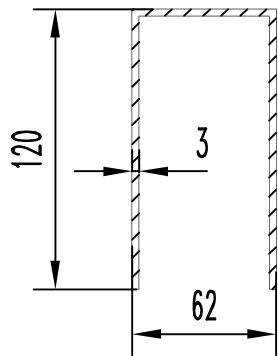
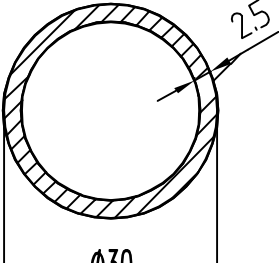
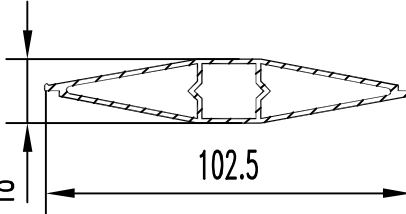
	БПЗ-1361 $F \text{ см}^2 = 0.440$ $Q \text{ кг.} = 0.119$ $D \text{ оп.мм} = 9.0$ $P \text{ н.мм} = 28.3$ $P \text{ вн.мм} = 15.7$ Гр. сл. = III Точн. = Н		БПЗ-1366 $F \text{ см}^2 = 0.407$ $Q \text{ кг.} = 0.110$ $D \text{ оп.мм} = 12.0$ $P \text{ н.мм} = 37.7$ $P \text{ вн.мм} = 30.2$ Гр. сл. = V Точн. = Н
	БПЗ-1362 $F \text{ см}^2 = 7.216$ $Q \text{ кг.} = 1.956$ $D \text{ оп.мм} = 153.0$ $P \text{ н.мм} = 492.7$ $P \text{ вн.мм} = 229.8$ Гр. сл. = VI Точн. = П		БПЗ-1367 $F \text{ см}^2 = 1.767$ $Q \text{ кг.} = 0.479$ $D \text{ оп.мм} = 25.0$ $P \text{ н.мм} = 78.5$ $P \text{ вн.мм} = 62.8$ Гр. сл. = IV Точн. = П
	БПЗ-1363 $F \text{ см}^2 = 23.750$ $Q \text{ кг.} = 6.436$ $D \text{ оп.мм} = 132.0$ $P \text{ н.мм} = 414.7$ $P \text{ вн.мм} = 377.0$ Гр. сл. = V Точн. = П		БПЗ-1368 $F \text{ см}^2 = 6.665$ $Q \text{ кг.} = 1.806$ $D \text{ оп.мм} = 105.0$ $P \text{ н.мм} = 377.7$ $P \text{ вн.мм} = 120.6$ Гр. сл. = V Точн. = П
	БПЗ-1364 $F \text{ см}^2 = 13.934$ $Q \text{ кг.} = 3.776$ $D \text{ оп.мм} = 89.0$ $P \text{ н.мм} = 491.3$ $P \text{ вн.мм} = 140.1$ Гр. сл. = 0соб. Точн. = П		БПЗ-1369 $F \text{ см}^2 = 11.230$ $Q \text{ кг.} = 3.043$ $D \text{ оп.мм} = 150.0$ $P \text{ н.мм} = 468.2$ $P \text{ вн.мм} = 453.1$ Гр. сл. = VI Точн. = П
	БПЗ-1365 $F \text{ см}^2 = 5.870$ $Q \text{ кг.} = 1.591$ $D \text{ оп.мм} = 34.0$ $P \text{ н.мм} = 96.6$ $P \text{ вн.мм} = 21.1$ Гр. сл. = V Точн. = П		БПЗ-1370 $F \text{ см}^2 = 3.214$ $Q \text{ кг.} = 0.871$ $D \text{ оп.мм} = 84.0$ $P \text{ н.мм} = 203.1$ $P \text{ вн.мм} = 188.7$ Гр. сл. = III Точн. = П

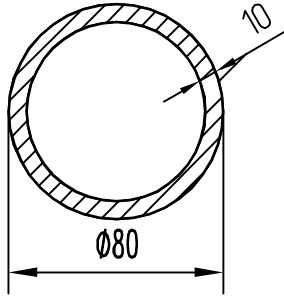
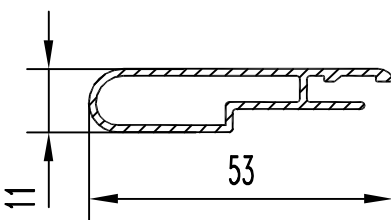
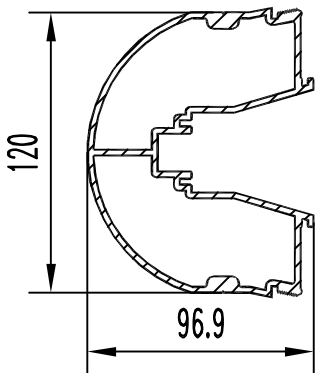
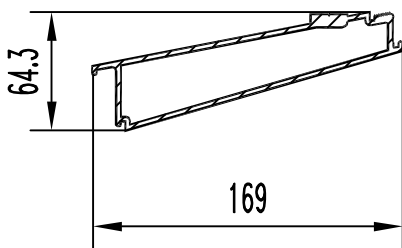
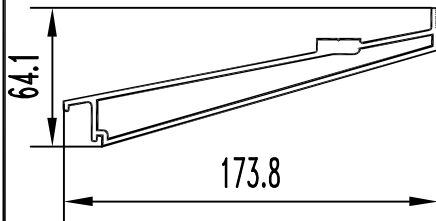
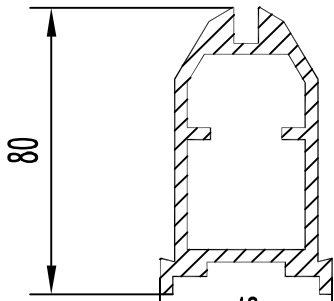
	БПЗ-1351		
	БПЗ-1353 $F \text{ см}^2 = 1.490$ $Q \text{ кг.} = 0.404$ $D \text{ оп.мм} = 25.0$ $P \text{ н.мм} = 107.5$ $P \text{ в.н.мм} = 86.1$ Гр. сл. = VI Точн. = П		
	БПЗ-1354 $F \text{ см}^2 = 1.145$ $Q \text{ кг.} = 0.310$ $D \text{ оп.мм} = 28.0$ $P \text{ н.мм} = 91.4$ $P \text{ в.н.мм} = 76.2$ Гр. сл. = VI Точн. = П		
	БПЗ-1355		БПО-1360 $F \text{ см}^2 = 12.554$ $Q \text{ кг.} = 3.402$ $D \text{ оп.мм} = 70.0$ $P \text{ н.мм} = 186.8$ $P \text{ в.н.мм} = 59.7$ Гр. сл. = V

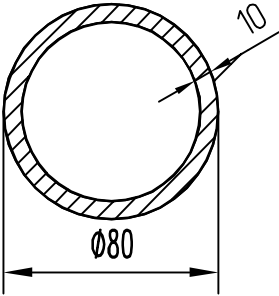
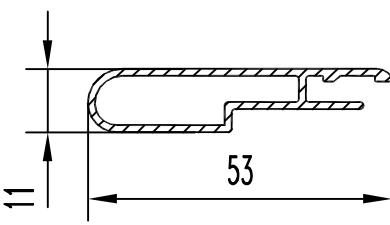
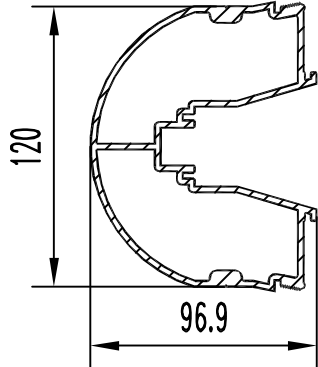
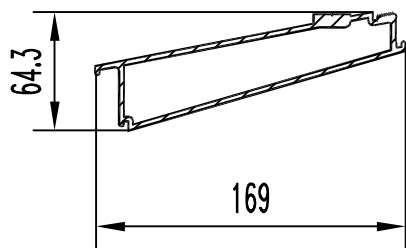
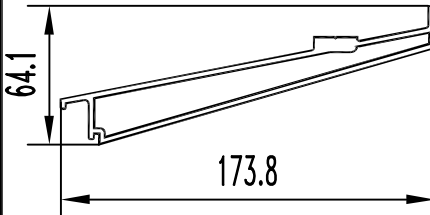
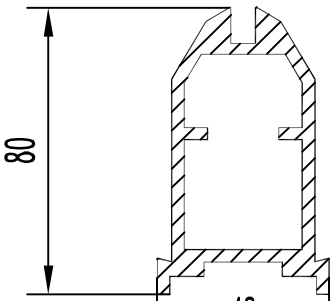
	БПЗ-1361 $F \text{ см}^2 = 0.440$ $Q \text{ кг.} = 0.119$ $D \text{ оп.мм} = 9.0$ $P \text{ н.мм} = 28.3$ $P \text{ вн.мм} = 15.7$ Гр. сл. = III Точн. = Н		БПЗ-1366 $F \text{ см}^2 = 0.407$ $Q \text{ кг.} = 0.110$ $D \text{ оп.мм} = 12.0$ $P \text{ н.мм} = 37.7$ $P \text{ вн.мм} = 30.2$ Гр. сл. = V Точн. = Н
	БПЗ-1362 $F \text{ см}^2 = 7.216$ $Q \text{ кг.} = 1.956$ $D \text{ оп.мм} = 153.0$ $P \text{ н.мм} = 492.7$ $P \text{ вн.мм} = 229.8$ Гр. сл. = VI Точн. = П		БПЗ-1367 $F \text{ см}^2 = 1.767$ $Q \text{ кг.} = 0.479$ $D \text{ оп.мм} = 25.0$ $P \text{ н.мм} = 78.5$ $P \text{ вн.мм} = 62.8$ Гр. сл. = IV Точн. = П
	БПЗ-1363 $F \text{ см}^2 = 23.750$ $Q \text{ кг.} = 6.436$ $D \text{ оп.мм} = 132.0$ $P \text{ н.мм} = 414.7$ $P \text{ вн.мм} = 377.0$ Гр. сл. = V Точн. = П		БПЗ-1368 $F \text{ см}^2 = 6.665$ $Q \text{ кг.} = 1.806$ $D \text{ оп.мм} = 105.0$ $P \text{ н.мм} = 377.7$ $P \text{ вн.мм} = 120.6$ Гр. сл. = V Точн. = П
	БПЗ-1364 $F \text{ см}^2 = 13.934$ $Q \text{ кг.} = 3.776$ $D \text{ оп.мм} = 89.0$ $P \text{ н.мм} = 491.3$ $P \text{ вн.мм} = 140.1$ Гр. сл. = 0соб. Точн. = П		БПЗ-1369 $F \text{ см}^2 = 11.230$ $Q \text{ кг.} = 3.043$ $D \text{ оп.мм} = 150.0$ $P \text{ н.мм} = 468.2$ $P \text{ вн.мм} = 453.1$ Гр. сл. = VI Точн. = П
	БПЗ-1365 $F \text{ см}^2 = 5.870$ $Q \text{ кг.} = 1.591$ $D \text{ оп.мм} = 34.0$ $P \text{ н.мм} = 96.6$ $P \text{ вн.мм} = 21.1$ Гр. сл. = V Точн. = П		БПЗ-1370 $F \text{ см}^2 = 3.214$ $Q \text{ кг.} = 0.871$ $D \text{ оп.мм} = 84.0$ $P \text{ н.мм} = 203.1$ $P \text{ вн.мм} = 188.7$ Гр. сл. = III Точн. = П

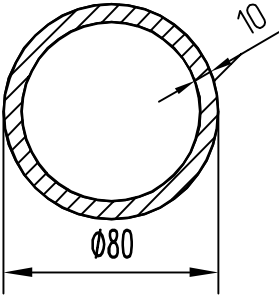
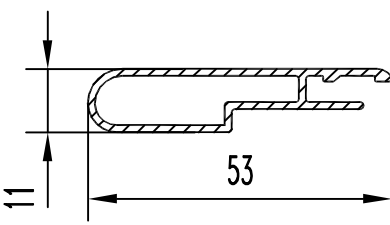
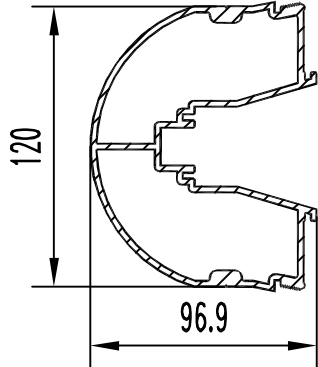
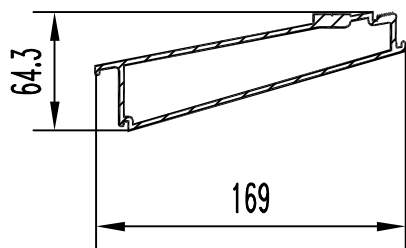
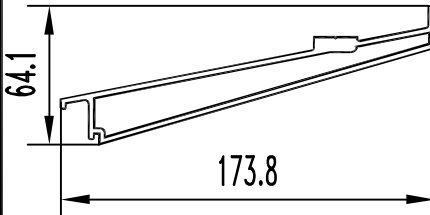
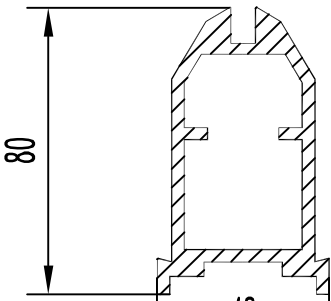
	БПЗ-1371 $F \text{ см}^2 = 0.909$ $Q \text{ кг.} = 0.246$ $D \text{ оп.мм} = 26$ $P \text{ н.мм} = 99.4$ $P \text{ вн.мм} = 36.4$ Гр. сл. = VI Точн. = П		БПЗ-1376 $F \text{ см}^2 = 3.302$ $Q \text{ кг.} = 0.895$ $D \text{ оп.мм} = 50.2$ $P \text{ н.мм} = 140.6$ $P \text{ вн.мм} = 120.6$ Гр. сл. = III Точн. = П
	БПЗ-1372 $F \text{ см}^2 = 0.777$ $Q \text{ кг.} = 0.211$ $D \text{ оп.мм} = 25$ $P \text{ н.мм} = 78.7$ $P \text{ вн.мм} = 48.9$ Гр. сл. = V Точн. = П		БПЗ-1377 $F \text{ см}^2 = 5.1$ $Q \text{ кг.} = 1.39$ $D \text{ оп.мм} = 59.6$ $P \text{ н.мм} = 207.3$ $P \text{ вн.мм} = 169.2$ Гр. сл. = VI Точн. = П
	БПЗ-1373 $F \text{ см}^2 = 1.193$ $Q \text{ кг.} = 0.323$ $D \text{ оп.мм} = 33$ $P \text{ н.мм} = 101.7$ $P \text{ вн.мм} = 87.9$ Гр. сл. = IV Точн. = П		БПЗ-1378 $F \text{ см}^2 = 1.06$ $Q \text{ кг.} = 0.287$ $D \text{ оп.мм} = 29$ $P \text{ н.мм} = 96.4$ $P \text{ вн.мм} = 67$ Гр. сл. = VI Точн. = П
	БПЗ-1374 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. =		БПЗ-1379 $F \text{ см}^2 = 1.078$ $Q \text{ кг.} = 0.292$ $D \text{ оп.мм} = 33$ $P \text{ н.мм} = 130.1$ $P \text{ вн.мм} = 39.4$ Гр. сл. = V Точн. = П
	БПЗ-1375 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. =		БПЗ-1380 $F \text{ см}^2 = 1.509$ $Q \text{ кг.} = 0.409$ $D \text{ оп.мм} = 40$ $P \text{ н.мм} = 120.7$ $P \text{ вн.мм} = 87.8$ Гр. сл. = VI Точн. = П

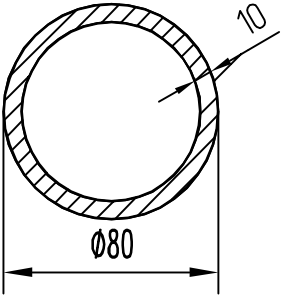
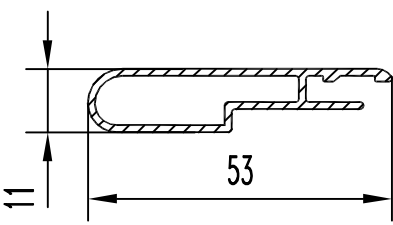
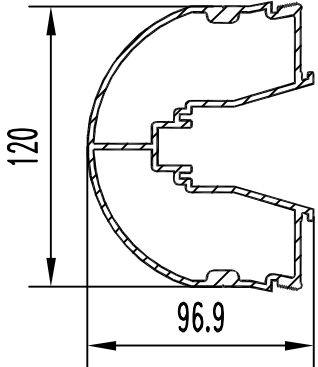
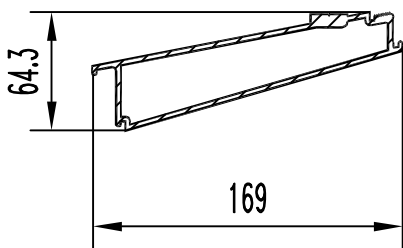
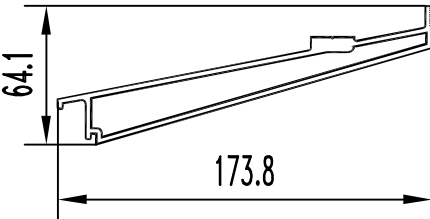
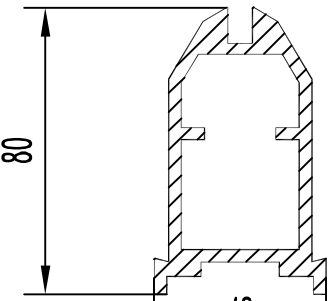
	БПЗ-1391		БПЗ-1396
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} =$		$F \text{ см}^2 = 8.765$ $Q \text{ кг.} = 2.375$ $D \text{ оп.мм} = 96$ $P \text{ н.мм} = 301.6$ $P \text{ вн.мм} = 282.7$ $\Gamma \text{ р. сл.} = V$ $\text{Точн.} = П$
	БПЗ-1392		БПЗ-1397
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} =$		$F \text{ см}^2 = 1.641$ $Q \text{ кг.} = 0.445$ $D \text{ оп.мм} = 40$ $P \text{ н.мм} = 193.7$ $P \text{ вн.мм} = 0$ $\Gamma \text{ р. сл.} = V$ $\text{Точн.} = П$
	БПЗ-1393		БПЗ-1398
	$F \text{ см}^2 = 4.7$ $Q \text{ кг.} = 1.274$ $D \text{ оп.мм} = 55.8$ $P \text{ н.мм} = 147.1$ $P \text{ вн.мм} = 139.2$ $\Gamma \text{ р. сл.} = \text{особая}$ $\text{Точн.} = П$		$F \text{ см}^2 = 1.004$ $Q \text{ кг.} = 0.272$ $D \text{ оп.мм} = 33.1$ $P \text{ н.мм} = 111.8$ $P \text{ вн.мм} = 47.1$ $\Gamma \text{ р. сл.} = IV$ $\text{Точн.} = П$
	БПЗ-1394		БПЗ-1399
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} =$		$F \text{ см}^2 = 5.972$ $Q \text{ кг.} = 1.62$ $D \text{ оп.мм} = 83.5$ $P \text{ н.мм} = 348$ $P \text{ вн.мм} = 163$ $\Gamma \text{ р. сл.} = \text{особая}$ $\text{Точн.} = П$
	БПЗ-1395		БПЗ-1400
	$F \text{ см}^2 = 2.268$ $Q \text{ кг.} = 0.615$ $D \text{ оп.мм} = 58$ $P \text{ н.мм} = 193.4$ $P \text{ вн.мм} = 109.3$ $\Gamma \text{ р. сл.} = IV$ $\text{Точн.} =$		$F \text{ см}^2 = 8.878$ $Q \text{ кг.} = 2.406$ $D \text{ оп.мм} = 80.5$ $P \text{ н.мм} = 213.2$ $P \text{ вн.мм} = 211.4$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} =$

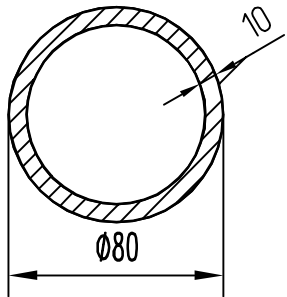
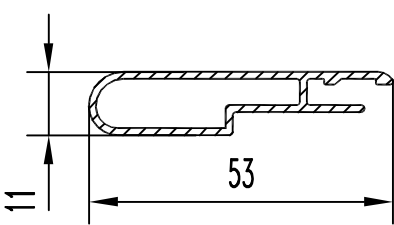
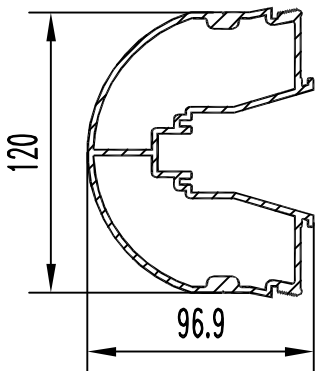
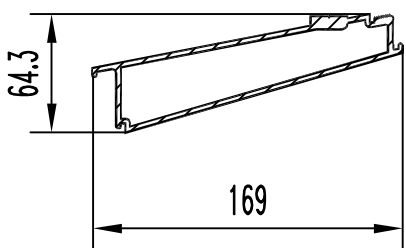
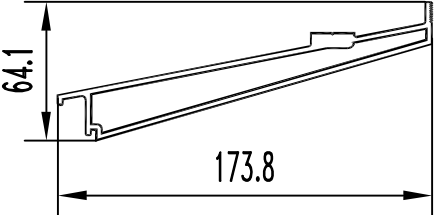
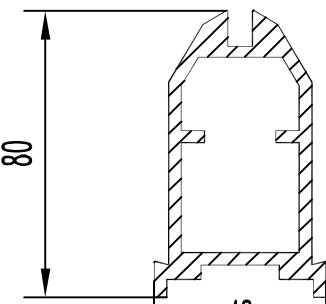
	БПЗ-1411 $F \text{ см}^2 = 7.296$ $Q \text{ кг.} = 1.977$ $D \text{ оп.мм} = 80$ $P \text{ н.мм} = 348.2$ $P \text{ в.мм} = 199$ Гр. сл. = IV Точн. = П		БПЗ-1416 $F \text{ см}^2 = 18.445$ $Q \text{ кг.} = 4.999$ $D \text{ оп.мм} = 190$ $P \text{ н.мм} = 593.5$ $P \text{ в.мм} = 349.7$ Гр. сл. = 0соб. Точн. = П
	БПЗ-1412 $F \text{ см}^2 = 4.577$ $Q \text{ кг.} = 1.24$ $D \text{ оп.мм} = 100$ $P \text{ н.мм} = 316.5$ $P \text{ в.мм} = 245$ Гр. сл. = 0соб. Точн. = П		БПЗ-1417 $F \text{ см}^2 = 2.391$ $Q \text{ кг.} = 0.648$ $D \text{ оп.мм} = 55$ $P \text{ н.мм} = 251.7$ $P \text{ в.мм} = 98.1$ Гр. сл. = VI Точн. = П
	БПЗ-1413 $F \text{ см}^2 = 6.16$ $Q \text{ кг.} = 1.669$ $D \text{ оп.мм} = 154$ $P \text{ н.мм} = 374.5$ $P \text{ в.мм} = 293.3$ Гр. сл. = 0соб. Точн. = П		БПЗ-1418 $F \text{ см}^2 = 1.778$ $Q \text{ кг.} = 0.482$ $D \text{ оп.мм} = 50.3$ $P \text{ н.мм} = 144.9$ $P \text{ в.мм} = 60.3$ Гр. сл. = V Точн. = П
	БПЗ-1414 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ в.мм} =$ Гр. сл. = Точн. =		БПЗ-1419 $F \text{ см}^2 = 8.888$ $Q \text{ кг.} = 2.406$ $D \text{ оп.мм} = 123$ $P \text{ н.мм} = 598$ $P \text{ в.мм} =$ Гр. сл. = VI Точн. = П
	БПЗ-1415 $F \text{ см}^2 = 2.16$ $Q \text{ кг.} = 0.585$ $D \text{ оп.мм} = 30$ $P \text{ н.мм} = 94.3$ $P \text{ в.мм} = 78.5$ Гр. сл. = IV Точн. = П		БПЗ-1420 $F \text{ см}^2 = 3.15$ $Q \text{ кг.} = 0.853$ $D \text{ оп.мм} = 103$ $P \text{ н.мм} = 214.7$ $P \text{ в.мм} = 249.9$ Гр. сл. = VI Точн. = П

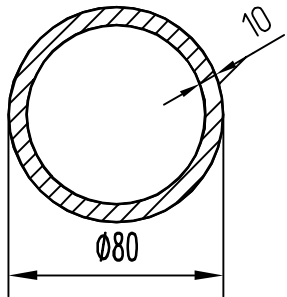
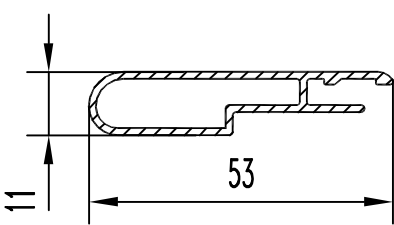
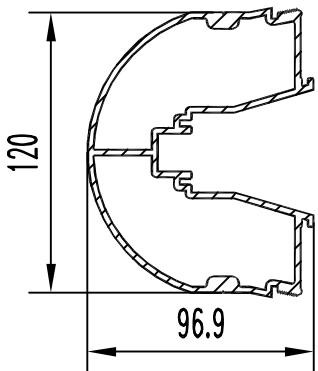
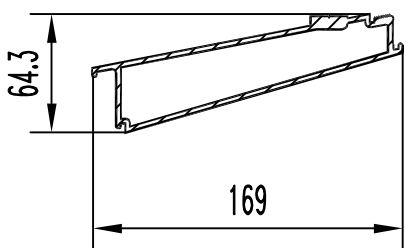
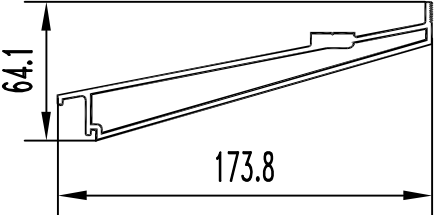
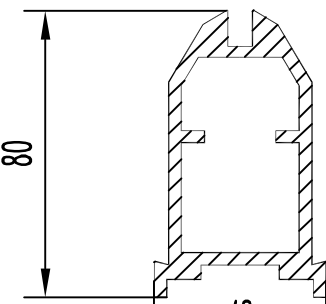
	БПЗ-1421		БПЗ-1426
	$F \text{ см}^2 = 22$ $Q \text{ кг.} = 5.962$ $D \text{ оп.мм} = 80$ $P \text{ н.мм} = 251.3$ $P \text{ вн.мм} = 188.5$ $\Gamma \text{ р. сл.} = \text{IV}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 1.41$ $Q \text{ кг.} = 0.382$ $D \text{ оп.мм} = 54$ $P \text{ н.мм} = 143.6$ $P \text{ вн.мм} = 84.1$ $\Gamma \text{ р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$
	БПЗ-1422		БПЗ-1427
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 14.98$ $Q \text{ кг.} = 4.06$ $D \text{ оп.мм} = 132$ $P \text{ н.мм} = 555.9$ $P \text{ вн.мм} = 520$ $\Gamma \text{ р. сл.} = \text{Особ}$ $\text{Точн.} = \text{П}$
	БПЗ-1423		БПЗ-1428
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 10.79$ $Q \text{ кг.} = 2.924$ $D \text{ оп.мм} = 169$ $P \text{ н.мм} = 433.4$ $P \text{ вн.мм} = 349.7$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} = \text{П}$
	БПЗ-1424		БПЗ-1429
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} =$		$F \text{ см}^2 = 10.48$ $Q \text{ кг.} = 2.84$ $D \text{ оп.мм} = 180.7$ $P \text{ н.мм} = 427.6$ $P \text{ вн.мм} = 343.8$ $\Gamma \text{ р. сл.} = \text{Особ}$ $\text{Точн.} = \text{П}$
	БПЗ-1425		БПЗ-1430
	$F \text{ см}^2 = 9.434$ $Q \text{ кг.} = 2.557$ $D \text{ оп.мм} = 88$ $P \text{ н.мм} = 276.2$ $P \text{ вн.мм} = 194.2$ $\Gamma \text{ р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 5.462$ $Q \text{ кг.} = 1.48$ $D \text{ оп.мм} = 35$ $P \text{ н.мм} = 110$ $P \text{ вн.мм} = 72.3$ $\Gamma \text{ р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$

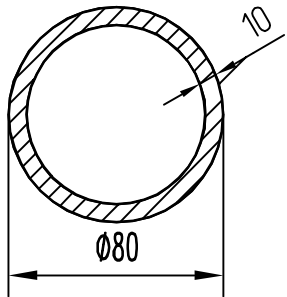
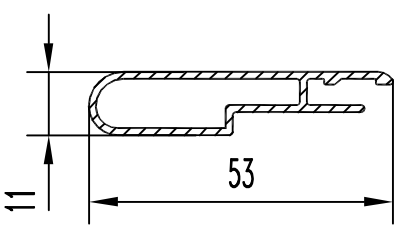
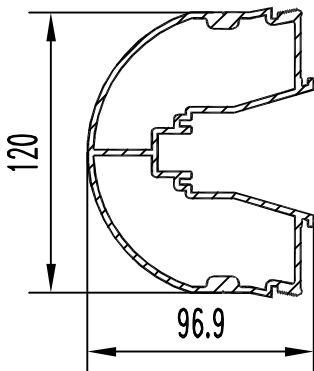
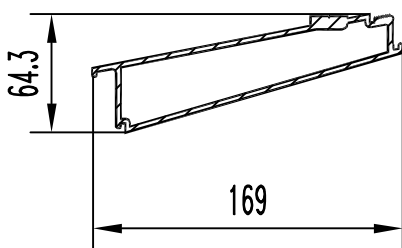
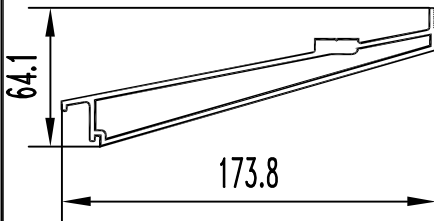
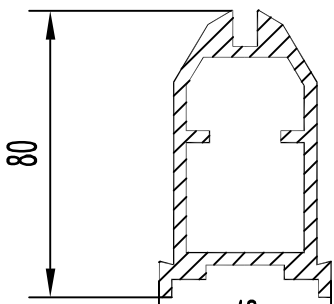
	БПЗ-1421 $F \text{ см}^2 = 22$ $Q \text{ кг.} = 5.962$ $D \text{ оп.мм} = 80$ $P \text{ н.мм} = 251.3$ $P \text{ вн.мм} = 188.5$ Гр. сл. = IV Точн. = П		БПЗ-1426 $F \text{ см}^2 = 1.41$ $Q \text{ кг.} = 0.382$ $D \text{ оп.мм} = 54$ $P \text{ н.мм} = 143.6$ $P \text{ вн.мм} = 84.1$ Гр. сл. = VI Точн. = П
	БПЗ-1422 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. = П		БПЗ-1427 $F \text{ см}^2 = 14.98$ $Q \text{ кг.} = 4.06$ $D \text{ оп.мм} = 132$ $P \text{ н.мм} = 555.9$ $P \text{ вн.мм} = 520$ Гр. сл. = Особ Точн. = П
	БПЗ-1423 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. = П		БПЗ-1428 $F \text{ см}^2 = 10.79$ $Q \text{ кг.} = 2.924$ $D \text{ оп.мм} = 169$ $P \text{ н.мм} = 433.4$ $P \text{ вн.мм} = 349.7$ Гр. сл. = Точн. = П
	БПЗ-1424 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. =		БПЗ-1429 $F \text{ см}^2 = 10.48$ $Q \text{ кг.} = 2.84$ $D \text{ оп.мм} = 180.7$ $P \text{ н.мм} = 427.6$ $P \text{ вн.мм} = 343.8$ Гр. сл. = Особ Точн. = П
	БПЗ-1425 $F \text{ см}^2 = 9.434$ $Q \text{ кг.} = 2.557$ $D \text{ оп.мм} = 88$ $P \text{ н.мм} = 276.2$ $P \text{ вн.мм} = 194.2$ Гр. сл. = VI Точн. = П		БПЗ-1430 $F \text{ см}^2 = 5.462$ $Q \text{ кг.} = 1.48$ $D \text{ оп.мм} = 35$ $P \text{ н.мм} = 110$ $P \text{ вн.мм} = 72.3$ Гр. сл. = VI Точн. = П

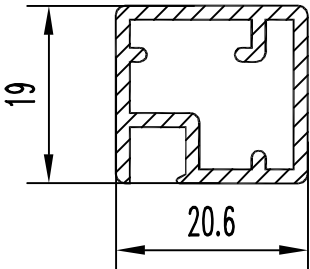
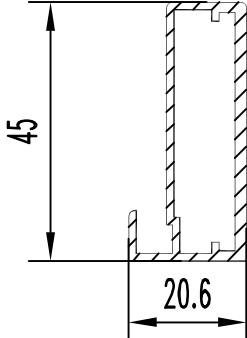
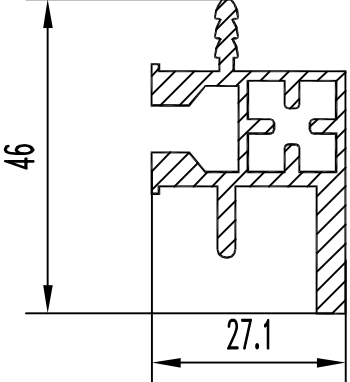
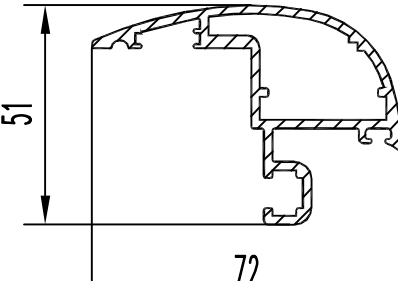
	БПЗ-1421 $F \text{ см}^2 = 22$ $Q \text{ кг.} = 5.962$ $D \text{ оп.мм} = 80$ $P \text{ н.мм} = 251.3$ $P \text{ вн.мм} = 188.5$ Гр. сл. = IV Точн. = П		БПЗ-1426 $F \text{ см}^2 = 1.41$ $Q \text{ кг.} = 0.382$ $D \text{ оп.мм} = 54$ $P \text{ н.мм} = 143.6$ $P \text{ вн.мм} = 84.1$ Гр. сл. = VI Точн. = П
	БПЗ-1422 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. = П		БПЗ-1427 $F \text{ см}^2 = 14.98$ $Q \text{ кг.} = 4.06$ $D \text{ оп.мм} = 132$ $P \text{ н.мм} = 555.9$ $P \text{ вн.мм} = 520$ Гр. сл. = Особ Точн. = П
	БПЗ-1423 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. = П		БПЗ-1428 $F \text{ см}^2 = 10.79$ $Q \text{ кг.} = 2.924$ $D \text{ оп.мм} = 169$ $P \text{ н.мм} = 433.4$ $P \text{ вн.мм} = 349.7$ Гр. сл. = Точн. = П
	БПЗ-1424 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. =		БПЗ-1429 $F \text{ см}^2 = 10.48$ $Q \text{ кг.} = 2.84$ $D \text{ оп.мм} = 180.7$ $P \text{ н.мм} = 427.6$ $P \text{ вн.мм} = 343.8$ Гр. сл. = Особ Точн. = П
	БПЗ-1425 $F \text{ см}^2 = 9.434$ $Q \text{ кг.} = 2.557$ $D \text{ оп.мм} = 88$ $P \text{ н.мм} = 276.2$ $P \text{ вн.мм} = 194.2$ Гр. сл. = VI Точн. = П		БПЗ-1430 $F \text{ см}^2 = 5.462$ $Q \text{ кг.} = 1.48$ $D \text{ оп.мм} = 35$ $P \text{ н.мм} = 110$ $P \text{ вн.мм} = 72.3$ Гр. сл. = VI Точн. = П

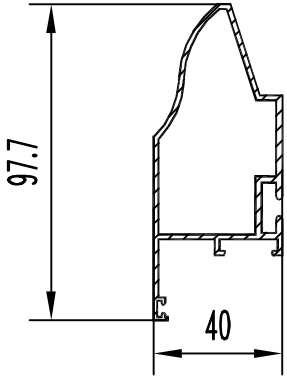
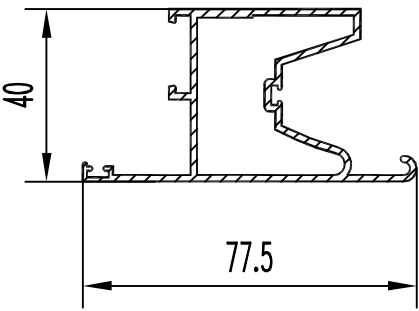
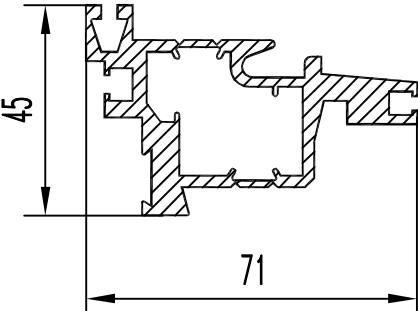
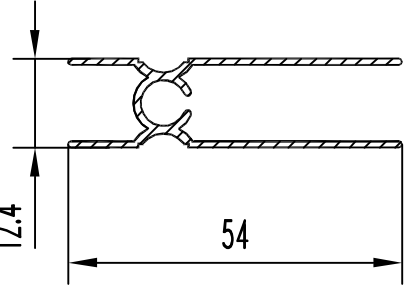
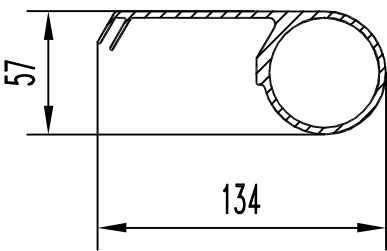
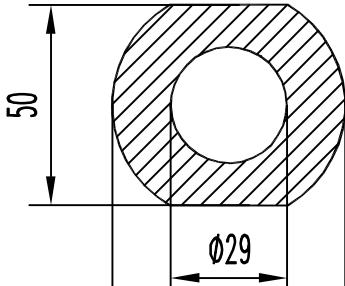
	БПЗ-1421 $F \text{ см}^2 = 22$ $Q \text{ кг.} = 5.962$ $D \text{ оп.мм} = 80$ $P \text{ н.мм} = 251.3$ $P \text{ вн.мм} = 188.5$ $\Gamma \text{ р. сл.} = \text{IV}$ $\text{Точн.} = \text{П}$		БПЗ-1426 $F \text{ см}^2 = 1.41$ $Q \text{ кг.} = 0.382$ $D \text{ оп.мм} = 54$ $P \text{ н.мм} = 143.6$ $P \text{ вн.мм} = 84.1$ $\Gamma \text{ р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$
	БПЗ-1422 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} = \text{П}$		БПЗ-1427 $F \text{ см}^2 = 14.98$ $Q \text{ кг.} = 4.06$ $D \text{ оп.мм} = 132$ $P \text{ н.мм} = 555.9$ $P \text{ вн.мм} = 520$ $\Gamma \text{ р. сл.} = \text{Особ}$ $\text{Точн.} = \text{П}$
	БПЗ-1423 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} = \text{П}$		БПЗ-1428 $F \text{ см}^2 = 10.79$ $Q \text{ кг.} = 2.924$ $D \text{ оп.мм} = 169$ $P \text{ н.мм} = 433.4$ $P \text{ вн.мм} = 349.7$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} = \text{П}$
	БПЗ-1424 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} =$		БПЗ-1429 $F \text{ см}^2 = 10.48$ $Q \text{ кг.} = 2.84$ $D \text{ оп.мм} = 180.7$ $P \text{ н.мм} = 427.6$ $P \text{ вн.мм} = 343.8$ $\Gamma \text{ р. сл.} = \text{Особ}$ $\text{Точн.} = \text{П}$
	БПЗ-1425 $F \text{ см}^2 = 9.434$ $Q \text{ кг.} = 2.557$ $D \text{ оп.мм} = 88$ $P \text{ н.мм} = 276.2$ $P \text{ вн.мм} = 194.2$ $\Gamma \text{ р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		БПЗ-1430 $F \text{ см}^2 = 5.462$ $Q \text{ кг.} = 1.48$ $D \text{ оп.мм} = 35$ $P \text{ н.мм} = 110$ $P \text{ вн.мм} = 72.3$ $\Gamma \text{ р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$

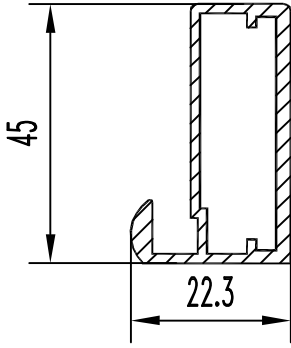
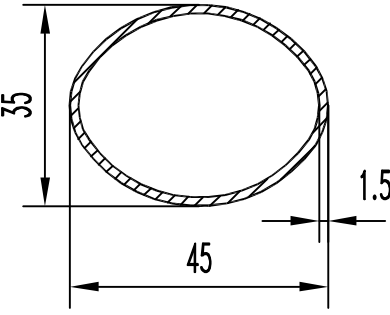
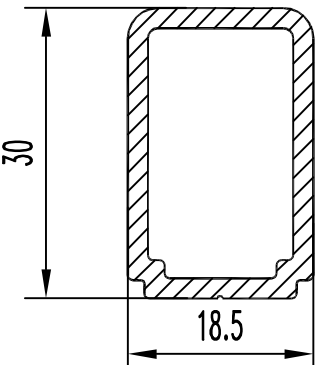
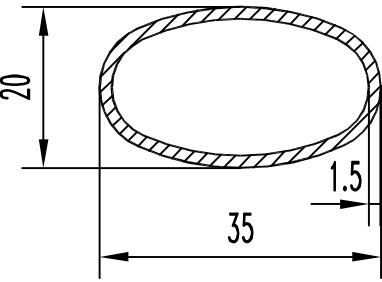
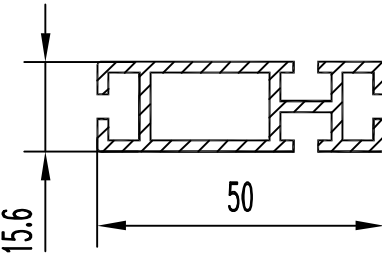
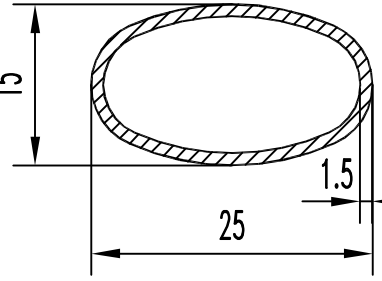
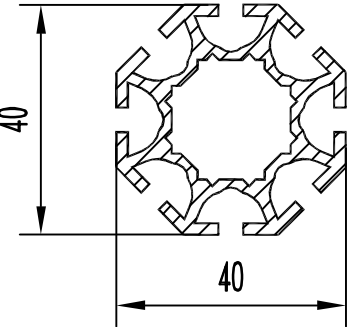
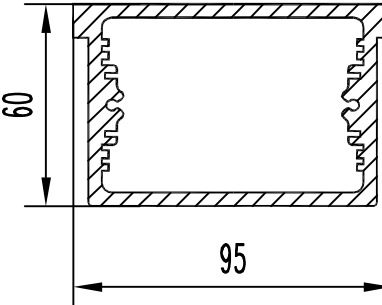
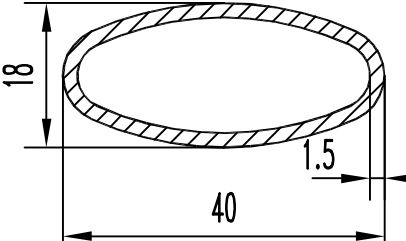
	БПЗ-1421		БПЗ-1426
	$F \text{ см}^2 = 22$ $Q \text{ кг.} = 5.962$ $D \text{ оп.мм} = 80$ $P \text{ н.мм} = 251.3$ $P \text{ вн.мм} = 188.5$ $\text{Гр. сл.} = \text{IV}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 1.41$ $Q \text{ кг.} = 0.382$ $D \text{ оп.мм} = 54$ $P \text{ н.мм} = 143.6$ $P \text{ вн.мм} = 84.1$ $\text{Гр. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$
	БПЗ-1422		БПЗ-1427
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\text{Гр. сл.} =$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 14.98$ $Q \text{ кг.} = 4.06$ $D \text{ оп.мм} = 132$ $P \text{ н.мм} = 555.9$ $P \text{ вн.мм} = 520$ $\text{Гр. сл.} = \text{Особ}$ $\text{Точн.} = \text{П}$
	БПЗ-1423		БПЗ-1428
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\text{Гр. сл.} =$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 10.79$ $Q \text{ кг.} = 2.924$ $D \text{ оп.мм} = 169$ $P \text{ н.мм} = 433.4$ $P \text{ вн.мм} = 349.7$ $\text{Гр. сл.} =$ $\text{Точн.} = \text{П}$
	БПЗ-1424		БПЗ-1429
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\text{Гр. сл.} =$ $\text{Точн.} =$		$F \text{ см}^2 = 10.48$ $Q \text{ кг.} = 2.84$ $D \text{ оп.мм} = 180.7$ $P \text{ н.мм} = 427.6$ $P \text{ вн.мм} = 343.8$ $\text{Гр. сл.} = \text{Особ}$ $\text{Точн.} = \text{П}$
	БПЗ-1425		БПЗ-1430
	$F \text{ см}^2 = 9.434$ $Q \text{ кг.} = 2.557$ $D \text{ оп.мм} = 88$ $P \text{ н.мм} = 276.2$ $P \text{ вн.мм} = 194.2$ $\text{Гр. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 5.462$ $Q \text{ кг.} = 1.48$ $D \text{ оп.мм} = 35$ $P \text{ н.мм} = 110$ $P \text{ вн.мм} = 72.3$ $\text{Гр. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$

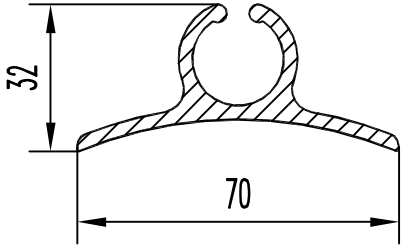
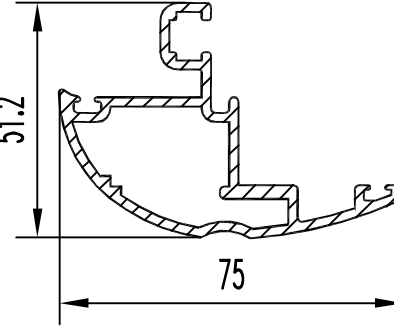
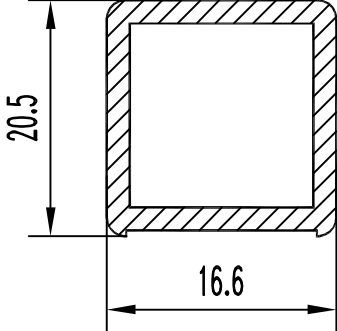
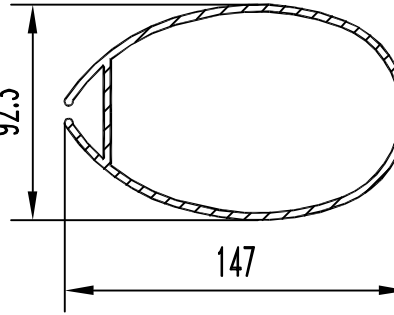
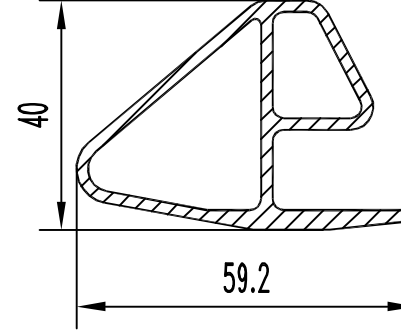
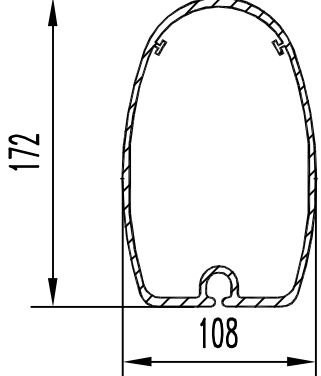
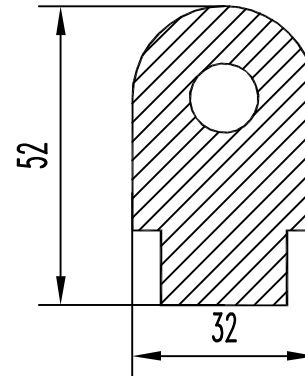
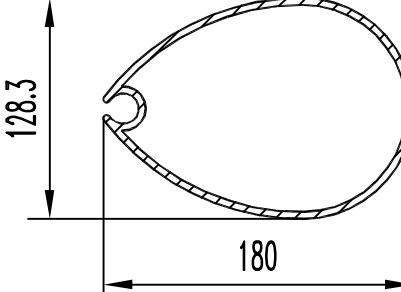
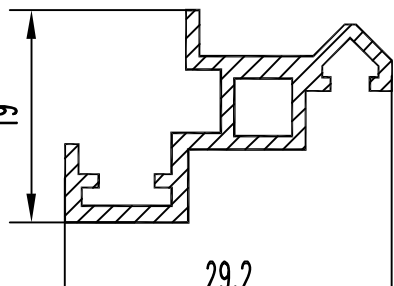
	БПЗ-1421		БПЗ-1426
	$F \text{ см}^2 = 22$ $Q \text{ кг.} = 5.962$ $D \text{ оп.мм} = 80$ $P \text{ н.мм} = 251.3$ $P \text{ вн.мм} = 188.5$ $\text{Гр. сл.} = \text{IV}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 1.41$ $Q \text{ кг.} = 0.382$ $D \text{ оп.мм} = 54$ $P \text{ н.мм} = 143.6$ $P \text{ вн.мм} = 84.1$ $\text{Гр. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$
	БПЗ-1422		БПЗ-1427
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\text{Гр. сл.} =$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 14.98$ $Q \text{ кг.} = 4.06$ $D \text{ оп.мм} = 132$ $P \text{ н.мм} = 555.9$ $P \text{ вн.мм} = 520$ $\text{Гр. сл.} = \text{Особ}$ $\text{Точн.} = \text{П}$
	БПЗ-1423		БПЗ-1428
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\text{Гр. сл.} =$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 10.79$ $Q \text{ кг.} = 2.924$ $D \text{ оп.мм} = 169$ $P \text{ н.мм} = 433.4$ $P \text{ вн.мм} = 349.7$ $\text{Гр. сл.} =$ $\text{Точн.} = \text{П}$
	БПЗ-1424		БПЗ-1429
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\text{Гр. сл.} =$ $\text{Точн.} =$		$F \text{ см}^2 = 10.48$ $Q \text{ кг.} = 2.84$ $D \text{ оп.мм} = 180.7$ $P \text{ н.мм} = 427.6$ $P \text{ вн.мм} = 343.8$ $\text{Гр. сл.} = \text{Особ}$ $\text{Точн.} = \text{П}$
	БПЗ-1425		БПЗ-1430
	$F \text{ см}^2 = 9.434$ $Q \text{ кг.} = 2.557$ $D \text{ оп.мм} = 88$ $P \text{ н.мм} = 276.2$ $P \text{ вн.мм} = 194.2$ $\text{Гр. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 5.462$ $Q \text{ кг.} = 1.48$ $D \text{ оп.мм} = 35$ $P \text{ н.мм} = 110$ $P \text{ вн.мм} = 72.3$ $\text{Гр. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$

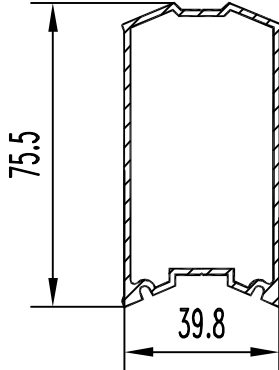
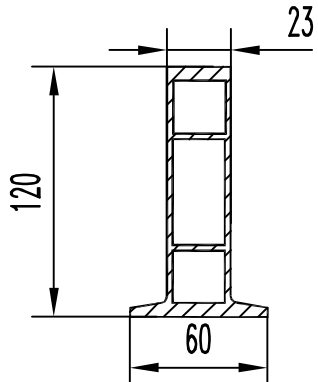
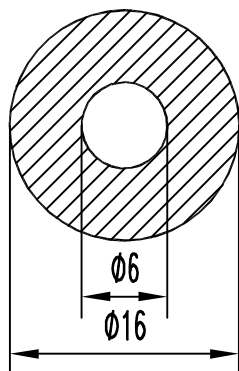
	БПЗ-1421		БПЗ-1426
	$F \text{ см}^2 = 22$ $Q \text{ кг.} = 5.962$ $D \text{ оп.мм} = 80$ $P \text{ н.мм} = 251.3$ $P \text{ вн.мм} = 188.5$ $\text{Гр. сл.} = \text{IV}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 1.41$ $Q \text{ кг.} = 0.382$ $D \text{ оп.мм} = 54$ $P \text{ н.мм} = 143.6$ $P \text{ вн.мм} = 84.1$ $\text{Гр. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$
	БПЗ-1422		БПЗ-1427
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\text{Гр. сл.} =$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 14.98$ $Q \text{ кг.} = 4.06$ $D \text{ оп.мм} = 132$ $P \text{ н.мм} = 555.9$ $P \text{ вн.мм} = 520$ $\text{Гр. сл.} = \text{Особ}$ $\text{Точн.} = \text{П}$
	БПЗ-1423		БПЗ-1428
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\text{Гр. сл.} =$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 10.79$ $Q \text{ кг.} = 2.924$ $D \text{ оп.мм} = 169$ $P \text{ н.мм} = 433.4$ $P \text{ вн.мм} = 349.7$ $\text{Гр. сл.} =$ $\text{Точн.} = \text{П}$
	БПЗ-1424		БПЗ-1429
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\text{Гр. сл.} =$ $\text{Точн.} =$		$F \text{ см}^2 = 10.48$ $Q \text{ кг.} = 2.84$ $D \text{ оп.мм} = 180.7$ $P \text{ н.мм} = 427.6$ $P \text{ вн.мм} = 343.8$ $\text{Гр. сл.} = \text{Особ}$ $\text{Точн.} = \text{П}$
	БПЗ-1425		БПЗ-1430
	$F \text{ см}^2 = 9.434$ $Q \text{ кг.} = 2.557$ $D \text{ оп.мм} = 88$ $P \text{ н.мм} = 276.2$ $P \text{ вн.мм} = 194.2$ $\text{Гр. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 5.462$ $Q \text{ кг.} = 1.48$ $D \text{ оп.мм} = 35$ $P \text{ н.мм} = 110$ $P \text{ вн.мм} = 72.3$ $\text{Гр. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$

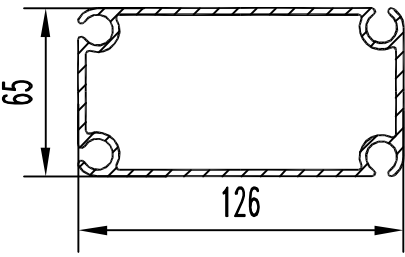
	БПЗ-1431		БПЗ-1436
	$F \text{ см}^2 = 1.33$ $Q \text{ кг.} = 0.36$ $D \text{ оп.мм} = 27.2$ $P \text{ н.мм} = 90.9$ $P \text{ вн.мм} = 84.6$ Гр. сл. = V Точн. = П		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. = П
	БПЗ-1432		БПЗ-1437
	$F \text{ см}^2 = 2.03$ $Q \text{ кг.} = 0.55$ $D \text{ оп.мм} = 49$ $P \text{ н.мм} = 146.9$ $P \text{ вн.мм} = 112$ Гр. сл. = VI Точн. = П		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. = П
	БПЗ-1433		БПЗ-1438
	$F \text{ см}^2 = 3.27$ $Q \text{ кг.} = 0.886$ $D \text{ оп.мм} = 49.2$ $P \text{ н.мм} = 206.3$ $P \text{ вн.мм} = 78.3$ Гр. сл. = Особ Точн. = П		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. = П
	БПЗ-1434		БПЗ-1439
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. =		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. = П
	БПЗ-1435		БПЗ-1440
	$F \text{ см}^2 = 4.44$ $Q \text{ кг.} = 1.203$ $D \text{ оп.мм} = 76.1$ $P \text{ н.мм} = 302.5$ $P \text{ вн.мм} = 128.9$ Гр. сл. = Особ		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. =

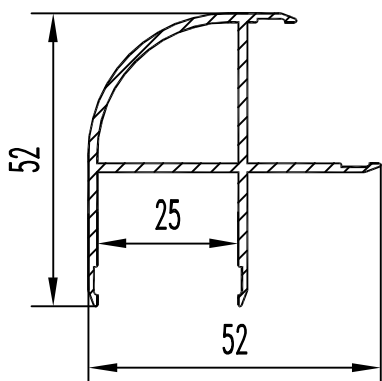
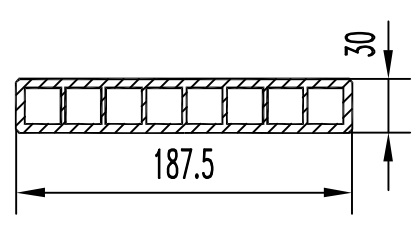
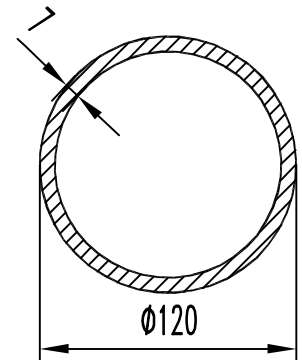
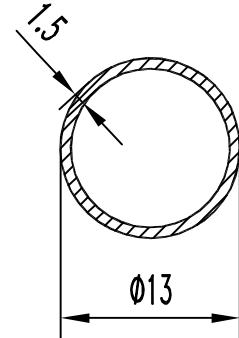
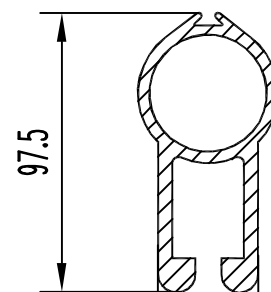
	БПЗ-1441 $F \text{ см}^2 = 1.4.161$ $Q \text{ кг.} = 1.128$ $D \text{ оп.мм} = 101$ $P \text{ н.мм} = 327$ $P \text{ вн.мм} = 191$ Гр. сл. = VI Точн. = П		БПЗ-1446 $F \text{ см}^2 = 24.875$ $Q \text{ кг.} = 6.741$ $D \text{ оп.мм} = 156$ $P \text{ н.мм} = 1474.8$ $P \text{ вн.мм} = 362.9$ Гр. сл. = 0соб. Точн. = П
	БПЗ-1442 $F \text{ см}^2 = 3.68$ $Q \text{ кг.} = 0.997$ $D \text{ оп.мм} = 80.7$ $P \text{ н.мм} = 319.7$ $P \text{ вн.мм} = 170.9$ Гр. сл. = VI Точн. = П		БПЗ-1447 $F \text{ см}^2 = 7.061$ $Q \text{ кг.} = 1.914$ $D \text{ оп.мм} = 65.4$ $P \text{ н.мм} = 323$ $P \text{ вн.мм} = 138.5$ Гр. сл. = 0соб. Точн. = П
	БПЗ-1443 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. = П		БПЗ-1448 $F \text{ см}^2 = 1.4$ $Q \text{ кг.} = 0.38$ $D \text{ оп.мм} = 56$ $P \text{ н.мм} = 243.7$ $P \text{ вн.мм} =$ Гр. сл. = IV Точн. = П
	БПЗ-1444 $F \text{ см}^2 = 9.35$ $Q \text{ кг.} = 2.534$ $D \text{ оп.мм} = 135$ $P \text{ н.мм} = 398.8$ $P \text{ вн.мм} = 160.2$ Гр. сл. = VI Точн. = П		БПЗ-1449 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. = П
	БПЗ-1445 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. = П		БПЗ-1450 $F \text{ см}^2 = 18.225$ $Q \text{ кг.} = 4.939$ $D \text{ оп.мм} = 58$ $P \text{ н.мм} = 179.4$ $P \text{ вн.мм} = 91.1$ Гр. сл. = III Точн. = П

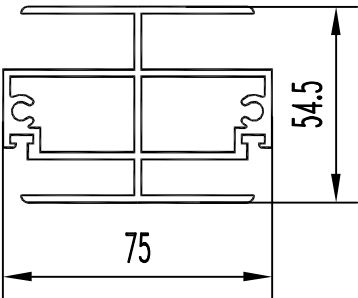
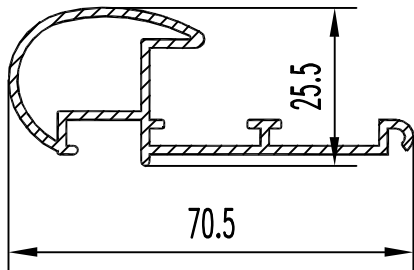
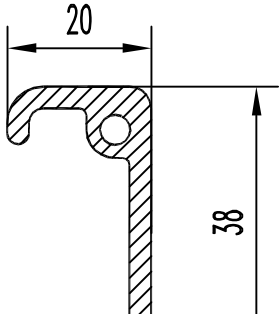
	БПЗ-1451 $F \text{ см}^2 = 2.13$ $Q \text{ кг.} = 0.577$ $D \text{ оп.мм} = 49$ $P \text{ н.мм} = 147.7$ $P \text{ в.мм} = 111.4$ Гр. сл. = VI Точн. = П		БПЗ-1456 $F \text{ см}^2 = 1.9$ $Q \text{ кг.} = 0.515$ $D \text{ оп.мм} = 46$ $P \text{ н.мм} = 124.7$ $P \text{ в.мм} = 115.3$ Гр. сл. = IV Точн. = П
	БПЗ-1452 $F \text{ см}^2 = 1.744$ $Q \text{ кг.} = 0.473$ $D \text{ оп.мм} = 34$ $P \text{ н.мм} = 93.6$ $P \text{ в.мм} = 78.9$ Гр. сл. = V Точн. = П		БПЗ-1457 $F \text{ см}^2 = 1.27$ $Q \text{ кг.} = 0.344$ $D \text{ оп.мм} = 36$ $P \text{ н.мм} = 89.4$ $P \text{ в.мм} = 80$ Гр. сл. = IV Точн. = П
	БПЗ-1453 $F \text{ см}^2 = 2.875$ $Q \text{ кг.} = 0.779$ $D \text{ оп.мм} = 51$ $P \text{ н.мм} = 237.4$ $P \text{ в.мм} = 65.2$ Гр. сл. = V Точн. = П		БПЗ-1458 $F \text{ см}^2 = 0.899$ $Q \text{ кг.} = 0.244$ $D \text{ оп.мм} = 26$ $P \text{ н.мм} = 64.6$ $P \text{ в.мм} = 56.2$ Гр. сл. = IV Точн. = П
	БПЗ-1454 $F \text{ см}^2 = 4.286$ $Q \text{ кг.} = 1.161$ $D \text{ оп.мм} = 44$ $P \text{ н.мм} = 351.1$ $P \text{ в.мм} = 83.9$ Гр. сл. = V Точн. = П		БПЗ-1459 $F \text{ см}^2 = 14.28$ $Q \text{ кг.} = 3.87$ $D \text{ оп.мм} = 109$ $P \text{ н.мм} = 309$ $P \text{ в.мм} = 352$ Гр. сл. = VI Точн. = П
	БПЗ-1455 $F \text{ см}^2 = 1.36$ $Q \text{ кг.} = 0.369$ $D \text{ оп.мм} = 41$ $P \text{ н.мм} = 95.4$ $P \text{ в.мм} = 86$ Гр. сл. = IV		БПЗ-1460 $F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ в.мм} =$ Гр. сл. =

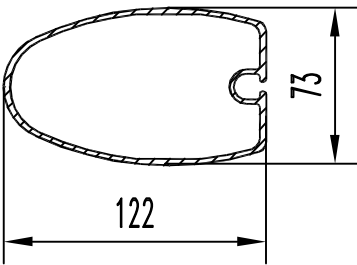
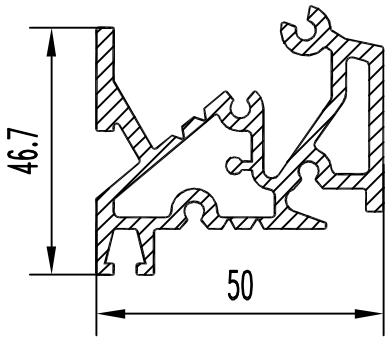
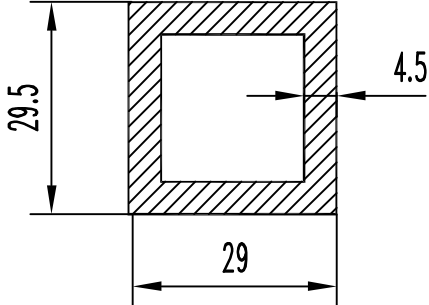
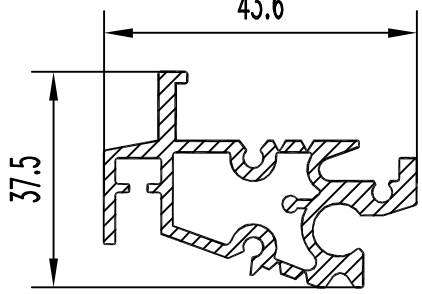
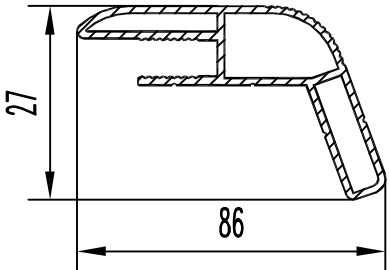
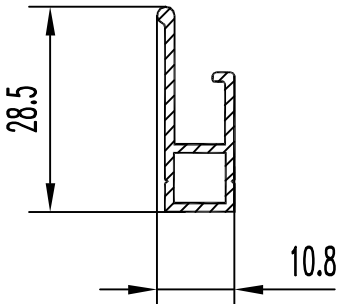
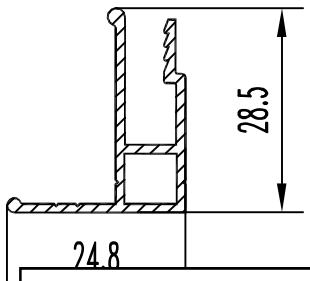
	БПЗ-1461 $F \text{ см}^2 = 4.092$ $Q \text{ кг.} = 1.109$ $D \text{ оп.мм} = 70$ $P \text{ н.мм} = 241.1$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} = V$ $\text{Точн.} = П$		БПЗ-1466 $F \text{ см}^2 = 4.743$ $Q \text{ кг.} = 1.285$ $D \text{ оп.мм} = 79$ $P \text{ н.мм} = 308.2$ $P \text{ вн.мм} = 137.6$ $\Gamma \text{ р. сл.} = VI$ $\text{Точн.} = П$
	БПЗ-1462 $F \text{ см}^2 = 1.435$ $Q \text{ кг.} = 0.389$ $D \text{ оп.мм} = 28$ $P \text{ н.мм} = 79.3$ $P \text{ вн.мм} = 64$ $\Gamma \text{ р. сл.} = V$ $\text{Точн.} = П$		БПЗ-1467 $F \text{ см}^2 = 12.2$ $Q \text{ кг.} = 3.306$ $D \text{ оп.мм} = 145$ $P \text{ н.мм} = 464.1$ $P \text{ вн.мм} = 348.3$ $\Gamma \text{ р. сл.} = \text{Особ.}$ $\text{Точн.} = П$
	БПЗ-1463 $F \text{ см}^2 = 4.129$ $Q \text{ кг.} = 1.119$ $D \text{ оп.мм} = 62$ $P \text{ н.мм} = 196.1$ $P \text{ вн.мм} = 164.2$ $\Gamma \text{ р. сл.} = \text{Особ.}$ $\text{Точн.} = П$		БПЗ-1468 $F \text{ см}^2 = 0.899$ $Q \text{ кг.} = 0.244$ $D \text{ оп.мм} = 26$ $P \text{ н.мм} = 64.6$ $P \text{ вн.мм} = 56.2$ $\Gamma \text{ р. сл.} = IV$ $\text{Точн.} = П$
	БПЗ-1464 $F \text{ см}^2 = 19.55$ $Q \text{ кг.} = 5.298$ $D \text{ оп.мм} = 172$ $P \text{ н.мм} = 525.2$ $P \text{ вн.мм} = 520.3$ $\Gamma \text{ р. сл.} = \text{Особ.}$ $\text{Точн.} = П$		БПЗ-1469 $F \text{ см}^2 = 13.11$ $Q \text{ кг.} = 3.553$ $D \text{ оп.мм} = 55$ $P \text{ н.мм} = 154.3$ $P \text{ вн.мм} = 37.7$ $\Gamma \text{ р. сл.} = IV$ $\text{Точн.} = П$
	БПЗ-1465 $F \text{ см}^2 = 20.154$ $Q \text{ кг.} = 5.462$ $D \text{ оп.мм} = 180$ $P \text{ н.мм} = 529$ $P \text{ вн.мм} = 470$ $\Gamma \text{ р. сл.} = \text{Особ.}$ $\text{Точн.} = П$		БПЗ-1470 $F \text{ см}^2 = 1.061$ $Q \text{ кг.} = 0.287$ $D \text{ оп.мм} = 33$ $P \text{ н.мм} = 131$ $P \text{ вн.мм} = 20.8$ $\Gamma \text{ р. сл.} = VI$ $\text{Точн.} = П$

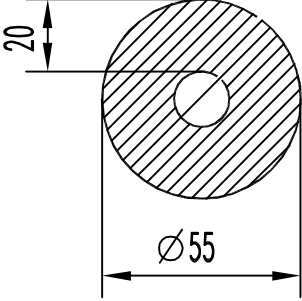
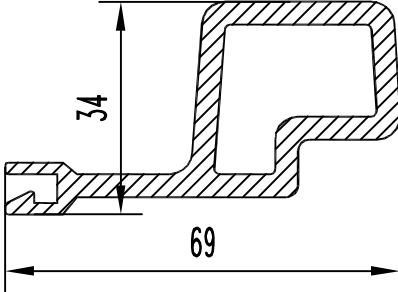
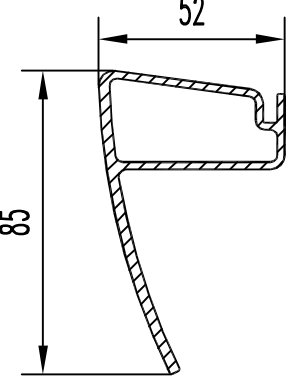
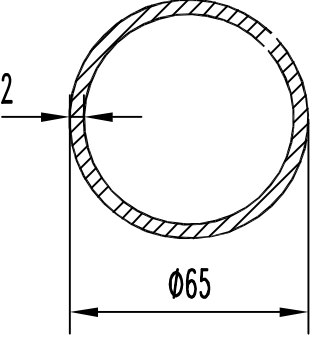
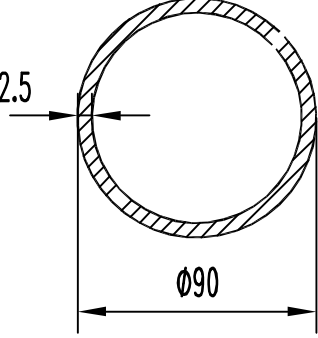
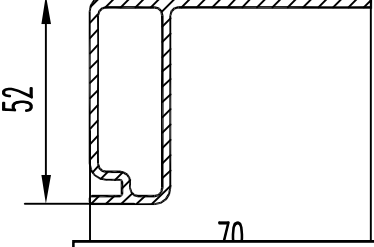
	БПЗ-1471		БПЗ-1476
	$F \text{ см}^2 = 3.565$ $Q \text{ кг.} = 0.966$ $D \text{ оп.мм} = 82$ $P \text{ н.мм} = 240.2$ $P \text{ вн.мм} = 210.4$ $\text{Гр. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\text{Гр. сл.} =$ $\text{Точн.} = \text{П}$
	БПЗ-1472		БПЗ-1477
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\text{Гр. сл.} =$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\text{Гр. сл.} =$ $\text{Точн.} = \text{П}$
	БПЗ-1473		БПЗ-1478
	$F \text{ см}^2 = 11.61$ $Q \text{ кг.} = 3.146$ $D \text{ оп.мм} = 125$ $P \text{ н.мм} = 353.6$ $P \text{ вн.мм} = 344$ $\text{Гр. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\text{Гр. сл.} =$ $\text{Точн.} = \text{П}$
	БПЗ-1474		БПЗ-1479
	$F \text{ см}^2 = 1.928$ $Q \text{ кг.} = 0.522$ $D \text{ оп.мм} = 16$ $P \text{ н.мм} = 50.3$ $P \text{ вн.мм} = 18.9$ $\text{Гр. сл.} = \text{III}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\text{Гр. сл.} =$ $\text{Точн.} = \text{П}$
	БПЗ-1475		БПЗ-1480
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$

	БПЗ-1481		БПЗ-1486
	F см ² = Q кг. = D оп.мм= P н.мм = P вн.мм= Гр. сл. = Точн. = П		F см ² = 11.377 Q кг. = 3.08 D оп.мм= 138 P н.мм =491.7 P вн.мм= 349.2 Гр. сл. = 0соб. Точн. = П
	БПЗ-1482		БПЗ-1487
	F см ² = Q кг. = D оп.мм= P н.мм = P вн.мм= Гр. сл. = Точн. = П		F см ² = Q кг. = D оп.мм= P н.мм = P вн.мм= Гр. сл. = Точн. = П
	БПЗ-1483		БПЗ-1488
	F см ² = Q кг. = D оп.мм= P н.мм = P вн.мм= Гр. сл. = Точн. = П		F см ² = Q кг. = D оп.мм= P н.мм = P вн.мм= Гр. сл. = Точн. = П
	БПЗ-1484		БПЗ-1489
	F см ² = Q кг. = D оп.мм= P н.мм = P вн.мм= Гр. сл. = Точн. = П		F см ² = Q кг. = D оп.мм= P н.мм = P вн.мм= Гр. сл. = Точн. = П
	БПЗ-1485		БПЗ-1490
	F см ² = Q кг. = D оп.мм= P н.мм = P вн.мм= Гр. сл. = Точн. = П		F см ² = Q кг. = D оп.мм= P н.мм = P вн.мм= Гр. сл. = Точн. = П

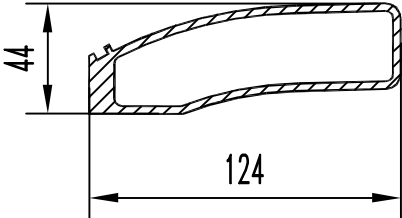
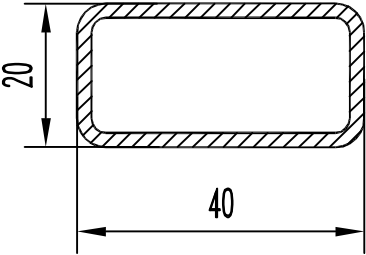
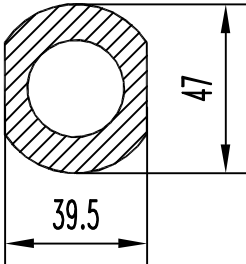
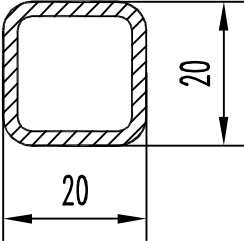
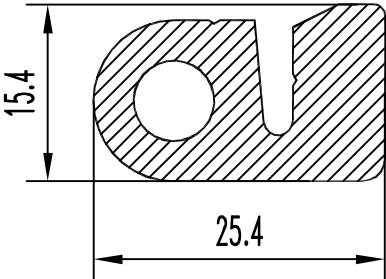
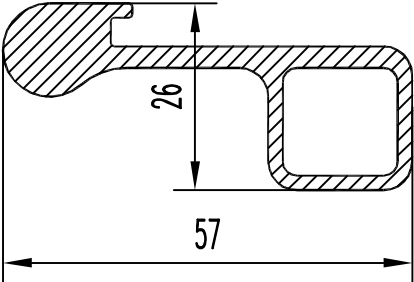
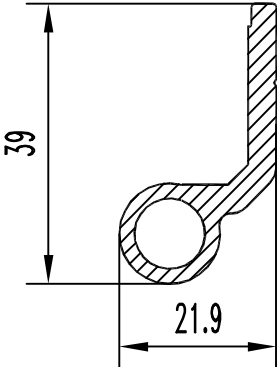
	БПЗ-1491		БПЗ-1496
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} = \Pi$		$F \text{ см}^2 = 2.64$ $Q \text{ кг.} = 0.715$ $D \text{ оп.мм} = 63$ $P \text{ н.мм} = 275$ $P \text{ вн.мм} = 89.9$ $\Gamma \text{ р. сл.} = V$ $\text{Точн.} = \Pi$
	БПЗ-1492		БПЗ-1497
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} = \Pi$		$F \text{ см}^2 = 24.17$ $Q \text{ кг.} = 6.55$ $D \text{ оп.мм} = 190$ $P \text{ н.мм} = 430.3$ $P \text{ вн.мм} = 640$ $\Gamma \text{ р. сл.} = \text{Особ.}$ $\text{Точн.} = \Pi$
	БПЗ-1493		БПЗ-1498
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} = \Pi$		$F \text{ см}^2 = 24.85$ $Q \text{ кг.} = 6.374$ $D \text{ оп.мм} = 120$ $P \text{ н.мм} = 377$ $P \text{ вн.мм} = 333$ $\Gamma \text{ р. сл.} = IV$ $\text{Точн.} = \Pi$
	БПЗ-1494		БПЗ-1499
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ $\Gamma \text{ р. сл.} =$ $\text{Точн.} = \Pi$		$F \text{ см}^2 = 0.542$ $Q \text{ кг.} = 0.147$ $D \text{ оп.мм} = 13$ $P \text{ н.мм} = 40$ $P \text{ вн.мм} = 31.4$ $\Gamma \text{ р. сл.} = III$ $\text{Точн.} = \Pi$
	БПЗ-1495		БПЗ-1500
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$		$F \text{ см}^2 = 12.548$ $Q \text{ кг.} = 3.4$ $D \text{ оп.мм} = 100$ $P \text{ н.мм} = 387$ $P \text{ вн.мм} = 129$

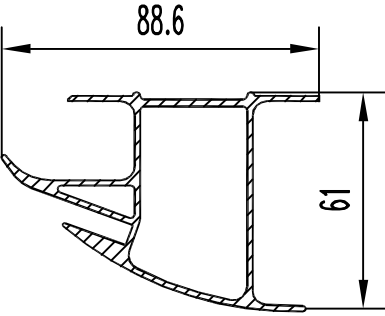
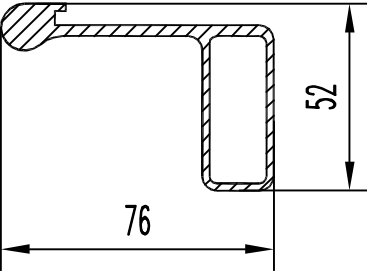
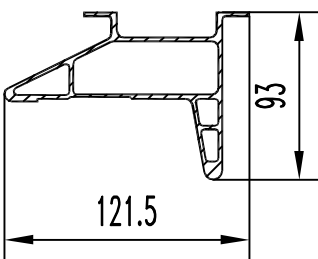
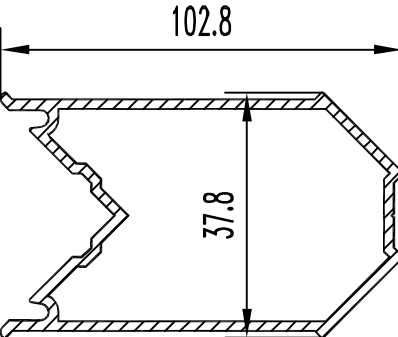
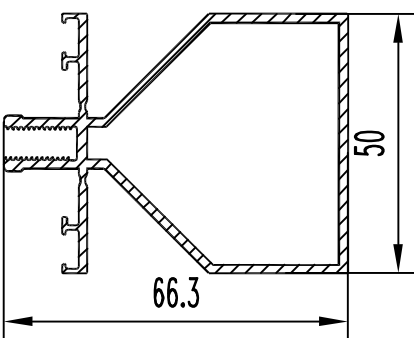
	БПЗ-1501		БПЗ-1506
	$F \text{ см}^2 = 15.49$ $Q \text{ кг.} = 4.19$ $D \text{ оп.мм} = 88$ $P \text{ н.мм} = 179.4$ $P \text{ вн.мм} = 108.4$ Гр. сл. = III Точн. = Н		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм} = 0$ $P \text{ н.мм} = 0$ $P \text{ вн.мм} = 0$ Гр. сл. = Точн. = П
	БПЗ-1502		БПЗ-1507
	$F \text{ см}^2 = 8.26$ $Q \text{ кг.} = 2.24$ $D \text{ оп.мм} = 88$ $P \text{ н.мм} = 532.7$ $P \text{ вн.мм} = 248$ Гр. сл. = особая Точн. = П		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. = П
	БПЗ-1503		БПЗ-1508
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. = П		$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. = П
	БПЗ-1504		БПЗ-1509
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$ Гр. сл. = Точн. = П		$F \text{ см}^2 = 2.592$ $Q \text{ кг.} = 0.702$ $D \text{ оп.мм} = 72$ $P \text{ н.мм} = 250.7$ $P \text{ вн.мм} = 90.7$ Гр. сл. = VI Точн. = П
	БПЗ-1505		БПЗ-1510
	$F \text{ см}^2 =$ $Q \text{ кг.} =$ $D \text{ оп.мм} =$ $P \text{ н.мм} =$ $P \text{ вн.мм} =$		$F \text{ см}^2 = 1.99$ $Q \text{ кг.} = 0.539$ $D \text{ оп.мм} = 42$ $P \text{ н.мм} = 117.6$ $P \text{ вн.мм} = 126$

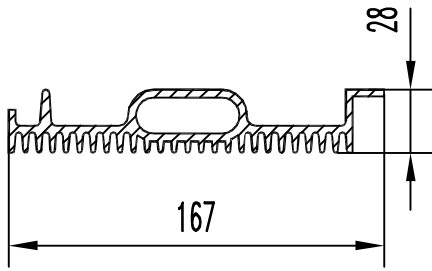
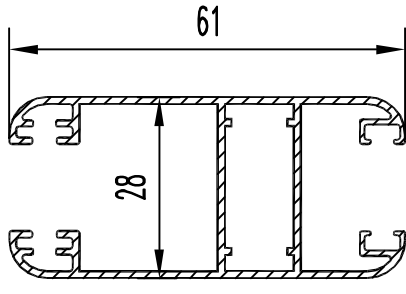
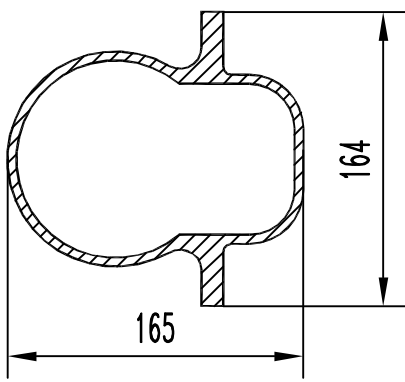
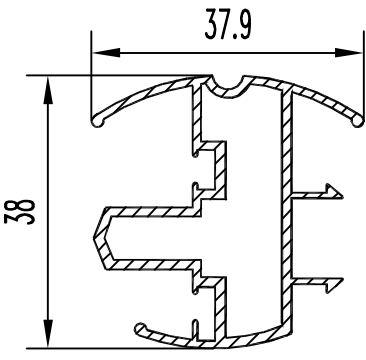
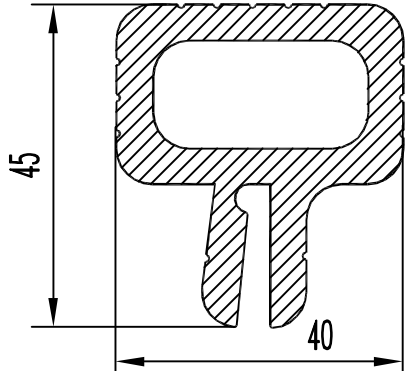
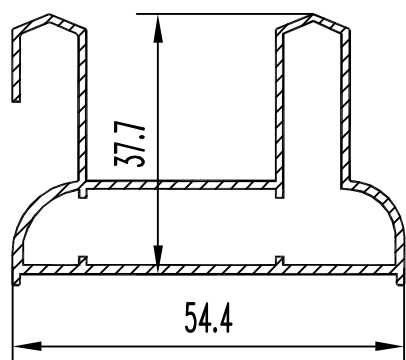
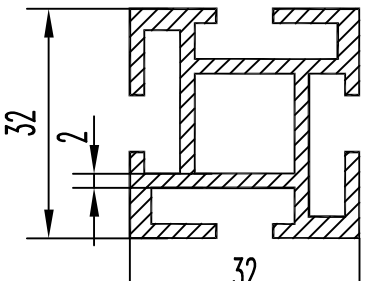
	БПЗ-1511 $F \text{ см}^2 = 8.827$ $Q \text{ кг.} = 2.392$ $D \text{ оп.мм} = 130$ $P \text{ н.мм} = 337$ $P \text{ вн.мм} = 108.4$ Гр. сл. = особая Точн. = П		БПЗ-1516 $F \text{ см}^2 = 5.934$ $Q \text{ кг.} = 1.608$ $D \text{ оп.мм} = 63$ $P \text{ н.мм} = 314.1$ $P \text{ вн.мм} = 145.2$ Гр. сл. = особая Точн. = П
	БПЗ-1512 $F \text{ см}^2 = 4.46$ $Q \text{ кг.} = 1.209$ $D \text{ оп.мм} = 43$ $P \text{ н.мм} = 117$ $P \text{ вн.мм} = 81$ Гр. сл. = IV Точн. = П		БПЗ-1517 $F \text{ см}^2 = 4.51$ $Q \text{ кг.} = 1.222$ $D \text{ оп.мм} = 57$ $P \text{ н.мм} = 285.6$ $P \text{ вн.мм} = 107.7$ Гр. сл. = особая Точн. = П
	БПЗ-1513 $F \text{ см}^2 = 5.503$ $Q \text{ кг.} = 1.491$ $D \text{ оп.мм} = 96$ $P \text{ н.мм} = 295.9$ $P \text{ вн.мм} = 248.4$ Гр. сл. = особая Точн. = П		БПЗ-1518
	БПЗ-1514 $F \text{ см}^2 = 0.82$ $Q \text{ кг.} = 0.222$ $D \text{ оп.мм} = 31$ $P \text{ н.мм} = 100.2$ $P \text{ вн.мм} = 28.6$ Гр. сл. = VI Точн. = П		БПЗ-1519
	БПЗ-1515 $F \text{ см}^2 = 1.11$ $Q \text{ кг.} = 0.3$ $D \text{ оп.мм} = 36$ $P \text{ н.мм} = 147.6$ $P \text{ вн.мм} = 28.6$		БПЗ-1520 2

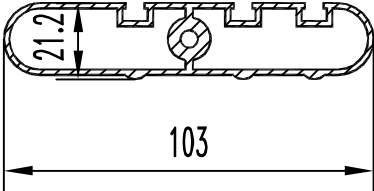
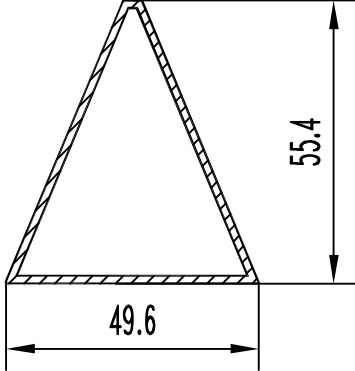
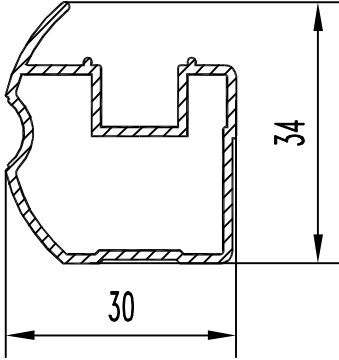
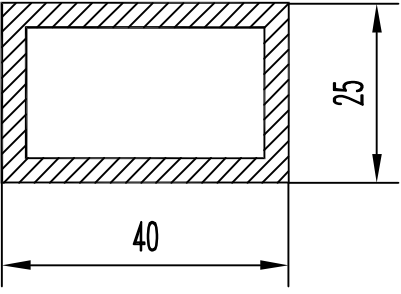
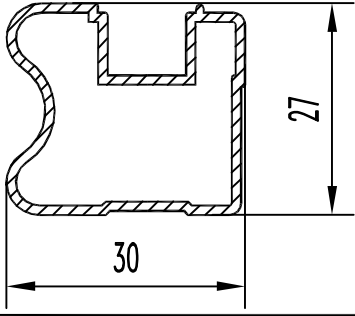
	БПЗ-1521		БПЗ-1526
	$F \text{ см}^2 = 21.99$ $Q \text{ кг.} = 5.96$ $D \text{ оп.мм} = 55$ $P \text{ н.мм} = 172.8$ $P \text{ вн.мм} = 47.1$ Гр. сл. = IV Точн. = П		$F \text{ см}^2 = 6.24$ $Q \text{ кг.} = 1.691$ $D \text{ оп.мм} = 77$ $P \text{ н.мм} = 221.3$ $P \text{ вн.мм} = 102.2$ Гр. сл. = VI Точн. = П
	БПЗ-1522		БПЗ-1527
			$F \text{ см}^2 = 4.99$ $Q \text{ кг.} = 1.352$ $D \text{ оп.мм} = 90$ $P \text{ н.мм} = 278.9$ $P \text{ вн.мм} = 128.8$ Гр. сл. = VI Точн. = П
	БПЗ-1523		БПЗ-1528
	$F \text{ см}^2 = 3.959$ $Q \text{ кг.} = 1.073$ $D \text{ оп.мм} = 65$ $P \text{ н.мм} = 204.2$ $P \text{ вн.мм} = 191.6$ Гр. сл. = III Точн. = П		
	БПЗ-1524		БПЗ-1529
	$F \text{ см}^2 = 6.872$ $Q \text{ кг.} = 1.862$ $D \text{ оп.мм} = 90$ $P \text{ н.мм} = 282.7$ $P \text{ вн.мм} = 267$ Гр. сл. = III Точн. = П		2
	БПЗ-1525		БПЗ-1530
	$F \text{ см}^2 = 4.475$ $Q \text{ кг.} = 1.213$ $D \text{ оп.мм} = 87$ $P \text{ н.мм} = 253.1$ $P \text{ вн.мм} = 120.6$ Гр. сл. = IV Точн. = П		2

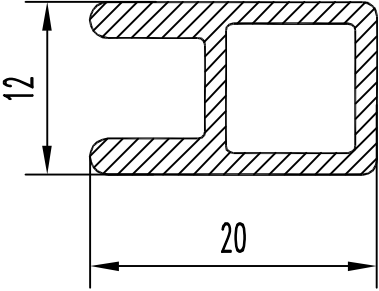
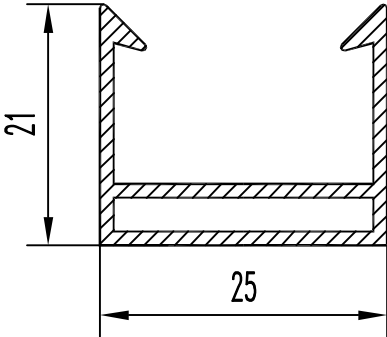
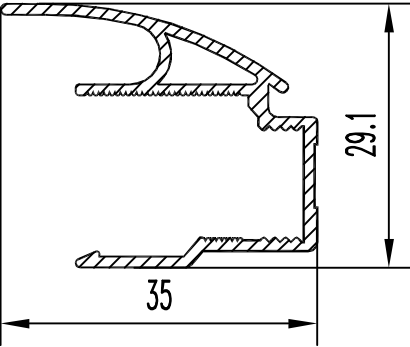
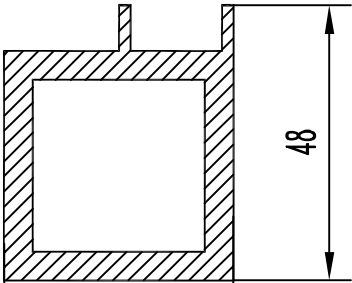
	БПЗ-1531		БПЗ-1536
	БПЗ-1532	ОРЕЛ	БПЗ-1537
	БПЗ-1533	ОРЕЛ	БПЗ-1538
			F см ² = Q кг. = D оп.мм= P н.мм = P вн.мм= Гр. сл. = Точн. = П
	БПЗ-1534	ОРЕЛ	БПЗ-1539
	БПЗ-1535		БПЗ-1540

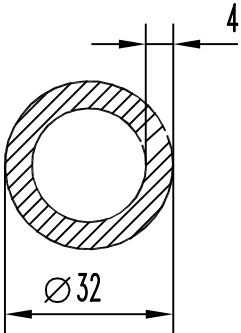
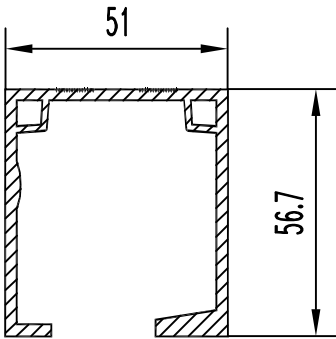
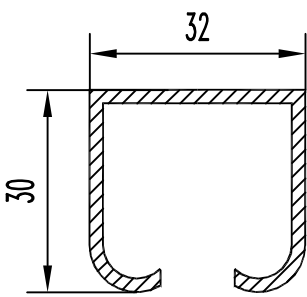
	БПЗ-1541		БПЗ-1546
			$F \text{ см}^2 = 10.09$ $Q \text{ кг.} = 2.73$ $D \text{ оп.мм} = 131$ $P \text{ н.мм} = 312.6$ $P \text{ вн.мм} = 268.5$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$
	БПЗ-1542		БПЗ-1547
	$F \text{ см}^2 = 2.137$ $Q \text{ кг.} = 0.579$ $D \text{ оп.мм} = 43$ $P \text{ н.мм} = 113.1$ $P \text{ вн.мм} = 100.6$ $\Gamma \text{р. сл.} = \text{III}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 10.329$ $Q \text{ кг.} = 2.799$ $D \text{ оп.мм} = 47$ $P \text{ н.мм} = 144.7$ $P \text{ вн.мм} = 84.8$ $\Gamma \text{р. сл.} = \text{IV}$ $\text{Точн.} = \text{H}$
	БПЗ-1543		БПЗ-1548
	$F \text{ см}^2 = 1.336$ $Q \text{ кг.} = 0.362$ $D \text{ оп.мм} = 25$ $P \text{ н.мм} = 73.1$ $P \text{ вн.мм} = 60.6$ $\Gamma \text{р. сл.} = \text{III}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 2.825$ $Q \text{ кг.} = 0.766$ $D \text{ оп.мм} = 27$ $P \text{ н.мм} = 92$ $P \text{ вн.мм} = 22$ $\Gamma \text{р. сл.} = \text{IV}$ $\text{Точн.} = \text{П}$
	БПЗ-1544		БПЗ-1549
	$F \text{ см}^2 = 3.913$ $Q \text{ кг.} = 1.06$ $D \text{ оп.мм} = 60$ $P \text{ н.мм} = 164.5$ $P \text{ вн.мм} = 58.6$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 2.059$ $Q \text{ кг.} = 0.558$ $D \text{ оп.мм} = 42$ $P \text{ н.мм} = 107.2$ $P \text{ вн.мм} = 31.4$ $\Gamma \text{р. сл.} = \text{IV}$ $\text{Точн.} = \text{П}$
	БПЗ-1545		БПЗ-1550

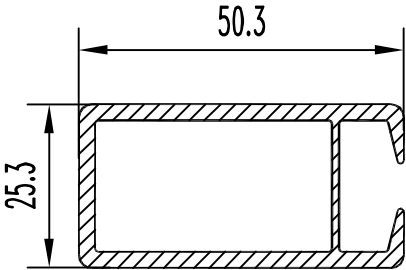
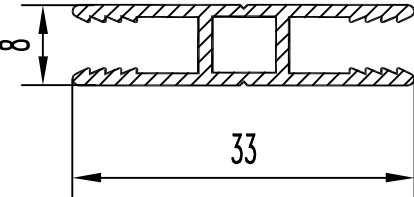
	БПЗ-1551		БПЗ-1556
	БПЗ-1552 $F \text{ см}^2 = 5.62$ $Q \text{ кг.} = 1.523$ $D \text{ оп.мм} = 85$ $P \text{ н.мм} = 380.6$ $P \text{ вн.мм} = 213.7$ Гр. сл. = VI Точн. = П		БПЗ-1557 $F \text{ см}^2 = 5.52$ $Q \text{ кг.} = 1.496$ $D \text{ оп.мм} = 87$ $P \text{ н.мм} = 254.5$ $P \text{ вн.мм} = 110.6$ Гр. сл. = IV Точн. = П
	БПЗ-1553 $F \text{ см}^2 = 10.502$ $Q \text{ кг.} = 2.846$ $D \text{ оп.мм} = 147$ $P \text{ н.мм} = 478.7$ $P \text{ вн.мм} = 392$ Гр. сл. = особая Точн. = П		БПЗ-1558 $F \text{ см}^2 = 4.175$ $Q \text{ кг.} = 1.131$ $D \text{ оп.мм} = 107$ $P \text{ н.мм} = 297.3$ $P \text{ вн.мм} = 252.1$ Гр. сл. = VI Точн. = П
	БПЗ-1554		БПЗ-1559 $F \text{ см}^2 = 5.2$ $Q \text{ кг.} = 1.413$ $D \text{ оп.мм} = 76$ $P \text{ н.мм} = 367$ $P \text{ вн.мм} = 167.5$ Гр. сл. = VI Точн. = П
	БПЗ-1555		БПЗ-1560

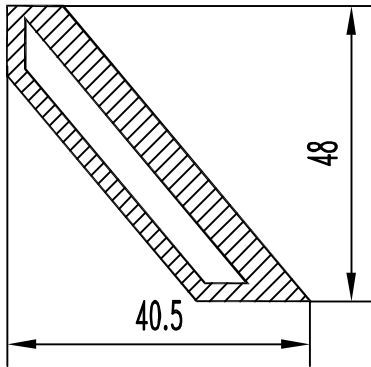
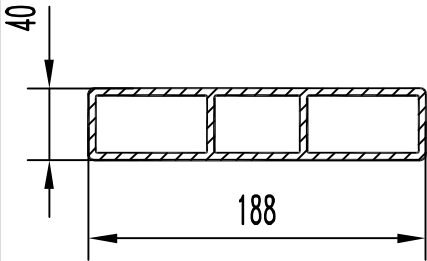
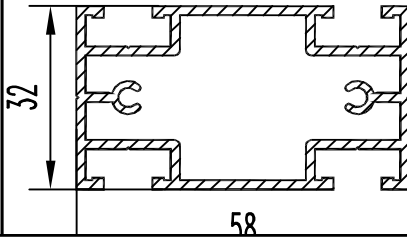
	БПЗ-1561		БПЗ-1566
	БПЗ-1562 $F \text{ см}^2 = 14.439$ $Q \text{ кг.} = 3.913$ $D \text{ оп.мм} = 175$ $P \text{ н.мм} = 777.5$ $P \text{ вн.мм} = 110.3$ Гр. сл. = особая Точн. = П		БПЗ-1567 $F \text{ см}^2 = 3.37$ $Q \text{ кг.} = 0.913$ $D \text{ оп.мм} = 63$ $P \text{ н.мм} = 401$ $P \text{ вн.мм} = 83$ Гр. сл. = VI Точн. = П
	БПЗ-1563 $F \text{ см}^2 = 32.87$ $Q \text{ кг.} = 8.908$ $D \text{ оп.мм} = 176$ $P \text{ н.мм} = 588.9$ $P \text{ вн.мм} = 441.5$ Гр. сл. = особая Точн. = П		БПЗ-1568 $F \text{ см}^2 = 2.42$ $Q \text{ кг.} = 0.66$ $D \text{ оп.мм} = 45$ $P \text{ н.мм} = 250$ $P \text{ вн.мм} = 123$ Гр. сл. = VI Точн. = П
	БПЗ-1564 $F \text{ см}^2 = 7.355$ $Q \text{ кг.} = 1.993$ $D \text{ оп.мм} = 56$ $P \text{ н.мм} = 204.1$ $P \text{ вн.мм} = 81.4$ Гр. сл. = V Точн. = П		БПЗ-1569 $F \text{ см}^2 = 3$ $Q \text{ кг.} = 0.813$ $D \text{ оп.мм} = 65$ $P \text{ н.мм} = 255$ $P \text{ вн.мм} = 172$ Гр. сл. = VI Точн. = П
	БПЗ-1565 $F \text{ см}^2 = 3.64$ $Q \text{ кг.} = 0.986$ $D \text{ оп.мм} = 45$ $P \text{ н.мм} = 280$ $P \text{ вн.мм} = 56$ Гр. сл. = VI		БПЗ-1570

	БПЗ-1571		БПЗ-1576
			$F \text{ см}^2 = 5.08$ $Q \text{ кг.} = 1.377$ $D \text{ оп.мм} = 100$ $P \text{ н.мм} = 271.6$ $P \text{ вн.мм} = 314.8$ Гр. сл. = особая Точн. = особой
	БПЗ-1572		БПЗ-1577
			$F \text{ см}^2 = 2.506$ $Q \text{ кг.} = 0.679$ $D \text{ оп.мм} = 67$ $P \text{ н.мм} = 173.1$ $P \text{ вн.мм} = 160.6$ Гр. сл. = VI Точн. = П
	БПЗ-1573		БПЗ-1578
			$F \text{ см}^2 = 1.56$ $Q \text{ кг.} = 0.423$ $D \text{ оп.мм} = 41$ $P \text{ н.мм} = 145$ $P \text{ вн.мм} = 113.8$ Гр. сл. = особая Точн. = особой
	БПЗ-1574		БПЗ-1579
	$F \text{ см}^2 = 3.958$ $Q \text{ кг.} = 1.073$ $D \text{ оп.мм} = 48$ $P \text{ н.мм} = 130$ $P \text{ вн.мм} = 102$ Гр. сл. = III Точн. = П		$F \text{ см}^2 = 1.521$ $Q \text{ кг.} = 0.412$ $D \text{ оп.мм} = 39$ $P \text{ н.мм} = 130.8$ $P \text{ вн.мм} = 122.1$ Гр. сл. = особая Точн. = особой
	БПЗ-1575		БПЗ-1580

	БПЗ-1581		БПЗ-1586
	БПЗ-1582 $F \text{ см}^2 = 1.015$ $Q \text{ кг.} = 0.275$ $D \text{ оп.мм} = 23$ $P \text{ н.мм} = 76.6$ $P \text{ вн.мм} = 35.1$ $\Gamma \text{р. сл.} = V$ $\text{Точн.} = П$		БПЗ-1587
	БПЗ-1583		БПЗ-1588
			$F \text{ см}^2 = 1.126$ $Q \text{ кг.} = 0.305$ $D \text{ оп.мм} = 33$ $P \text{ н.мм} = 131.2$ $P \text{ вн.мм} = 51.2$ $\Gamma \text{р. сл.} = \text{особая}$ $\text{Точн.} = Н$
	БПЗ-1584 $F \text{ см}^2 = 1.26$ $Q \text{ кг.} = 0.341$ $D \text{ оп.мм} = 44$ $P \text{ н.мм} = 202.7$ $P \text{ вн.мм} = 29.2$ $\Gamma \text{р. сл.} = IV$ $\text{Точн.} = П$		БПЗ-1589
	БПЗ-1585 $F \text{ см}^2 = 7.32$ $Q \text{ кг.} = 1.984$ $D \text{ оп.мм} = 63$ $P \text{ н.мм} = 192$ $P \text{ вн.мм} = 120$ $\Gamma \text{р. сл.} = V$		БПЗ-1590

	БПЗ-1591		БПЗ-1596
			$F \text{ см}^2 = 3.52$ $Q \text{ кг.} = 0.954$ $D \text{ оп.мм} = 32$ $P \text{ н.мм} = 100.5$ $P \text{ вн.мм} = 75.4$ $\text{Гр. сл.} = \text{IV}$ $\text{Точн.} = \text{особой}$
	БПЗ-1592		БПЗ-1597
			$F \text{ см}^2 = 5.457$ $Q \text{ кг.} = 1.479$ $D \text{ оп.мм} = 76.3$ $P \text{ н.мм} = 372.5$ $P \text{ вн.мм} = 45.7$ $\text{Гр. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$
	БПЗ-1593		БПЗ-1598
			$F \text{ см}^2 = 2.005$ $Q \text{ кг.} = 0.543$ $D \text{ оп.мм} = 42$ $P \text{ н.мм} = 204.5$ $P \text{ вн.мм} =$ $\text{Гр. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$
	БПЗ-1594		БПЗ-1599
	БПЗ-1595		БПЗ-1600

	БПЗ-1601		БПЗ-1606
			$F \text{ см}^2 = 3.44$ $Q \text{ кг.} = 0.932$ $D \text{ оп.мм} = 55$ $P \text{ н.мм} = 190.2$ $P \text{ вн.мм} = 113.1$ $\Gamma \text{р. сл.} = V$ $\text{Точн.} = П$
	БПЗ-1602		БПЗ-1607
			$F \text{ см}^2 = 1.299$ $Q \text{ кг.} = 0.352$ $D \text{ оп.мм} = 34$ $P \text{ н.мм} = 135.6$ $P \text{ вн.мм} = 18$ $\Gamma \text{р. сл.} = VI$ $\text{Точн.} = П$
	БПЗ-1603		БПЗ-1608
	БПЗ-1604		БПЗ-1609
	БПЗ-1605		БПЗ-1610

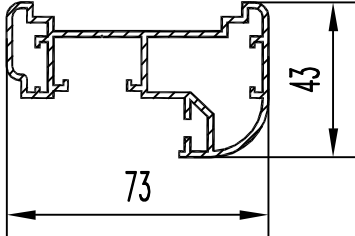
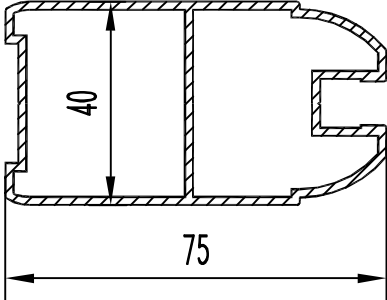
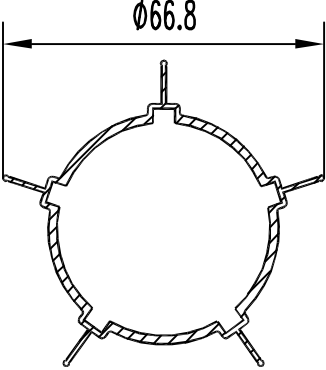
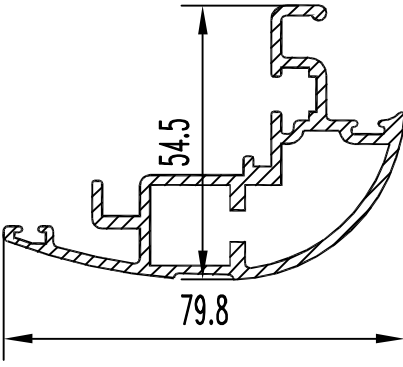
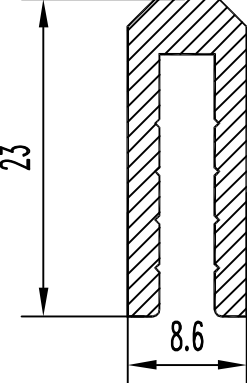
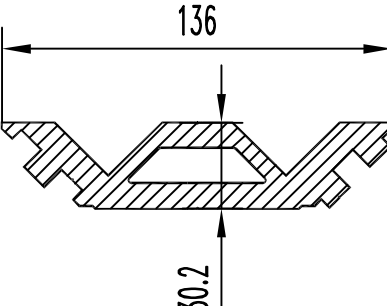
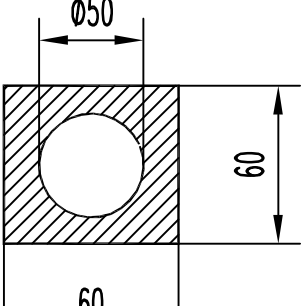
	БПЗ-1621		БПЗ-1626
	БПЗ-1622		БПЗ-1627
			$F \text{ см}^2 = 4.522$ $Q \text{ кг.} = 1.225$ $D \text{ оп.мм} = 64$ $P \text{ н.мм} = 139.1$ $P \text{ вн.мм} = 112.1$ $\Gamma \text{р. сл.} = V$ $\text{Точн.} = П$
	БПЗ-1623		БПЗ-1628
	$F \text{ см}^2 = 20.11$ $Q \text{ кг.} = 5.45$ $D \text{ оп.мм} = 191$ $P \text{ н.мм} = 450.9$ $P \text{ вн.мм} = 530.9$ $\Gamma \text{р. сл.} = \text{особая}$ $\text{Точн.} = П$		
	БПЗ-1624		БПЗ-1629
	БПЗ-1625		БПЗ-1630
			$F \text{ см}^2 = 4.108$ $Q \text{ кг.} = 1.113$ $D \text{ оп.мм} = 67$ $P \text{ н.мм} = 295$ $P \text{ вн.мм} = 227.5$ $\Gamma \text{р. сл.} = V$

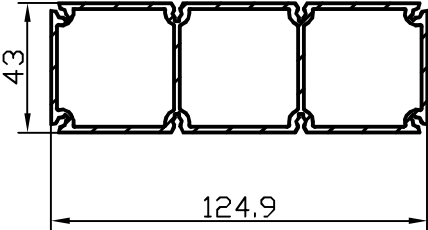
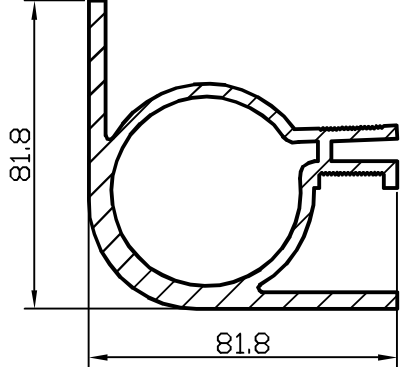
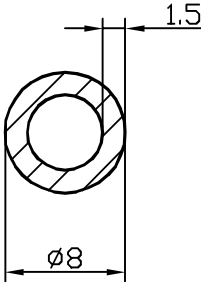
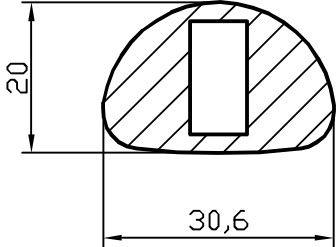
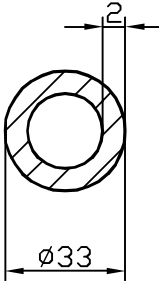
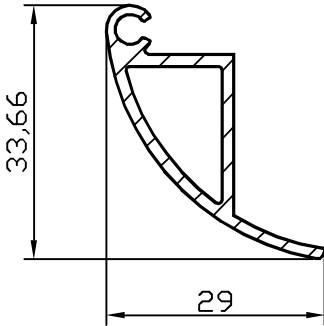
pdfMachine

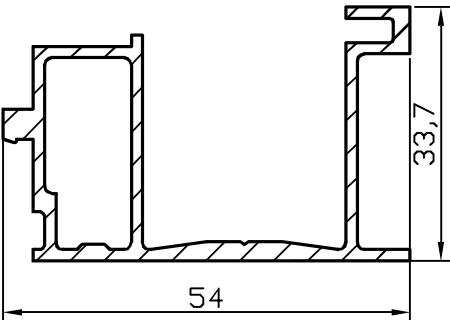
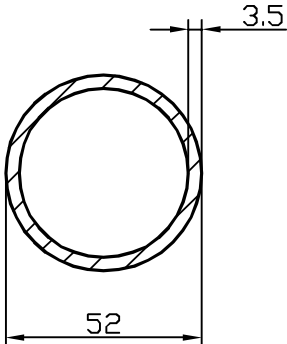
A pdf writer that produces quality PDF files with ease!

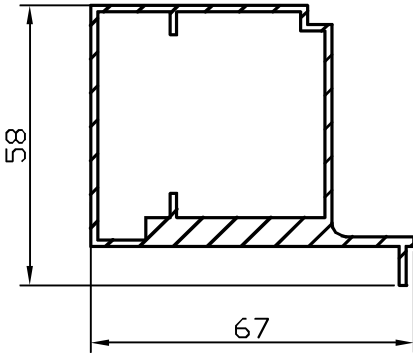
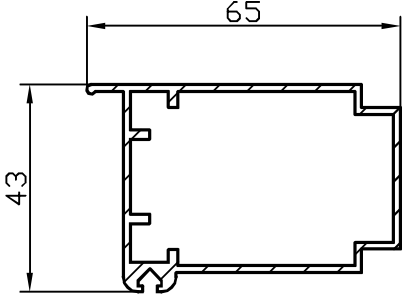
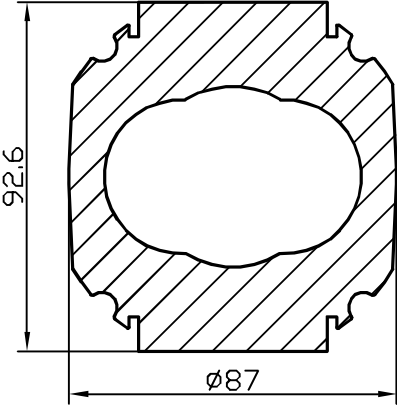
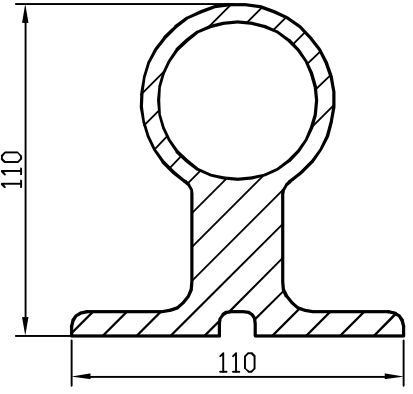
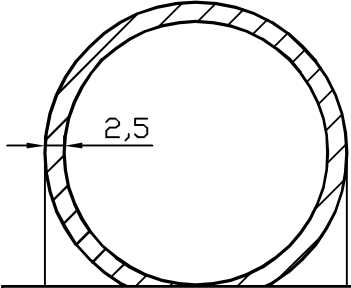
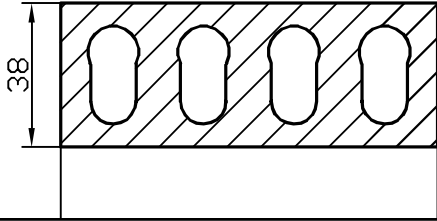
Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

Get yours now!

	БПЗ-1631 $F \text{ см}^2 = 4.42$ $Q \text{ кг.} = 1.198$ $D \text{ оп.мм} = 100$ $P \text{ н.мм} = 323.7$ $P \text{ вн.мм} = 229.3$ Гр. сл. = III Точн. = особая		БПЗ-1636
	БПЗ-1632 $F \text{ см}^2 = 4.51$ $Q \text{ кг.} = 1.222$ $D \text{ оп.мм} = 95$ $P \text{ н.мм} = 249$ $P \text{ вн.мм} = 307.5$ Гр. сл. = VI Точн. = П		БПЗ-1637
	БПЗ-1633		БПЗ-1638 $F \text{ см}^2 = 4.991$ $Q \text{ кг.} = 1.353$ $D \text{ оп.мм} = 42$ $P \text{ н.мм} = 118.3$ $P \text{ вн.мм} = 80$ Гр. сл. = IV Точн. = Н
	БПЗ-1634 $F \text{ см}^2 = 5.396$ $Q \text{ кг.} = 1.462$ $D \text{ оп.мм} = 87$ $P \text{ н.мм} = 355.9$ $P \text{ вн.мм} = 153.7$ Гр. сл. = особая Точн. = П		БПЗ-1639 $F \text{ см}^2 = 1.17$ $Q \text{ кг.} = 0.317$ $D \text{ оп.мм} = 24$ $P \text{ н.мм} = 100.4$ $P \text{ вн.мм} =$ Гр. сл. = IV Точн. = П
	БПЗ-1635 $F \text{ см}^2 = 21.303$ $Q \text{ кг.} = 5.773$ $D \text{ оп.мм} = 137$ $P \text{ н.мм} = 382.6$ $P \text{ вн.мм} = 106.9$ Гр. сл. = VI		БПЗ-1640 $F \text{ см}^2 = 16.365$ $Q \text{ кг.} = 4.435$ $D \text{ оп.мм} = 61$ $P \text{ н.мм} = 240$ $P \text{ вн.мм} = 157$ Гр. сл. = III

	БПЗ-1641 $F \text{ см}^2 = 8,641$ $Q \text{ кг.} = 2,342$ $D \text{ оп.мм.} = 131$ $P \text{ н.} = 416,5$ $P_{\text{вн.}} = 446,9$ Гр. с.л. = особая Точн. = П		БПЗ-1646
	БПЗ-1642 $F \text{ см}^2 = 13.504$ $Q \text{ кг.} = 3.66$ $D \text{ оп.мм.} = 116$ $P \text{ н.} = 446.8$ $P_{\text{вн.}} = 168.3$ Гр. с.л. = V Точн. = П		БПЗ-1647 $F \text{ см}^2 = 0.306$ $Q \text{ кг.} = 0.083$ $D \text{ оп.мм.} = 8$ $P \text{ н.} = 25.1$ $P_{\text{вн.}} = 15.7$ Гр. с.л. = VI Точн. = П
	БПЗ-1643 $F \text{ см}^2 = 3.786$ $Q \text{ кг.} = 1.026$ $D \text{ оп.мм.} = 32$ $P \text{ н.} = 82.8$ $P_{\text{вн.}} = 45.2$ Гр. с.л. = IV Точн. = Н		БПЗ-1648 $F \text{ см}^2 = 1.95$ $Q \text{ кг.} = 0.528$ $D \text{ оп.мм.} = 33$ $P \text{ н.} = 103.7$ $P_{\text{вн.}} = 91.1$ Гр. с.л. = IV Точн. = П
БПЗ-1644 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = 0 Точн. = 0		БПЗ-1649 $F \text{ см}^2 = 1.38$ $Q \text{ кг.} = 0.374$ $D \text{ оп.мм.} = 43$ $P \text{ н.} = 115.1$ $P_{\text{вн.}} = 53.5$ Гр. с.л. = V Точн. = П	
	БПЗ-1645 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		БПЗ-1650 $F \text{ см} = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$

	БПЗ-1651		БПЗ-0
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-0		БПЗ-1657
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		$F \text{ см}^2 = 2.893$ $Q \text{ кг.} = 0.784$ $D \text{ оп.мм.} = 60$ $P \text{ н.} = 260.2$ $P_{\text{вн.}} = 72.4$ Гр. сл. = VI Точн. = П
	БПЗ-0		БПЗ-1658
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		$F \text{ см}^2 = 5.333$ $Q \text{ кг.} = 1.445$ $D \text{ оп.мм.} = 52$ $P \text{ н.} = 163.4$ $P_{\text{вн.}} = 141.4$ Гр. сл. = IV Точн. = Н
	БПЗ-0		БПЗ-0
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-0		БПЗ-0
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$

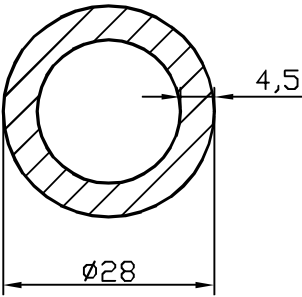
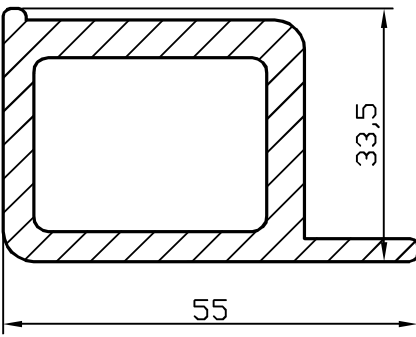
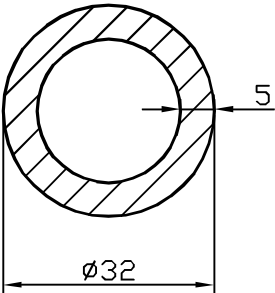
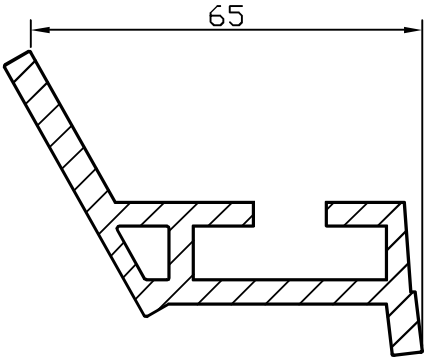
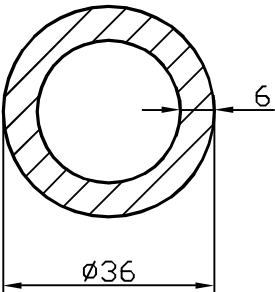
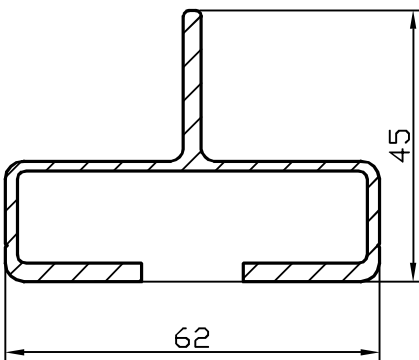
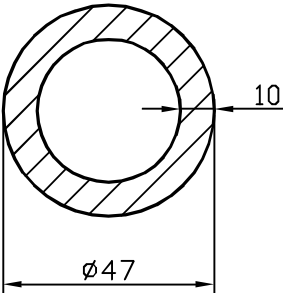
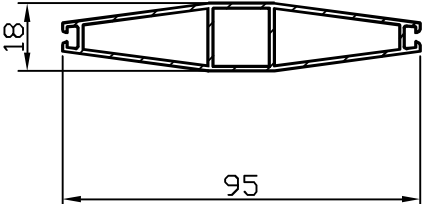
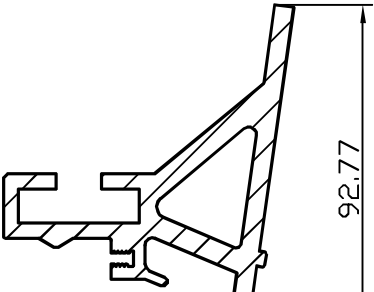
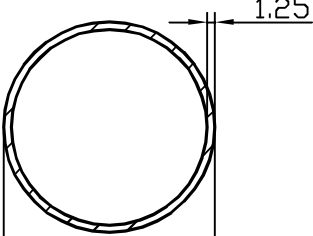
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-1666 $F \text{ см}^2 = 5.049$ $Q \text{ кг.} = 1.368$ $D \text{ оп.мм.} = 89$ $P \text{ н.} = 248.7$ $P_{\text{вн.}} = 208.4$ Гр. сл. = VI Точн. = П
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-1667 $F \text{ см}^2 = 3.22$ $Q \text{ кг.} = 0.873$ $D \text{ оп.мм.} = 73$ $P \text{ н.} = 223.9$ $P_{\text{вн.}} = 209.4$ Гр. сл. = VI Точн. = П
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1664 $F \text{ см}^2 = 44.183$ $Q \text{ кг.} = 11.974$ $D \text{ оп.мм.} = 106$ $P \text{ н.} = 359.3$ $P_{\text{вн.}} = 185.8$ Гр. сл. = особая Точн. = П		БПЗ-1669 $F \text{ см}^2 = 30.96$ $Q \text{ кг.} = 8.39$ $D \text{ оп.мм.} = 140$ $P \text{ н.} = 458$ $P_{\text{вн.}} = 163.4$ Гр. сл. = V Точн. = П
	БПЗ-1665 $F \text{ см}^2 = 6.951$ $Q \text{ кг.} = 1.884$ $D \text{ оп.мм.} = 91$ $P \text{ н.} = 285.9$ $P_{\text{вн.}} = 270.2$		БПЗ-1670 $F \text{ см}^2 = 6.59$ $Q \text{ кг.} = 1.786$ $D \text{ оп.мм.} = 50$ $P \text{ н.} = 138$ $P_{\text{вн.}} = 135.2$ Гр. сл. = особая Точн. = П

pdfMachine

A pdf writer that produces quality PDF files with ease!

Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

Get yours now!

	БПЗ-1671 $F \text{ см}^2 = 3.322$ $Q \text{ кг.} = 0.9$ $D \text{ оп.мм.} = 28$ $P \text{ н.} = 88$ $P_{\text{вн.}} = 59.7$ Гр. с.л. = III Точн. = Н		БПЗ-1676 $F \text{ см}^2 = 6.122$ $Q \text{ кг.} = 1.66$ $D \text{ оп.мм.} = 65$ $P \text{ н.} = 171.9$ $P_{\text{вн.}} = 104.6$ Гр. с.л. = IV Точн. = П
	БПЗ-1672 $F \text{ см}^2 = 4.241$ $Q \text{ кг.} = 1.149$ $D \text{ оп.мм.} = 32$ $P \text{ н.} = 100.5$ $P_{\text{вн.}} = 69.1$ Гр. с.л. = III Точн. = Н		БПЗ-1677 $F \text{ см}^2 = 6.327$ $Q \text{ кг.} = 1.715$ $D \text{ оп.мм.} = 32$ $P \text{ н.} = 275.1$ $P_{\text{вн.}} = 31.2$ Гр. с.л. = IV Точн. = П
	БПЗ-1673 $F \text{ см}^2 = 5.655$ $Q \text{ кг.} = 1.533$ $D \text{ оп.мм.} = 36$ $P \text{ н.} = 113.1$ $P_{\text{вн.}} = 75.4$ Гр. с.л. = III Точн. = Н		БПЗ-1678 $F \text{ см}^2 = 3.661$ $Q \text{ кг.} = 0.992$ $D \text{ оп.мм.} = 68$ $P \text{ н.} = 323$ $P_{\text{вн.}} = 0$ Гр. с.л. = V Точн. = П
	БПЗ-1674 $F \text{ см}^2 = 11.624$ $Q \text{ кг.} = 3.15$ $D \text{ оп.мм.} = 47$ $P \text{ н.} = 147.7$ $P_{\text{вн.}} = 84.8$ Гр. с.л. = III Точн. = Н		БПЗ-1679 $F \text{ см}^2 = 3.12$ $Q \text{ кг.} = 0.846$ $D \text{ оп.мм.} = 93$ $P \text{ н.} = 233.8$ $P_{\text{вн.}} = 238.5$ Гр. с.л. = VI Точн. = П
	БПЗ-1675 $F \text{ см}^2 = 12.987$ $Q \text{ кг.} = 3.519$ $D \text{ оп.мм.} = 104$ $P \text{ н.} = 423.5$ $P_{\text{вн.}} = 91.6$		БПЗ-1680 $F \text{ см}^2 = 0.66$ $Q \text{ кг.} = 0.179$ $D \text{ оп.мм.} = 18$ $P \text{ н.} = 56.6$ $P_{\text{вн.}} = 48.7$

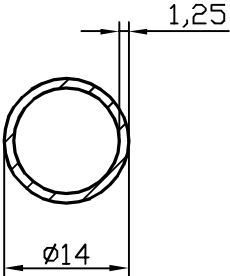
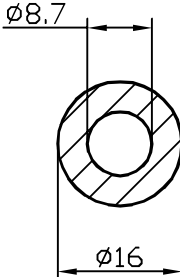
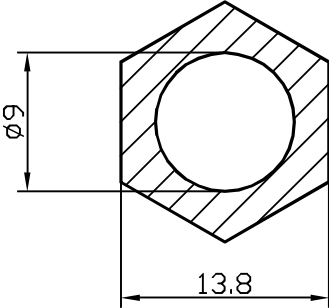
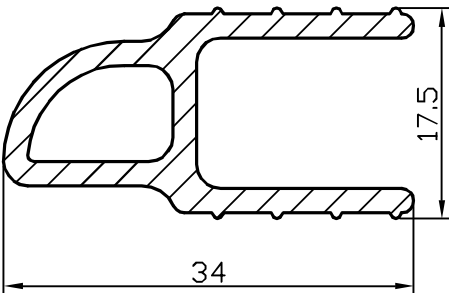
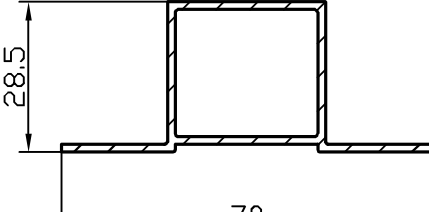
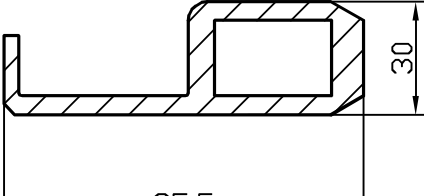
pdfMachine

A pdf writer that produces quality PDF files with ease!

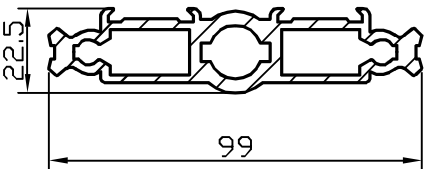
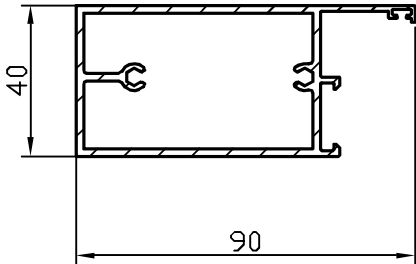
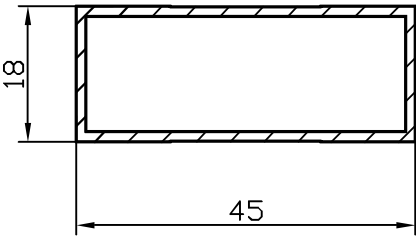
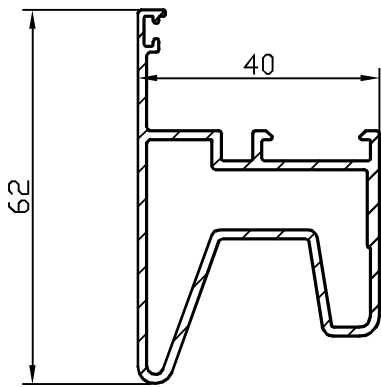
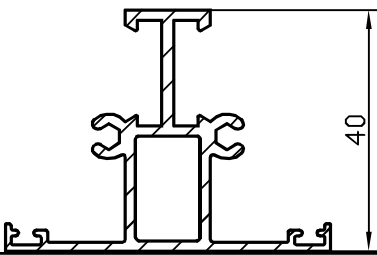
Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

Get yours now!

IV
П

	БПЗ-1681 $F \text{ см}^2 = 0.5$ $Q \text{ кг.} = 0.136$ $D \text{ оп.мм.} = 14$ $P \text{ н.} = 44$ $P_{\text{вн.}} = 36.1$ Гр. с.л. = IV Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		БПЗ-1687 $F \text{ см}^2 = 1.42$ $Q \text{ кг.} = 0.385$ $D \text{ оп.мм.} = 16$ $P \text{ н.} = 50.3$ $P_{\text{вн.}} = 27.3$ Гр. с.л. = V Точн. = П
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		БПЗ-1688 $F \text{ см}^2 = 1.01$ $Q \text{ кг.} = 0.275$ $D \text{ оп.мм.} = 15$ $P \text{ н.} = 47.8$ $P_{\text{вн.}} = 28.3$ Гр. с.л. = V Точн. = П
	БПЗ-1684 $F \text{ см}^2 = 1.755$ $Q \text{ кг.} = 0.476$ $D \text{ оп.мм.} = 36.2$ $P \text{ н.} = 129.5$ $P_{\text{вн.}} = 34.6$ Гр. с.л. = VI Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-1685 $F \text{ см}^2 = 2.267$ $Q \text{ кг.} = 0.614$ $D \text{ оп.мм.} = 71$ $P \text{ н.} = 199.1$ $P_{\text{вн.}} = 101.1$		БПЗ-1690 $F \text{ см}^2 = 10.313$ $Q \text{ кг.} = 2.795$ $D \text{ оп.мм.} = 95$ $P \text{ н.} = 270.9$ $P_{\text{вн.}} = 102$

	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1692 $F \text{ см}^2 = 1.34$ $Q \text{ кг.} = 0.364$ $D \text{ оп.мм.} = 23$ $P \text{ н.} = 68.8$ $P_{\text{вн.}} = 18.9$ Гр. сл. = V Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1693 $F \text{ см}^2 = 4.273$ $Q \text{ кг.} = 1.158$ $D \text{ оп.мм.} = 58$ $P \text{ н.} = 341.2$ $P_{\text{вн.}} = 0$ Гр. сл. = VI Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1694 $F \text{ см}^2 = 6.08$ $Q \text{ кг.} = 1.648$ $D \text{ оп.мм.} = 30$ $P \text{ н.} = 99.4$ $P_{\text{вн.}} = 31.4$ Гр. сл. = IV Точн. = П		БПЗ-1699 $F \text{ см}^2 = 7.924$ $Q \text{ кг.} = 2.147$ $D \text{ оп.мм.} = 94$ $P \text{ н.} = 380.6$ $P_{\text{вн.}} = 249.5$ Гр. сл. = V Точн. = П
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$

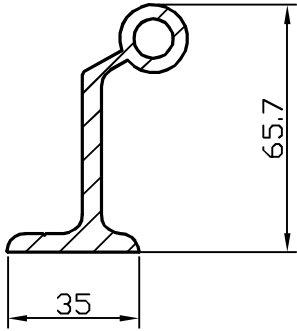
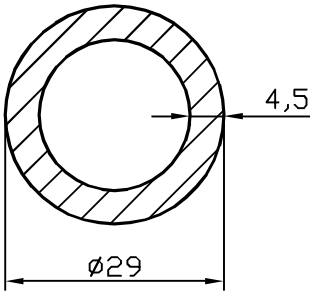
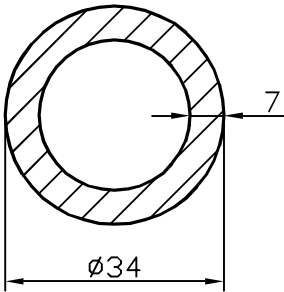
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1702 $F \text{ см}^2 = 7.47$ $Q \text{ кг.} = 2.025$ $D \text{ оп.мм.} = 100$ $P \text{ н.} = 273.9$ $P_{\text{вн.}} = 223.9$ Гр. сл. = особая Точн. = П		БПЗ-1707 $F \text{ см}^2 = 5.305$ $Q \text{ кг.} = 1.438$ $D \text{ оп.мм.} = 99$ $P \text{ н.} = 298.4$ $P_{\text{вн.}} = 257.9$ Гр. сл. = VI Точн. = П
	БПЗ-1703 $F \text{ см}^2 = 1.53$ $Q \text{ кг.} = 0.415$ $D \text{ оп.мм.} = 49$ $P \text{ н.} = 126.4$ $P_{\text{вн.}} = 115.6$ Гр. сл. = IV Точн. = П		БПЗ-1708 $F \text{ см}^2 = 3.27$ $Q \text{ кг.} = 0.886$ $D \text{ оп.мм.} = 67$ $P \text{ н.} = 260.2$ $P_{\text{вн.}} = 171.3$ Гр. сл. = VI Точн. = П
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		БПЗ-1710 $F \text{ см}^2 = 2.918$ $Q \text{ кг.} = 0.791$ $D \text{ оп.мм.} = 59$ $P \text{ н.} = 291.8$ $P_{\text{вн.}} = 54.9$ Гр. сл. = VI Точн. = П

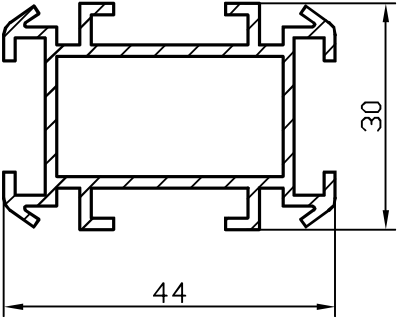
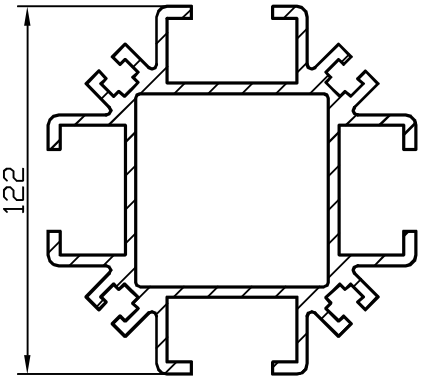
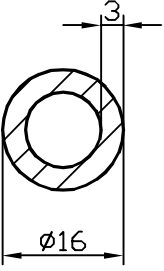
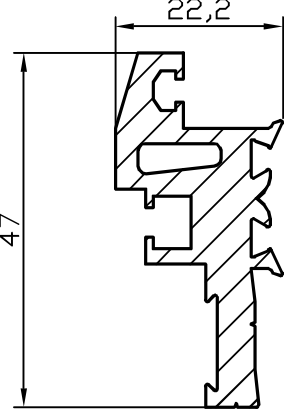
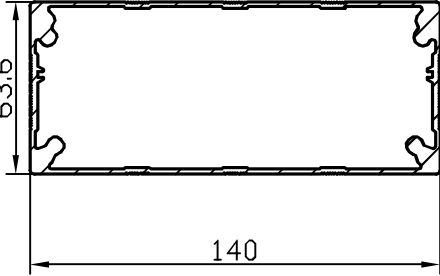
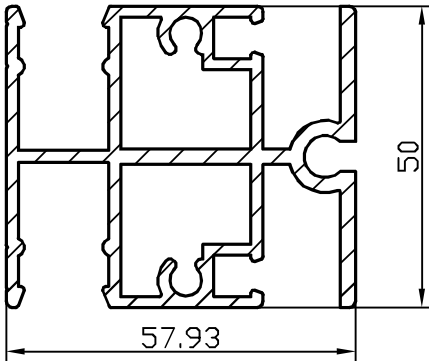
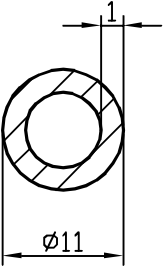
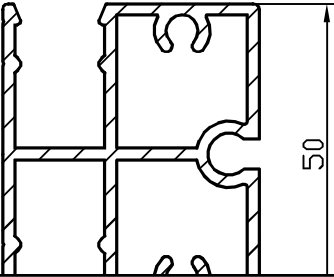
pdfMachine

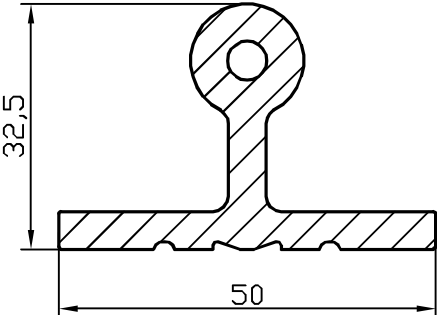
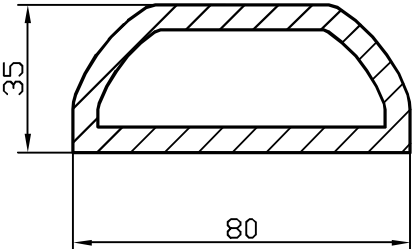
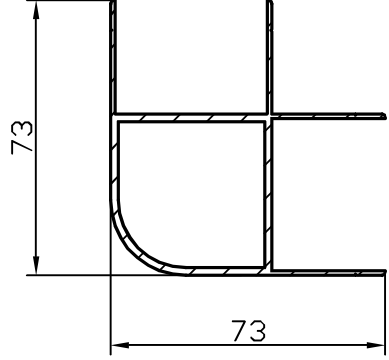
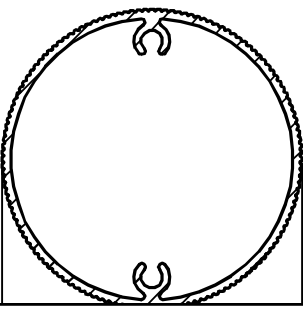
A pdf writer that produces quality PDF files with ease!

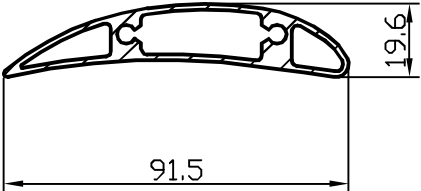
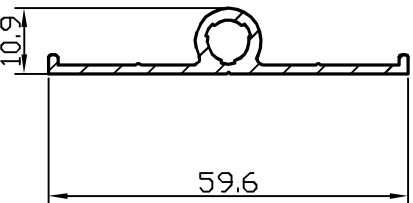
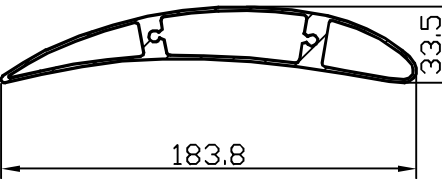
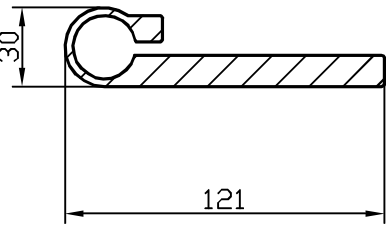
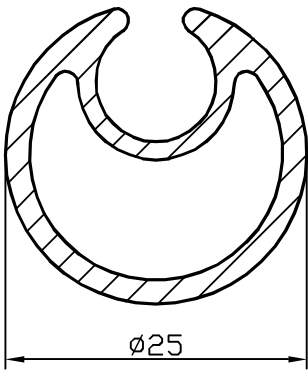
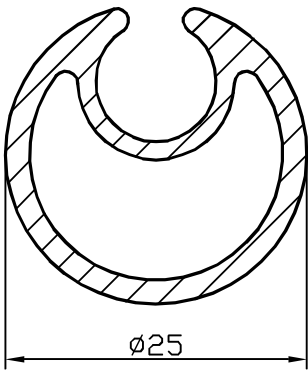
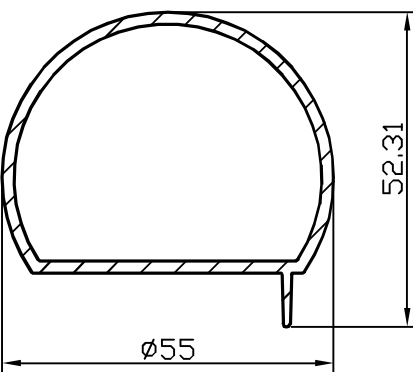
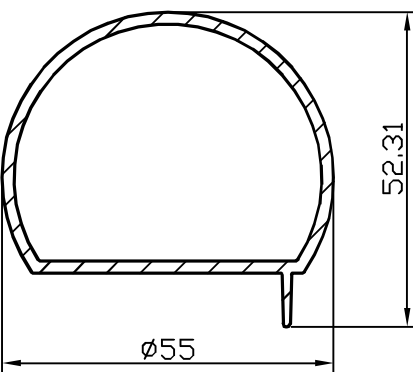
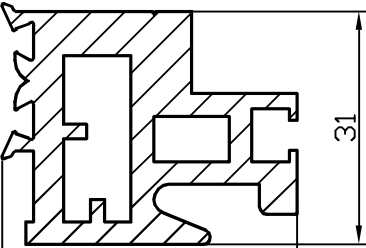
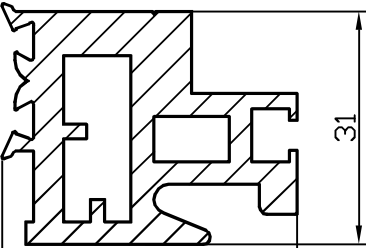
Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

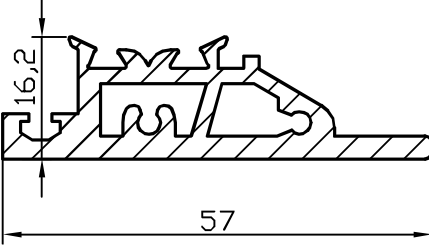
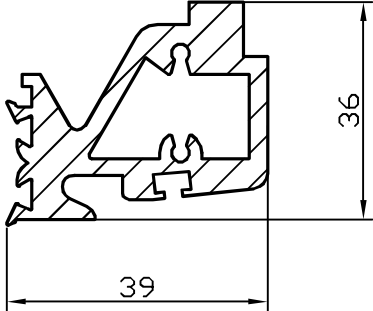
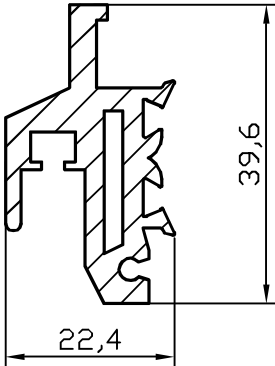
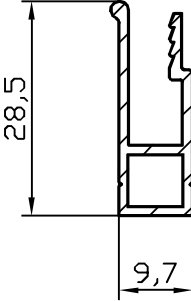
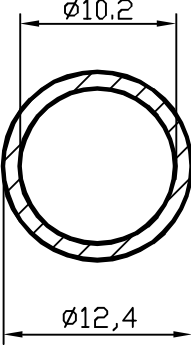
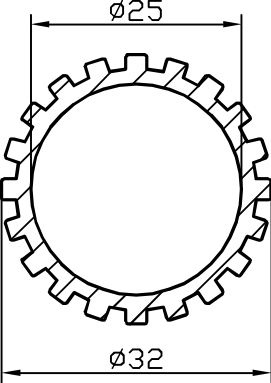
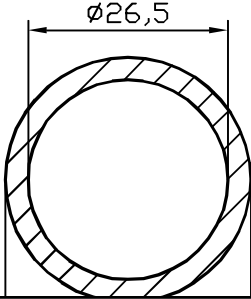
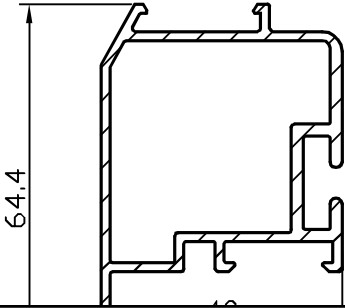
Get yours now!

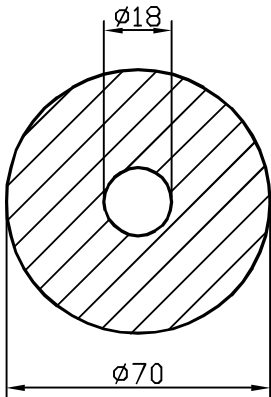
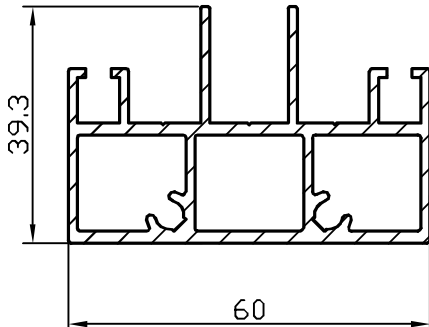
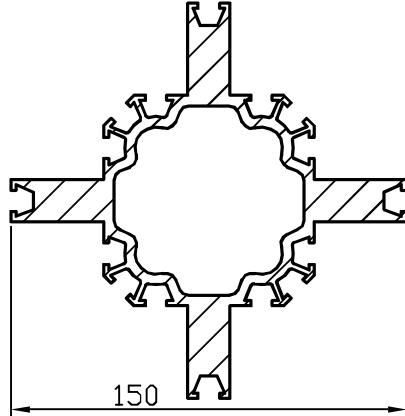
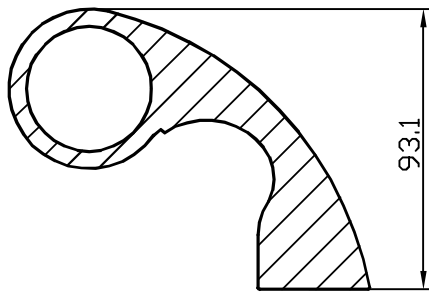
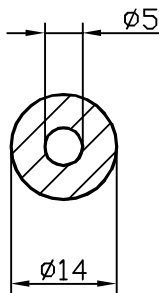
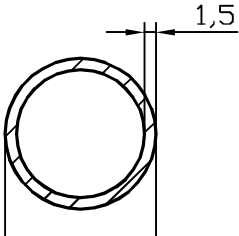
	БПЗ-1711		БПЗ-1715
	$F \text{ см}^2 = 5.93$ $Q \text{ кг.} = 1.607$ $D \text{ оп.мм.} = 77$ $P \text{ н.} = 224.1$ $P_{\text{вн.}} = 31.4$ Гр. с.л. = V Точн. = П		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-1712		БПЗ-0
	$F \text{ см}^2 = 3.464$ $Q \text{ кг.} = 0.939$ $D \text{ оп.мм.} = 29$ $P \text{ н.} = 91.1$ $P_{\text{вн.}} = 62.8$ Гр. с.л. = III Точн. = Н		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-1713		БПЗ-0
	$F \text{ см}^2 = 5.938$ $Q \text{ кг.} = 1.609$ $D \text{ оп.мм.} = 34$ $P \text{ н.} = 106.8$ $P_{\text{вн.}} = 62.8$ Гр. с.л. = III Точн. = Н		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-0		БПЗ-0
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-0		БПЗ-0
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$

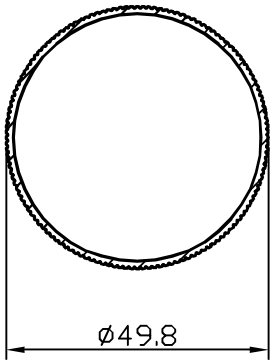
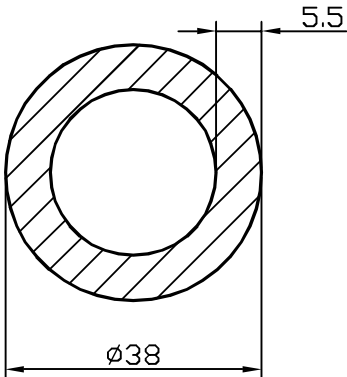
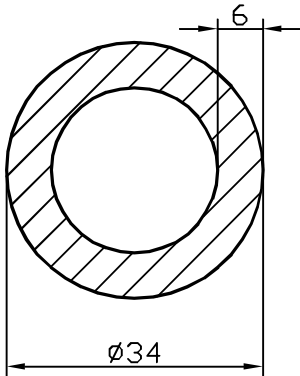
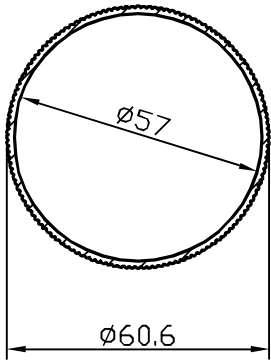
	БПЗ-1721 $F \text{ см}^2 = 2.823$ $Q \text{ кг.} = 0.765$ $D \text{ оп.мм.} = 50$ $P \text{ н.} = 281.9$ $P_{вн.} = 92$ $\text{Гр. сл.} = V$ $\text{Точн.} = П$		БПЗ-1726 $F \text{ см}^2 = 24.711$ $Q \text{ кг.} = 6.697$ $D \text{ оп.мм.} = 130$ $P \text{ н.} = 1001$ $P_{вн.} = 253.4$ $\text{Гр. сл.} = VI$ $\text{Точн.} = П$
	БПЗ-1722 $F \text{ см}^2 = 1.225$ $Q \text{ кг.} = 0.332$ $D \text{ оп.мм.} = 16$ $P \text{ н.} = 50.3$ $P_{вн.} = 31.4$ $\text{Гр. сл.} = IV$ $\text{Точн.} = \text{особая}$		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{вн.} = 0$ $\text{Гр. сл.} = \text{особая}$ $\text{Точн.} = П$
	БПЗ-1723 $F \text{ см}^2 = 4.001$ $Q \text{ кг.} = 1.084$ $D \text{ оп.мм.} = 50$ $P \text{ н.} = 192.6$ $P_{вн.} = 27.4$ $\text{Гр. сл.} = VI$ $\text{Точн.} = П$		БПЗ-1728 $F \text{ см}^2 = 11.74$ $Q \text{ кг.} = 3.182$ $D \text{ оп.мм.} = 163$ $P \text{ н.} = 472.4$ $P_{вн.} = 466.6$ $\text{Гр. сл.} = VI$ $\text{Точн.} = П$
БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{вн.} = 0$ $\text{Гр. сл.} = \text{особая}$ $\text{Точн.} = П$			БПЗ-1729 $F \text{ см}^2 = 7.186$ $Q \text{ кг.} = 1.947$ $D \text{ оп.мм.} = 75$ $P \text{ н.} = 462.3$ $P_{вн.} = 196.7$ $\text{Гр. сл.} = \text{особая}$ $\text{Точн.} = П$
	БПЗ-1725 $F \text{ см}^2 = 0.314$ $Q \text{ кг.} = 0.085$ $D \text{ оп.мм.} = 11$ $P \text{ н.} = 34.6$ $P_{вн.} = 28.3$		БПЗ-1730 $F \text{ см}^2 = 5.338$ $Q \text{ кг.} = 1.447$ $D \text{ оп.мм.} = 65$ $P \text{ н.} = 303.2$ $P_{вн.} = 217.8$ $\text{Гр. сл.} = \text{особая}$ $\text{Точн.} = П$

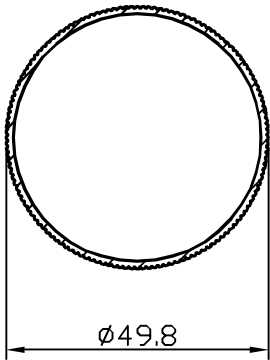
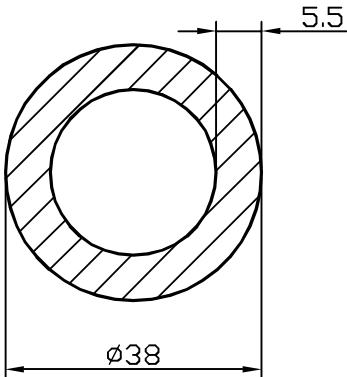
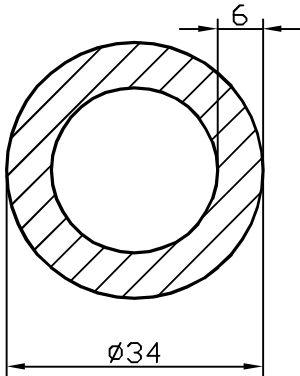
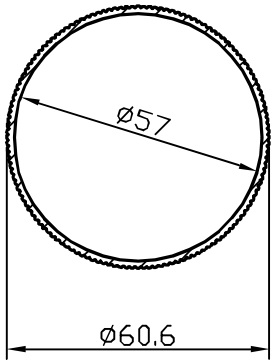
	БПЗ-1731 $F \text{ см}^2 = 4.65$ $Q \text{ кг.} = 1.26$ $D \text{ оп.мм.} = 52$ $P \text{ н.} = 173.8$ $P_{\text{вн.}} = 15.7$ Гр. сл. = V Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1732 $F \text{ см}^2 = 11.148$ $Q \text{ кг.} = 3.021$ $D \text{ оп.мм.} = 82$ $P \text{ н.} = 207.2$ $P_{\text{вн.}} = 164.2$ Гр. сл. = IV Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1733 $F \text{ см}^2 = 4.54$ $Q \text{ кг.} = 1.23$ $D \text{ оп.мм.} = 103$ $P \text{ н.} = 403.5$ $P_{\text{вн.}} = 147.5$ Гр. сл. = VI Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		БПЗ-1740 $F \text{ см}^2 = 2.451$ $Q \text{ кг.} = 0.664$ $D \text{ оп.мм.} = 49.8$ $P \text{ н.} = 184.5$ $P_{\text{вн.}} = 192.8$

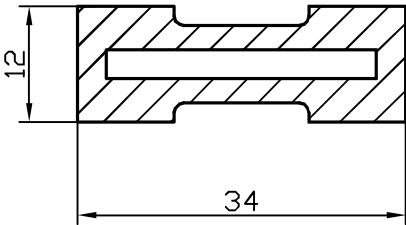
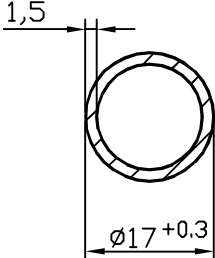
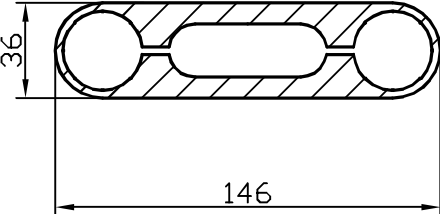
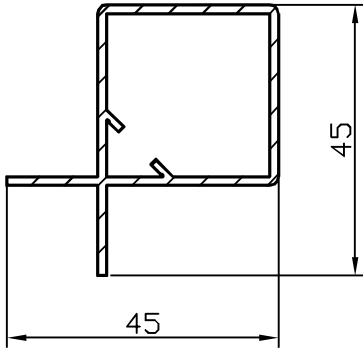
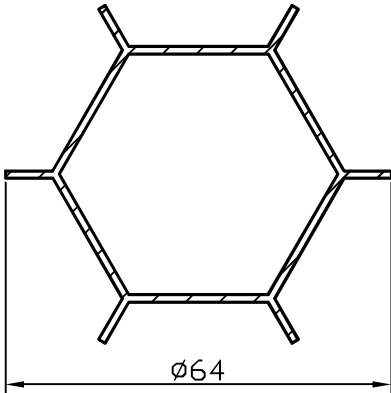
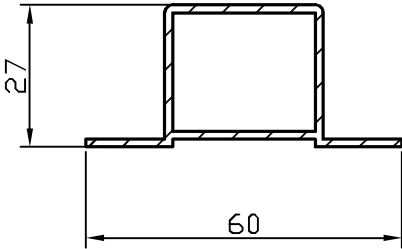
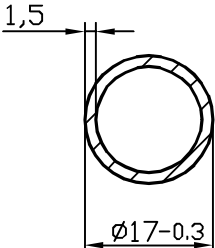
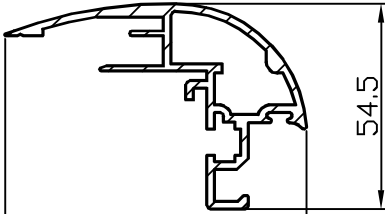
	БПЗ-1741 $F \text{ см}^2 = 4.18$ $Q \text{ кг.} = 1.133$ $D \text{ оп.мм.} = 91.5$ $P \text{ н.} = 196.6$ $P_{\text{вн.}} = 211.5$ Гр. сл. = особая Точн. = П		БПЗ-1746 $F \text{ см}^2 = 1.41$ $Q \text{ кг.} = 0.383$ $D \text{ оп.мм.} = 60$ $P \text{ н.} = 143.5$ $P_{\text{вн.}} = 24.2$ Гр. сл. = VI Точн. = П
	БПЗ-1742 $F \text{ см}^2 = 9.125$ $Q \text{ кг.} = 2.473$ $D \text{ оп.мм.} = 184$ $P \text{ н.} = 388.9$ $P_{\text{вн.}} = 430.3$ Гр. сл. = особая Точн. = П		БПЗ-1747 $F \text{ см}^2 = 14.7$ $Q \text{ кг.} = 3.98$ $D \text{ оп.мм.} = 122$ $P \text{ н.} = 370.7$ $P_{\text{вн.}} = 0$ Гр. сл. = VI Точн. = П
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-1748 $F \text{ см}^2 = 1.762$ $Q \text{ кг.} = 0.478$ $D \text{ оп.мм.} = 25$ $P \text{ н.} = 102.8$ $P_{\text{вн.}} = 71.9$ Гр. сл. = V Точн. = П
	БПЗ-1744 $F \text{ см}^2 = 3.298$ $Q \text{ кг.} = 0.894$ $D \text{ оп.мм.} = 60$ $P \text{ н.} = 181.9$ $P_{\text{вн.}} = 152.1$ Гр. сл. = V Точн. = особая		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		БПЗ-1750 $F \text{ см}^2 = 5.704$ $Q \text{ кг.} = 1.546$ $D \text{ оп.мм.} = 49$ $P \text{ н.} = 199.7$ $P_{\text{вн.}} = 108$

	БПЗ-1751 $F \text{ см}^2 = 3.526$ $Q \text{ кг.} = 0.955$ $D \text{ оп.мм.} = 58$ $P \text{ н.} = 175.5$ $P_{\text{вн.}} = 91$ Гр. с.л. = V Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-1752 $F \text{ см}^2 = 6.01$ $Q \text{ кг.} = 1.628$ $D \text{ оп.мм.} = 54$ $P \text{ н.} = 214.6$ $P_{\text{вн.}} = 100.4$ Гр. с.л. = особая Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-1753 $F \text{ см}^2 = 3.211$ $Q \text{ кг.} = 0.87$ $D \text{ оп.мм.} = 41$ $P \text{ н.} = 182$ $P_{\text{вн.}} = 42.1$ Гр. с.л. = VI Точн. = П		БПЗ-1758 $F \text{ см}^2 = 0.917$ $Q \text{ кг.} = 0.249$ $D \text{ оп.мм.} = 31$ $P \text{ н.} = 116.6$ $P_{\text{вн.}} = 28.6$ Гр. с.л. = VI Точн. = П
	БПЗ-1754 $F \text{ см}^2 = 0.391$ $Q \text{ кг.} = 0.106$ $D \text{ оп.мм.} = 12.4$ $P \text{ н.} = 39$ $P_{\text{вн.}} = 32$ Гр. с.л. = особая Точн. = особой		БПЗ-1759 $F \text{ см}^2 = 2.36$ $Q \text{ кг.} = 0.64$ $D \text{ оп.мм.} = 32$ $P \text{ н.} = 153.7$ $P_{\text{вн.}} = 78.5$ Гр. с.л. = VI Точн. = П
	БПЗ-1755 $F \text{ см}^2 = 2.78$ $Q \text{ кг.} = 0.753$ $D \text{ оп.мм.} = 33$ $P \text{ н.} = 102.1$ $P_{\text{вн.}} = 83.3$		БПЗ-1760 $F \text{ см}^2 = 3.484$ $Q \text{ кг.} = 0.944$ $D \text{ оп.мм.} = 71$ $P \text{ н.} = 285.5$ $P_{\text{вн.}} = 143.1$ Гр. с.л. = VI Точн. = П

	БПЗ-1761 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-1766 $F \text{ см}^2 = 35.94$ $Q \text{ кг.} = 9.74$ $D \text{ оп.мм.} = 70$ $P \text{ н.} = 219.9$ $P_{\text{вн.}} = 56.6$ Гр. сл. = IV Точн. = П
	БПЗ-1762 $F \text{ см}^2 = 4.816$ $Q \text{ кг.} = 1.305$ $D \text{ оп.мм.} = 66$ $P \text{ н.} = 319.3$ $P_{\text{вн.}} = 216.2$ Гр. сл. = VI Точн. = П		БПЗ-1767 $F \text{ см}^2 = 32.95$ $Q \text{ кг.} = 8.929$ $D \text{ оп.мм.} = 150$ $P \text{ н.} = 913$ $P_{\text{вн.}} = 246.4$ Гр. сл. = VI Точн. = П
	БПЗ-1763 $F \text{ см}^2 = 31.04$ $Q \text{ кг.} = 8.42$ $D \text{ оп.мм.} = 141$ $P \text{ н.} = 375.4$ $P_{\text{вн.}} = 128.8$ Гр. сл. = VI Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1764 $F \text{ см}^2 = 1.343$ $Q \text{ кг.} = 0.364$ $D \text{ оп.мм.} = 14$ $P \text{ н.} = 44$ $P_{\text{вн.}} = 15.7$ Гр. сл. = IV Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1765 $F \text{ см}^2 = 0.872$ $Q \text{ кг.} = 0.236$ $D \text{ оп.мм.} = 20$ $P \text{ н.} = 62.8$ $P_{\text{вн.}} = 53.4$		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$

	БПЗ-1771		БПЗ-0
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-0		БПЗ-0
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1773		БПЗ-1778
	$F \text{ см}^2 = 2.112$ $Q \text{ кг.} = 0.573$ $D \text{ оп.мм.} = 49.8$ $P \text{ н.} = 184.5$ $P_{\text{вн.}} = 147$ Гр. сл. = VI Точн. = П		$F \text{ см}^2 = 5.616$ $Q \text{ кг.} = 1.522$ $D \text{ оп.мм.} = 38$ $P \text{ н.} = 119.4$ $P_{\text{вн.}} = 84.8$ Гр. сл. = V Точн. = П
	БПЗ-1774		БПЗ-1779
	$F \text{ см}^2 = 5.28$ $Q \text{ кг.} = 1.431$ $D \text{ оп.мм.} = 34$ $P \text{ н.} = 106.8$ $P_{\text{вн.}} = 69.1$ Гр. сл. = III Точн. = П		$F \text{ см}^2 = 3.035$ $Q \text{ кг.} = 0.822$ $D \text{ оп.мм.} = 61$ $P \text{ н.} = 219.4$ $P_{\text{вн.}} = 179.1$ Гр. сл. = VI Точн. = П
	БПЗ-0		БПЗ-0
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$

	БПЗ-1771		БПЗ-0
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-0		БПЗ-0
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1773		БПЗ-1778
	$F \text{ см}^2 = 2.112$ $Q \text{ кг.} = 0.573$ $D \text{ оп.мм.} = 49.8$ $P \text{ н.} = 184.5$ $P_{\text{вн.}} = 147$ Гр. сл. = VI Точн. = П		$F \text{ см}^2 = 5.616$ $Q \text{ кг.} = 1.522$ $D \text{ оп.мм.} = 38$ $P \text{ н.} = 119.4$ $P_{\text{вн.}} = 84.8$ Гр. сл. = V Точн. = П
	БПЗ-1774		БПЗ-1779
	$F \text{ см}^2 = 5.28$ $Q \text{ кг.} = 1.431$ $D \text{ оп.мм.} = 34$ $P \text{ н.} = 106.8$ $P_{\text{вн.}} = 69.1$ Гр. сл. = III Точн. = П		$F \text{ см}^2 = 3.035$ $Q \text{ кг.} = 0.822$ $D \text{ оп.мм.} = 61$ $P \text{ н.} = 219.4$ $P_{\text{вн.}} = 179.1$ Гр. сл. = VI Точн. = П
	БПЗ-0		БПЗ-0
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$

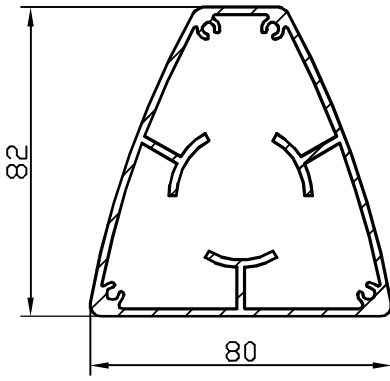
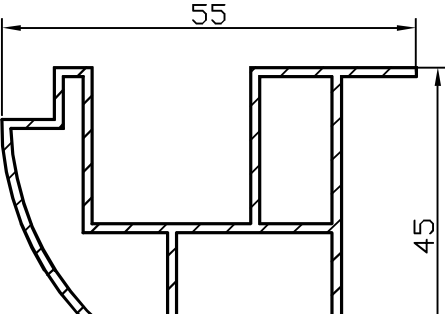
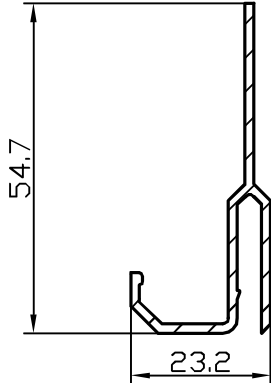
	БПЗ-1781 $F \text{ см}^2 = 2.689$ $Q \text{ кг.} = 0.729$ $D \text{ оп.мм.} = 35$ $P \text{ н.} = 98.3$ $P_{\text{вн.}} = 62$ Гр. сл. = IV Точн. = П		БПЗ-1786 $F \text{ см}^2 = 0.872$ $Q \text{ кг.} = 0.236$ $D \text{ оп.мм.} = 20$ $P \text{ н.} = 62.8$ $P_{\text{вн.}} = 53.4$ Гр. сл. = V Точн. = П
	БПЗ-1782 $F \text{ см}^2 = 23.91$ $Q \text{ кг.} = 6.48$ $D \text{ оп.мм.} = 147$ $P \text{ н.} = 333.1$ $P_{\text{вн.}} = 364$ Гр. сл. = особая Точн. = Н		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1783 $F \text{ см}^2 = 2.226$ $Q \text{ кг.} = 0.603$ $D \text{ оп.мм.} = 56$ $P \text{ н.} = 178.1$ $P_{\text{вн.}} = 121$ Гр. сл. = VI Точн. = П		БПЗ-1788 $F \text{ см}^2 = 2.267$ $Q \text{ кг.} = 0.614$ $D \text{ оп.мм.} = 64$ $P \text{ н.} = 240.1$ $P_{\text{вн.}} = 138.6$ Гр. сл. = VI Точн. = П
	БПЗ-1784 $F \text{ см}^2 = 2.06$ $Q \text{ кг.} = 0.558$ $D \text{ оп.мм.} = 61$ $P \text{ н.} = 175.7$ $P_{\text{вн.}} = 99$ Гр. сл. = VI Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = 0 Точн. = П
	БПЗ-1785 $F \text{ см}^2 = 0.73$ $Q \text{ кг.} = 0.198$ $D \text{ оп.мм.} = 17$ $P \text{ н.} = 53.4$ $P_{\text{вн.}} = 44$		БПЗ-1790 $F \text{ см}^2 = 5.183$ $Q \text{ кг.} = 1.405$ $D \text{ оп.мм.} = 85$ $P \text{ н.} = 378.9$ $P_{\text{вн.}} = 110.8$ Гр. сл. = особая Точн. = П

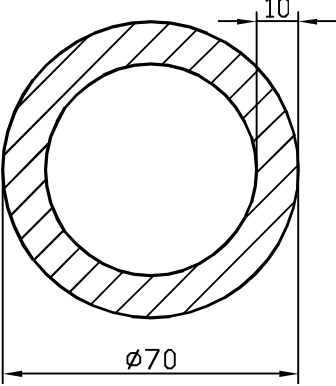
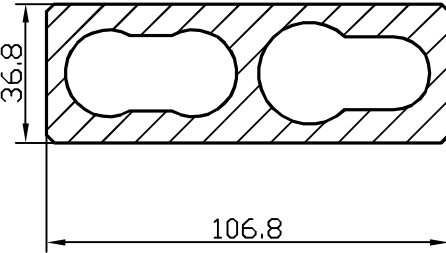
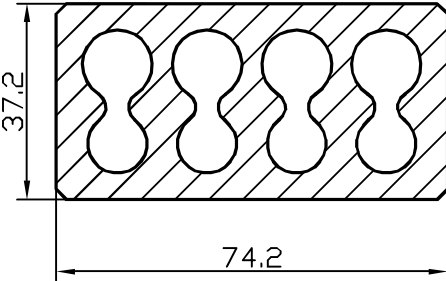
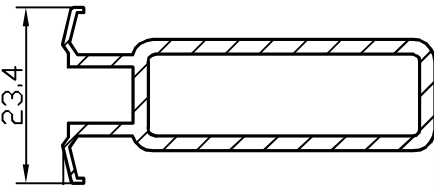
pdfMachine

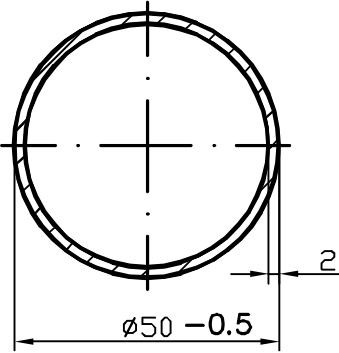
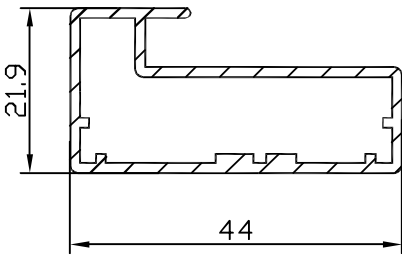
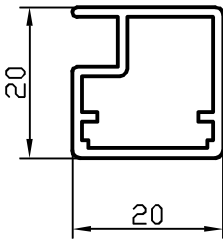
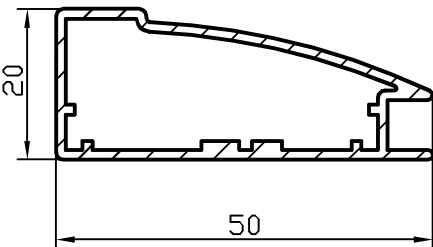
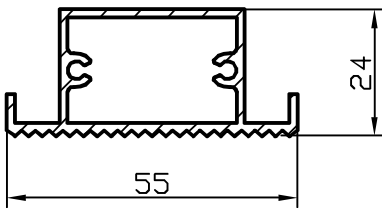
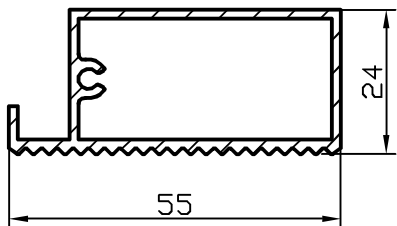
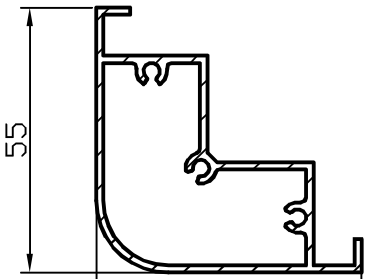
A pdf writer that produces quality PDF files with ease!

Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

Get yours now!

	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-1796 $F \text{ см}^2 = 7.19$ $Q \text{ кг.} = 1.95$ $D \text{ оп.мм.} = 102$ $P \text{ н.} = 274.9$ $P_{\text{вн.}} = 491.3$ Гр. сл. = V Точн. = П
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-1799 $F \text{ см}^2 = 1.54$ $Q \text{ кг.} = 0.417$ $D \text{ оп.мм.} = 58$ $P \text{ н.} = 208$ $P_{\text{вн.}} = 0$ Гр. сл. = VI Точн. = П
	БПЗ-1795 $F \text{ см}^2 = 2.425$ $Q \text{ кг.} = 0.657$ $D \text{ оп.мм.} = 63$ $P \text{ н.} = 225.7$ $P_{\text{вн.}} = 251.2$		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$

	БПЗ-1801 $F \text{ см}^2 = 18.85$ $Q \text{ кг.} = 5.108$ $D \text{ оп.мм.} = 70$ $P \text{ н.} = 219.9$ $P_{\text{вн.}} = 157.1$ $\Gamma \text{р. сл.} = \text{I}$ $\text{Точн.} = \text{П}$		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$
	БПЗ-1802 $F \text{ см}^2 = 21.18$ $Q \text{ кг.} = 5.74$ $D \text{ оп.мм.} = 110$ $P \text{ н.} = 282.5$ $P_{\text{вн.}} = 237.8$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$
	БПЗ-1803 $F \text{ см}^2 = 17.51$ $Q \text{ кг.} = 4.745$ $D \text{ оп.мм.} = 81$ $P \text{ н.} = 218.1$ $P_{\text{вн.}} = 294.5$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		БПЗ-1810 $F \text{ см}^2 = 2.47$ $Q \text{ кг.} = 0.669$ $D \text{ оп.мм.} = 51$ $P \text{ н.} = 167.2$ $P_{\text{вн.}} = 93.2$

	БПЗ-1811 $F \text{ см}^2 = 3.016$ $Q \text{ кг.} = 0.817$ $D \text{ оп.мм.} = 50$ $P \text{ н.} = 157.1$ $P_{\text{вн.}} = 144.5$ Гр. с.л. = V Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-1812 $F \text{ см}^2 = 1.882$ $Q \text{ кг.} = 0.51$ $D \text{ оп.мм.} = 48$ $P \text{ н.} = 141.5$ $P_{\text{вн.}} = 135.4$ Гр. с.л. = VI Точн. = П		БПЗ-1817 $F \text{ см}^2 = 1.107$ $Q \text{ кг.} = 0.291$ $D \text{ оп.мм.} = 29$ $P \text{ н.} = 89.9$ $P_{\text{вн.}} = 77.2$ Гр. с.л. = VI Точн. = П
	БПЗ-1813 $F \text{ см}^2 = 1.874$ $Q \text{ кг.} = 0.508$ $D \text{ оп.мм.} = 54$ $P \text{ н.} = 141.7$ $P_{\text{вн.}} = 129.3$ Гр. с.л. = V Точн. = П		БПЗ-1818 $F \text{ см}^2 = 2.676$ $Q \text{ кг.} = 0.725$ $D \text{ оп.мм.} = 58$ $P \text{ н.} = 193.3$ $P_{\text{вн.}} = 132.7$ Гр. с.л. = VI Точн. = П
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		БПЗ-1819 $F \text{ см}^2 = 2.601$ $Q \text{ кг.} = 0.705$ $D \text{ оп.мм.} = 58$ $P \text{ н.} = 182.3$ $P_{\text{вн.}} = 138.4$ Гр. с.л. = VI Точн. = П
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		БПЗ-1820 $F \text{ см}^2 = 3.386$ $Q \text{ кг.} = 0.918$ $D \text{ оп.мм.} = 78$ $P \text{ н.} = 234.4$ $P_{\text{вн.}} = 206.2$

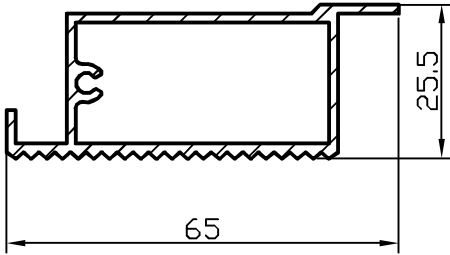
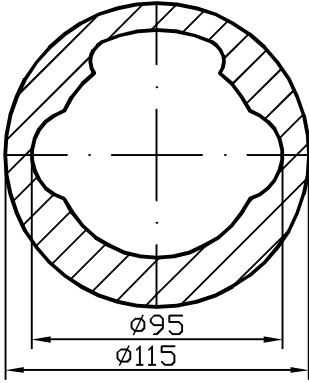
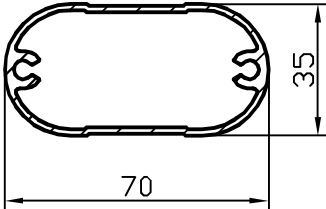
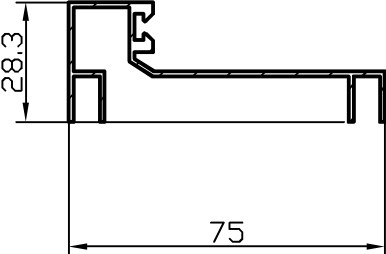
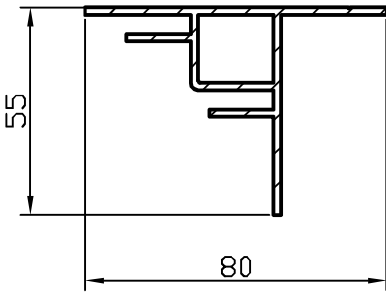
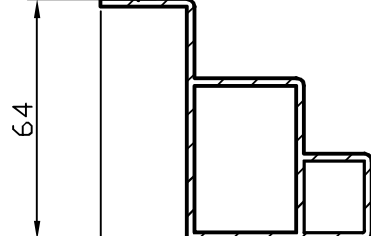
pdfMachine

A pdf writer that produces quality PDF files with ease!

Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

Get yours now!

VI
П

	БПЗ-0		БПЗ-0
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-1822		БПЗ-1827
	$F \text{ см}^2 = 2.807$ $Q \text{ кг.} = 0.761$ $D \text{ оп.мм.} = 70$ $P \text{ н.} = 204.4$ $P_{\text{вн.}} = 138.4$ Гр. с.л. = VI Точн. = П		$F \text{ см}^2 = 47.31$ $Q \text{ кг.} = 12.8$ $D \text{ оп.мм.} = 115$ $P \text{ н.} = 361.3$ $P_{\text{вн.}} = 284.2$ Гр. с.л. = IV Точн. = П
	БПЗ-1823		БПЗ-1828
	$F \text{ см}^2 = 3.797$ $Q \text{ кг.} = 1.03$ $D \text{ оп.мм.} = 70$ $P \text{ н.} = 180.8$ $P_{\text{вн.}} = 212.5$ Гр. с.л. = V Точн. = П		$F \text{ см}^2 = 2.16$ $Q \text{ кг.} = 0.585$ $D \text{ оп.мм.} = 81$ $P \text{ н.} = 336.2$ $P_{\text{вн.}} = 0$ Гр. с.л. = VI Точн. = П
	БПЗ-1824		БПЗ-0
	$F \text{ см}^2 = 4.131$ $Q \text{ кг.} = 1.12$ $D \text{ оп.мм.} = 86$ $P \text{ н.} = 337.4$ $P_{\text{вн.}} = 75.8$ Гр. с.л. = VI Точн. = П		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-1825		БПЗ-0
	$F \text{ см}^2 = 4.745$ $Q \text{ кг.} = 1.286$ $D \text{ оп.мм.} = 96$ $P \text{ н.} = 268.8$ $P_{\text{вн.}} = 201.8$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$

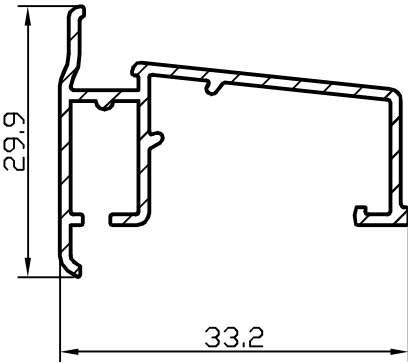
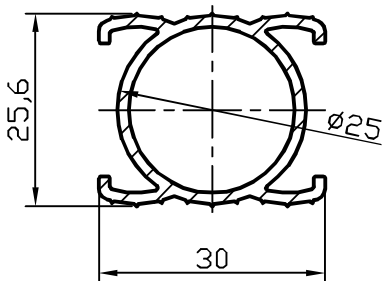
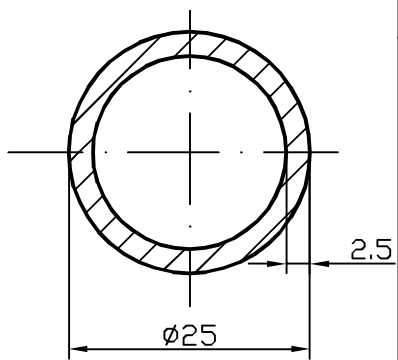
pdfMachine

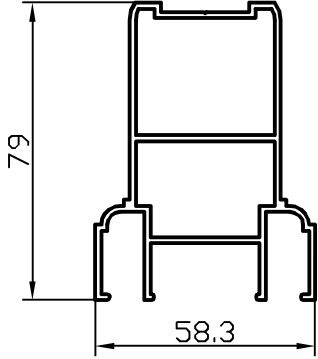
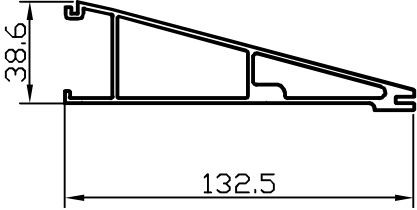
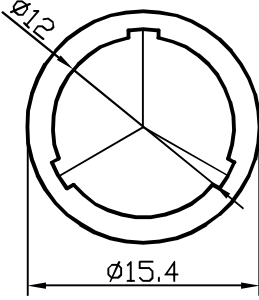
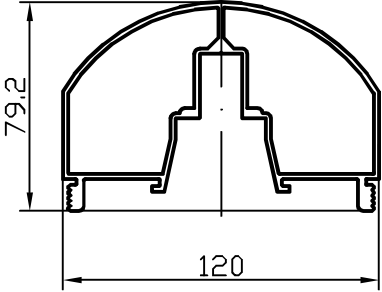
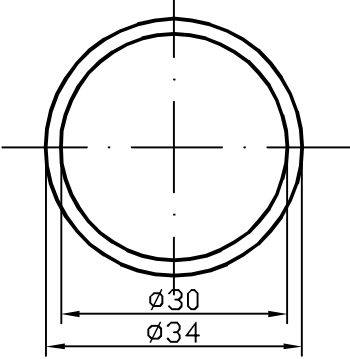
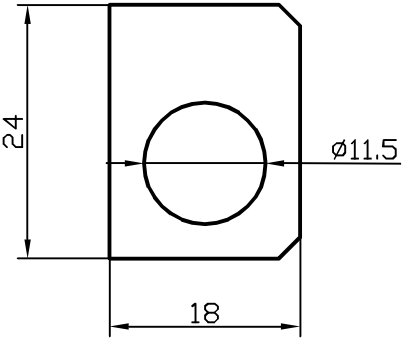
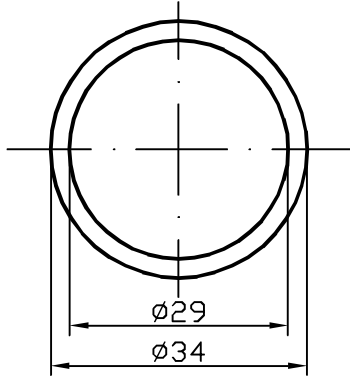
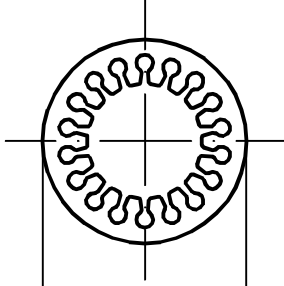
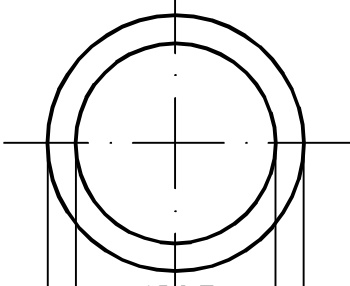
A pdf writer that produces quality PDF files with ease!

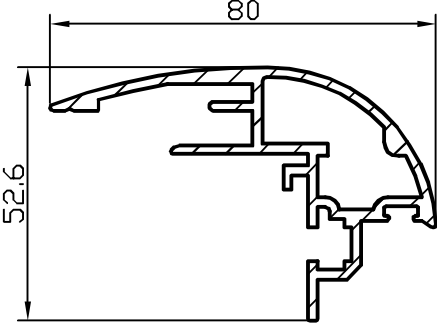
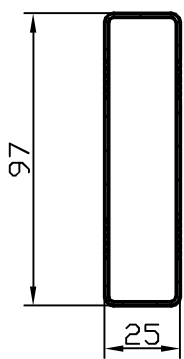
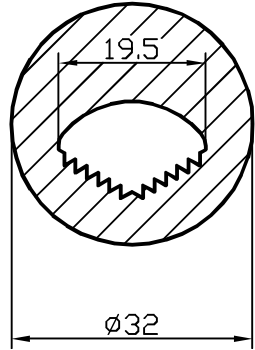
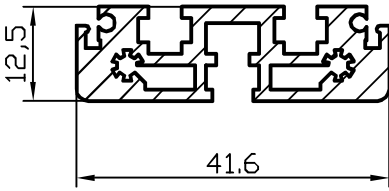
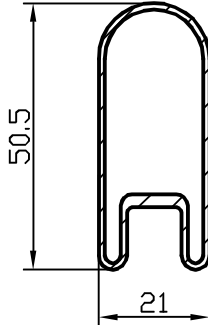
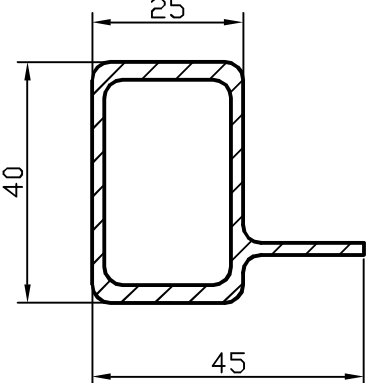
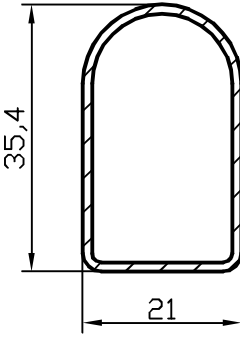
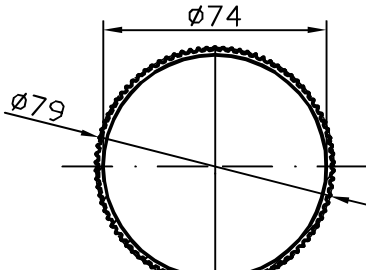
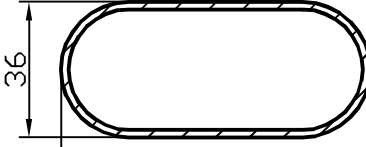
Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

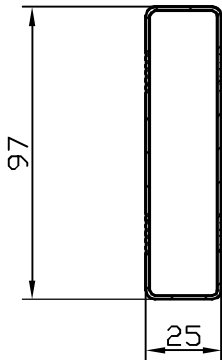
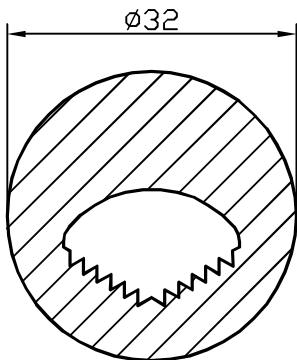
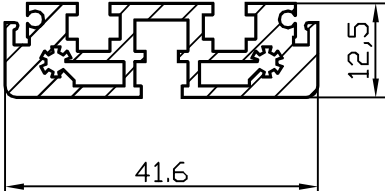
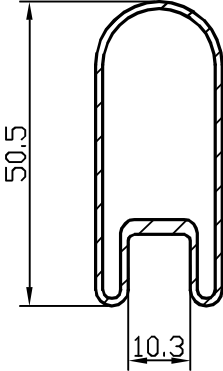
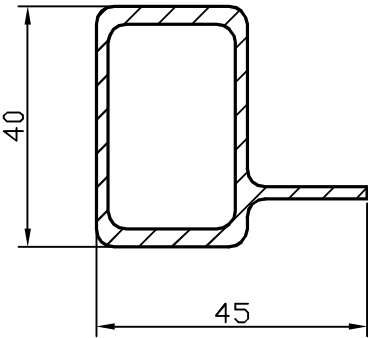
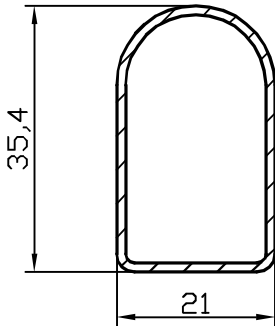
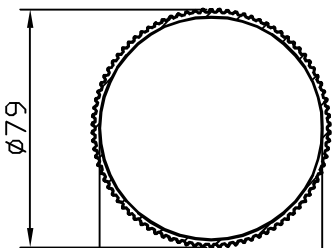
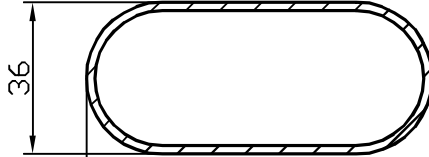
Get yours now!

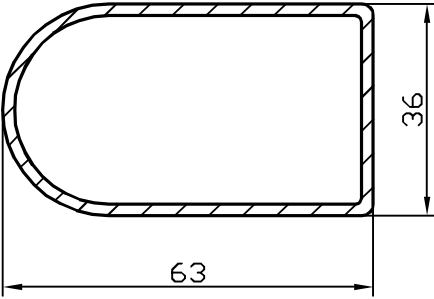
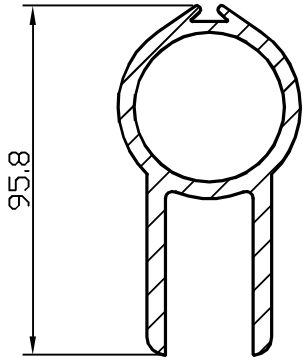
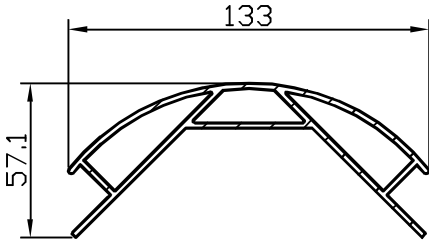
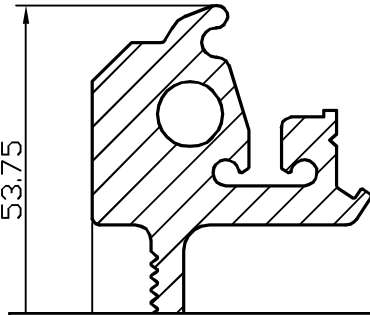
особая
П

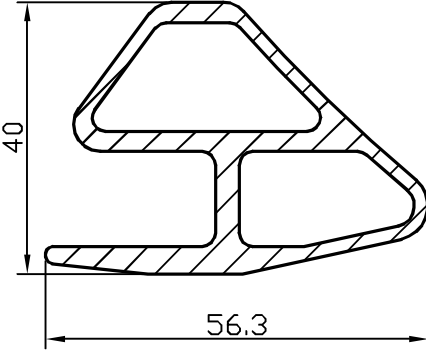
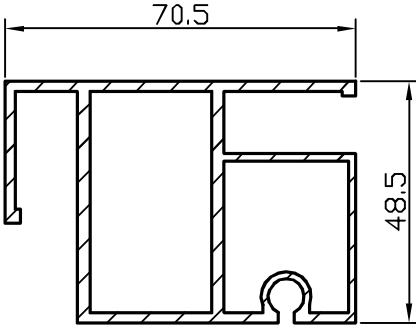
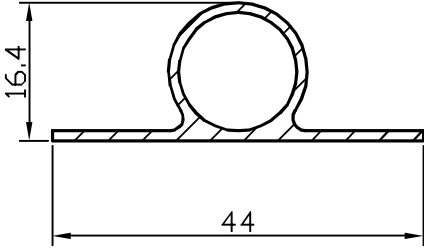
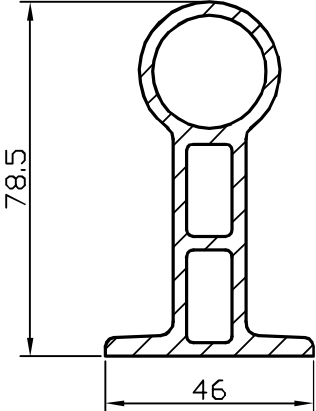
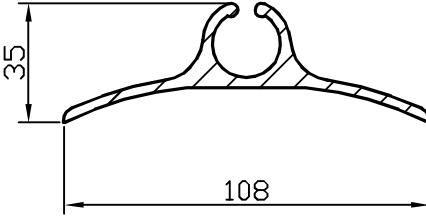
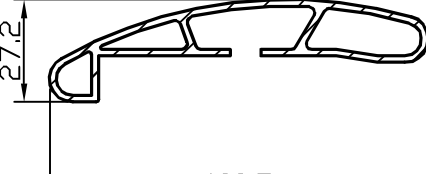
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-1836 $F \text{ см}^2 = 1.354$ $Q \text{ кг.} = 0.367$ $D \text{ оп.мм.} = 45$ $P \text{ н.} = 220.5$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1833 $F \text{ см}^2 = 1.76$ $Q \text{ кг.} = 0.477$ $D \text{ оп.мм.} = 37$ $P \text{ н.} = 162$ $P_{\text{вн.}} = 62$ Гр. сл. = IV Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1834 $F \text{ см}^2 = 1.767$ $Q \text{ кг.} = 0.479$ $D \text{ оп.мм.} = 25$ $P \text{ н.} = 78.5$ $P_{\text{вн.}} = 62.8$ Гр. сл. = IV Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$

	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-1846 $F \text{ см}^2 = 5.466$ $Q \text{ кг.} = 1.481$ $D \text{ оп.мм.} = 96$ $P \text{ н.} = 403.9$ $P_{\text{вн.}} = 269.1$ Гр. сл. = особая Точн. = П
	БПЗ-1842 $F \text{ см}^2 = 7.625$ $Q \text{ кг.} = 2.066$ $D \text{ оп.мм.} = 137$ $P \text{ н.} = 379.9$ $P_{\text{вн.}} = 266.8$ Гр. сл. = VI Точн. = П		БПЗ-1847 $F \text{ см}^2 = 0.702$ $Q \text{ кг.} = 0.19$ $D \text{ оп.мм.} = 15.4$ $P \text{ н.} = 48.4$ $P_{\text{вн.}} = 40.7$ Гр. сл. = особая Точн. = П
	БПЗ-1843 $F \text{ см}^2 = 10.481$ $Q \text{ кг.} = 2.84$ $D \text{ оп.мм.} = 127$ $P \text{ н.} = 508.4$ $P_{\text{вн.}} = 422.1$ Гр. сл. = особая Точн. = П		БПЗ-1848 $F \text{ см}^2 = 2.011$ $Q \text{ кг.} = 0.545$ $D \text{ оп.мм.} = 34$ $P \text{ н.} = 106.8$ $P_{\text{вн.}} = 94.3$ Гр. сл. = V Точн. = П
	БПЗ-1844 $F \text{ см}^2 = 3.24$ $Q \text{ кг.} = 0.88$ $D \text{ оп.мм.} = 29$ $P \text{ н.} = 81.7$ $P_{\text{вн.}} = 36.1$ Гр. сл. = V Точн. = П		БПЗ-1849 $F \text{ см}^2 = 2.474$ $Q \text{ кг.} = 0.67$ $D \text{ оп.мм.} = 34$ $P \text{ н.} = 106.8$ $P_{\text{вн.}} = 91.1$ Гр. сл. = V Точн. = П
	БПЗ-1845 $F \text{ см}^2 = 0.725$ $Q \text{ кг.} = 0.196$ $D \text{ оп.мм.} = 13.5$ $P \text{ н.} = 42.4$ $P_{\text{вн.}} = 98.1$		БПЗ-1850 $F \text{ см}^2 = 3.564$ $Q \text{ кг.} = 0.966$ $D \text{ оп.мм.} = 34$ $P \text{ н.} = 106.8$ $P_{\text{вн.}} = 83.3$

	БПЗ-1851 $F \text{ см}^2 = 5.0$ $Q \text{ кг.} = 1.36$ $D \text{ оп.мм.} = 85$ $P \text{ н.} = 348.3$ $P_{\text{вн.}} = 110.8$ Гр. с.л. = особая Точн. = П		БПЗ-1856 $F \text{ см}^2 = 2.998$ $Q \text{ кг.} = 0.813$ $D \text{ оп.мм.} = 99$ $P \text{ н.} = 242.4$ $P_{\text{вн.}} = 230.7$ Гр. с.л. = VI Точн. = П
	БПЗ-1852 $F \text{ см}^2 =$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		БПЗ-1857 $F \text{ см}^2 = 6.39$ $Q \text{ кг.} = 1.73$ $D \text{ оп.мм.} = 32$ $P \text{ н.} = 100.5$ $P_{\text{вн.}} = 68.7$ Гр. с.л. = V Точн. = П
	БПЗ-1853 $F \text{ см}^2 = 2.76$ $Q \text{ кг.} = 0.747$ $D \text{ оп.мм.} = 46$ $P \text{ н.} = 196.3$ $P_{\text{вн.}} = 74.4$ Гр. с.л. = особая Точн. = П		БПЗ-1858 $F \text{ см}^2 = 1.94$ $Q \text{ кг.} = 0.526$ $D \text{ оп.мм.} = 52$ $P \text{ н.} = 152.3$ $P_{\text{вн.}} = 147.2$ Гр. с.л. = VI Точн. = П
	БПЗ-1854 $F \text{ см}^2 = 3.3$ $Q \text{ кг.} = 0.894$ $D \text{ оп.мм.} = 55$ $P \text{ н.} = 162.3$ $P_{\text{вн.}} = 104.3$ Гр. с.л. = V Точн. = П		БПЗ-1859 $F \text{ см}^2 = 1.176$ $Q \text{ кг.} = 0.319$ $D \text{ оп.мм.} = 37$ $P \text{ н.} = 101.8$ $P_{\text{вн.}} = 94.2$ Гр. с.л. = V Точн. = П
	БПЗ-1855 $F \text{ см}^2 = 4.44$ $Q \text{ кг.} = 1.2$ $D \text{ оп.мм.} = 79$ $P \text{ н.} = 324.7$ $P_{\text{вн.}} = 232.5$		БПЗ-1860 $F \text{ см}^2 = 3.98$ $Q \text{ кг.} = 1.079$ $D \text{ оп.мм.} = 82$ $P \text{ н.} = 205.1$ $P_{\text{вн.}} = 192.5$ Гр. с.л. = V Точн. = П

	БПЗ-1851 $F \text{ см}^2 = 5$ $Q \text{ кг.} = 1.36$ $D \text{ оп.мм.} = 85$ $P \text{ н.} = 348.3$ $P_{\text{вн.}} = 110.8$ Гр. сл. = особая Точн. = П		БПЗ-1856 $F \text{ см}^2 = 2.998$ $Q \text{ кг.} = 0.813$ $D \text{ оп.мм.} = 99$ $P \text{ н.} = 242.4$ $P_{\text{вн.}} = 230.7$ Гр. сл. = VI Точн. = П
	БПЗ-1852 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-1857 $F \text{ см}^2 = 6.39$ $Q \text{ кг.} = 1.73$ $D \text{ оп.мм.} = 32$ $P \text{ н.} = 100.5$ $P_{\text{вн.}} = 68.7$ Гр. сл. = V Точн. = П
	БПЗ-1853 $F \text{ см}^2 = 2.76$ $Q \text{ кг.} = 0.747$ $D \text{ оп.мм.} = 46$ $P \text{ н.} = 196.3$ $P_{\text{вн.}} = 74.4$ Гр. сл. = особая Точн. = П		БПЗ-1858 $F \text{ см}^2 = 1.94$ $Q \text{ кг.} = 0.526$ $D \text{ оп.мм.} = 52$ $P \text{ н.} = 152.3$ $P_{\text{вн.}} = 147.2$ Гр. сл. = VI Точн. = П
	БПЗ-1854 $F \text{ см}^2 = 3.3$ $Q \text{ кг.} = 0.894$ $D \text{ оп.мм.} = 55$ $P \text{ н.} = 162.3$ $P_{\text{вн.}} = 104.9$ Гр. сл. = V Точн. = П		БПЗ-1859 $F \text{ см}^2 = 1.176$ $Q \text{ кг.} = 0.319$ $D \text{ оп.мм.} = 37$ $P \text{ н.} = 101.8$ $P_{\text{вн.}} = 94.2$ Гр. сл. = V Точн. = П
	БПЗ-1855 $F \text{ см}^2 = 4.44$ $Q \text{ кг.} = 1.2$ $D \text{ оп.мм.} = 79$ $P \text{ н.} = 324.7$ $P_{\text{вн.}} = 232.5$		БПЗ-1860 $F \text{ см}^2 = 3.98$ $Q \text{ кг.} = 1.079$ $D \text{ оп.мм.} = 82$ $P \text{ н.} = 205.1$ $P_{\text{вн.}} = 192.5$

	БПЗ-1861 $F \text{ см}^2 = 3.495$ $Q \text{ кг.} = 0.947$ $D \text{ оп.мм.} = 67$ $P \text{ н.} = 180.8$ $P_{\text{вн.}} = 167.4$ Гр. сл. = V Точн. = П		БПЗ-1866 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1862 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-1867 $F \text{ см}^2 = 10.2$ $Q \text{ кг.} = 2.76$ $D \text{ оп.мм.} = 97$ $P \text{ н.} = 323.1$ $P_{\text{вн.}} = 115.8$ Гр. сл. = IV Точн. = П
	БПЗ-1863 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-1868 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1864 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-1869 $F \text{ см}^2 = 7.986$ $Q \text{ кг.} = 2.164$ $D \text{ оп.мм.} = 136$ $P \text{ н.} = 403.5$ $P_{\text{вн.}} = 335.2$ Гр. сл. = особая Точн. = П
	БПЗ-1865 $F \text{ см}^2 = 8.254$ $Q \text{ кг.} = 2.24$ $D \text{ оп.мм.} = 56$ $P \text{ н.} = 233$ $P_{\text{вн.}} = 31.4$		БПЗ-1870 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$

	БПЗ-1871 $F \text{ см}^2 = 5.145$ $Q \text{ кг.} = 1.394$ $D \text{ оп.мм.} = 60$ $R \text{ н.} = 198.2$ $R_{\text{вн.}} = 157.7$ Гр. сл. = особая Точн. = П		БПЗ-1876 $F \text{ см}^2 = 6.434$ $Q \text{ кг.} = 1.744$ $D \text{ оп.мм.} = 86$ $R \text{ н.} = 367.9$ $R_{\text{вн.}} = 261.8$ Гр. сл. = особая Точн. = П
	БПЗ-1872 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $R \text{ н.} = 0$ $R_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-1877 $F \text{ см}^2 = 1.08$ $Q \text{ кг.} = 0.293$ $D \text{ оп.мм.} = 44$ $R \text{ н.} = 116.6$ $R_{\text{вн.}} = 44$ Гр. сл. = V Точн. = П
	БПЗ-1873 $F \text{ см}^2 = 7.633$ $Q \text{ кг.} = 2.07$ $D \text{ оп.мм.} = 85$ $R \text{ н.} = 250.2$ $R_{\text{вн.}} = 195.3$ Гр. сл. = VI Точн. = П		БПЗ-1878 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $R \text{ н.} = 0$ $R_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1874 $F \text{ см}^2 = 5.83$ $Q \text{ кг.} = 1.58$ $D \text{ оп.мм.} = 108$ $R \text{ н.} = 309.4$ $R_{\text{вн.}} = 0$ Гр. сл. = V Точн. = П		БПЗ-1879 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $R \text{ н.} = 0$ $R_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1875 $F \text{ см}^2 = 4.351$ $Q \text{ кг.} = 1.18$ $D \text{ оп.мм.} = 100.5$ $R \text{ н.} = 297.7$ $R_{\text{вн.}} = 161.5$		БПЗ-1880 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $R \text{ н.} = 0$ $R_{\text{вн.}} = 0$

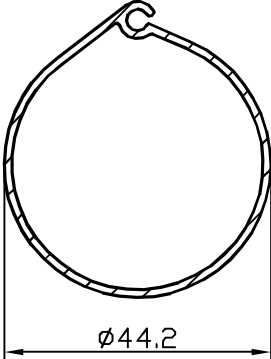
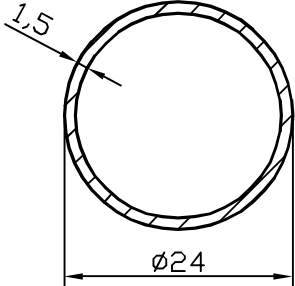
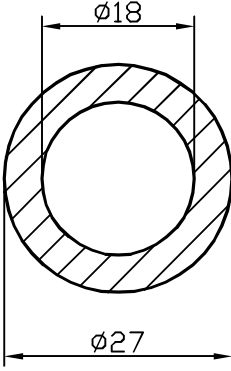
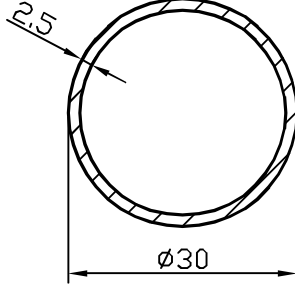
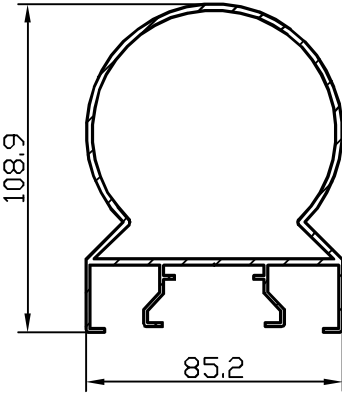
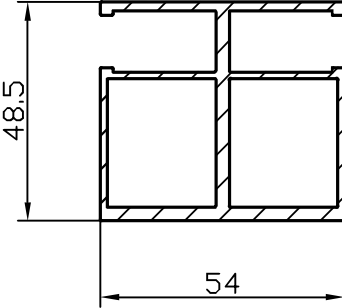
pdfMachine

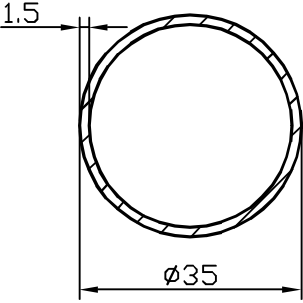
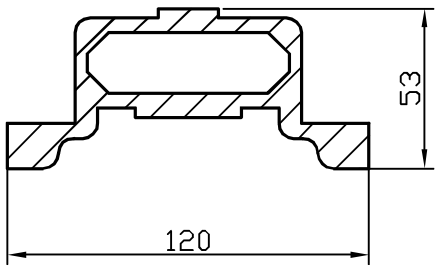
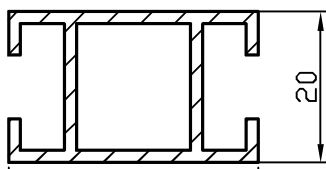
A pdf writer that produces quality PDF files with ease!

Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

Get yours now!

особая
П

	БПЗ-1881 $F \text{ см}^2 = 1.885$ $Q \text{ кг.} = 0.511$ $D \text{ оп.мм.} = 50$ $P \text{ н.} = 154.4$ $P_{\text{вн.}} = 133.7$ Гр. сл. = особая Точн. = П		БПЗ-1886 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1882 $F \text{ см}^2 = 1.06$ $Q \text{ кг.} = 0.287$ $D \text{ оп.мм.} = 24$ $P \text{ н.} = 75.4$ $P_{\text{вн.}} = 66$ Гр. сл. = IV Точн. = П		БПЗ-1887 $F \text{ см}^2 = 3.18$ $Q \text{ кг.} = 0.862$ $D \text{ оп.мм.} = 27$ $P \text{ н.} = 84.8$ $P_{\text{вн.}} = 56.6$ Гр. сл. = IV Точн. = П
	БПЗ-1883 $F \text{ см}^2 = 2.116$ $Q \text{ кг.} = 0.573$ $D \text{ оп.мм.} = 30$ $P \text{ н.} = 94.2$ $P_{\text{вн.}} = 78.5$ Гр. сл. = IV Точн. = П		БПЗ-1888 $F \text{ см}^2 = 7.838$ $Q \text{ кг.} = 2.124$ $D \text{ оп.мм.} = 126$ $P \text{ н.} = 555.2$ $P_{\text{вн.}} = 307.4$ Гр. сл. = V Точн. = П
	БПЗ-1884 $F \text{ см}^2 = 5.737$ $Q \text{ кг.} = 1.555$ $D \text{ оп.мм.} = 77$ $P \text{ н.} = 312.9$ $P_{\text{вн.}} = 209$ Гр. сл. = VI Точн. = П		БПЗ-1889 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1885 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		БПЗ-1890 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$

	БПЗ-1891		БПЗ-1896
	$F \text{ см}^2 = 1.579$ $Q \text{ кг.} = 0.428$ $D \text{ оп.мм.} = 35$ $P \text{ н.} = 110$ $P_{\text{вн.}} = 100.5$ $\text{Гр. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\text{Гр. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$
	БПЗ-1892		БПЗ-1897
	$F \text{ см}^2 = 18$ $Q \text{ кг.} = 4.88$ $D \text{ оп.мм.} = 121$ $P \text{ н.} = 374.8$ $P_{\text{вн.}} = 198.5$ $\text{Гр. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\text{Гр. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$
	БПЗ-1893		БПЗ-1898
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\text{Гр. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\text{Гр. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$
	БПЗ-1894		БПЗ-1899
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\text{Гр. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 2.82$ $Q \text{ кг.} = 0.764$ $D \text{ оп.мм.} = 77$ $P \text{ н.} = 192.6$ $P_{\text{вн.}} = 182.8$ $\text{Гр. сл.} = \text{IV}$ $\text{Точн.} = \text{П}$
	БПЗ-1895		БПЗ-1900
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		$F \text{ см}^2 = 1.866$ $Q \text{ кг.} = 0.506$ $D \text{ оп.мм.} = 39$ $P \text{ н.} = 169.2$ $P_{\text{вн.}} = 64$

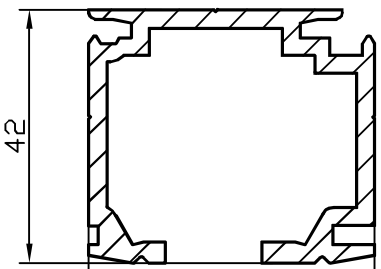
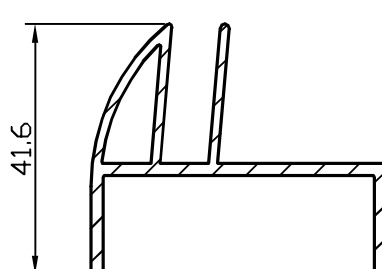
pdfMachine

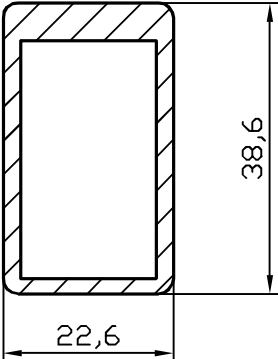
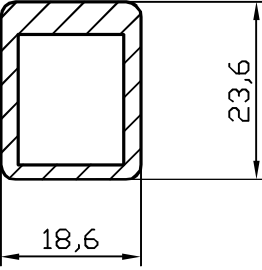
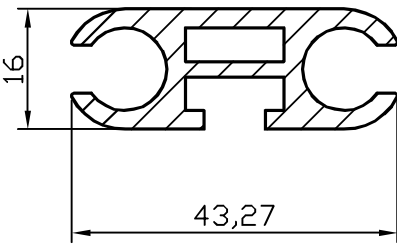

A pdf writer that produces quality PDF files with ease!

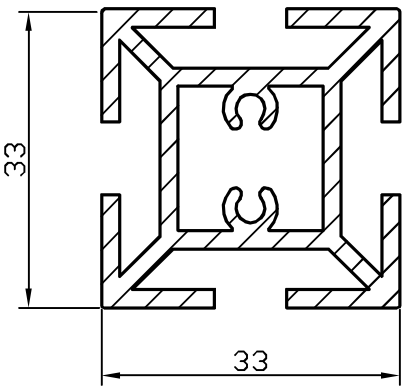
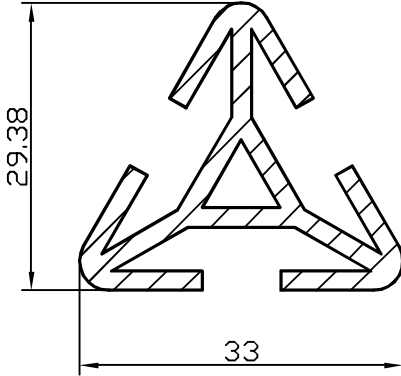
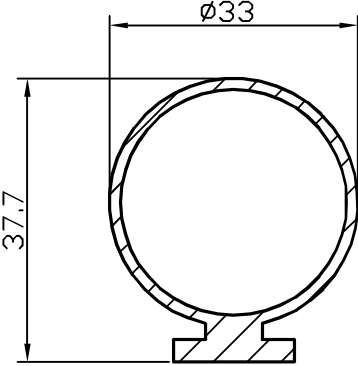
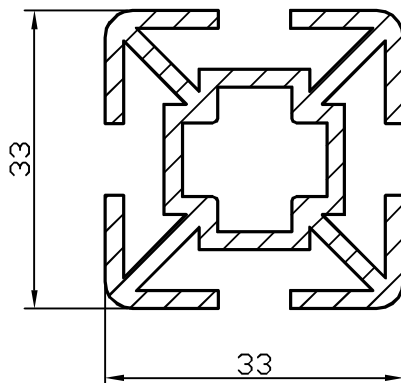
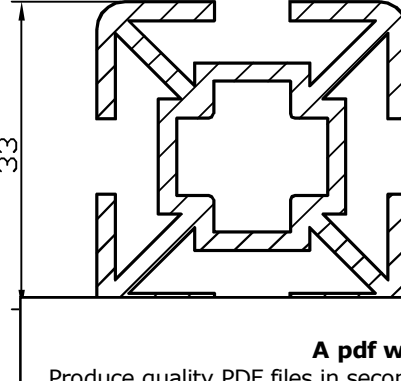
Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

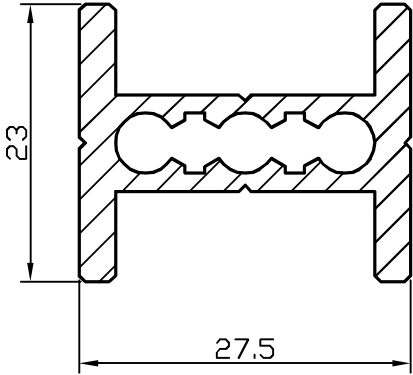
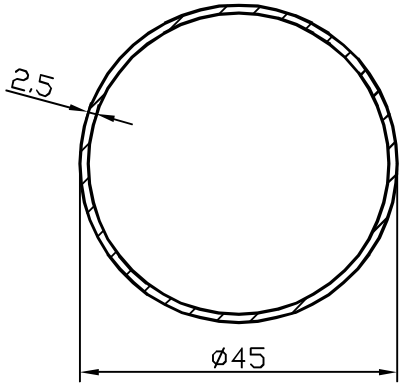
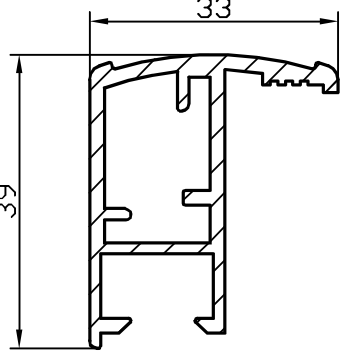
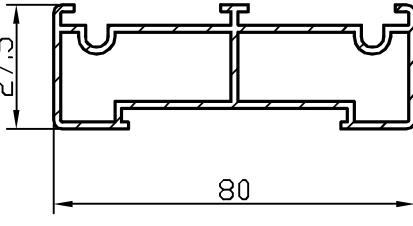
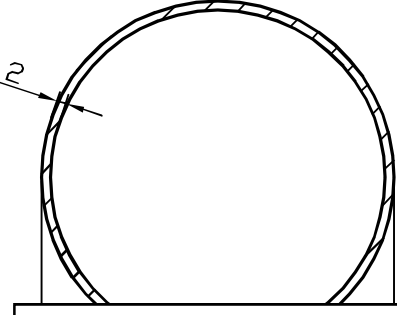
Get yours now!

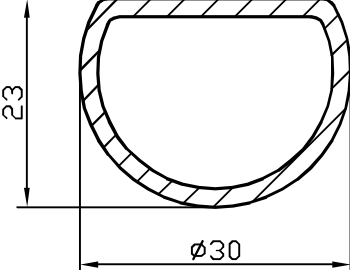
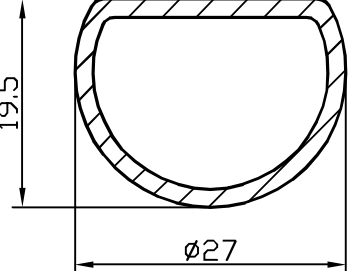
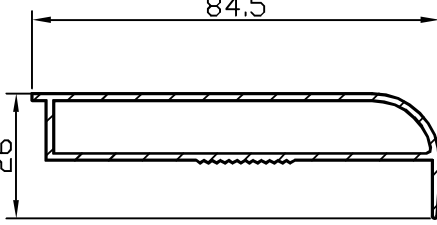
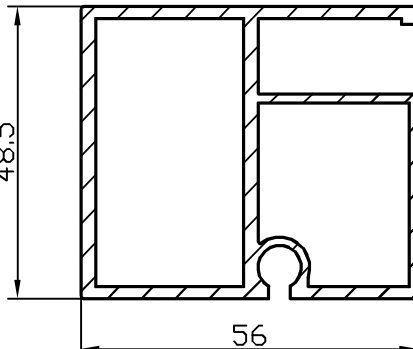
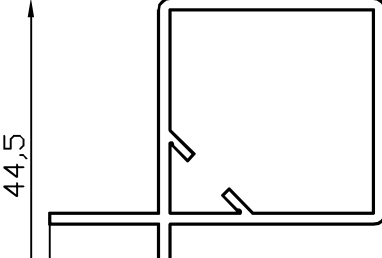
VI
П

	БПЗ-1901		БПЗ-1906
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-1902		БПЗ-1907
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-1903		БПЗ-1908
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-1904		БПЗ-1909
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-1905		БПЗ-1910
	$F \text{ см}^2 = 5.019$ $Q \text{ кг.} = 1.36$ $D \text{ оп.мм.} = 63$ $P \text{ н.} = 351.2$ $P_{\text{вн.}} = 0$		$F \text{ см}^2 = 2.695$ $Q \text{ кг.} = 0.73$ $D \text{ оп.мм.} = 58$ $P \text{ н.} = 251.5$ $P_{\text{вн.}} = 50.5$
pdfMachine A pdf writer that produces quality PDF files with ease! Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine. Get yours now!			
			VI П

	БПЗ-1911		БПЗ-1916
	$F \text{ см}^2 = 3$ $Q \text{ кг.} = 0.813$ $D \text{ оп.мм.} = 43$ $P \text{ н.} = 119$ $P_{\text{вн.}} = 99.2$ $\text{Гр. сл.} = \text{IV}$ $\text{Точн.} = \text{особой}$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\text{Гр. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$
	БПЗ-1912		БПЗ-1917
	$F \text{ см}^2 = 1.933$ $Q \text{ кг.} = 0.54$ $D \text{ оп.мм.} = 29$ $P \text{ н.} = 81$ $P_{\text{вн.}} = 62.6$ $\text{Гр. сл.} = \text{IV}$ $\text{Точн.} = \text{особой}$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\text{Гр. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$
	БПЗ-1913		БПЗ-1918
	$F \text{ см}^2 = 3.03$ $Q \text{ кг.} = 0.82$ $D \text{ оп.мм.} = 44$ $P \text{ н.} = 183.7$ $P_{\text{вн.}} = 35$ $\text{Гр. сл.} = \text{IV}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\text{Гр. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$
	БПЗ-1914		БПЗ-1919
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\text{Гр. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\text{Гр. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$
	БПЗ-1915		БПЗ-1920
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		$F \text{ см}^2 = 6.722$ $Q \text{ кг.} = 1.822$ $D \text{ оп.мм.} = 106$ $P \text{ н.} = 352.8$ $P_{\text{вн.}} = 343.2$ $\text{Гр. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$

	БПЗ-1921 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-1926 $F \text{ см}^2 = 4.096$ $Q \text{ кг.} = 1.11$ $D \text{ оп.мм.} = 47$ $P \text{ н.} = 307.8$ $P_{\text{вн.}} = 99.6$ Гр. сл. = IV Точн. = П
	БПЗ-1922 $F \text{ см}^2 = 2.596$ $Q \text{ кг.} = 0.703$ $D \text{ оп.мм.} = 38$ $P \text{ н.} = 229.8$ $P_{\text{вн.}} = 23.9$ Гр. сл. = V Точн. = П		БПЗ-1927 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1923 $F \text{ см}^2 = 2.105$ $Q \text{ кг.} = 0.57$ $D \text{ оп.мм.} = 40$ $P \text{ н.} = 130.7$ $P_{\text{вн.}} = 94.2$ Гр. сл. = V Точн. = П		БПЗ-1928 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1924 $F \text{ см}^2 = 4.071$ $Q \text{ кг.} = 1.1$ $D \text{ оп.мм.} = 44$ $P \text{ н.} = 331.3$ $P_{\text{вн.}} = 63.1$ Гр. сл. = IV Точн. = П		БПЗ-1929 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1925 $F \text{ см}^2 = 4.11$ $Q \text{ кг.} = 1.114$ $D \text{ оп.мм.} = 46$ $P \text{ н.} = 333.6$ $P_{\text{вн.}} = 63.14$		БПЗ-1930 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$

	БПЗ-1931 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		БПЗ-1936 $F \text{ см}^2 = 2.206$ $Q \text{ кг.} = 0.598$ $D \text{ оп.мм.} = 36$ $P \text{ н.} = 130.3$ $P_{\text{вн.}} = 58.4$ Гр. с.л. = V Точн. = П
	БПЗ-1932 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		БПЗ-1937 $F \text{ см}^2 = 3.338$ $Q \text{ кг.} = 0.905$ $D \text{ оп.мм.} = 45$ $P \text{ н.} = 141.4$ $P_{\text{вн.}} = 125.7$ Гр. с.л. = V Точн. = П
	БПЗ-1933 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		БПЗ-1938 $F \text{ см}^2 = 2.58$ $Q \text{ кг.} = 0.7$ $D \text{ оп.мм.} = 49$ $P \text{ н.} = 181$ $P_{\text{вн.}} = 93.1$ Гр. с.л. = V Точн. = П
	БПЗ-1934 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		БПЗ-1939 $F \text{ см}^2 = 3.957$ $Q \text{ кг.} = 1.07$ $D \text{ оп.мм.} = 84$ $P \text{ н.} = 280.9$ $P_{\text{вн.}} = 243.8$ Гр. с.л. = особая Точн. = П
	БПЗ-1935 $F \text{ см}^2 = 4.77$ $Q \text{ кг.} = 1.293$ $D \text{ оп.мм.} = 78$ $P \text{ н.} = 245$ $P_{\text{вн.}} = 232.5$		БПЗ-1940 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$

	БПЗ-1941 $F \text{ см}^2 = 1.659$ $Q \text{ кг.} = 0.45$ $D \text{ оп.мм.} = 30$ $P \text{ н.} = 89.1$ $P_{\text{вн.}} = 76$ Гр. с.л. = V Точн. = П		БПЗ-1946 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-1942 $F \text{ см}^2 = 3.136$ $Q \text{ кг.} = 0.85$ $D \text{ оп.мм.} = 27$ $P \text{ н.} = 78.4$ $P_{\text{вн.}} = 43.8$ Гр. с.л. = III Точн. = П		БПЗ-1947 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-1943 $F \text{ см}^2 = 2.946$ $Q \text{ кг.} = 0.798$ $D \text{ оп.мм.} = 89$ $P \text{ н.} = 217.4$ $P_{\text{вн.}} = 172.9$ Гр. с.л. = VI Точн. = П		БПЗ-1948 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-1944 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		БПЗ-1949 $F \text{ см}^2 = 5.499$ $Q \text{ кг.} = 1.49$ $D \text{ оп.мм.} = 74$ $P \text{ н.} = 282.9$ $P_{\text{вн.}} = 248.4$ Гр. с.л. = VI Точн. = П
	БПЗ-1945 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		БПЗ-1950 $F \text{ см}^2 = 2.223$ $Q \text{ кг.} = 0.602$ $D \text{ оп.мм.} = 55$ $P \text{ н.} = 176.1$ $P_{\text{вн.}} = 123$

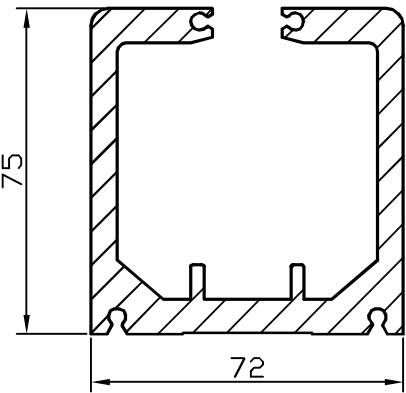
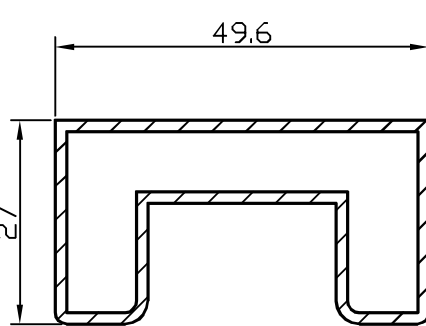
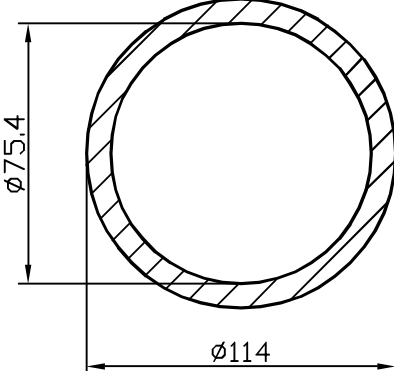
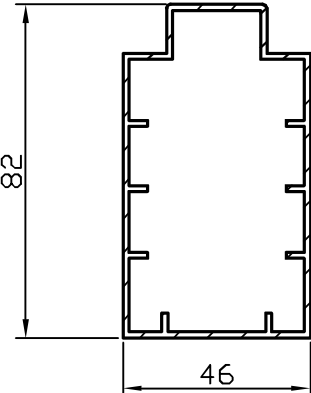
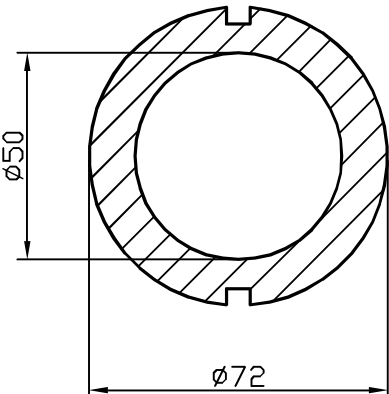
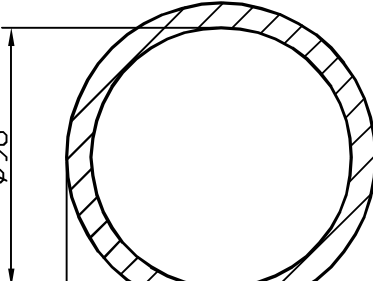
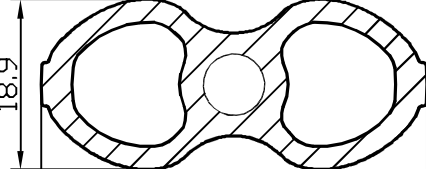
pdfMachine

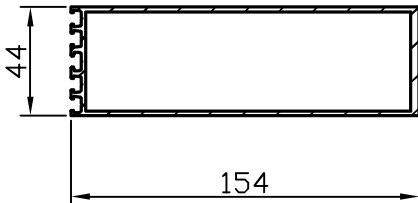
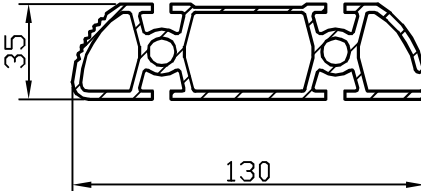
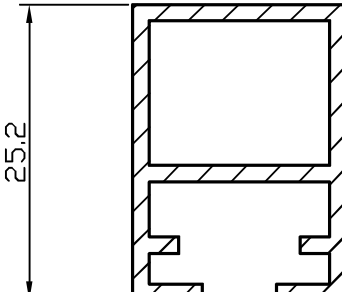
A pdf writer that produces quality PDF files with ease!

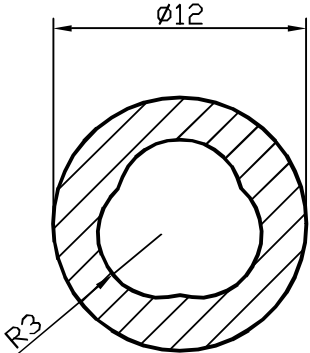
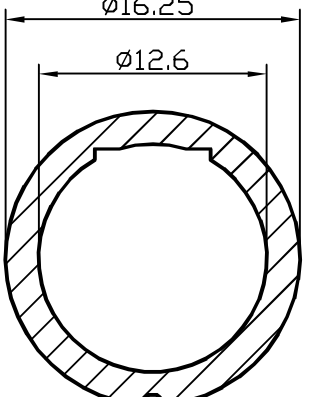
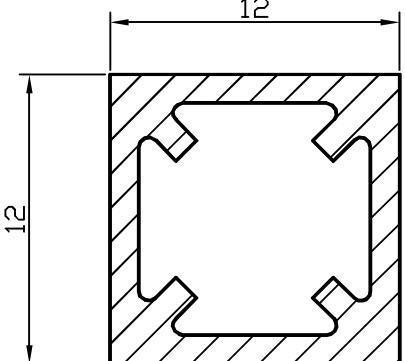
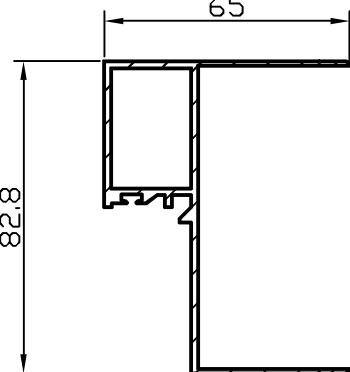
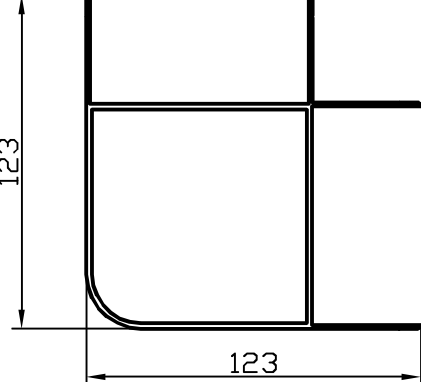
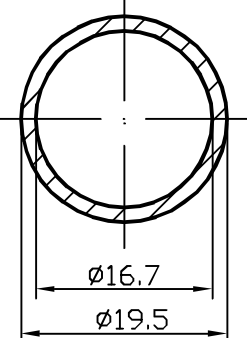
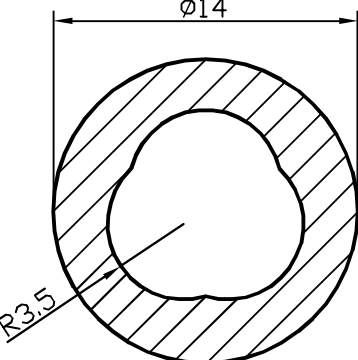
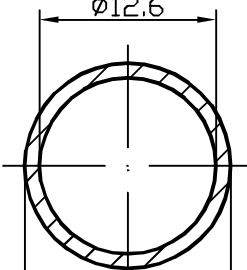
Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

Get yours now!

VI
П

	БПЗ-1951 $F \text{ см}^2 = 17.84$ $Q \text{ кг.} = 4.835$ $D \text{ оп.мм.} = 103$ $P \text{ н.} = 569.7$ $P_{\text{вн.}} = 0$ Гр. с.л. = V Точн. = П		БПЗ-1956 $F \text{ см}^2 = 2.649$ $Q \text{ кг.} = 0.718$ $D \text{ оп.мм.} = 57$ $P \text{ н.} = 181.3$ $P_{\text{вн.}} = 171.9$ Гр. с.л. = V Точн. = П
	БПЗ-1952 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		БПЗ-1957 $F \text{ см}^2 = 57.42$ $Q \text{ кг.} = 15.56$ $D \text{ оп.мм.} = 114$ $P \text{ н.} = 358.1$ $P_{\text{вн.}} = 236.9$ Гр. с.л. = V Точн. = П
	БПЗ-1953 $F \text{ см}^2 = 4.286$ $Q \text{ кг.} = 1.162$ $D \text{ оп.мм.} = 91$ $P \text{ н.} = 255.1$ $P_{\text{вн.}} = 316$ Гр. с.л. = VI Точн. = П		БПЗ-1958 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-1954 $F \text{ см}^2 = 17.81$ $Q \text{ кг.} = 4.827$ $D \text{ оп.мм.} = 72$ $P \text{ н.} = 241.7$ $P_{\text{вн.}} = 157$ Гр. с.л. = V Точн. = П		БПЗ-1959 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-1955 $F \text{ см}^2 = 29.69$ $Q \text{ кг.} = 8.045$ $D \text{ оп.мм.} = 114$ $P \text{ н.} = 358.1$ $P_{\text{вн.}} = 301.6$		БПЗ-1960 $F \text{ см}^2 = 3.095$ $Q \text{ кг.} = 0.839$ $D \text{ оп.мм.} = 43$ $P \text{ н.} = 108.8$ $P_{\text{вн.}} = 105.8$

	БПЗ-1961		БПЗ-1966
	F см ² = 9.038 Q кг. = 2.449 D оп.мм.= 161.1 Р н. = 467 Рвн. = 376 Гр. сл. = IV Точн. = П		F см ² = 12.839 Q кг. = 3.479 D оп.мм.= 130 Р н. = 532.8 Рвн. = 288.3 Гр. сл. = особая Точн. = П
	БПЗ-1962		БПЗ-1967
	F см ² = 0 Q кг. = 0 D оп.мм.= 0 Р н. = 0 Рвн. = 0 Гр. сл. = особая Точн. = П		F см ² = 0 Q кг. = 0 D оп.мм.= 0 Р н. = 0 Рвн. = 0 Гр. сл. = особая Точн. = П
	БПЗ-1963		БПЗ-1968
	F см ² = 0 Q кг. = 0 D оп.мм.= 0 Р н. = 0 Рвн. = 0 Гр. сл. = особая Точн. = П		F см ² = 0 Q кг. = 0 D оп.мм.= 0 Р н. = 0 Рвн. = 0 Гр. сл. = особая Точн. = П
	БПЗ-1964		БПЗ-1969
	F см ² = 0 Q кг. = 0 D оп.мм.= 0 Р н. = 0 Рвн. = 0 Гр. сл. = особая Точн. = П		F см ² = 0 Q кг. = 0 D оп.мм.= 0 Р н. = 0 Рвн. = 0 Гр. сл. = особая Точн. = П
	БПЗ-1965		БПЗ-1970
	F см ² = 0 Q кг. = 0 D оп.мм.= 0 Р н. = 0 Рвн. = 0		F см ² = 1.33 Q кг. = 0.36 D оп.мм.= 31 Р н. = 134.8 Рвн. = 55.2

	БПЗ-1971 $F \text{ см}^2 = 0.682$ $Q \text{ кг.} = 0.185$ $D \text{ оп.мм.} = 12$ $P \text{ н.} = 37.7$ $P_{\text{вн.}} = 24.1$ Гр. сл. = VI Точн. = П		БПЗ-1976 $F \text{ см}^2 = 0.814$ $Q \text{ кг.} = 0.221$ $D \text{ оп.мм.} = 16.5$ $P \text{ н.} = 51.5$ $P_{\text{вн.}} = 40.5$ Гр. сл. = V Точн. = П
	БПЗ-1972 $F \text{ см}^2 = 0.654$ $Q \text{ кг.} = 0.177$ $D \text{ оп.мм.} = 18$ $P \text{ н.} = 48$ $P_{\text{вн.}} = 46$ Гр. сл. = V Точн. = П		БПЗ-1977 $F \text{ см}^2 = 4.166$ $Q \text{ кг.} = 1.129$ $D \text{ оп.мм.} = 105$ $P \text{ н.} = 401.4$ $P_{\text{вн.}} = 106.4$ Гр. сл. = особая Точн. = особая
	БПЗ-1973 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-1978 $F \text{ см}^2 = 8.547$ $Q \text{ кг.} = 2.316$ $D \text{ оп.мм.} = 173$ $P \text{ н.} = 643.9$ $P_{\text{вн.}} = 307.9$ Гр. сл. = VI Точн. = особая
	БПЗ-1974 $F \text{ см}^2 = 0.796$ $Q \text{ кг.} = 0.216$ $D \text{ оп.мм.} = 19.5$ $P \text{ н.} = 61.3$ $P_{\text{вн.}} = 52.5$ Гр. сл. = V Точн. = П		БПЗ-1979 $F \text{ см}^2 = 0.818$ $Q \text{ кг.} = 0.222$ $D \text{ оп.мм.} = 14$ $P \text{ н.} = 44$ $P_{\text{вн.}} = 31$ Гр. сл. = V Точн. = П
	БПЗ-1975 $F \text{ см}^2 = 0.866$ $Q \text{ кг.} = 0.235$ $D \text{ оп.мм.} = 16.5$ $P \text{ н.} = 51.5$ $P_{\text{вн.}} = 39.6$		БПЗ-1980 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$

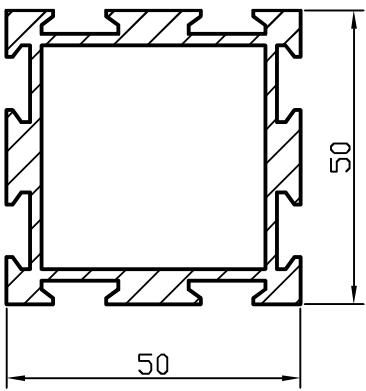
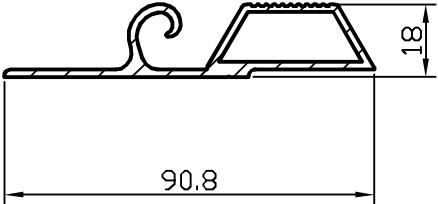
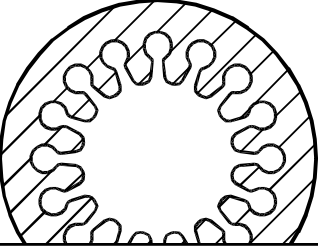
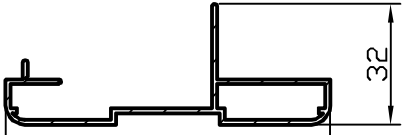
pdfMachine

A pdf writer that produces quality PDF files with ease!

Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

Get yours now!

особая
П

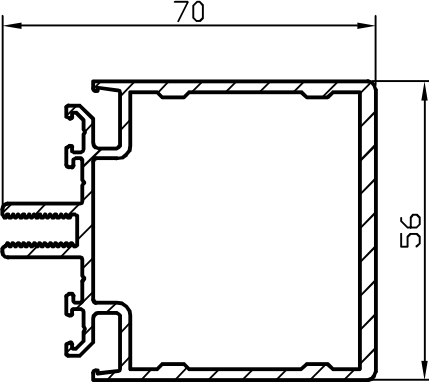
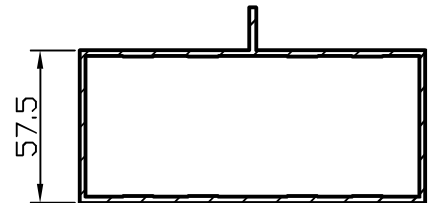
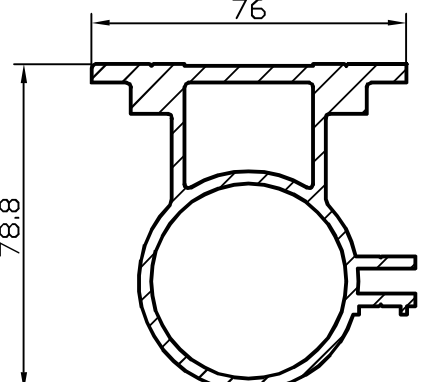
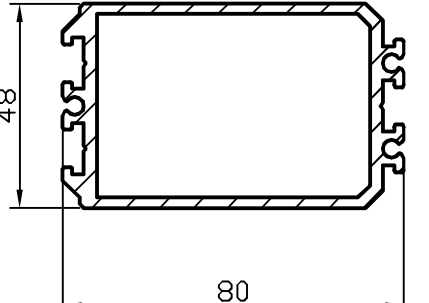
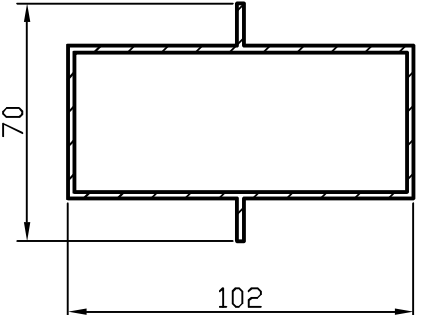
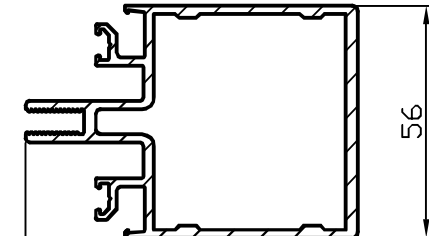
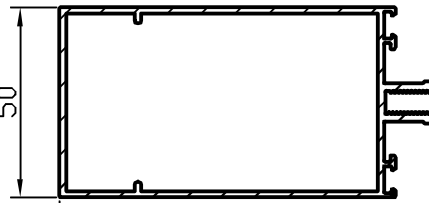
	БПЗ-1981 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-1986 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1982 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-1987 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1983 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-1988 $F \text{ см}^2 = 6.96$ $Q \text{ кг.} = 1.886$ $D \text{ оп.мм.} = 71$ $P \text{ н.} = 312$ $P_{\text{вн.}} = 152$ Гр. сл. = IV Точн. = П
	БПЗ-1984 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-1989 $F \text{ см}^2 = 3.5$ $Q \text{ кг.} = 0.949$ $D \text{ оп.мм.} = 91$ $P \text{ н.} = 260.6$ $P_{\text{вн.}} = 84.5$ Гр. сл. = VI Точн. = П
	БПЗ-1985 $F \text{ см}^2 = 0.715$ $Q \text{ кг.} = 0.194$ $D \text{ оп.мм.} = 12.5$ $P \text{ н.} = 39.3$ $P_{\text{вн.}} = 85.3$		БПЗ-1990 $F \text{ см}^2 = 2.527$ $Q \text{ кг.} = 0.685$ $D \text{ оп.мм.} = 87$ $P \text{ н.} = 296.1$ $P_{\text{вн.}} = 77.3$ Гр. сл. = VI Точн. = П

pdfMachine

A pdf writer that produces quality PDF files with ease!

Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

Get yours now!

	БПЗ-1991 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-1996 $F \text{ см}^2 = 6.34$ $Q \text{ кг.} = 1.718$ $D \text{ оп.мм.} = 81$ $P \text{ н.} = 378$ $P_{\text{вн.}} = 207$ Гр. сл. = VI Точн. = П
	БПЗ-1992 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-1997 $F \text{ см}^2 = 5.556$ $Q \text{ кг.} = 1.507$ $D \text{ оп.мм.} = 112$ $P \text{ н.} = 319$ $P_{\text{вн.}} = 281$ Гр. сл. = VI Точн. = П
	БПЗ-1993 $F \text{ см}^2 = 12.04$ $Q \text{ кг.} = 3.263$ $D \text{ оп.мм.} = 101$ $P \text{ н.} = 396.2$ $P_{\text{вн.}} = 260.4$ Гр. сл. = VI Точн. = П		БПЗ-1998 $F \text{ см}^2 = 7.44$ $Q \text{ кг.} = 2.016$ $D \text{ оп.мм.} = 87$ $P \text{ н.} = 328$ $P_{\text{вн.}} = 211$ Гр. сл. = V Точн. = П
	БПЗ-1994 $F \text{ см}^2 = 6.22$ $Q \text{ кг.} = 1.686$ $D \text{ оп.мм.} = 112$ $P \text{ н.} = 344$ $P_{\text{вн.}} = 278$ Гр. сл. = V Точн. = П		БПЗ-1999 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-1995 $F \text{ см}^2 = 7.2$ $Q \text{ кг.} = 1.951$ $D \text{ оп.мм.} = 90$ $P \text{ н.} = 424$ $P_{\text{вн.}} = 224$		БПЗ-2000 $F \text{ см}^2 = 7.72$ $Q \text{ кг.} = 1.496$ $D \text{ оп.мм.} = 108$ $P \text{ н.} = 376$ $P_{\text{вн.}} = 265$

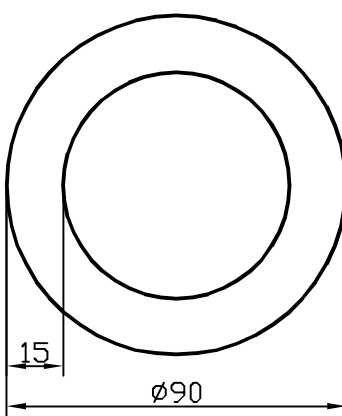
pdfMachine

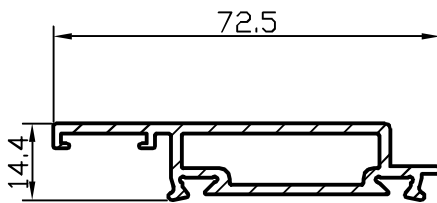
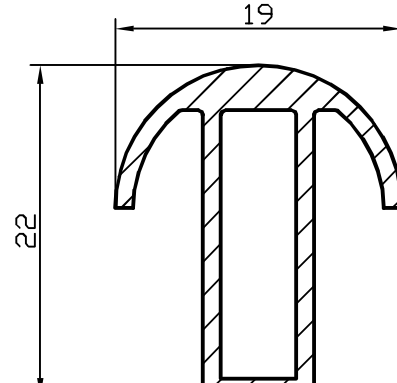
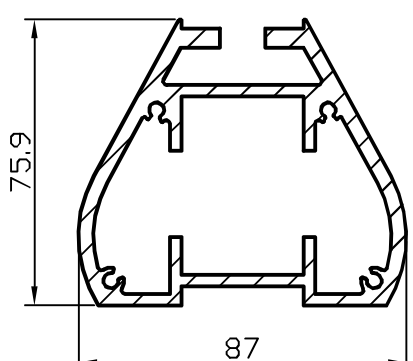
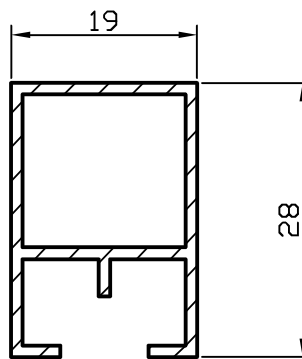
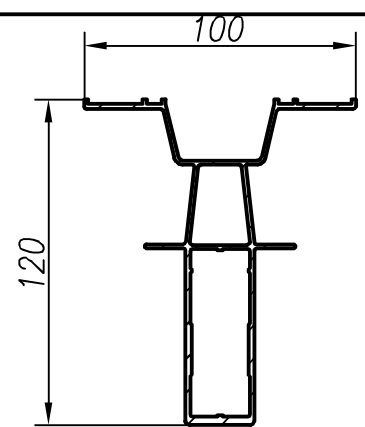
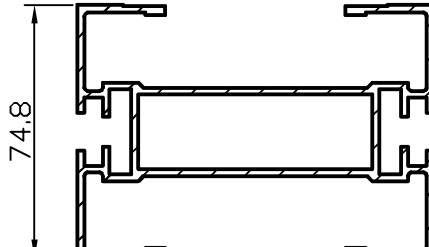
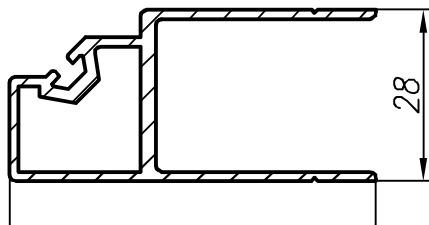
A pdf writer that produces quality PDF files with ease!

Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

Get yours now!

VI
П

	БПЗ-2001		БПЗ-2006
	F см² = 0 Q кг. = 0 D оп.мм.= 0 Р н. = 0 Рвн. = 0 Гр. с.л. = особая Точн. = П		F см² = 0 Q кг. = 0 D оп.мм.= 0 Р н. = 0 Рвн. = 0 Гр. с.л. = особая Точн. = П
	БПЗ-2002		БПЗ-2007
	F см² = 0 Q кг. = 0 D оп.мм.= 0 Р н. = 0 Рвн. = 0 Гр. с.л. = особая Точн. = П		F см² = 0 Q кг. = 0 D оп.мм.= 0 Р н. = 0 Рвн. = 0 Гр. с.л. = особая Точн. = П
	БПЗ-2003		БПЗ-2008
	F см² = 0 Q кг. = 0 D оп.мм.= 0 Р н. = 0 Рвн. = 0 Гр. с.л. = особая Точн. = П		F см² = 0 Q кг. = 0 D оп.мм.= 0 Р н. = 0 Рвн. = 0 Гр. с.л. = особая Точн. = П
	БПЗ-2004		БПЗ-2009
	F см² = 35.34 Q кг. = 9.577 D оп.мм.= 90 Р н. = 282.7 Рвн. = 188.5 Гр. с.л. = III Точн. = П		F см² = 0 Q кг. = 0 D оп.мм.= 0 Р н. = 0 Рвн. = 0 Гр. с.л. = особая Точн. = П
	БПЗ-2005		БПЗ-2010
	F см² = 0 Q кг. = 0 D оп.мм.= 0 Р н. = 0 Рвн. = 0		F см² = 0 Q кг. = 0 D оп.мм.= 0 Р н. = 0 Рвн. = 0
pdfMachine A pdf writer that produces quality PDF files with ease! Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.			
особая П			

	БПЗ-2011 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-2016 $F \text{ см}^2 = 2.9$ $Q \text{ кг.} = 0.786$ $D \text{ оп.мм.} = 74$ $P \text{ н.} = 214$ $P_{\text{вн.}} = 91$ Гр. сл. = IV Точн. = П
	БПЗ-2012 $F \text{ см}^2 = 0.979$ $Q \text{ кг.} = 0.265$ $D \text{ оп.мм.} = 25$ $P \text{ н.} = 95.2$ $P_{\text{вн.}} = 45.4$ Гр. сл. = V Точн. = П		БПЗ-2017 $F \text{ см}^2 = 13.37$ $Q \text{ кг.} = 3.623$ $D \text{ оп.мм.} = 99$ $P \text{ н.} = 373.4$ $P_{\text{вн.}} = 361$ Гр. сл. = VI Точн. = П
	БПЗ-2013 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-2018 $F \text{ см}^2 = 1.207$ $Q \text{ кг.} = 0.327$ $D \text{ оп.мм.} = 34$ $P \text{ н.} = 136.8$ $P_{\text{вн.}} = 64.4$ Гр. сл. = V Точн. = П
	БПЗ-2014 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-2019 $F \text{ см}^2 = 7.19$ $Q \text{ кг.} = 1.948$ $D \text{ оп.мм.} = 143$ $P \text{ н.} = 538$ $P_{\text{вн.}} = 265.8$ Гр. сл. = особая Точн. = П
	БПЗ-2015 $F \text{ см}^2 = 10.479$ $Q \text{ кг.} = 2.84$ $D \text{ оп.мм.} = 129$ $P \text{ н.} = 830.1$ $P_{\text{вн.}} = 182$		БПЗ-2020 $F \text{ см}^2 = 2.935$ $Q \text{ кг.} = 0.795$ $D \text{ оп.мм.} = 66$ $P \text{ н.} = 255.3$ $P_{\text{вн.}} = 83.7$

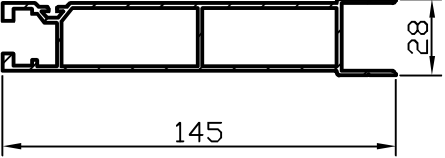
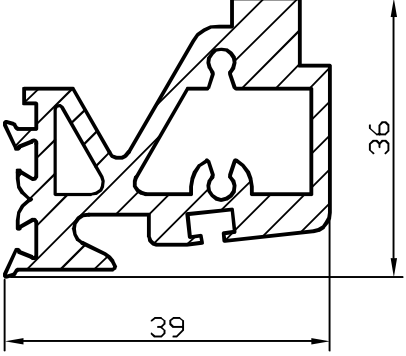
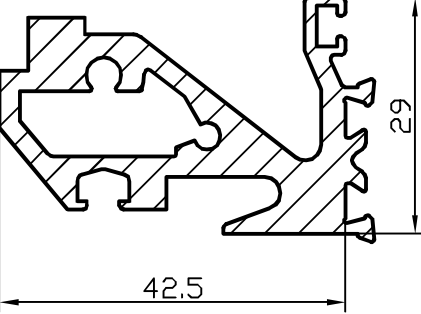
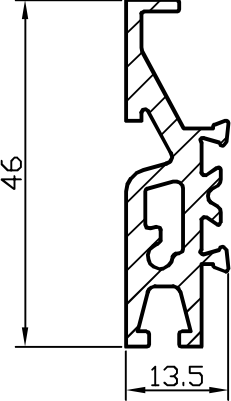
pdfMachine

A pdf writer that produces quality PDF files with ease!

Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

Get yours now!

VI
П

	БПЗ-2021 $F \text{ см}^2 = 6.87$ $Q \text{ кг.} = 1.862$ $D \text{ оп.мм.} = 150$ $P \text{ н.} = 462$ $P_{\text{вн.}} = 282.2$ Гр. с.л. = VI Точн. = П		БПЗ-2026 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-2022 $F \text{ см}^2 = 5.68$ $Q \text{ кг.} = 1.54$ $D \text{ оп.мм.} = 54$ $P \text{ н.} = 214.5$ $P_{\text{вн.}} = 125.5$ Гр. с.л. = особая Точн. = П		БПЗ-2027 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-2023 $F \text{ см}^2 = 4.843$ $Q \text{ кг.} = 1.312$ $D \text{ оп.мм.} = 51$ $P \text{ н.} = 235.2$ $P_{\text{вн.}} = 71.5$ Гр. с.л. = особая Точн. = П		БПЗ-2028 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-2024 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		БПЗ-2029 $F \text{ см}^2 = 2.655$ $Q \text{ кг.} = 0.72$ $D \text{ оп.мм.} = 47$ $P \text{ н.} = 173.3$ $P_{\text{вн.}} = 32.2$ Гр. с.л. = VI Точн. = П
	БПЗ-2025 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		БПЗ-2030 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$

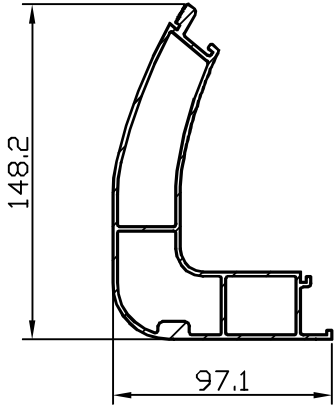
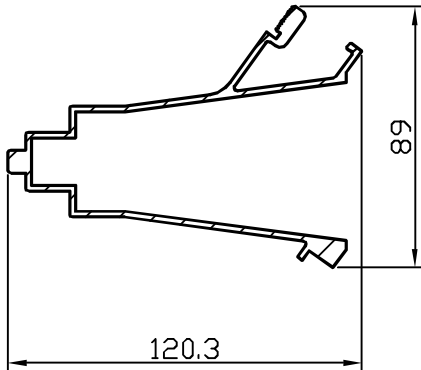
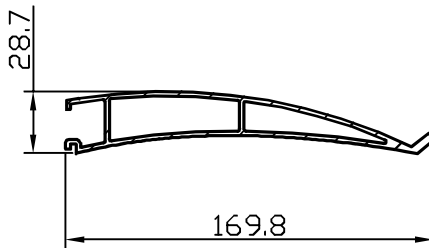
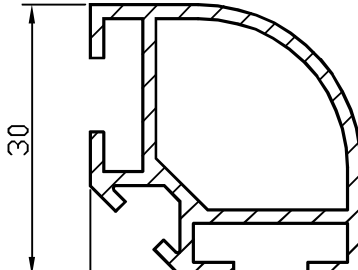
pdfMachine

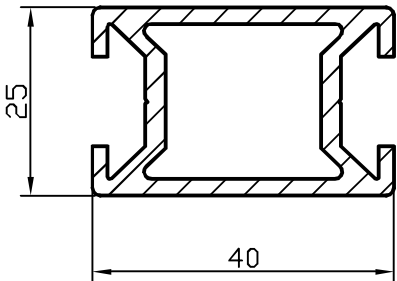
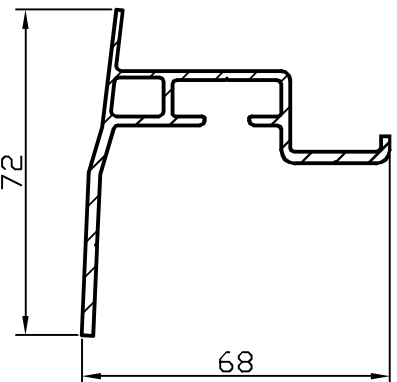
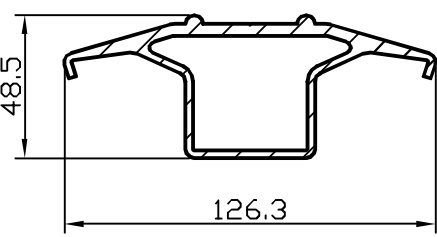
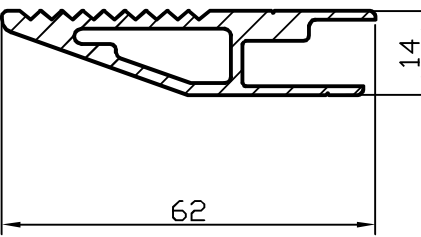
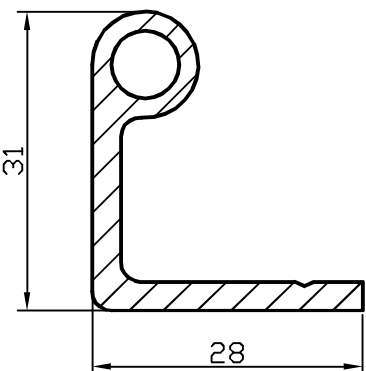
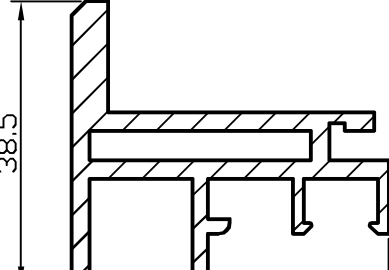
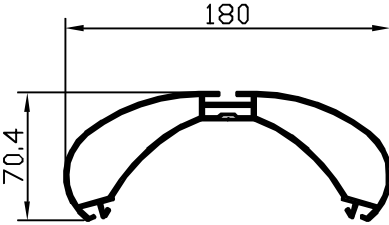
A pdf writer that produces quality PDF files with ease!

Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

Get yours now!

особая
П

	БПЗ-2031		БПЗ-2036
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-2032		БПЗ-2037
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		$F \text{ см}^2 = 11.37$ $Q \text{ кг.} = 3.08$ $D \text{ оп.мм.} = 162$ $P \text{ н.} = 505.7$ $P_{\text{вн.}} = 500.4$ Гр. с.л. = особая Точн. = П
	БПЗ-2033		БПЗ-2038
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		$F \text{ см}^2 = 9.16$ $Q \text{ кг.} = 2.48$ $D \text{ оп.мм.} = 128$ $P \text{ н.} = 651.8$ $P_{\text{вн.}} = 115.5$ Гр. с.л. = особая Точн. = П
	БПЗ-2034		БПЗ-2039
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		$F \text{ см}^2 = 11.107$ $Q \text{ кг.} = 3.001$ $D \text{ оп.мм.} = 171$ $P \text{ н.} = 425.9$ $P_{\text{вн.}} = 300.9$ Гр. с.л. = особая Точн. = П
	БПЗ-2035		БПЗ-2040
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		$F \text{ см}^2 = 1.968$ $Q \text{ кг.} = 0.533$ $D \text{ оп.мм.} = 43$ $P \text{ н.} = 180.2$ $P_{\text{вн.}} = 74.4$

	БПЗ-2041 $F \text{ см}^2 = 3.297$ $Q \text{ кг.} = 0.894$ $D \text{ оп.мм.} = 48$ $P \text{ н.} = 180.2$ $P_{\text{вн.}} = 96.7$ Гр. с.л. = VI Точн. = П		БПЗ-2046 $F \text{ см}^2 = 3.951$ $Q \text{ кг.} = 1.07$ $D \text{ оп.мм.} = 86$ $P \text{ н.} = 335.1$ $P_{\text{вн.}} = 38$ Гр. с.л. = VI Точн. = П
	БПЗ-2042 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		БПЗ-2047 $F \text{ см}^2 = 9.106$ $Q \text{ кг.} = 2.468$ $D \text{ оп.мм.} = 131$ $P \text{ н.} = 344.6$ $P_{\text{вн.}} = 196.8$ Гр. с.л. = VI Точн. = П
	БПЗ-2043 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		БПЗ-2048 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-2044 $F \text{ см}^2 = 3.07$ $Q \text{ кг.} = 0.832$ $D \text{ оп.мм.} = 63$ $P \text{ н.} = 190.6$ $P_{\text{вн.}} = 63.8$ Гр. с.л. = VI Точн. = П		БПЗ-2049 $F \text{ см}^2 = 1.984$ $Q \text{ кг.} = 0.538$ $D \text{ оп.мм.} = 40$ $P \text{ н.} = 124.6$ $P_{\text{вн.}} = 22$ Гр. с.л. = V Точн. = П
	БПЗ-2045 $F \text{ см}^2 = 3.963$ $Q \text{ кг.} = 1.074$ $D \text{ оп.мм.} = 55$ $P \text{ н.} = 242.9$ $P_{\text{вн.}} = 68$		БПЗ-2050 $F \text{ см}^2 = 7.797$ $Q \text{ кг.} = 2.113$ $D \text{ оп.мм.} = 180$ $P \text{ н.} = 608.2$ $P_{\text{вн.}} = 488.1$

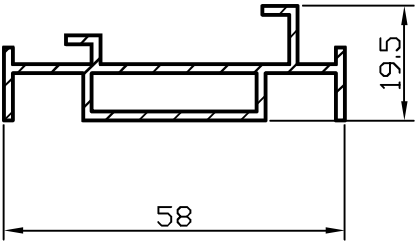
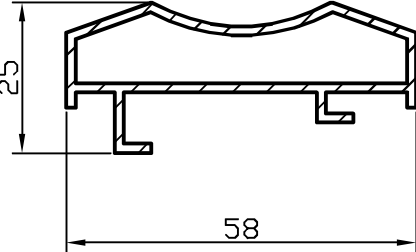
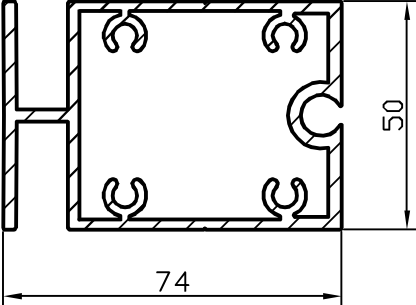
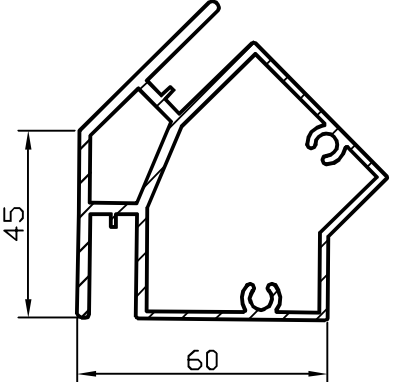
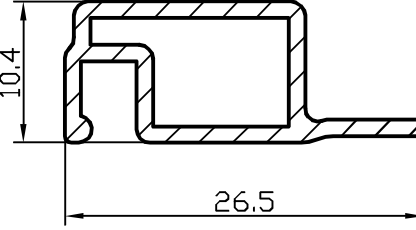
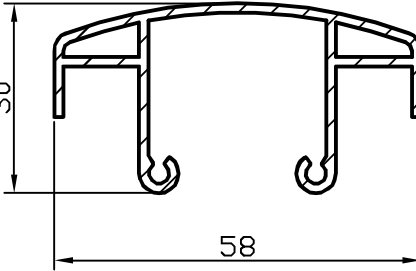
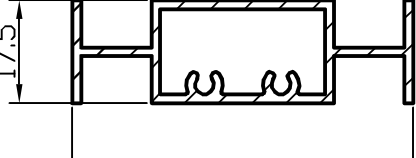
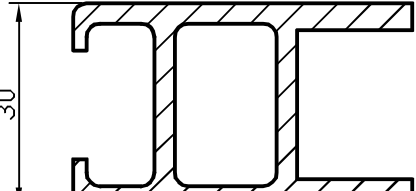
pdfMachine

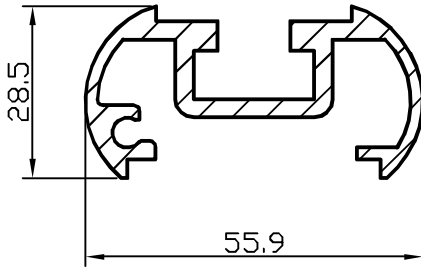
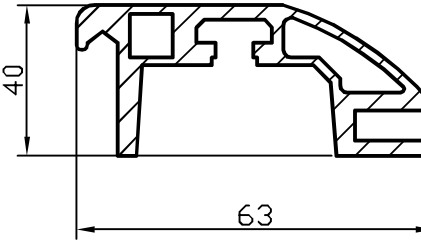
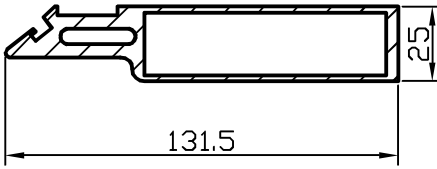
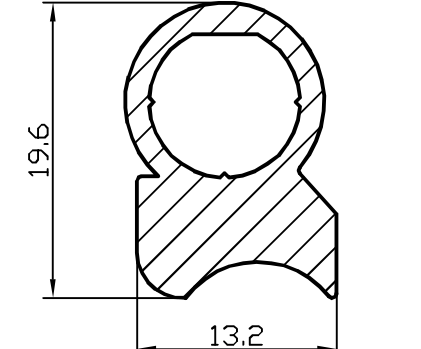
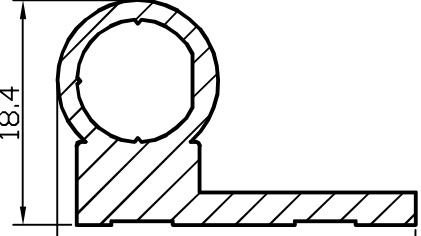
A pdf writer that produces quality PDF files with ease!

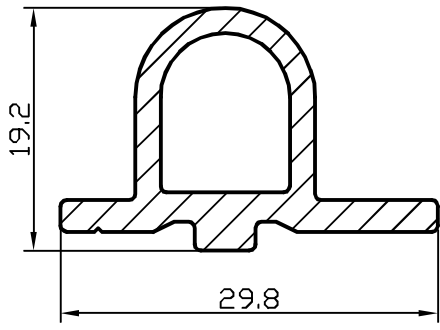
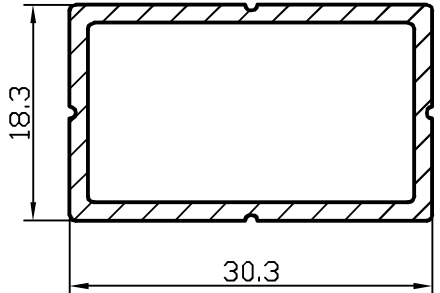
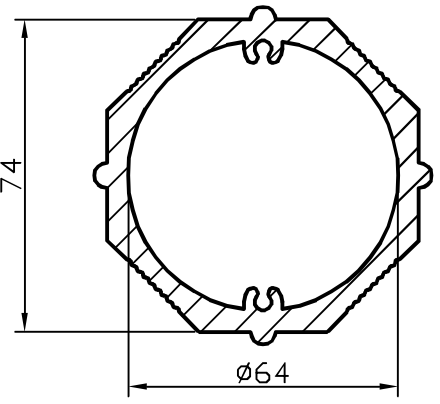
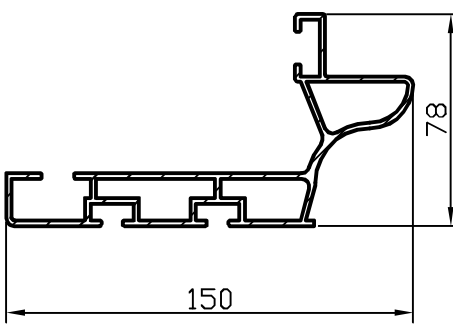
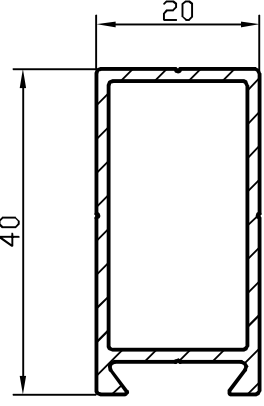
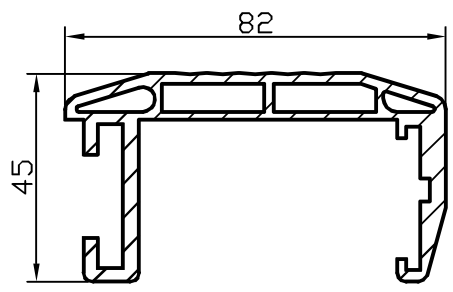
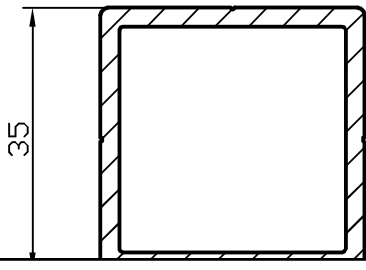
Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

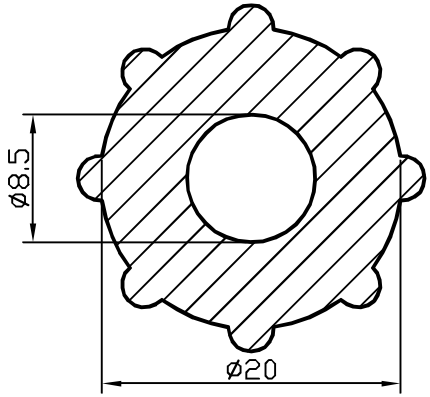
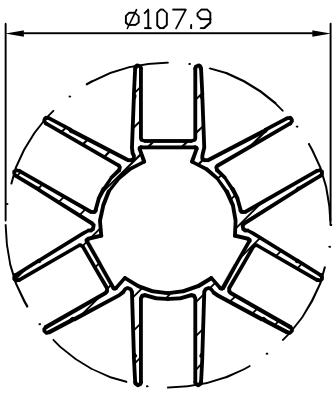
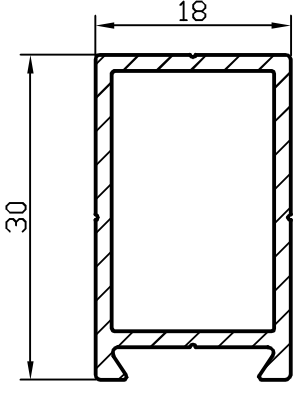
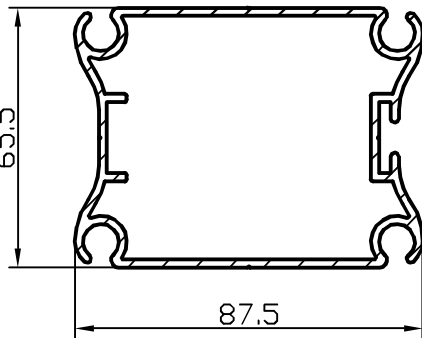
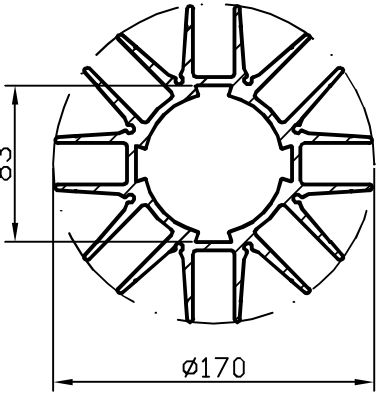
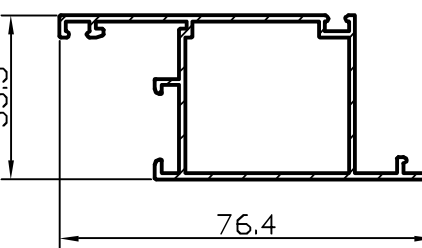
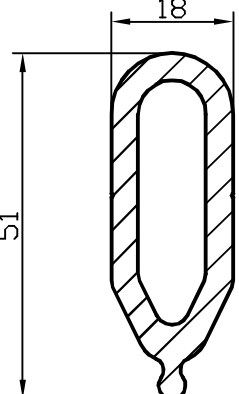
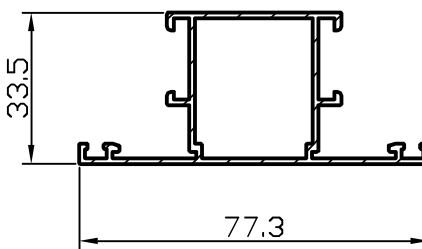
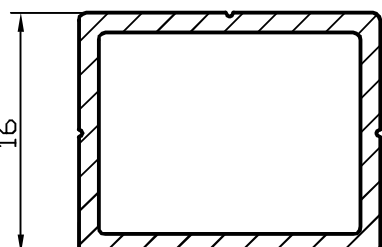
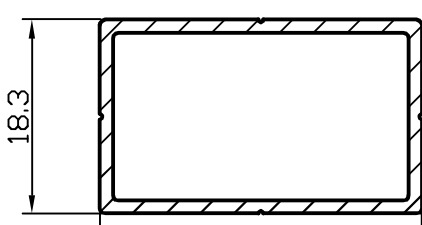
Get yours now!

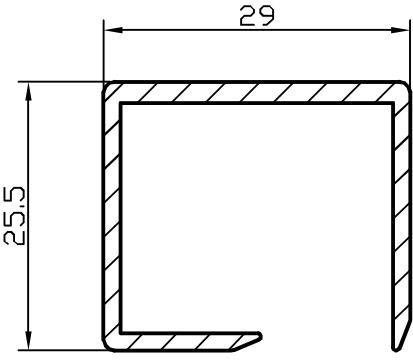
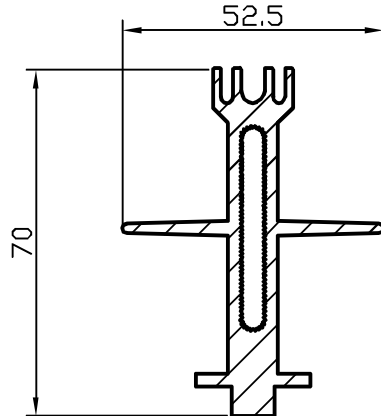
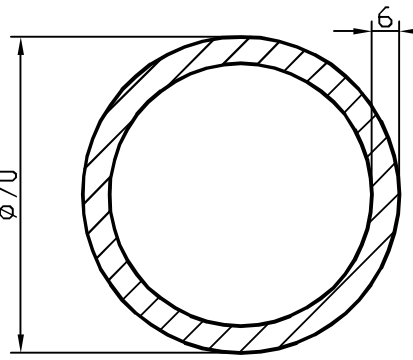
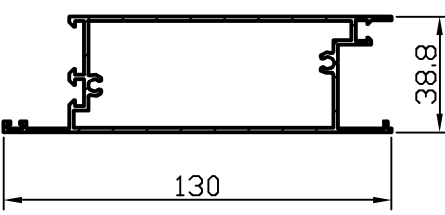
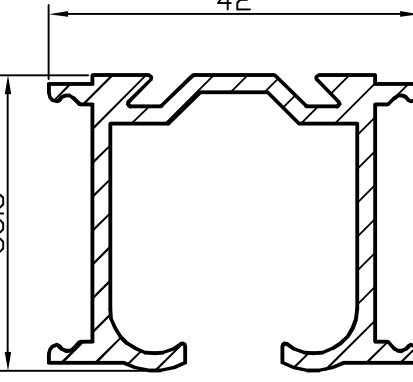
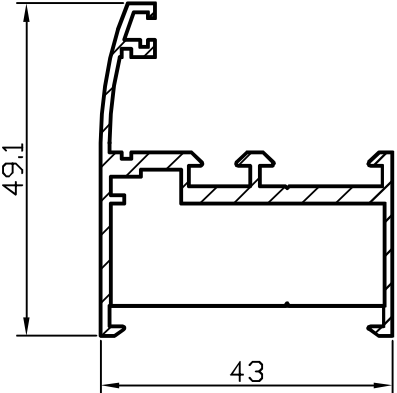
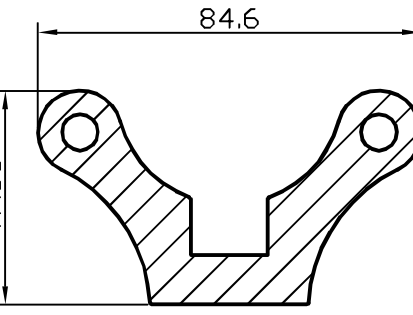
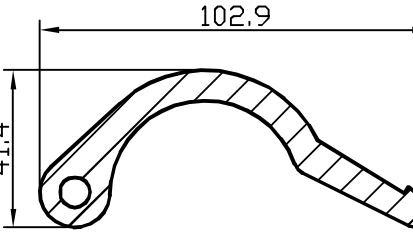
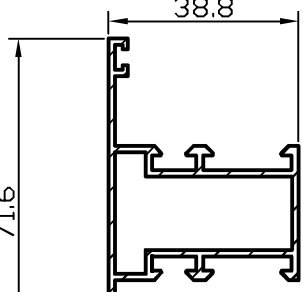
особая
П

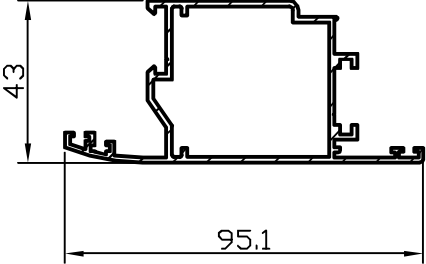
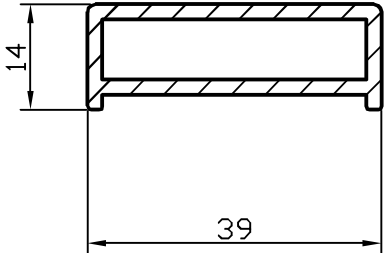
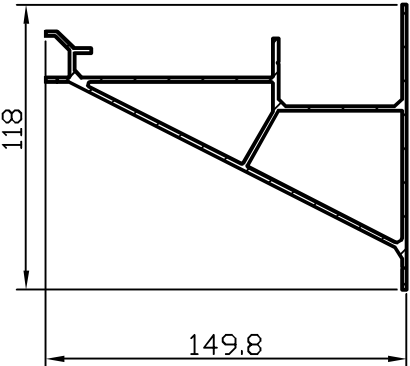
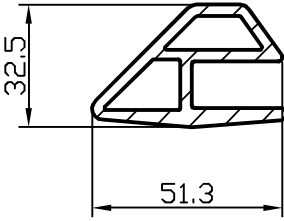
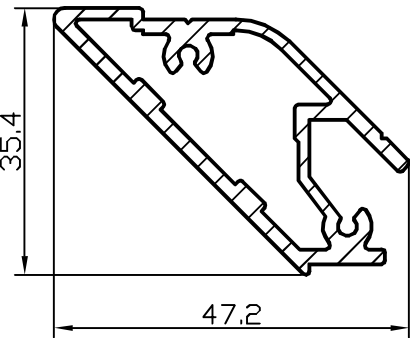
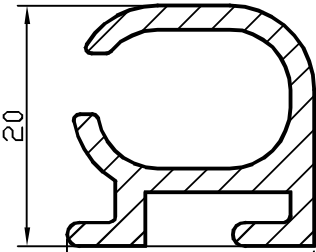
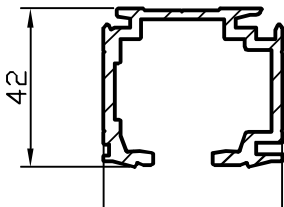
	БПЗ-2051 $F \text{ см}^2 = 2.22$ $Q \text{ кг.} = 0.602$ $D \text{ оп.мм.} = 59$ $P \text{ н.} = 227$ $P_{\text{вн.}} = 69$ $\Gamma \text{ р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		БПЗ-2056 $F \text{ см}^2 = 2.437$ $Q \text{ кг.} = 0.66$ $D \text{ оп.мм.} = 60$ $P \text{ н.} = 197.1$ $P_{\text{вн.}} = 127.7$ $\Gamma \text{ р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$
	БПЗ-2052 $F \text{ см}^2 = 8.88$ $Q \text{ кг.} = 2.406$ $D \text{ оп.мм.} = 89$ $P \text{ н.} = 363$ $P_{\text{вн.}} = 361$ $\Gamma \text{ р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$		БПЗ-2057 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{ р. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$
	БПЗ-2053 $F \text{ см}^2 = 7.42$ $Q \text{ кг.} = 2.011$ $D \text{ оп.мм.} = 88$ $P \text{ н.} = 360$ $P_{\text{вн.}} = 324$ $\Gamma \text{ р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$		БПЗ-2058 $F \text{ см}^2 = 0.79$ $Q \text{ кг.} = 0.214$ $D \text{ оп.мм.} = 27$ $P \text{ н.} = 83.3$ $P_{\text{вн.}} = 44.8$ $\Gamma \text{ р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$
	БПЗ-2054 $F \text{ см}^2 = 2.606$ $Q \text{ кг.} = 0.706$ $D \text{ оп.мм.} = 59$ $P \text{ н.} = 279.2$ $P_{\text{вн.}} = 63.3$ $\Gamma \text{ р. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$		БПЗ-2059 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{ р. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$
	БПЗ-2055 $F \text{ см}^2 = 2.49$ $Q \text{ кг.} = 0.675$ $D \text{ оп.мм.} = 61$ $P \text{ н.} = 215$ $P_{\text{вн.}} = 111.6$		БПЗ-2060 $F \text{ см}^2 = 4.992$ $Q \text{ кг.} = 1.353$ $D \text{ оп.мм.} = 58$ $P \text{ н.} = 228.9$ $P_{\text{вн.}} = 74.6$

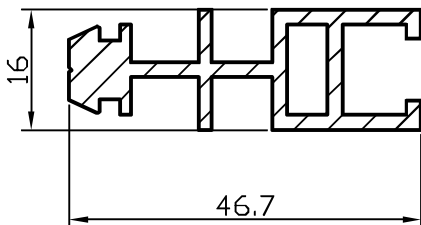
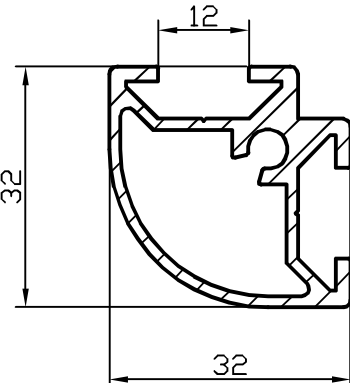
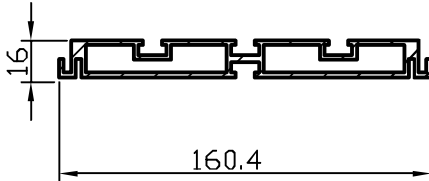
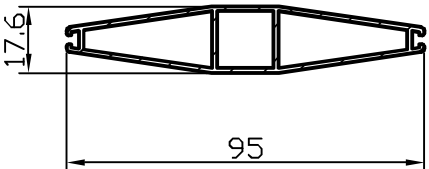
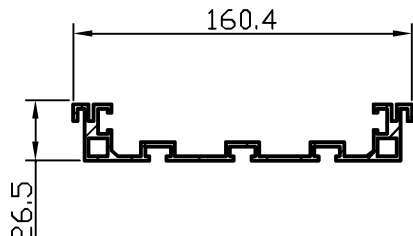
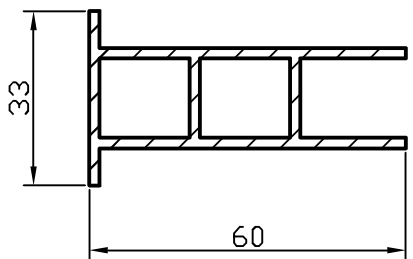
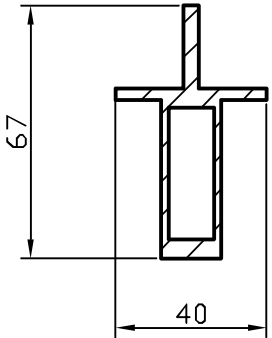
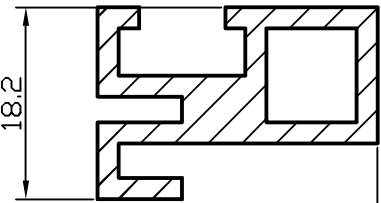
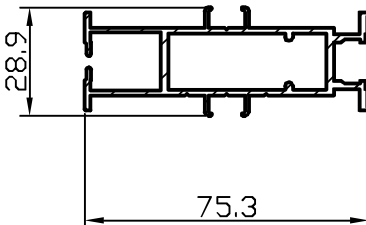
	БПЗ-2061 $F \text{ см}^2 = 4.2$ $Q \text{ кг.} = 1.14$ $D \text{ оп.мм.} = 56$ $P \text{ н.} = 300.7$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		БПЗ-2066 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-2062 $F \text{ см}^2 = 10.53$ $Q \text{ кг.} = 2.854$ $D \text{ оп.мм.} = 102$ $P \text{ н.} = 380.7$ $P_{\text{вн.}} = 130.2$ Гр. с.л. = особая Точн. = П		БПЗ-2067 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-2063 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		БПЗ-2068 $F \text{ см}^2 = 9.087$ $Q \text{ кг.} = 2.463$ $D \text{ оп.мм.} = 132$ $P \text{ н.} = 317.9$ $P_{\text{вн.}} = 260.6$ Гр. с.л. = особая Точн. = П
	БПЗ-2064 $F \text{ см}^2 = 1.352$ $Q \text{ кг.} = 0.366$ $D \text{ оп.мм.} = 20$ $P \text{ н.} = 63.3$ $P_{\text{вн.}} = 31.3$ Гр. с.л. = V Точн. = П		БПЗ-2069 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-2065 $F \text{ см}^2 = 1.64$ $Q \text{ кг.} = 0.444$ $D \text{ оп.мм.} = 32.3$ $P \text{ н.} = 93.6$ $P_{\text{вн.}} = 32$		БПЗ-2070 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$

	БПЗ-2071 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		БПЗ-2076 $F \text{ см}^2 = 1.55$ $Q \text{ кг.} = 0.42$ $D \text{ оп.мм.} = 30$ $P \text{ н.} = 92$ $P_{\text{вн.}} = 40.8$ Гр. с.л. = VI Точн. = П
	БПЗ-2072 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		БПЗ-2077 $F \text{ см}^2 = 1.616$ $Q \text{ кг.} = 0.438$ $D \text{ оп.мм.} = 36$ $P \text{ н.} = 97.5$ $P_{\text{вн.}} = 81.9$ Гр. с.л. = III Точн. = П
	БПЗ-2073 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		БПЗ-2078 $F \text{ см}^2 = 14.134$ $Q \text{ кг.} = 3.83$ $D \text{ оп.мм.} = 80$ $P \text{ н.} = 270.4$ $P_{\text{вн.}} = 236$ Гр. с.л. = V Точн. = П
	БПЗ-2074 $F \text{ см}^2 = 9.605$ $Q \text{ кг.} = 2.603$ $D \text{ оп.мм.} = 158$ $P \text{ н.} = 613.7$ $P_{\text{вн.}} = 307.3$ Гр. с.л. = особая Точн. = П		БПЗ-2079 $F \text{ см}^2 = 1.78$ $Q \text{ кг.} = 0.483$ $D \text{ оп.мм.} = 44.4$ $P \text{ н.} = 134.24$ $P_{\text{вн.}} = 99.14$ Гр. с.л. = V Точн. = П
	БПЗ-2075 $F \text{ см}^2 = 7.301$ $Q \text{ кг.} = 1.978$ $D \text{ оп.мм.} = 87$ $P \text{ н.} = 373.6$ $P_{\text{вн.}} = 175.7$		БПЗ-2080 $F \text{ см}^2 = 3.24$ $Q \text{ кг.} = 0.878$ $D \text{ оп.мм.} = 50$ $P \text{ н.} = 139.4$ $P_{\text{вн.}} = 119.1$ Гр. с.л. = IV Точн. = П

	БПЗ-2081 $F \text{ см}^2 = 2.866$ $Q \text{ кг.} = 0.777$ $D \text{ оп.мм.} = 23$ $P \text{ н.} = 78.3$ $P_{вн.} = 26.7$ Гр. с.л. = IV Точн. = П		БПЗ-2086 $F \text{ см}^2 = 12.162$ $Q \text{ кг.} = 3.296$ $D \text{ оп.мм.} = 108$ $P \text{ н.} = 833.9$ $P_{вн.} = 179.3$ Гр. с.л. = VI Точн. = П
	БПЗ-2082 $F \text{ см}^2 = 1.39$ $Q \text{ кг.} = 0.377$ $D \text{ оп.мм.} = 35$ $P \text{ н.} = 105$ $P_{вн.} = 77.5$ Гр. с.л. = VI Точн. = П		БПЗ-2087 $F \text{ см}^2 = 7.52$ $Q \text{ кг.} = 2.038$ $D \text{ оп.мм.} = 104$ $P \text{ н.} = 412.4$ $P_{вн.} = 314.7$ Гр. с.л. = особая Точн. = П
	БПЗ-2083 $F \text{ см}^2 = 44.365$ $Q \text{ кг.} = 12.02$ $D \text{ оп.мм.} = 170$ $P \text{ н.} = 1543$ $P_{вн.} = 286.3$ Гр. с.л. = особая Точн. = П		БПЗ-2088 $F \text{ см}^2 = 2.661$ $Q \text{ кг.} = 0.721$ $D \text{ оп.мм.} = 83$ $P \text{ н.} = 287$ $P_{вн.} = 128.8$ Гр. с.л. = VI Точн. = П
	БПЗ-2084 $F \text{ см}^2 = 4.09$ $Q \text{ кг.} = 1.108$ $D \text{ оп.мм.} = 51$ $P \text{ н.} = 120.6$ $P_{вн.} = 82$ Гр. с.л. = VI Точн. = П		БПЗ-2089 $F \text{ см}^2 = 2.767$ $Q \text{ кг.} = 0.75$ $D \text{ оп.мм.} = 78$ $P \text{ н.} = 318.6$ $P_{вн.} = 113.8$ Гр. с.л. = VI Точн. = П
	БПЗ-2085 $F \text{ см}^2 = 0.864$ $Q \text{ кг.} = 0.234$ $D \text{ оп.мм.} = 26$ $P \text{ н.} = 72.3$ $P_{вн.} = 60.7$		БПЗ-2090 $F \text{ см}^2 = 1.149$ $Q \text{ кг.} = 0.311$ $D \text{ оп.мм.} = 36$ $P \text{ н.} = 97.5$ $P_{вн.} = 86.4$

	БПЗ-2091 $F \text{ см}^2 = 1.508$ $Q \text{ кг.} = 0.409$ $D \text{ оп.мм.} = 38$ $P \text{ н.} = 179.2$ $P_{\text{вн.}} = 0$ Гр. с.л. = VI Точн. = П		БПЗ-2096 $F \text{ см}^2 = 6.384$ $Q \text{ кг.} = 1.73$ $D \text{ оп.мм.} = 71$ $P \text{ н.} = 312.7$ $P_{\text{вн.}} = 129.4$ Гр. с.л. = особая Точн. = П
	БПЗ-2092 $F \text{ см}^2 = 12.06$ $Q \text{ кг.} = 3.269$ $D \text{ оп.мм.} = 70$ $P \text{ н.} = 219.9$ $P_{\text{вн.}} = 182.2$ Гр. с.л. = IV Точн. = Н		БПЗ-2097 $F \text{ см}^2 = 5.368$ $Q \text{ кг.} = 1.455$ $D \text{ оп.мм.} = 136$ $P \text{ н.} = 437.9$ $P_{\text{вн.}} = 288.3$ Гр. с.л. = VI Точн. = П
	БПЗ-2093 $F \text{ см}^2 = 2.929$ $Q \text{ кг.} = 0.794$ $D \text{ оп.мм.} = 53$ $P \text{ н.} = 275.5$ $P_{\text{вн.}} = 0$ Гр. с.л. = VI Точн. = П		БПЗ-2098 $F \text{ см}^2 = 2.553$ $Q \text{ кг.} = 0.692$ $D \text{ оп.мм.} = 64$ $P \text{ н.} = 257.3$ $P_{\text{вн.}} = 124.8$ Гр. с.л. = VI Точн. = П
	БПЗ-2094 $F \text{ см}^2 = 14.99$ $Q \text{ кг.} = 4.064$ $D \text{ оп.мм.} = 85$ $P \text{ н.} = 273.2$ $P_{\text{вн.}} = 50.3$ Гр. с.л. = VI Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-2095 $F \text{ см}^2 = 11.31$ $Q \text{ кг.} = 3.07$ $D \text{ оп.мм.} = 103$ $P \text{ н.} = 272.5$ $P_{\text{вн.}} = 25.1$		БПЗ-2100 $F \text{ см}^2 = 2.926$ $Q \text{ кг.} = 0.793$ $D \text{ оп.мм.} = 73$ $P \text{ н.} = 318.5$ $P_{\text{вн.}} = 122.4$

	БПЗ-2101 $F \text{ см}^2 = 4.132$ $Q \text{ кг.} = 1.12$ $D \text{ оп.мм.} = 97$ $P \text{ н.} = 383.8$ $P_{\text{вн.}} = 177.7$ Гр. с.л. = VI Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = 0 Точн. = П
	БПЗ-2102 $F \text{ см}^2 = 1.954$ $Q \text{ кг.} = 0.53$ $D \text{ оп.мм.} = 41$ $P \text{ н.} = 108.3$ $P_{\text{вн.}} = 86$ Гр. с.л. = IV Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = 0 Точн. = П
	БПЗ-2103 $F \text{ см}^2 = 10.42$ $Q \text{ кг.} = 2.82$ $D \text{ оп.мм.} = 183$ $P \text{ н.} = 595.7$ $P_{\text{вн.}} = 389$ Гр. с.л. = IV Точн. = П		БПЗ-2108 $F \text{ см}^2 = 5.11$ $Q \text{ кг.} = 1.385$ $D \text{ оп.мм.} = 52$ $P \text{ н.} = 186.1$ $P_{\text{вн.}} = 119.2$ Гр. с.л. = особая Точн. = П
	БПЗ-2104 $F \text{ см}^2 = 2.964$ $Q \text{ кг.} = 0.803$ $D \text{ оп.мм.} = 55$ $P \text{ н.} = 166.5$ $P_{\text{вн.}} = 131$ Гр. с.л. = VI Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = 0 Точн. = П
	БПЗ-2105 $F \text{ см}^2 = 1.434$ $Q \text{ кг.} = 0.389$ $D \text{ оп.мм.} = 26$ $P \text{ н.} = 135.4$ $P_{\text{вн.}} = 0$		БПЗ-2110 $F \text{ см}^2 = 5.12$ $Q \text{ кг.} = 1.388$ $D \text{ оп.мм.} = 60$ $P \text{ н.} = 344.8$ $P_{\text{вн.}} = 0$

	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		БПЗ-2116 $F \text{ см}^2 = 2.746$ $Q \text{ кг.} = 0.744$ $D \text{ оп.мм.} = 48.5$ $P \text{ н.} = 206.8$ $P_{\text{вн.}} = 34.6$ Гр. с.л. = VI Точн. = П
	БПЗ-2112 $F \text{ см}^2 = 2.603$ $Q \text{ кг.} = 0.705$ $D \text{ оп.мм.} = 45$ $P \text{ н.} = 169.6$ $P_{\text{вн.}} = 97.8$ Гр. с.л. = V Точн. = П		БПЗ-2117 $F \text{ см}^2 = 8.78$ $Q \text{ кг.} = 2.38$ $D \text{ оп.мм.} = 161$ $P \text{ н.} = 491$ $P_{\text{вн.}} = 316$ Гр. с.л. = VI Точн. = П
	БПЗ-2113 $F \text{ см}^2 = 3.041$ $Q \text{ кг.} = 0.824$ $D \text{ оп.мм.} = 96$ $P \text{ н.} = 223.6$ $P_{\text{вн.}} = 238$ Гр. с.л. = VI Точн. = П		БПЗ-2118 $F \text{ см}^2 = 7.552$ $Q \text{ кг.} = 2.05$ $D \text{ оп.мм.} = 161$ $P \text{ н.} = 617.5$ $P_{\text{вн.}} = 69.6$ Гр. с.л. = особая Точн. = П
	БПЗ-2114 $F \text{ см}^2 = 3.58$ $Q \text{ кг.} = 0.97$ $D \text{ оп.мм.} = 66$ $P \text{ н.} = 226$ $P_{\text{вн.}} = 128$ Гр. с.л. = VI Точн. = П		БПЗ-2119 $F \text{ см}^2 = 4.6$ $Q \text{ кг.} = 1.247$ $D \text{ оп.мм.} = 68$ $P \text{ н.} = 214$ $P_{\text{вн.}} = 94$ Гр. с.л. = V Точн. = П
	БПЗ-2115 $F \text{ см}^2 = 1.992$ $Q \text{ кг.} = 0.539$ $D \text{ оп.мм.} = 32$ $P \text{ н.} = 138$ $P_{\text{вн.}} = 34.8$		БПЗ-2120 $F \text{ см}^2 = 3.604$ $Q \text{ кг.} = 0.977$ $D \text{ оп.мм.} = 79.5$ $P \text{ н.} = 357.8$ $P_{\text{вн.}} = 120$

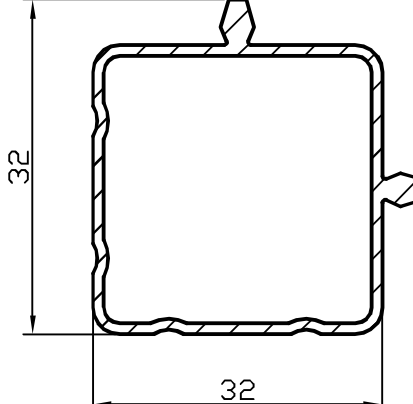
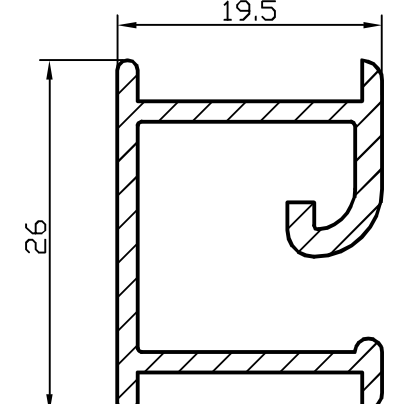
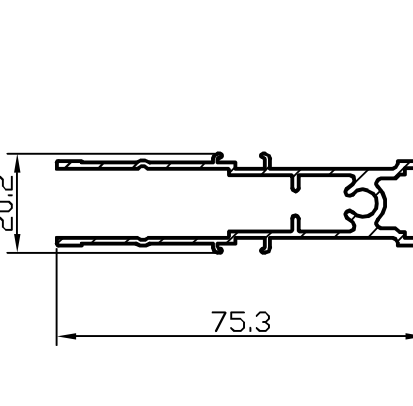
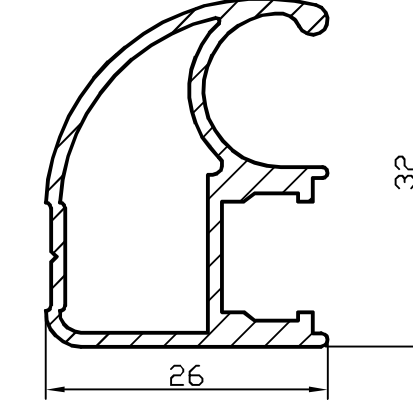
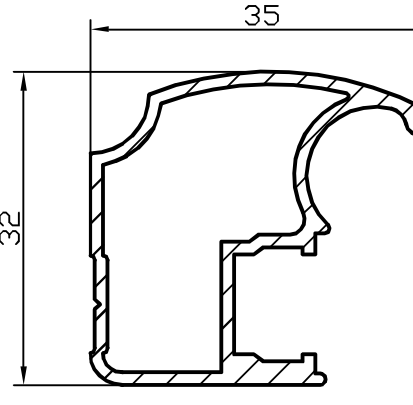
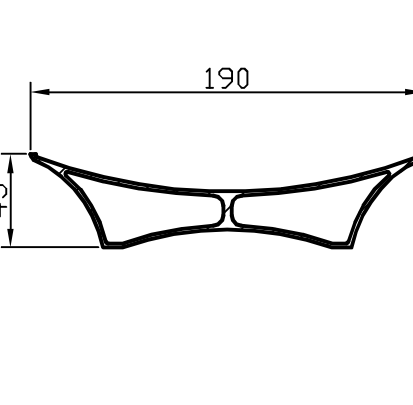
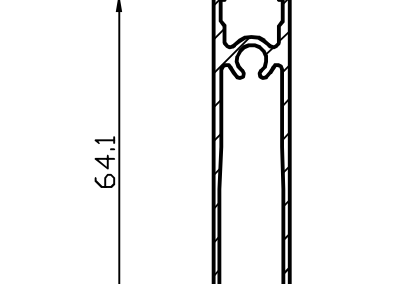
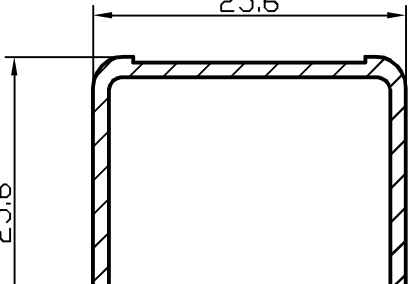
pdfMachine

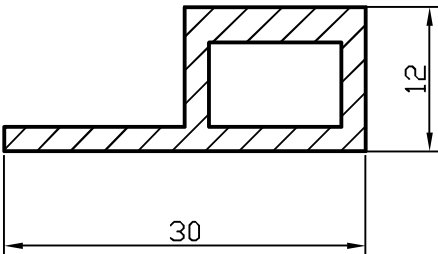
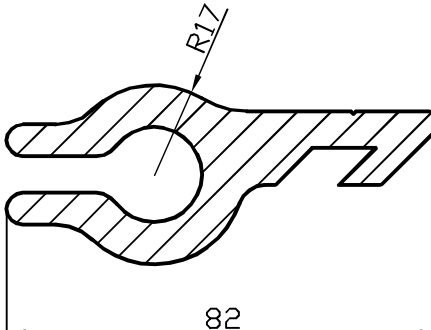
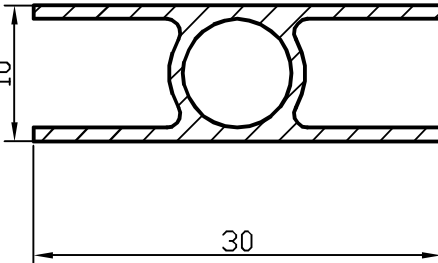
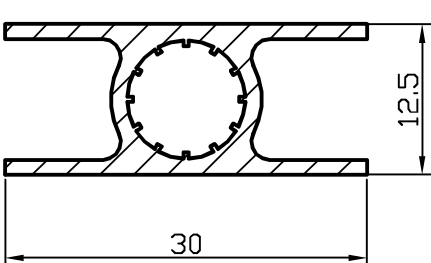
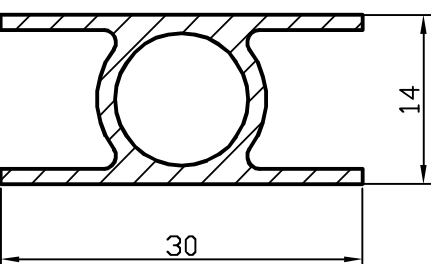
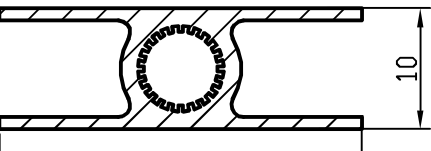
A pdf writer that produces quality PDF files with ease!

Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

Get yours now!

VI
П

	БПЗ-2121 $F \text{ см}^2 = 1.72$ $Q \text{ кг.} = 0.466$ $D \text{ оп.мм.} = 42.8$ $P \text{ н.} = 143.4$ $P_{\text{вн.}} = 116$ $\Gamma \text{ р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		БПЗ-2126 $F \text{ см}^2 = 1.319$ $Q \text{ кг.} = 0.357$ $D \text{ оп.мм.} = 32$ $P \text{ н.} = 166.7$ $P_{\text{вн.}} = 0$ $\Gamma \text{ р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$
	БПЗ-2122 $F \text{ см}^2 = 2.82$ $Q \text{ кг.} = 0.765$ $D \text{ оп.мм.} = 77.1$ $P \text{ н.} = 386.9$ $P_{\text{вн.}} = 0$ $\Gamma \text{ р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		БПЗ-2127 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{ р. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$
	БПЗ-2123 $F \text{ см}^2 = 1.76$ $Q \text{ кг.} = 0.477$ $D \text{ оп.мм.} = 38.9$ $P \text{ н.} = 145.6$ $P_{\text{вн.}} = 81.5$ $\Gamma \text{ р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		БПЗ-2128 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{ р. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$
	БПЗ-2124 $F \text{ см}^2 = 1.79$ $Q \text{ кг.} = 0.485$ $D \text{ оп.мм.} = 43.3$ $P \text{ н.} = 148.7$ $P_{\text{вн.}} = 100.1$ $\Gamma \text{ р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		БПЗ-2129 $F \text{ см}^2 = 9.06$ $Q \text{ кг.} = 2.455$ $D \text{ оп.мм.} = 190$ $P \text{ н.} = 437.4$ $P_{\text{вн.}} = 369.4$ $\Gamma \text{ р. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$
	БПЗ-2125 $F \text{ см}^2 = 2.195$ $Q \text{ кг.} = 0.595$ $D \text{ оп.мм.} = 65.4$ $P \text{ н.} = 293.5$ $P_{\text{вн.}} = 0$		БПЗ-2130 $F \text{ см}^2 = 1.213$ $Q \text{ кг.} = 0.329$ $D \text{ оп.мм.} = 35$ $P \text{ н.} = 100.1$ $P_{\text{вн.}} = 88.7$

	БПЗ-2131 $F \text{ см}^2 = 1.33$ $Q \text{ кг.} = 0.36$ $D \text{ оп.мм.} = 33$ $P \text{ н.} = 84$ $P_{\text{вн.}} = 36$ $\text{Гр. сл.} = \text{IV}$ $\text{Точн.} = \text{П}$		БПЗ-2136 $F \text{ см}^2 = 11.349$ $Q \text{ кг.} = 3.08$ $D \text{ оп.мм.} = 84$ $P \text{ н.} = 296.7$ $P_{\text{вн.}} = 0$ $\text{Гр. сл.} = \text{IV}$ $\text{Точн.} = \text{H}$
	БПЗ-2132 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\text{Гр. сл.} = 0$ $\text{Точн.} = 0$		БПЗ-2137 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\text{Гр. сл.} = 0$ $\text{Точн.} = 0$
	БПЗ-2133 $F \text{ см}^2 = 0.84$ $Q \text{ кг.} = 0.228$ $D \text{ оп.мм.} = 32$ $P \text{ н.} = 122$ $P_{\text{вн.}} = 25.1$ $\text{Гр. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$		БПЗ-2138 $F \text{ см}^2 = 1.19$ $Q \text{ кг.} = 0.322$ $D \text{ оп.мм.} = 33$ $P \text{ н.} = 121.3$ $P_{\text{вн.}} = 42.8$ $\text{Гр. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$
	БПЗ-2134 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\text{Гр. сл.} = 0$ $\text{Точн.} = 0$		БПЗ-2139 $F \text{ см}^2 = 1.248$ $Q \text{ кг.} = 0.338$ $D \text{ оп.мм.} = 33$ $P \text{ н.} = 125.9$ $P_{\text{вн.}} = 34.6$ $\text{Гр. сл.} = \text{особая}$ $\text{Точн.} = \text{П}$
	БПЗ-2135 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		БПЗ-2140 $F \text{ см}^2 = 0.992$ $Q \text{ кг.} = 0.269$ $D \text{ оп.мм.} = 32$ $P \text{ н.} = 122$ $P_{\text{вн.}} = 46.3$

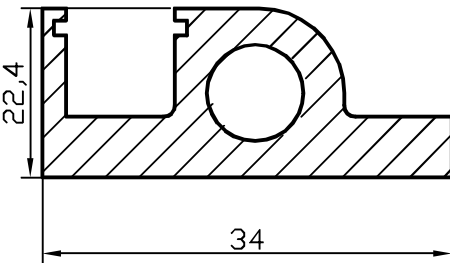
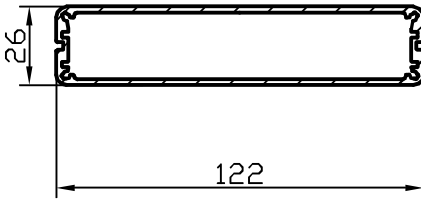
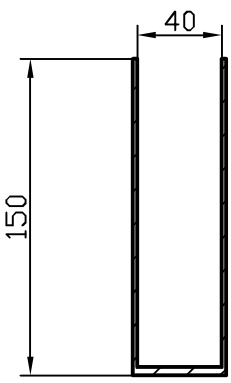
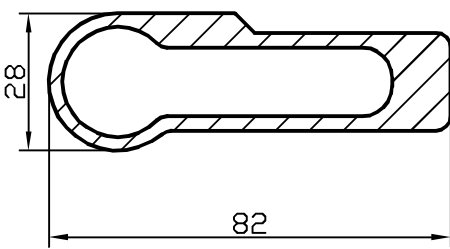
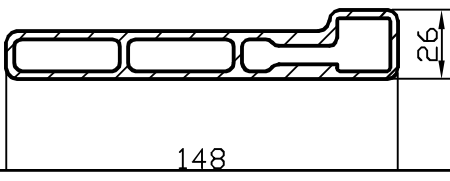
pdfMachine

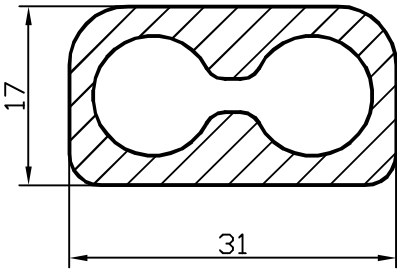
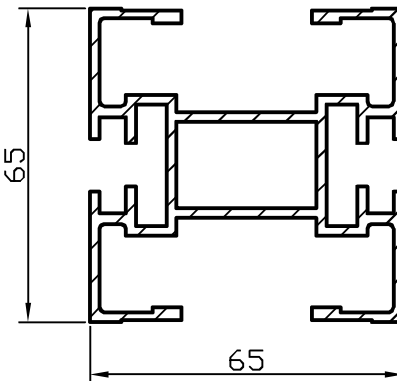
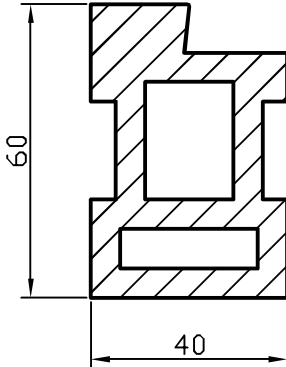
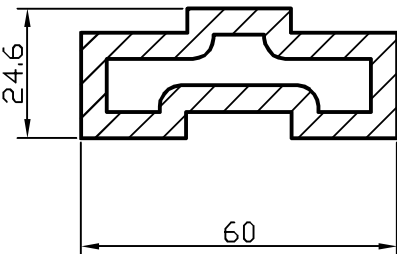
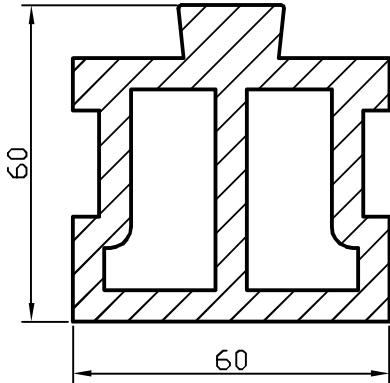
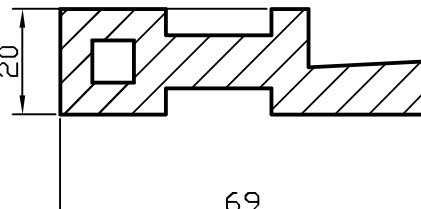
A pdf writer that produces quality PDF files with ease!

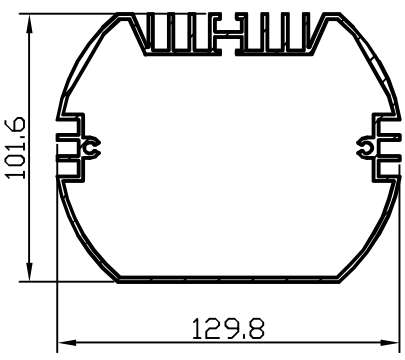
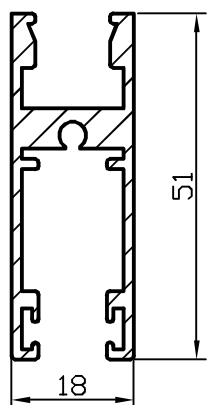
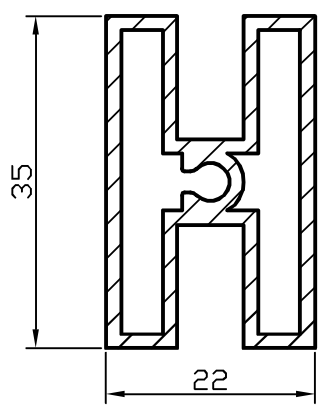
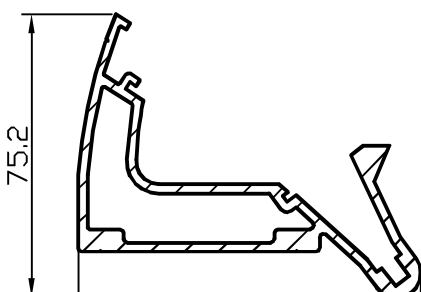
Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine.

Get yours now!

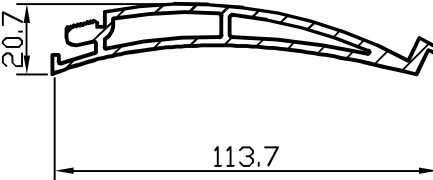
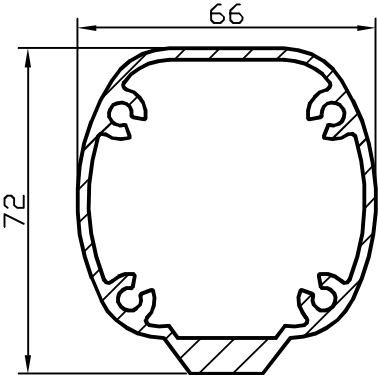
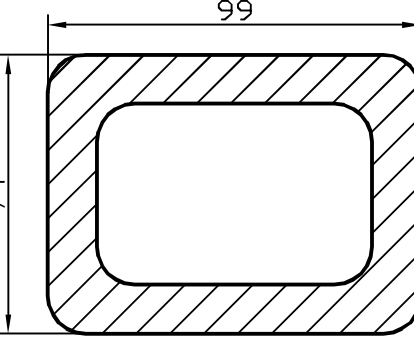
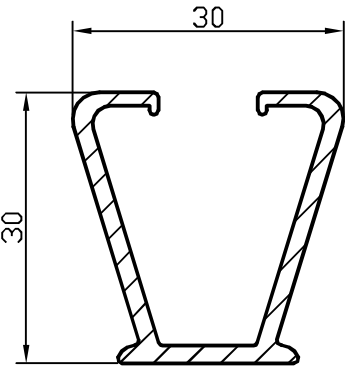
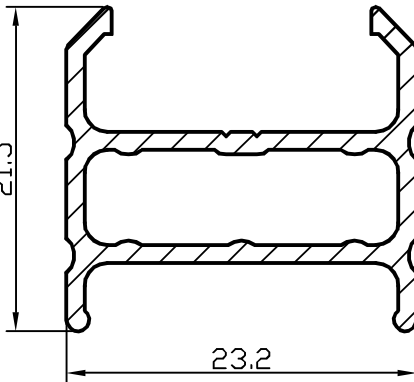
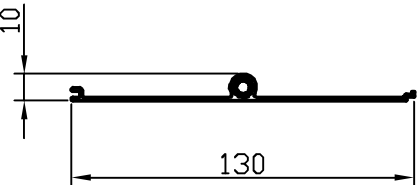
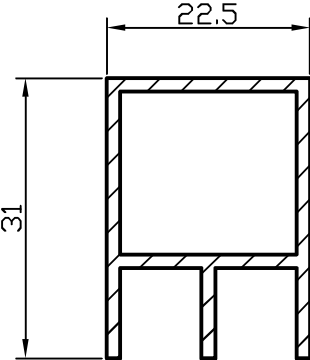
особая
П

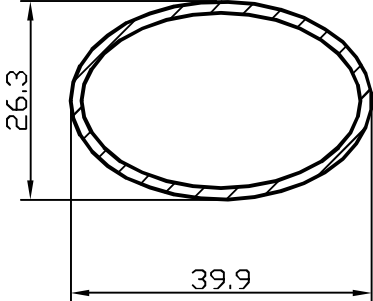
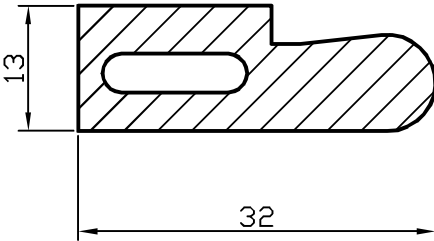
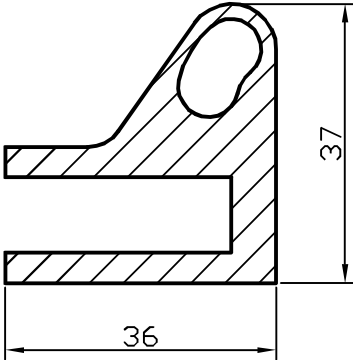
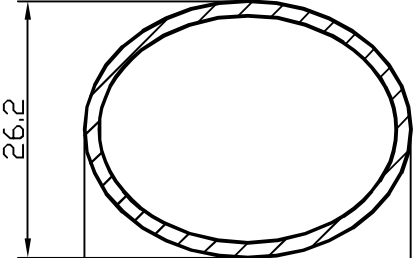
	БПЗ-2141		БПЗ-2146
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{ р. сл.} = 0$ $\text{Точн.} = 0$		$F \text{ см}^2 = 2.513$ $Q \text{ кг.} = 0.681$ $D \text{ оп.мм.} = 37$ $P \text{ н.} = 114.4$ $P_{\text{вн.}} = 25.1$ $\Gamma \text{ р. сл.} = V$ $\text{Точн.} = П$
	БПЗ-2142		БПЗ-2147
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{ р. сл.} = 0$ $\text{Точн.} = 0$		$F \text{ см}^2 = 6.225$ $Q \text{ кг.} = 1.687$ $D \text{ оп.мм.} = 124$ $P \text{ н.} = 298.3$ $P_{\text{вн.}} = 306.5$ $\Gamma \text{ р. сл.} = V$ $\text{Точн.} = П$
	БПЗ-2143		БПЗ-2148
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{ р. сл.} = 0$ $\text{Точн.} = 0$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{ р. сл.} = 0$ $\text{Точн.} = 0$
	БПЗ-2144		БПЗ-2149
	$F \text{ см}^2 = 7.6$ $Q \text{ кг.} = 2.06$ $D \text{ оп.мм.} = 157$ $P \text{ н.} = 680$ $P_{\text{вн.}} = 0$ $\Gamma \text{ р. сл.} = 0$ $\text{Точн.} = 0$		$F \text{ см}^2 = 7.75$ $Q \text{ кг.} = 2.1$ $D \text{ оп.мм.} = 85$ $P \text{ н.} = 200$ $P_{\text{вн.}} = 158.5$ $\Gamma \text{ р. сл.} = V$ $\text{Точн.} = П$
	БПЗ-2145		БПЗ-2150
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		$F \text{ см}^2 = 12.07$ $Q \text{ кг.} = 3.271$ $D \text{ оп.мм.} = 150$ $P \text{ н.} = 337.7$ $P_{\text{вн.}} = 350.9$ $\Gamma \text{ р. сл.} = V$ $\text{Точн.} = П$

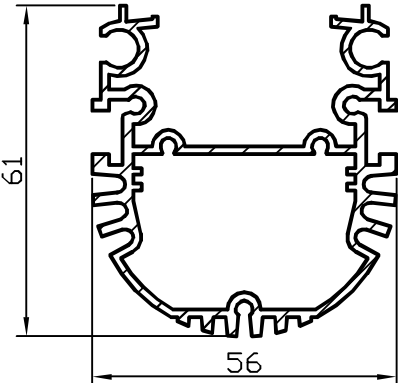
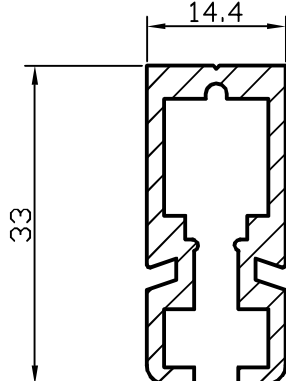
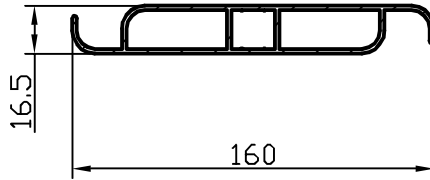
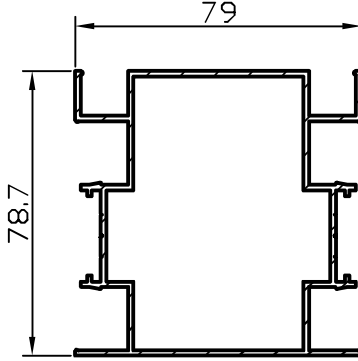
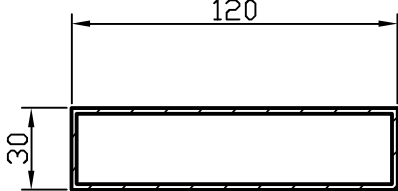
	БПЗ-2151 $F \text{ см}^2 = 2.93$ $Q \text{ кг.} = 0.794$ $D \text{ оп.мм.} = 33$ $P \text{ н.} = 88.6$ $P_{\text{вн.}} = 72.3$ Гр. сл. = V Точн. = П		БПЗ-2156 $F \text{ см}^2 = 7.78$ $Q \text{ кг.} = 2.108$ $D \text{ оп.мм.} = 93$ $P \text{ н.} = 669.3$ $P_{\text{вн.}} = 94$ Гр. сл. = VI Точн. = П
	БПЗ-2152 $F \text{ см}^2 = 13.11$ $Q \text{ кг.} = 3.55$ $D \text{ оп.мм.} = 73$ $P \text{ н.} = 220.8$ $P_{\text{вн.}} = 178$ Гр. сл. = особая Точн. = Н		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-2153 $F \text{ см}^2 = 7.823$ $Q \text{ кг.} = 2.12$ $D \text{ оп.мм.} = 64$ $P \text{ н.} = 179.2$ $P_{\text{вн.}} = 132.3$ Гр. сл. = V Точн. = Н		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-2154 $F \text{ см}^2 = 16.875$ $Q \text{ кг.} = 4.573$ $D \text{ оп.мм.} = 79$ $P \text{ н.} = 261.7$ $P_{\text{вн.}} = 232.5$ Гр. сл. = особая Точн. = Н		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-2155 $F \text{ см}^2 = 8.851$ $Q \text{ кг.} = 2.399$ $D \text{ оп.мм.} = 72$ $P \text{ н.} = 198.9$ $P_{\text{вн.}} = 32$		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$

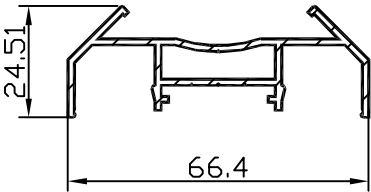
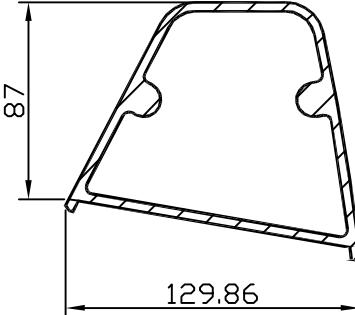
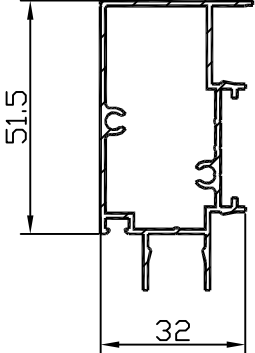
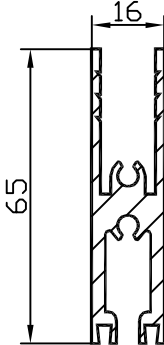
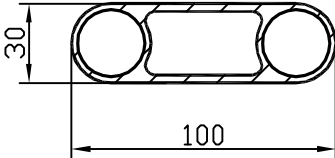
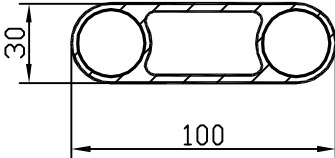
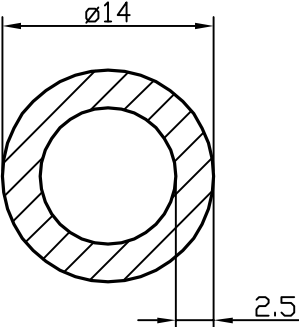
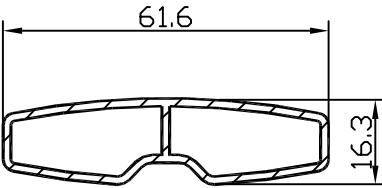
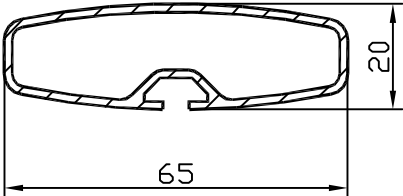
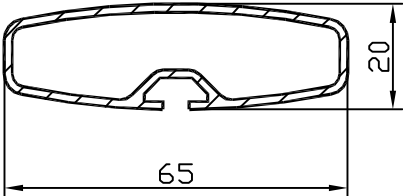
	БПЗ-0		БПЗ-0
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-2162		БПЗ-2167
	$F \text{ см}^2 = 11.662$ $Q \text{ кг.} = 3.16$ $D \text{ оп.мм.} = 132$ $P \text{ н.} = 720.9$ $P_{\text{вн.}} = 497$ Гр. с.л. = V Точн. = П		$F \text{ см}^2 = 2.92$ $Q \text{ кг.} = 0.792$ $D \text{ оп.мм.} = 55$ $P \text{ н.} = 283.2$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-0		БПЗ-0
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-0		БПЗ-2169
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		$F \text{ см}^2 = 2.673$ $Q \text{ кг.} = 0.724$ $D \text{ оп.мм.} = 42$ $P \text{ н.} = 166$ $P_{\text{вн.}} = 167.6$ Гр. с.л. = особая Точн. = П
	БПЗ-0		БПЗ-2170
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		$F \text{ см}^2 = 11.84$ $Q \text{ кг.} = 3.21$ $D \text{ оп.мм.} = 100$ $P \text{ н.} = 411.2$ $P_{\text{вн.}} = 187.7$
pdfMachine A pdf writer that produces quality PDF files with ease! Produce quality PDF files in seconds and preserve the integrity of your original documents. Compatible across nearly all Windows platforms, if you can print from a windows application you can use pdfMachine. Get yours now!			

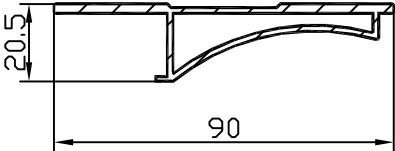
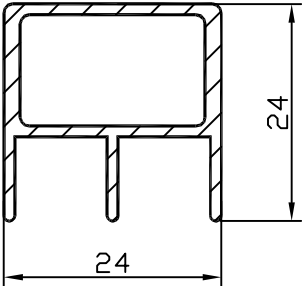
особая
П

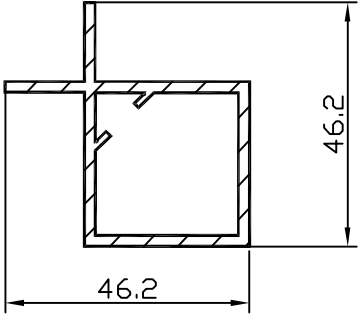
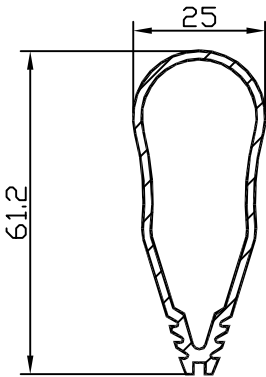
	БПЗ-2171 $F \text{ см}^2 = 6.382$ $Q \text{ кг.} = 1.73$ $D \text{ оп.мм.} = 114$ $P \text{ н.} = 285.2$ $P_{\text{вн.}} = 173.9$ Гр. сл. = особая Точн. = П		БПЗ-2176 $F \text{ см}^2 = 8.305$ $Q \text{ кг.} = 2.251$ $D \text{ оп.мм.} = 78$ $P \text{ н.} = 227.5$ $P_{\text{вн.}} = 296.9$ Гр. сл. = VI Точн. = П
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-2177 $F \text{ см}^2 = 38.2$ $Q \text{ кг.} = 10.352$ $D \text{ оп.мм.} = 116$ $P \text{ н.} = 328.8$ $P_{\text{вн.}} = 224.8$ Гр. сл. = IV Точн. = П
	БПЗ-2173 $F \text{ см}^2 = 1.781$ $Q \text{ кг.} = 0.483$ $D \text{ оп.мм.} = 38$ $P \text{ н.} = 185.3$ $P_{\text{вн.}} = 0$ Гр. сл. = VI Точн. = П		БПЗ-2178 $F \text{ см}^2 = 1.064$ $Q \text{ кг.} = 0.288$ $D \text{ оп.мм.} = 30$ $P \text{ н.} = 115.8$ $P_{\text{вн.}} = 52.4$ Гр. сл. = VI Точн. = П
	БПЗ-2174 $F \text{ см}^2 = 1.935$ $Q \text{ кг.} = 0.525$ $D \text{ оп.мм.} = 131$ $P \text{ н.} = 292.1$ $P_{\text{вн.}} = 89.85$ Гр. сл. = особая Точн. = П		БПЗ-2179 $F \text{ см}^2 = 1.665$ $Q \text{ кг.} = 0.451$ $D \text{ оп.мм.} = 39$ $P \text{ н.} = 147$ $P_{\text{вн.}} = 75$ Гр. сл. = V Точн. = П
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$

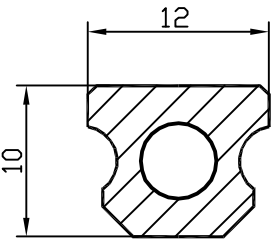
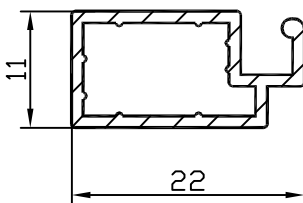
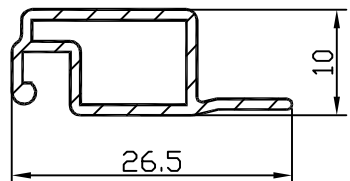
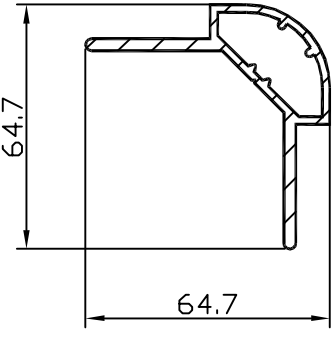
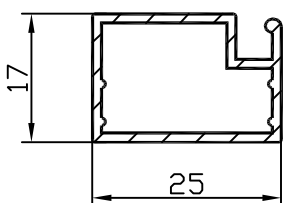
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		БПЗ-2186 $F \text{ см}^2 = 1.506$ $Q \text{ кг.} = 0.408$ $D \text{ оп.мм.} = 39.9$ $P \text{ н.} = 105.1$ $P_{\text{вн.}} = 95.7$ Гр. с.л. = VI Точн. = П
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-2183 $F \text{ см}^2 = 3.357$ $Q \text{ кг.} = 0.91$ $D \text{ оп.мм.} = 39$ $P \text{ н.} = 96.8$ $P_{\text{вн.}} = 50.3$ Гр. с.л. = особая Точн. = Н		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-2184 $F \text{ см}^2 = 5.418$ $Q \text{ кг.} = 1.468$ $D \text{ оп.мм.} = 50$ $P \text{ н.} = 193.4$ $P_{\text{вн.}} = 37$ Гр. с.л. = VI Точн. = Н		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. с.л. = особая Точн. = П
	БПЗ-2185 $F \text{ см}^2 = 1.33$ $Q \text{ кг.} = 0.36$ $D \text{ оп.мм.} = 33.3$ $P \text{ н.} = 93.8$ $P_{\text{вн.}} = 84.4$		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$

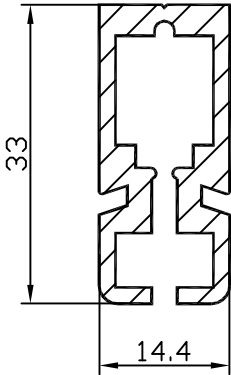
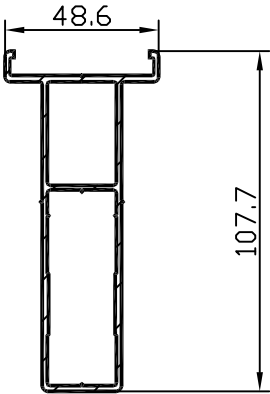
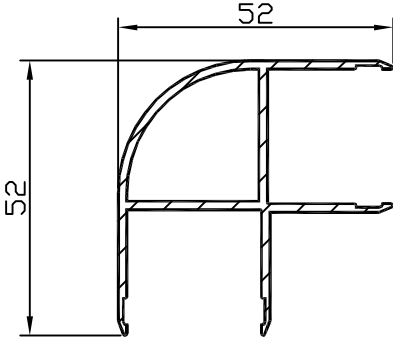
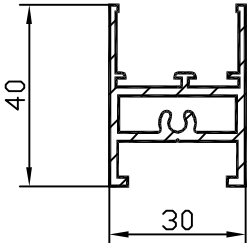
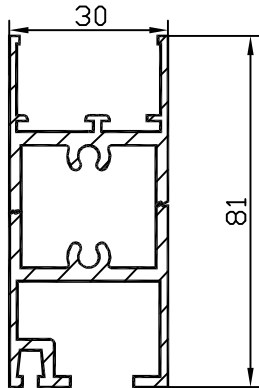
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-2192 $F \text{ см}^2 = 5.534$ $Q \text{ кг.} = 1.5$ $D \text{ оп.мм.} = 70$ $P \text{ н.} = 485.8$ $P_{\text{вн.}} = 163.4$ Гр. сл. = особая Точн. = П		БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-2193 $F \text{ см}^2 = 2.044$ $Q \text{ кг.} = 0.554$ $D \text{ оп.мм.} = 36$ $P \text{ н.} = 192.8$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-2198 $F \text{ см}^2 = 7.146$ $Q \text{ кг.} = 1.937$ $D \text{ оп.мм.} = 160$ $P \text{ н.} = 394.2$ $P_{\text{вн.}} = 311.7$ Гр. сл. = особая Точн. = Н
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П		БПЗ-2199 $F \text{ см}^2 = 5.92$ $Q \text{ кг.} = 1.6$ $D \text{ оп.мм.} = 85$ $P \text{ н.} = 517.5$ $P_{\text{вн.}} = 275.2$ Гр. сл. = VI Точн. = П
	БПЗ-0 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$		БПЗ-2200 $F \text{ см}^2 = 5.84$ $Q \text{ кг.} = 1.58$ $D \text{ оп.мм.} = 124$ $P \text{ н.} = 300$ $P_{\text{вн.}} = 284$

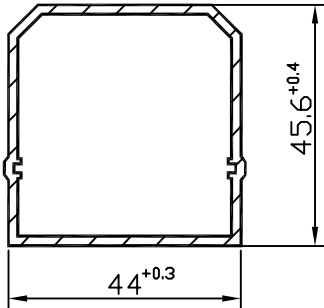
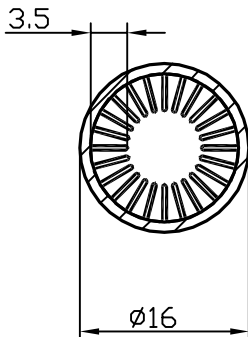
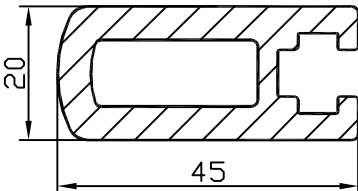
	БПЗ-2201 $F \text{ см}^2 = 2.416$ $Q \text{ кг.} = 0.655$ $D \text{ оп.мм.} = 68$ $P \text{ н.} = 279.3$ $P_{\text{вн.}} = 65.7$ Гр. сл. = VI Точн. = П		БПЗ-2206 $F \text{ см}^2 = 19.15$ $Q \text{ кг.} = 5.19$ $D \text{ оп.мм.} = 149$ $P \text{ н.} = 413.4$ $P_{\text{вн.}} = 393.2$ Гр. сл. = особая Точн. = V
	БПЗ-2202 $F \text{ см}^2 = 2.529$ $Q \text{ кг.} = 0.685$ $D \text{ оп.мм.} = 70$ $P \text{ н.} = 265.9$ $P_{\text{вн.}} = 176.6$ Гр. сл. = особая Точн. = П		БПЗ-2207 $F \text{ см}^2 = 4.344$ $Q \text{ кг.} = 1.177$ $D \text{ оп.мм.} = 67$ $P \text{ н.} = 343$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = П
	БПЗ-2203 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = 0		БПЗ-2208 $F \text{ см}^2 = 7.795$ $Q \text{ кг.} = 2.112$ $D \text{ оп.мм.} = 100$ $P \text{ н.} = 234.2$ $P_{\text{вн.}} = 291.8$ Гр. сл. = особая Точн. = П
	БПЗ-2204 $F \text{ см}^2 = 0.903$ $Q \text{ кг.} = 0.245$ $D \text{ оп.мм.} = 14$ $P \text{ н.} = 44$ $P_{\text{вн.}} = 28.3$ Гр. сл. = V Точн. = П		БПЗ-2209 $F \text{ см}^2 = 2.242$ $Q \text{ кг.} = 0.608$ $D \text{ оп.мм.} = 62$ $P \text{ н.} = 145$ $P_{\text{вн.}} = 151$ Гр. сл. = VI Точн. = П
	БПЗ-2205 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = особая Точн. = 0		БПЗ-2210 $F \text{ см}^2 = 2.47$ $Q \text{ кг.} = 0.67$ $D \text{ оп.мм.} = 66$ $P \text{ н.} = 147.3$ $P_{\text{вн.}} = 175$ Гр. сл. = VI Точн. = П

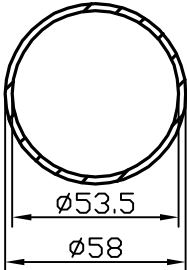
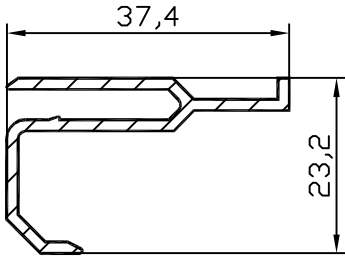
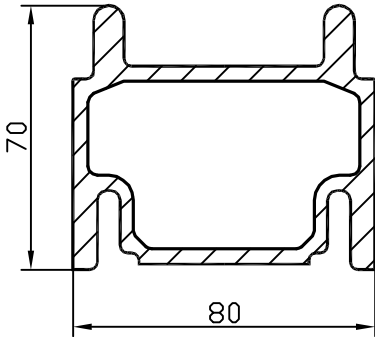
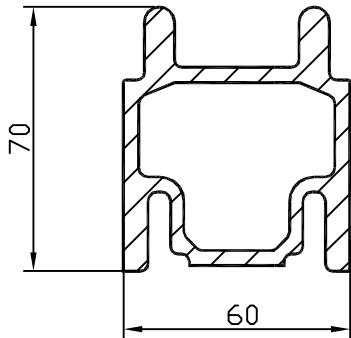
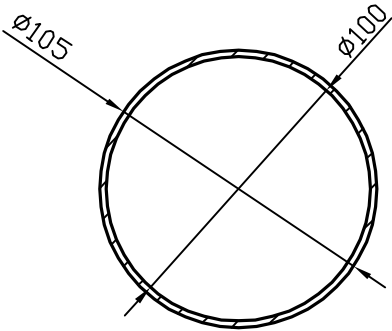
	БПЗ-2211		БПЗ-2216
	$F \text{ см}^2 = 3.21$ $Q \text{ кг.} = 0.87$ $D \text{ оп.мм.} = 90$ $P \text{ н.} = 219.1$ $P_{\text{вн.}} = 130.3$ Гр. сл. = VI Точн. = П		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = 0 Точн. = 0
	БПЗ-2212		БПЗ-2217
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = 0 Точн. = 0		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = 0 Точн. = 0
	БПЗ-2213		БПЗ-2218
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = 0 Точн. = 0		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = 0 Точн. = 0
	БПЗ-2214		БПЗ-2219
	$F \text{ см}^2 = 1.353$ $Q \text{ кг.} = 0.367$ $D \text{ оп.мм.} = 33$ $P \text{ н.} = 130.8$ $P_{\text{вн.}} = 63.7$ Гр. сл. = IV Точн. = Н		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = 0 Точн. = 0
	БПЗ-2215		БПЗ-2220
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = 0 Точн. = 0		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = 0 Точн. = 0

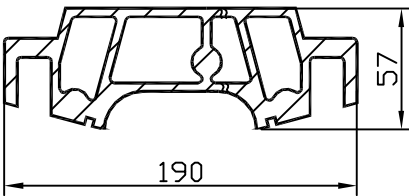
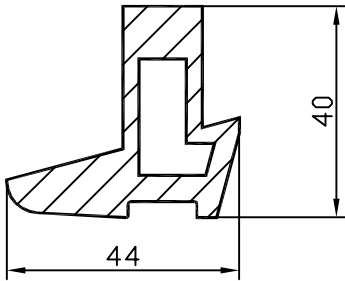
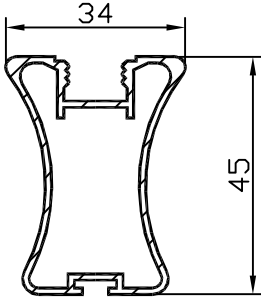
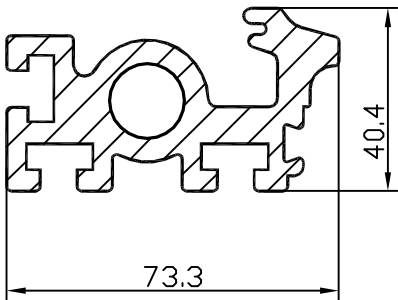
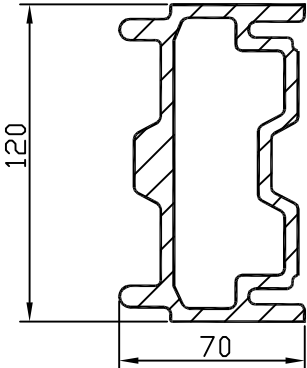
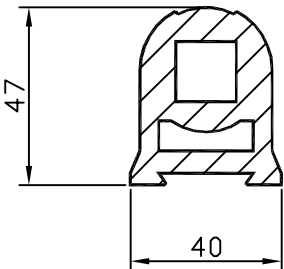
	БПЗ-2221		БПЗ-2226
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$
	БПЗ-2222		БПЗ-2227
	$F \text{ см}^2 = 3.13$ $Q \text{ кг.} = 0.848$ $D \text{ оп.мм.} = 57$ $P \text{ н.} = 184.8$ $P_{\text{вн.}} = 121$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$
	БПЗ-2223		БПЗ-2228
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$
	БПЗ-2224		БПЗ-2229
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$
	БПЗ-2225		БПЗ-2230
	$F \text{ см}^2 = 2.397$ $Q \text{ кг.} = 0.65$ $D \text{ оп.мм.} = 62$ $P \text{ н.} = 163.1$ $P_{\text{вн.}} = 128$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$

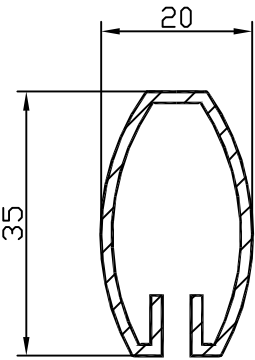
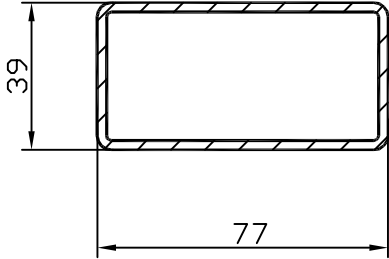
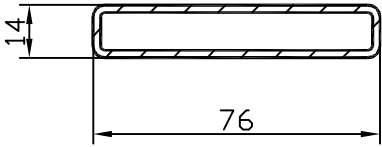
	БПЗ-2231		БПЗ-2236
	$F \text{ см}^2 = 0.768$ $Q \text{ кг.} = 0.208$ $D \text{ оп.мм.} = 14$ $P \text{ н.} = 41.6$ $P_{\text{вн.}} = 15.7$ $\Gamma \text{ р. сл.} = \text{IV}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 0.72$ $Q \text{ кг.} = 0.195$ $D \text{ оп.мм.} = 24$ $P \text{ н.} = 76.8$ $P_{\text{вн.}} = 52.8$ $\Gamma \text{ р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$
	БПЗ-2232		БПЗ-2237
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{ р. сл.} = 0$ $\text{Точн.} = 0$		$F \text{ см}^2 = 0.649$ $Q \text{ кг.} = 0.176$ $D \text{ оп.мм.} = 25$ $P \text{ н.} = 81.5$ $P_{\text{вн.}} = 44.8$ $\Gamma \text{ р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$
	БПЗ-2233		БПЗ-2238
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{ р. сл.} = 0$ $\text{Точн.} = 0$		$F \text{ см}^2 = 4.241$ $Q \text{ кг.} = 1.149$ $D \text{ оп.мм.} = 78$ $P \text{ н.} = 237.5$ $P_{\text{вн.}} = 99$ $\Gamma \text{ р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$
	БПЗ-2234		БПЗ-2239
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{ р. сл.} = 0$ $\text{Точн.} = 0$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{ р. сл.} = 0$ $\text{Точн.} = 0$
	БПЗ-2235		БПЗ-2240
	$F \text{ см}^2 = 1.04$ $Q \text{ кг.} = 0.282$ $D \text{ оп.мм.} = 30$ $P \text{ н.} = 94.7$ $P_{\text{вн.}} = 76.7$ $\Gamma \text{ р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{ р. сл.} = 0$ $\text{Точн.} = 0$

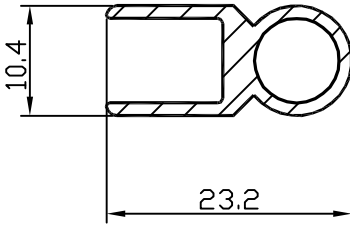
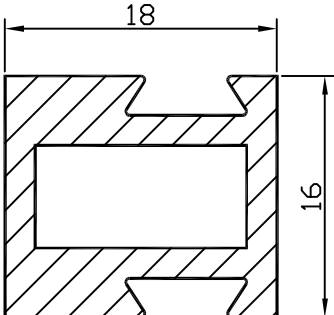
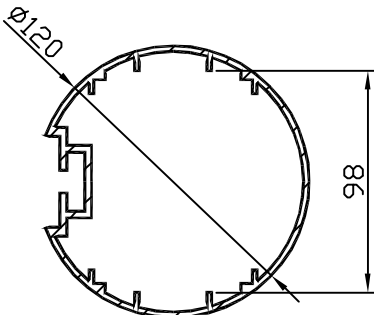
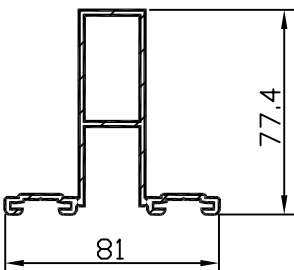

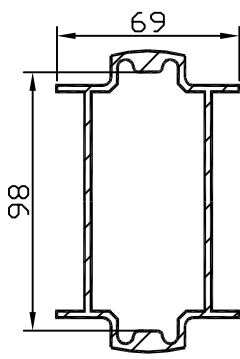
	БПЗ-2241 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$		БПЗ-2246 $F \text{ см}^2 = 2.208$ $Q \text{ кг.} = 0.598$ $D \text{ оп.мм.} = 36$ $P \text{ н.} = 200.4$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ особая $\text{Точн.} = \text{П}$
	БПЗ-2242 $F \text{ см}^2 = 5.112$ $Q \text{ кг.} = 1.385$ $D \text{ оп.мм.} = 114$ $P \text{ н.} = 327.8$ $P_{\text{вн.}} = 276.7$ $\Gamma \text{р. сл.} = 0$ особая $\text{Точн.} = \text{П}$		БПЗ-2247 $F \text{ см}^2 = 2.869$ $Q \text{ кг.} = 0.774$ $D \text{ оп.мм.} = 73$ $P \text{ н.} = 305.2$ $P_{\text{вн.}} = 89.9$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$
	БПЗ-2243 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$		БПЗ-2248 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$
	БПЗ-2244 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$		БПЗ-2249 $F \text{ см}^2 = 2.81$ $Q \text{ кг.} = 0.762$ $D \text{ оп.мм.} = 50$ $P \text{ н.} = 227.3$ $P_{\text{вн.}} = 83.9$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$
	БПЗ-2245 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$		БПЗ-2250 $F \text{ см}^2 = 5.364$ $Q \text{ кг.} = 1.454$ $D \text{ оп.мм.} = 87$ $P \text{ н.} = 367.3$ $P_{\text{вн.}} = 158.5$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$

	БПЗ-2251		БПЗ-2256
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$		$F \text{ см}^2 = 3.04$ $Q \text{ кг.} = 0.824$ $D \text{ оп.мм.} = 60$ $P \text{ н.} = 173.8$ $P_{\text{вн.}} = 167.5$ $\Gamma \text{р. сл.} = V$ $\text{Точн.} = П$
	БПЗ-2252		БПЗ-2257
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$
	БПЗ-2253		БПЗ-2258
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$		$F \text{ см}^2 = 0.813$ $Q \text{ кг.} = 0.22$ $D \text{ оп.мм.} = 16$ $P \text{ н.} = 50.3$ $P_{\text{вн.}} = 172.6$ $\Gamma \text{р. сл.} = \text{Особая}$ $\text{Точн.} = П$
	БПЗ-2254		БПЗ-2259
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$
	БПЗ-2255		БПЗ-2260
	$F \text{ см}^2 = 5.204$ $Q \text{ кг.} = 1.41$ $D \text{ оп.мм.} = 47$ $P \text{ н.} = 156.1$ $P_{\text{вн.}} = 67.2$ $\Gamma \text{р. сл.} = V$ $\text{Точн.} = Н$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$

	БПЗ-2261		БПЗ-2266
	$F \text{ см}^2 = 3.94$ $Q \text{ кг.} = 1.07$ $D \text{ оп.мм.} = 58$ $P \text{ н.} = 182.1$ $P_{\text{вн.}} = 168.1$ $\Gamma \text{р. сл.} = \text{IV}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 1.304$ $Q \text{ кг.} = 0.353$ $D \text{ оп.мм.} = 42$ $P \text{ н.} = 176.9$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{Н}$
	БПЗ-2262		БПЗ-2267
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$
	БПЗ-2263		БПЗ-2268
	$F \text{ см}^2 = 14.71$ $Q \text{ кг.} = 3.99$ $D \text{ оп.мм.} = 102$ $P \text{ н.} = 392.8$ $P_{\text{вн.}} = 213.2$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$
	БПЗ-2264		БПЗ-2269
	$F \text{ см}^2 = 13.123$ $Q \text{ кг.} = 3.56$ $D \text{ оп.мм.} = 89$ $P \text{ н.} = 352.8$ $P_{\text{вн.}} = 174.8$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$
	БПЗ-2265		БПЗ-2270
	$F \text{ см}^2 = 8.05$ $Q \text{ кг.} = 2.182$ $D \text{ оп.мм.} = 105$ $P \text{ н.} = 329.9$ $P_{\text{вн.}} = 314.2$ $\Gamma \text{р. сл.} = \text{IV}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$

	БПЗ-2271 $F \text{ см}^2 = 32.31$ $Q \text{ кг.} = 8.756$ $D \text{ оп.мм.} = 192$ $P \text{ н.} = 594.5$ $P_{\text{вн.}} = 513.3$ Гр. сл. = Особая Точн. = Н		БПЗ-2276 $F \text{ см}^2 = 6.281$ $Q \text{ кг.} = 1.7$ $D \text{ оп.мм.} = 52$ $P \text{ н.} = 163.3$ $P_{\text{вн.}} = 71.3$ Гр. сл. = V Точн. = Н
	БПЗ-2272 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = 0 Точн. = 0		БПЗ-2277 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = 0 Точн. = 0
	БПЗ-2273 $F \text{ см}^2 = 2.296$ $Q \text{ кг.} = 0.622$ $D \text{ оп.мм.} = 54$ $P \text{ н.} = 184$ $P_{\text{вн.}} = 167$ Гр. сл. = VI Точн. = П		БПЗ-2278 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = 0 Точн. = 0
	БПЗ-2274 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ Гр. сл. = 0 Точн. = 0		БПЗ-2279 $F \text{ см}^2 = 12.955$ $Q \text{ кг.} = 3.511$ $D \text{ оп.мм.} = 80$ $P \text{ н.} = 392.3$ $P_{\text{вн.}} = 52$ Гр. сл. = V Точн. = П
	БПЗ-2275 $F \text{ см}^2 = 24.44$ $Q \text{ кг.} = 6.63$ $D \text{ оп.мм.} = 133$ $P \text{ н.} = 491.2$ $P_{\text{вн.}} = 301.8$ Гр. сл. = V Точн. = П		БПЗ-2280 $F \text{ см}^2 = 10.76$ $Q \text{ кг.} = 2.92$ $D \text{ оп.мм.} = 55$ $P \text{ н.} = 169.1$ $P_{\text{вн.}} = 131.3$ Гр. сл. = VI Точн. = П

	БПЗ-2281		БПЗ-2286
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$
	БПЗ-2282		БПЗ-2287
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$
	БПЗ-2283		БПЗ-2288
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$		$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$
	БПЗ-2284		БПЗ-2289
	$F \text{ см}^2 = 1.468$ $Q \text{ кг.} = 0.398$ $D \text{ оп.мм.} = 37$ $P \text{ н.} = 198.6$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		$F \text{ см}^2 = 5.445$ $Q \text{ кг.} = 1.476$ $D \text{ оп.мм.} = 82$ $P \text{ н.} = 225.7$ $P_{\text{вн.}} = 209.9$ $\Gamma \text{р. сл.} = \text{IV}$ $\text{Точн.} = 0$
	БПЗ-2285		БПЗ-2290
	$F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$		$F \text{ см}^2 = 3.365$ $Q \text{ кг.} = 0.912$ $D \text{ оп.мм.} = 78$ $P \text{ н.} = 174.5$ $P_{\text{вн.}} = 161.9$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = 0$

	БПЗ-2291 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$		БПЗ-2296 $F \text{ см}^2 = 0.825$ $Q \text{ кг.} = 0.224$ $D \text{ оп.мм.} = 24$ $P \text{ н.} = 86.01$ $P_{\text{вн.}} = 25.13$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$
	БПЗ-2292 $F \text{ см}^2 = 1.577$ $Q \text{ кг.} = 0.427$ $D \text{ оп.мм.} = 24$ $P \text{ н.} = 83.97$ $P_{\text{вн.}} = 41.6$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$		БПЗ-2297 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$
	БПЗ-2293 $F \text{ см}^2 = 12.482$ $Q \text{ кг.} = 3.383$ $D \text{ оп.мм.} = 120$ $P \text{ н.} = 443.4$ $P_{\text{вн.}} = 495.4$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$		БПЗ-2298 $F \text{ см}^2 = 5.668$ $Q \text{ кг.} = 1.536$ $D \text{ оп.мм.} = 100$ $P \text{ н.} = 441.9$ $P_{\text{вн.}} = 122.2$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$
	БПЗ-2294 $F \text{ см}^2 = 8.846$ $Q \text{ кг.} = 2.397$ $D \text{ оп.мм.} = 154$ $P \text{ н.} = 385$ $P_{\text{вн.}} = 336$ $\Gamma \text{р. сл.} = \text{VI}$ $\text{Точн.} = \text{П}$		БПЗ-2299 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$
	БПЗ-2295 $F \text{ см}^2 = 9.973$ $Q \text{ кг.} = 2.7$ $D \text{ оп.мм.} = 114$ $P \text{ н.} = 394.4$ $P_{\text{вн.}} = 399.6$ $\Gamma \text{р. сл.} = \text{V}$ $\text{Точн.} = \text{П}$		БПЗ-2300 $F \text{ см}^2 = 0$ $Q \text{ кг.} = 0$ $D \text{ оп.мм.} = 0$ $P \text{ н.} = 0$ $P_{\text{вн.}} = 0$ $\Gamma \text{р. сл.} = 0$ $\text{Точн.} = 0$